Calibration Guide

Agilent Technologies ESA Spectrum Analyzers

This guide documents firmware revision A.05.xx

This manual provides documentation for the following instruments:

Agilent ESA-E Series
E4401B (9 kHz - 1.5 GHz)
E4402B (9 kHz - 3.0 GHz)
E4404B (9 kHz - 6.7 GHz)
E4405B (9 kHz - 13.2 GHz)
E4407B (9 kHz - 26.5 GHz)

and

Agilent ESA-L Series
E4411B (9 kHz - 1.5 GHz)
E4403B (9 kHz - 6.7 GHz)
E4408B (9 kHz - 26.5 GHz)



Agilent Technologies

Manufacturing Part Number: E4401-90223
Supersedes E4401-90192

Printed in USA
November 2000

© Copyright 2000 Agilent Technologies, Inc.

COPYRIGHT AND DISCLAIMER NOTICE

Copyright – Agilent Technologies, Inc. Reproduced with the permission of Agilent Technologies Inc. Agilent Technologies, Inc. makes no warranty of any kind with regard to this material including, but not limited to, the implied warranties of merchantability and fitness for a particular purpose. Agilent Technologies, Inc. is not liable for errors contained herein or for incidental or consequential damages in connection with the furnishing, performance, or use of this material or data.

The information contained in this document is subject to change without notice.

Agilent Technologies makes no warranty of any kind with regard to this material, including but not limited to, the implied warranties of merchantability and fitness for a particular purpose. Agilent Technologies shall not be liable for errors contained herein or for incidental or consequential damages in connection with the furnishing, performance, or use of this material.

The following safety symbols are used throughout this manual. Familiarize yourself with the symbols and their meaning before operating this instrument.

WARNING ***Warning*** **denotes a hazard. It calls attention to a procedure which, if not correctly performed or adhered to, could result in injury or loss of life. Do not proceed beyond a warning note until the indicated conditions are fully understood and met.**

WARNING **This is a Safety Class 1 Product (provided with a protective earthing ground incorporated in the power cord). The mains plug shall only be inserted in a socket outlet provided with a protected earth contact. Any interruption of the protective conductor inside or outside of the product is likely to make the product dangerous. Intentional interruption is prohibited.**

WARNING **If this product is not used as specified, the protection provided by the equipment could be impaired. This product must be used in a normal condition (in which all means for protection are intact) only.**

CAUTION *Caution* denotes a hazard. It calls attention to a procedure that, if not correctly performed or adhered to, could result in damage to or destruction of the instrument. Do not proceed beyond a caution sign until the indicated conditions are fully understood and met.

WARNING **This is a Safety Class 1 Product (provided with a protective earthing ground incorporated in the power cord. The mains plug shall only be inserted in a socket outlet provided with a protective earth contact. Any interruption of the protective conductor inside or outside of the product is likely to make the product dangerous. Intentional interruption is prohibited.**

WARNING **If this product is not used as specified, the protection provided by the equipment could be impaired. This product must be used in a normal condition (in which all means for protection are intact) only.**

CAUTION Always use the three-prong ac power cord supplied with this product. Failure to ensure adequate earth grounding by not using this cord may cause product damage.

CAUTION This instrument has autoranging line voltage input, be sure the supply voltage is within the specified range.

Warranty

This Agilent Technologies instrument product is warranted against defects in material and workmanship for a period of one year from date of shipment. During the warranty period, Agilent Technologies will, at its option, either repair or replace products which prove to be defective.

For warranty service or repair, this product must be returned to a service facility designated by Agilent Technologies. Buyer shall prepay shipping charges to Agilent Technologies and Agilent Technologies shall pay shipping charges to return the product to Buyer. However, Buyer shall pay all shipping charges, duties, and taxes for products returned to Agilent Technologies from another country.

Agilent Technologies warrants that its software and firmware designated by Agilent Technologies for use with an instrument will execute its programming instructions when properly installed on that instrument. Agilent Technologies does not warrant that the operation of the instrument, or software, or firmware will be uninterrupted or error-free.

LIMITATION OF WARRANTY

The foregoing warranty shall not apply to defects resulting from improper or inadequate maintenance by Buyer, Buyer-supplied software or interfacing, unauthorized modification or misuse, operation outside of the environmental specifications for the product, or improper site preparation or maintenance.

NO OTHER WARRANTY IS EXPRESSED OR IMPLIED. AGILENT TECHNOLOGIES SPECIFICALLY DISCLAIMS THE IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE.

EXCLUSIVE REMEDIES

THE REMEDIES PROVIDED HEREIN ARE BUYER'S SOLE AND EXCLUSIVE REMEDIES. AGILENT TECHNOLOGIES SHALL NOT BE LIABLE FOR ANY DIRECT, INDIRECT, SPECIAL, INCIDENTAL, OR CONSEQUENTIAL DAMAGES, WHETHER BASED ON CONTRACT, TORT, OR ANY OTHER LEGAL THEORY.

Where to Find the Latest Information

Documentation is updated periodically. For the latest information about Agilent ESA Spectrum Analyzers, including firmware upgrades and application information, please visit the following Internet URL: http//www.agilent.com/go/esa.

Contents

1. Calibrating

Calibration 1-2
Calibration Cycle 1-3
Performance Verification Test Tables 1-3
Before You Start 1-16
Recording the test results 1-16
Performing Self-Alignment 1-16
Periodic verification of operation 1-17
Test equipment you will need 1-17

2. Performance Verification Tests

..... 2-2
Calibration 2-4
1. 10 MHz Reference Accuracy 2-9
Equipment Required 2-9
Procedure 2-9
2. 10 MHz High-Stability Frequency Reference Accuracy: Agilent E4401B, E4402B, E4404B, E4405B, and E4407B (Option 1D5) 2-12
Equipment Required 2-12
Procedure 2-13
3. Frequency Readout and Marker Frequency Count Accuracy: Agilent E4401B, E4402B, E4405B, and E4411B 2-15
Equipment Required 2-15
Additional Equipment for 75 Ω Input 2-15
Procedure 2-16
4. Frequency Readout and Marker Frequency Count Accuracy: Agilent E4404B, E4405B, E4407B, and E4408B 2-18
Equipment Required 2-18
Additional Equipment for Option BAB 2-18
Procedure 2-18
5. Frequency Span Readout Accuracy: Agilent E4401B and Agilent E4411B 2-22
Equipment Required 2-22
Additional Equipment for 75 Ω Input 2-22
Procedure 2-22
100 kHz and 100 MHz Frequency Span Readout Accuracy 2-23
6. Frequency Span Readout Accuracy: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B 2-26
Equipment Required 2-26
Additional Equipment for Option BAB 2-26
Procedure 2-26
7. Noise Sidebands 2-30
Equipment Required 2-30
Additional Equipment for 75 Ω Input 2-30
Additional Equipment for Option BAB 2-30
Procedure 2-31
8. System-Related Sidebands 2-35
Equipment Required 2-35
Additional Equipment for 75 Ω Input 2-35
Additional Equipment for Option BAB 2-35

Contents

Procedure 2-36
9. Residual FM 2-38
Equipment Required 2-38
Additional Equipment for 75 Ω Input 2-38
Additional Equipment for Option BAB 2-38
Procedure 2-39
Part 1: Residual FM 2-39
Part 2: Residual FM for Option 1DR and 1D5 2-41
10. Sweep Time Accuracy 2-43
Equipment Required 2-43
Additional Equipment for 75 Ω Input 2-43
Additional Equipment for Option BAB 2-43
Procedure 2-44
11. Display Scale Fidelity 2-46
Equipment Required 2-46
Additional Equipment for 75 Ω Input 2-46
Additional Equipment for Option BAB 2-46
Procedure 2-47
Section 1: Log Display Scale Fidelity, Analog Bandwidths 2-48
Section 2: Log Display Scale Fidelity, Digital Bandwidths 2-51
Section 3: Linear Display Scale Fidelity, Analog Bandwidths 2-54
Section 4: Linear Display Scale Fidelity, Digital Bandwidths 2-56
12. Input Attenuation Switching Uncertainty 2-60
Equipment Required 2-60
Additional Equipment for 75 Ω Input 2-60
Additional Equipment for Option BAB 2-60
Procedure 2-61
13. Reference Level Accuracy: Agilent E4401B and Agilent E4411B 2-67
Equipment Required 2-67
Additional Equipment for 75 Ω Input 2-67
Procedure 2-68
14. Reference Level Accuracy: Agilent E4402B,
E4403B, E4404B, E4407B, and E4408B 2-76
Equipment Required 2-76
Additional Equipment for Option BAB 2-76
Procedure 2-77
15. Resolution Bandwidth Switching Uncertainty 2-84
Equipment Required for E4402B, E4403B, E4404B, E4405B, E4407B and E4408B 2-84
Additional Equipment for Option BAB 2-84
Procedure 2-84
16. Absolute Amplitude Accuracy (Reference Settings): Agilent E4401B and E4411B . . . 2-87
Absolute Amplitude Accuracy 2-87
Equipment Required 2-87
Additional Equipment for 75 Ω Input 2-87
Procedure 2-87
17. Absolute Amplitude Accuracy (Reference Settings): Agilent E4402B, E4403B, E4404B,
E4405B, E4407B, and E4408B 2-93
Absolute Amplitude Accuracy 2-93
Equipment Required 2-93

Contents

Additional Equipment for Option BAB 2-93
Procedure 2-93
18. Overall Amplitude Accuracy: Agilent E4401B and E4411B 2-98
Equipment Required 2-98
Additional Equipment for 75 Ω Input 2-98
Procedure 2-98
19.OverallAmplitudeAccuracy:Agilent E4402B,E4403B,E4404B,E4405B,E4407B, and E4408B 2-105
Equipment Required 2-105
Additional Equipment for Option BAB 2-105
Procedure 2-105
20. Resolution Bandwidth Accuracy 2-111
Equipment Required 2-111
Additional Equipment for 75 Ω Input 2-111
Additional Equipment for Option BAB 2-111
Procedure 2-112
21. Frequency Response: Agilent E4401B and E4411B 2-116
Equipment Required 2-116
Additional Equipment for 75 Ω Input 2-117
Procedure 2-117
22. Frequency Response, Agilent E4402B and E4403B 2-126
Equipment Required 2-126
Procedure 2-127
23. Frequency Response, Agilent E4404B, E4405B, E4407B, and E4408B 2-141
Equipment Required 2-141
Procedure 2-142
24. Frequency Response (Preamp On): Agilent E4401B 2-165
Equipment Required 2-165
Additional Equipment for 75 Ω Input 2-165
Procedure 2-166
25. Frequency Response (Preamp On): Agilent E4402B 2-173
Equipment Required 2-173
Procedure 2-173
26. Frequency Response (Preamp On): Agilent E4404B, E4405B, and E4407B. 2-183
Equipment Required 2-183
Additional Equipment for Option BAB 2-183
Procedure 2-184
27. Other Input-Related Spurious Responses: Agilent E4401B and E4411B 2-194
Equipment Required 2-194
Additional Equipment for 75 Ω Input 2-194
Procedure 2-194
28. Other Input-Related Spurious Responses: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B 2-199
Equipment Required 2-199
Procedure 2-200
29. Spurious Responses: Agilent E4401B and E4411B 2-205
Equipment Required 2-205
Additional Equipment for 75 Ω Input 2-206
Procedure 2-206

Contents

Part 1: Third Order Intermodulation Distortion 2-206
Part 2: Second Harmonic Distortion 2-211
30. Spurious Responses: Agilent E4402B and E4403B 2-213
Equipment Required 2-213
Procedure 2-214
Part 1: Third Order Intermodulation Distortion 2-214
Part 2: Second Harmonic Distortion 2-218
31. Spurious Responses: Agilent E4404B, E4405B, E4407B, and E4408B 2-221
Equipment Required 2-221
Procedure 2-222
Part 1: Third Order Intermodulation Distortion 2-222
Part 2: Second Harmonic Distortion 2-226
32. Gain Compression: Agilent E4401B, E4402B, E4403B, and E4411B 2-238
Equipment Required 2-238
Additional Equipment for 75 Ω Input 2-238
Procedure 2-238
33. Gain Compression: Agilent E4404B, E4405B, E4407B, and E4408B 2-242
Equipment Required 2-242
Additional Equipment for Option BAB 2-242
Procedure 2-242
34. Displayed Average Noise Level: Agilent E4401B and E4411B 2-246
Equipment Required 2-246
Additional Equipment for 75 Ω Input 2-246
Procedure 2-247
35. Displayed Average Noise Level: Agilent E4402B and E4403B 2-254
Equipment Required 2-254
Procedure 2-255
36. Displayed Average Noise Level: Agilent E4404B and E4405B 2-259
Equipment Required 2-259
Procedure 2-260
37. Displayed Average Noise Level: Agilent E4407B and E4408B 2-267
Equipment Required 2-267
Additional Equipment for Option BAB 2-267
Procedure 2-268
38. Residual Responses 2-274
Equipment Required 2-274
Additional Equipment for 75 Ω Input 2-274
Additional Equipment for Option BAB 2-274
Procedure 2-275
39. Fast Time Domain Amplitude Accuracy: Agilent E4401B, E4402B, E4404B, E4405B, and E4407B (Option AYX) 2-277
Equipment Required 2-277
Procedure 2-277
40. Tracking Generator Absolute Amplitude and Vernier Accuracy: Agilent E4401B and E4411B (Option 1DN or 1DQ) 2-279
Equipment Required 2-279
Additional Equipment for Option 1DQ 2-279
Procedure 2-280
41. Tracking Generator Absolute Amplitude and Vernier Accuracy: Agilent E4402B, E4403B,

Contents

E4404B, E4405B, E4407B and E4408B (Option 1DN). 2-283
Equipment Required 2-283
Procedure 2-283
42. Tracking Generator Level Flatness: Agilent E4401B and E4411B (Option 1DN or 1DQ) . 2-286
Equipment Required. 2-286
Additional Equipment for Option 1DQ 2-287
Procedure 2-287
Tracking Generator Level Flatness, Center Frequency ≥100 kHz. 2-287
Tracking Generator Level Flatness, Center Frequency £100 kHz. 2-289
43. Tracking Generator Level Flatness:
Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B (Option 1DN) 2-292
Equipment Required. 2-292
Procedure 2-293
Tracking Generator Level Flatness, Center Frequency
≥100 kHz 2-293
Tracking Generator Level Flatness, Center Frequency £100 kHz. 2-296
44. Tracking Generator Harmonic Spurious Outputs: Agilent E4401B and E4411B
(Option 1DN or 1DQ) 2-299
Equipment Required 2-299
Additional Equipment Required for Option 1DQ 2-299
Procedure 2-300
45. Tracking Generator Harmonic Spurious Outputs: Agilent E4402B, E4403B, E4404B,
E4405B, E4407B, and E4408B (Option 1DN) 2-303
Equipment Required 2-303
Procedure 2-303
46. Tracking Generator Non-Harmonic Spurious Outputs: Agilent E4401B and E4411B
(Option 1DN or 1DQ) 2-307
Equipment Required 2-307
Additional Equipment for 75 Ω Input 2-307
Procedure 2-308
Measuring Fundamental Amplitudes 2-309
Measuring Non-Harmonic Responses 2-309
Determining the Highest Non-harmonic Spurious Response. 2-312
47. Tracking Generator Non-Harmonic Spurious Outputs: Agilent E4402B, E4403B,
E4404B, E4405B, E4407B, and E4408B (Option 1DN) 2-313
Equipment Required 2-313
Procedure 2-313
48. Tracking Generator LO Feedthrough Amplitude: Agilent E4402B, E4403B, E4404B,
E4405B, E4407B, and E4408B (Option 1DN). 2-319
Equipment Required 2-319
Procedure 2-319
49. Gate Delay Accuracy and Gate Length Accuracy: Agilent E4401B, E4402B, E4404B,
E4405B, and E4407B (Option 1D6). 2-322
Equipment Required 2-322
Procedure 2-322
50. Gate Mode Additional Amplitude Error: Agilent E4401B, E4402B, E4404B, E4405B,
and E4407B (Option 1D6) 2-327
Equipment Required. 2-327

Contents

Additional Equipment for Option 1DP 2-327
Additional Equipment for Option BAB 2-327
Procedure 2-327
51. First LO OUTPUT Amplitude Accuracy (Option AYZ only) 2-329
Equipment Required 2-329
Procedure 2-330
52. IF INPUT Accuracy (Option AYZ only) 2-332
Equipment Required 2-332
Procedure 2-333
53. Comms Frequency Response (Option BAC or BAH) 2-336
Equipment Required 2-336
Procedure 2-337
55. Modulation Accuracy – Rho (Options BAC and B7E) 2-351
Equipment Required 2-351
Procedure 2-351
56. CDMA Modulation Accuracy – EVM (Options BAC and B7E) 2-354
Equipment Required 2-354
Procedure 2-354
57. CDMA – Code Domain Power (Options BAC and B7E) 2-357
Equipment Required 2-357
Procedure 2-357
58. GSM – Phase and Frequency (Options BAH and B7E) 2-360
Equipment Required 2-360
Procedure 2-360
59. Comms Absolute Amplitude Accuracy (Options BAC or BAH) 2-362
Equipment Required 2-362
Additional Equipment for Option BAB 2-363
Procedure 2-363

3. Performance Verification Test Records
Agilent E4401B Performance Verification Test Record 3-2
Agilent E4402B Performance Verification Test Record 3-26
Agilent E4403B Performance Verification Test Record 3-54
Agilent E4404B Performance Verification Test Record 3-67
Agilent E4405B Performance Verification Test Record 3-96
Agilent E4407B Performance Verification Test Record 3-127
Agilent E4408B Performance Verification Test Record 3-159
Agilent E4411B Performance Verification Test Record 3-176

4. If You Have a Problem
What You'll Find in This Chapter 4-2
Before You Call Agilent Technologies 4-3
Check the Basics 4-3
Read the Warranty 4-4
Service Options 4-4
How to Call Agilent Technologies 4-4
How to Return Your Analyzer for Service 4-6
Service Tag 4-6

Contents

Original Packaging 4-6
Other Packaging 4-8

1 Calibrating

Calibration

This chapter identifies the performance test procedures which test the electrical performance of the analyzer.

Allow the analyzer to warm up in accordance with the temperature stability specifications before performing the tests in this chapter.

None of the test procedures involve removing the cover of the analyzer.

Calibration verifies that the analyzer performance is within all specifications. It is time consuming and requires extensive test equipment. Calibration consists of *all* the performance tests. For a complete listing of the performance tests, see the performance verification tests table for your specific analyzer.

Calibration Cycle

The performance tests in chapter 2 should be used to check the analyzer against its specifications once every year. Specifications are listed in this calibration guide.

Performance Verification Test Tables

The tables on the following pages list the performance tests in Chapter 1, "Performance Verification Tests," required for each model number. Perform all the tests marked with a dot in the "Std" (standard) column. If any options are installed in the analyzer, also perform all tests marked with a dot in the appropriate option column.

Table 1-1 Agilent E4401B Performance Verification Tests

Performance Test Name		Calibration for Instrument Option:						
		Std[a]	1DN	1DQ	1DS	1D5	1D6	AYX
1.	10 MHz Reference Output Accuracy[b]	•						
2.	10 MHz Precision Frequency Reference Output Accuracy					•		
3.	Frequency Readout and Marker Frequency Count Accuracy	•						
5.	Frequency Span Readout Accuracy	•						
7.	Noise Sidebands	•						
8.	System Related Sidebands	•						
9.	Residual FM	•						
10.	Sweep Time Accuracy	•						
11.	Display Scale Fidelity	•						
12.	Input Attenuation Switching Uncertainty	•						
13.	Reference Level Accuracy	•						
15.	Resolution Bandwidth Switching Uncertainty	•						
16.	Absolute Amplitude Accuracy (Reference Settings)	•						
18.	Overall Absolute Amplitude Accuracy	•						
20.	Resolution Bandwidth Accuracy	•						
21.	Frequency Response	•						
24.	Frequency Response (Preamp On)				•			
27.	Other Input Related Spurious Responses	•						
29.	Spurious Responses	•						
32.	Gain Compression	•						
34.	Displayed Average Noise Level	•						
38.	Residual Responses	•						
39.	Fast Time Domain Amplitude Accuracy							•
40.	Tracking Generator Absolute Amplitude and Vernier Accuracy		•	•				
42.	Tracking Generator Level Flatness		•	•				
44.	Tracking Generator Harmonic Spurious Outputs		•	•				
46.	Tracking Generator Non-Harmonic Spurious Outputs		•	•				
49.	Gate Delay Accuracy and Gate Length Accuracy						•	
50.	Gate Mode Amplitude Error						•	

a. Perform these tests for all E4401B analyzers.
b. Perform this test only on analyzers not equipped with Option 1D5.

Table 1-2 Agilent E4402B Performance Verification Tests

	Performance Test Name	Calibration for Instrument Option:								
		Std[a]	1DN	1DS	1D5	1D6	AYX	BAC	BAH	B7E
1.	10 MHz Reference Output Accuracy[b]	•								
2.	10 MHz Precision Frequency Reference Output Accuracy				•					
3.	Frequency Readout and Marker Frequency Count Accuracy	•								
6.	Frequency Span Readout Accuracy	•								
7.	Noise Sidebands	•								
8.	System Related Sidebands	•								
9.	Residual FM	•								
10.	Sweep Time Accuracy	•								
11.	Display Scale Fidelity	•								
12.	Input Attenuation Switching Uncertainty	•								
14.	Reference Level Accuracy	•								
15.	Resolution Bandwidth Switching Uncertainty	•								
17.	Absolute Amplitude Accuracy (Reference Settings)	•								
19.	Overall Absolute Amplitude Accuracy	•								
20.	Resolution Bandwidth Accuracy	•								
22.	Frequency Response	•								
25.	Frequency Response (Preamp On)			•						
28.	Other Input Related Spurious Responses	•								
30.	Spurious Responses	•								
32.	Gain Compression	•								
35.	Displayed Average Noise Level	•								
38.	Residual Responses	•								
39.	Fast Time Domain Amplitude Accuracy						•			
41.	Tracking Generator Absolute Amplitude and Vernier Accuracy		•							
43.	Tracking Generator Level Flatness		•							
45.	Tracking Generator Harmonic Spurious Outputs		•							
47.	Tracking Generator Non-Harmonic Spurious Outputs		•							
48.	Tracking Generator L.O. Feedthrough Amplitude		•							
49.	Gate Delay Accuracy and Gate Length Accuracy					•				
50.	Gate Mode Amplitude Error					•				
53.	Comms Frequency Response							•	•	
55.	cdmaOne Modulation Accuracy (Rho)[c]									•

Table 1-2 Agilent E4402B Performance Verification Tests

Performance Test Name	Calibration for Instrument Option:								
	Std[a]	1DN	1DS	1D5	1D6	AYX	BAC	BAH	B7E
56. cdmaOne Modulation Accuracy - EVM (error vector magnitude)[c]									•
57. cdmaOne Code Domain Power[c]									•
58. GSM Phase and Frequency[d]									•
59. Comms Absolute Accuracy (Options BAC or BAH)							•	•	

a. Perform these tests for all E4402B analyzers.
b. Perform this test only on analyzers not equipped with Option 1D5.
c. Perform this test only on instruments having Option BAC, cdmaOne Measurement Personality.
d. Perform this test only on instruments having Option BAH, GSM Measurement Personality.

Table 1-3 Agilent E4403B Performance Verification Tests

	Performance Test Name	Calibration for Instrument Option:	
		Std[a]	1DN
1.	10 MHz Reference Output Accuracy	•	
3.	Frequency Readout and Marker Frequency Count Accuracy	•	
6.	Frequency Span Readout Accuracy	•	
7.	Noise Sidebands	•	
8.	System Related Sidebands	•	
9.	Residual FM	•	
10.	Sweep Time Accuracy	•	
11.	Display Scale Fidelity	•	
12.	Input Attenuation Switching Uncertainty	•	
14.	Reference Level Accuracy	•	
15.	Resolution Bandwidth Switching Uncertainty	•	
17.	Absolute Amplitude Accuracy (Reference Settings)	•	
19.	Overall Absolute Amplitude Accuracy	•	
20.	Resolution Bandwidth Accuracy	•	
22.	Frequency Response	•	
28.	Other Input Related Spurious Responses	•	
30.	Spurious Responses	•	
32.	Gain Compression	•	
35.	Displayed Average Noise Level	•	
38.	Residual Responses	•	
41.	Tracking Generator Absolute Amplitude and Vernier Accuracy		•
43.	Tracking Generator Level Flatness		•
45.	Tracking Generator Harmonic Spurious Outputs		•
47.	Tracking Generator Non-Harmonic Spurious Outputs		•
48.	Tracking Generator L.O. Feedthrough Amplitude		•

a. Perform these tests on all E4403B analyzers.

Table 1-4 Agilent E4404B Performance Verification Tests

	Performance Test Name	Calibration for Instrument Option:								
		Std[a]	1DN	1DS	1D5	1D6	AYX	BAC	BAH	B7E
1.	10 MHz Reference Output Accuracy[b]	•								
2.	10 MHz Precision Frequency Reference Output Accuracy				•					
4.	Frequency Readout and Marker Frequency Count Accuracy	•								
6.	Frequency Span Readout Accuracy	•								
7.	Noise Sidebands	•								
8.	System Related Sidebands	•								
9.	Residual FM	•								
10.	Sweep Time Accuracy	•								
11.	Display Scale Fidelity	•								
12.	Input Attenuation Switching Uncertainty	•								
14.	Reference Level Accuracy	•								
15.	Resolution Bandwidth Switching Uncertainty	•								
17.	Absolute Amplitude Accuracy (Reference Settings)	•								
19.	Overall Absolute Amplitude Accuracy	•								
20.	Resolution Bandwidth Accuracy	•								
23.	Frequency Response	•								
26.	Frequency Response (Preamp On)			•						
28.	Other Input Related Spurious Responses	•								
31.	Spurious Responses	•								
33.	Gain Compression	•								
36.	Displayed Average Noise Level	•								
38.	Residual Responses	•								
39.	Fast Time Domain Amplitude Accuracy						•			
41.	Tracking Generator Absolute Amplitude and Vernier Accuracy		•							
43.	Tracking Generator Level Flatness		•							
45.	Tracking Generator Harmonic Spurious Outputs		•							
47.	Tracking Generator Non-Harmonic Spurious Outputs		•							
48.	Tracking Generator L.O. Feedthrough Amplitude		•							
49.	Gate Delay Accuracy and Gate Length Accuracy					•				
50.	Gate Mode Amplitude Error					•				
53.	Comms Frequency Response							•	•	
55.	cdmaOne Modulation Accuracy (Rho)[c]									•
56.	cdmaOne Modulation Accuracy - EVM (error vector magnitude)[c]									•

Table 1-4 Agilent E4404B Performance Verification Tests

Performance Test Name	Calibration for Instrument Option:								
	Std[a]	1DN	1DS	1D5	1D6	AYX	BAC	BAH	B7E
57. cdmaOne Code Domain Power[c]									•
58. GSM Phase and Frequency[d]									•
59. Comms Absolute Accuracy (Options BAC or BAH)							•	•	

a. Perform these tests on all Agilent E4404B analyzers.
b. Perform this test only on analyzers not equipped with Option 1D5.
c. Perform this test only on instruments having Option BAC, cdmaOne Measurement Personality.
d. Perform this test only on instruments having Option BAH, GSM Measurement Personality.

Table 1-5 Agilent E4405B Performance Verification Tests

	Performance Test Name	Calibration for Instrument Option:								
		Std[a]	1DN	1DS	1D5	1D6	AYX	BAC	BAH	B7E
1.	10 MHz Reference Output Accuracy[b]	•								
2.	10 MHz Precision Frequency Reference Output Accuracy				•					
4.	Frequency Readout and Marker Frequency Count Accuracy	•								
6.	Frequency Span Readout Accuracy	•								
7.	Noise Sidebands	•								
8.	System Related Sidebands	•								
9.	Residual FM	•								
10.	Sweep Time Accuracy	•								
11.	Display Scale Fidelity	•								
12.	Input Attenuation Switching Uncertainty	•								
14.	Reference Level Accuracy	•								
15.	Resolution Bandwidth Switching Uncertainty	•								
17.	Absolute Amplitude Accuracy (Reference Settings)	•								
19.	Overall Absolute Amplitude Accuracy	•								
20.	Resolution Bandwidth Accuracy	•								
23.	Frequency Response	•								
26.	Frequency Response (Preamp On)			•						
28.	Other Input Related Spurious Responses	•								
31.	Spurious Responses	•								
33.	Gain Compression	•								
36.	Displayed Average Noise Level	•								
38.	Residual Responses	•								
39.	Fast Time Domain Amplitude Accuracy						•			
41.	Tracking Generator Absolute Amplitude and Vernier Accuracy		•							
43.	Tracking Generator Level Flatness		•							
45.	Tracking Generator Harmonic Spurious Outputs		•							
47.	Tracking Generator Non-Harmonic Spurious Outputs		•							
48.	Tracking Generator L.O. Feedthrough Amplitude		•							
49.	Gate Delay Accuracy and Gate Length Accuracy					•				
50.	Gate Mode Amplitude Error					•				
53.	Comms Frequency Response							•	•	
55.	cdmaOne Modulation Accuracy (Rho)[c]									•

Table 1-5 Agilent E4405B Performance Verification Tests

Performance Test Name	Calibration for Instrument Option:								
	Std[a]	1DN	1DS	1D5	1D6	AYX	BAC	BAH	B7E
56. cdmaOne Modulation Accuracy - EVM (error vector magnitude)[c]									•
57. cdmaOne Code Domain Power[c]									•
58. GSM Phase and Frequency[d]									•
59. Comms Absolute Accuracy (Options BAC or BAH)							•	•	

a. Perform these tests on all E4405B analyzers.
b. Perform this test only if the analyzer is not equipped with Option 1D5.
c. Perform this test only on instruments having Option BAC, cdmaOne Measurement Personality.
d. Perform this test only on instruments having Option BAH, GSM Measurement Personality.

Table 1-6 Agilent E4407B Performance Verification Tests

	Performance Test Name	Calibration for Instrument Option:									
		Std[a]	1DN	1DS	1D5	1D6	AYX	AYZ	BAC	BAH	B7E
1.	10 MHz Reference Output Accuracy[b]	•									
2.	10 MHz Precision Frequency Reference Output Accuracy				•						
4.	Frequency Readout and Marker Frequency Count Accuracy	•									
6.	Frequency Span Readout Accuracy	•									
7.	Noise Sidebands	•									
8.	System Related Sidebands	•									
9.	Residual FM	•									
10.	Sweep Time Accuracy	•									
11.	Display Scale Fidelity	•									
12.	Input Attenuation Switching Uncertainty	•									
14.	Reference Level Accuracy	•									
15.	Resolution Bandwidth Switching Uncertainty	•									
17.	Absolute Amplitude Accuracy (Reference Settings)	•									
19.	Overall Absolute Amplitude Accuracy	•									
20.	Resolution Bandwidth Accuracy	•									
23.	Frequency Response	•									
26.	Frequency Response (Preamp On)			•							
28.	Other Input Related Spurious Responses	•									
31.	Spurious Responses	•									
33.	Gain Compression	•									
37.	Displayed Average Noise Level	•									
38.	Residual Responses	•									
39.	Fast Time Domain Amplitude Accuracy						•				
41.	Tracking Generator Absolute Amplitude and Vernier Accuracy		•								
43.	Tracking Generator Level Flatness		•								
45.	Tracking Generator Harmonic Spurious Outputs		•								
47.	Tracking Generator Non-Harmonic Spurious Outputs		•								
48.	Tracking Generator L.O. Feedthrough Amplitude		•								
49.	Gate Delay Accuracy and Gate Length Accuracy					•					
50.	Gate Mode Amplitude Error					•					
52.	IF Input Accuracy							•			
53.	Comms Frequency Response								•	•	

Table 1-6 Agilent E4407B Performance Verification Tests

Performance Test Name		Calibration for Instrument Option:									
		Std[a]	1DN	1DS	1D5	1D6	AYX	AYZ	BAC	BAH	B7E
55.	cdmaOne Modulation Accuracy (Rho)[c]										•
56.	cdmaOne Modulation Accuracy - EVM (error vector magnitude)[d]										•
58.	GSM Phase and Frequency[d]										•
59.	Comms Absolute Accuracy (Options BAC or BAH)								•	•	

a. Perform these tests on all E4407B analyzers.
b. Perform this test only on analyzers not equipped with Option 1D5.
c. Perform this test only on instruments having Option BAC, cdmaOne Measurement Personality.
d. Perform this test only on instruments having Option BAH, GSM Measurement Personality.

Table 1-7 Agilent E4408B Performance Verification Tests

	Performance Test Name	Calibration for Instrument Option:	
		Std[a]	1DN
1.	10 MHz Reference Output Accuracy	•	
4.	Frequency Readout and Marker Frequency Count Accuracy	•	
6.	Frequency Span Readout Accuracy	•	
7.	Noise Sidebands	•	
8.	System Related Sidebands	•	
9.	Residual FM	•	
10.	Sweep Time Accuracy	•	
11.	Display Scale Fidelity	•	
12.	Input Attenuation Switching Uncertainty	•	
14.	Reference Level Accuracy	•	
15.	Resolution Bandwidth Switching Uncertainty	•	
17.	Absolute Amplitude Accuracy (Reference Settings)	•	
19.	Overall Absolute Amplitude Accuracy	•	
20.	Resolution Bandwidth Accuracy	•	
23.	Frequency Response	•	
28.	Other Input Related Spurious Responses	•	
31.	Spurious Responses	•	
33.	Gain Compression	•	
37.	Displayed Average Noise Level	•	
38.	Residual Responses	•	
41.	Tracking Generator Absolute Amplitude and Vernier Accuracy		•
43.	Tracking Generator Level Flatness		•
45.	Tracking Generator Harmonic Spurious Outputs		•
47.	Tracking Generator Non-Harmonic Spurious Outputs		•
48.	Tracking Generator L.O. Feedthrough Amplitude		•

a. Perform these tests on all E4408B analyzers.

Table 1-8 Agilent E4411B Performance Verification Tests

	Performance Test Name	Calibration for Instrument Option:		
		Std[a]	1DN	1DQ
1.	10 MHz Reference Output Accuracy	•		
3.	Frequency Readout and Marker Frequency Count Accuracy	•		
5.	Frequency Span Readout Accuracy	•		
7.	Noise Sidebands	•		
8.	System Related Sidebands	•		
9.	Residual FM	•		
10.	Sweep Time Accuracy	•		
11.	Display Scale Fidelity	•		
12.	Input Attenuation Switching Uncertainty	•		
13.	Reference Level Accuracy	•		
15.	Resolution Bandwidth Switching Uncertainty	•		
16.	Absolute Amplitude Accuracy (Reference Settings)	•		
18.	Overall Absolute Amplitude Accuracy	•		
20.	Resolution Bandwidth Accuracy	•		
21.	Frequency Response	•		
27.	Other Input Related Spurious Responses	•		
29.	Spurious Responses	•		
32.	Gain Compression	•		
34.	Displayed Average Noise Level	•		
38.	Residual Responses	•		
40.	Tracking Generator Absolute Amplitude and Vernier Accuracy		•	•
42.	Tracking Generator Level Flatness		•	•
44.	Tracking Generator Harmonic Spurious Outputs		•	•
46.	Tracking Generator Non-Harmonic Spurious Outputs		•	•

a. Perform these tests on all E4411B analyzers.

Before You Start

This brief procedure should be performed before starting the performance verification tests:

1. Switch the analyzer on and let it warm up for five minutes.
2. If the analyzer is an Agilent E4402B, E4403B, E4404B, E4405B, E4407B, or E4408B, connect a cable from AMPTD REF OUT to the 50 Ω Input.
3. Press **System**, **Alignments**, **Align Now**, **All**, and wait for the auto alignments to finish.
4. Read the remainder of this section before you start any of the tests, and make a copy of the Performance Verification Test Record described below in "Recording the test results."

Recording the test results

Performance verification test records, for each analyzer, are provided in the chapter following the tests.

Each test result is identified as a *TR Entry* in the performance tests and on the performance verification test record. We recommend that you make a copy of the performance verification test record, record the test results on the copy, and keep the copy for your calibration test record. This record could prove valuable in tracking gradual changes in test results over long periods of time.

Performing Self-Alignment

Perform a complete self-alignment at least once per day, or if the analyzer fails a verification test. To perform a self-alignment, press **System**, **Alignment**, **Align Now**, **All**. The instrument must be up to operating temperature in order for this test to be valid. If the analyzer continuously fails one or more specifications, complete any remaining tests and record all test results on a copy of the test record. Then refer to Chapter 4 , "If You Have a Problem," for instructions on how to solve the problem.

Periodic verification of operation

The analyzer requires periodic verification of operation. Under most conditions of use, you should test the analyzer at least once a year with the complete set of performance verification tests.

Test equipment you will need

The following tables list the recommended test equipment for the performance tests. The tables also list recommended equipment for the analyzer adjustment procedures which are located in the *Agilent ESA Spectrum Analyzers Assembly-Level Repair Service Guide*. Any equipment that meets the critical specifications given in the table can be substituted for the recommended model.

Table 1-9 Recommended Test Equipment

Equipment	Critical Specifications for Equipment Substitution	Recommended HP/Agilent Model	Use [a]
Digital Multimeter	Input Resistance ≥10 megohms Accuracy: ±10 mV on 100 V range	3458A 1160-0113-578 8-31-03	P,A,T
DVM Test Leads	For use with HP/Agilent 3458A Digital Multimeter	34118B	T
Universal Counter	Frequency Range: 10 MHz ±100 Hz Time Interval Range: 25 ms to 100 ms Single Operation Range: 2.5 Vdc to –2.5 Vdc External Reference Input	53132A 1160-0129-047 2-28-01	P,A,T
Frequency Standard	Frequency: 10 MHz Timebase Accuracy (Aging): $<1\times10^{-9}$/day	5071A FS 1002 1160 0171-180 12-30-99	P,A
Oscilloscope	Bandwidth: dc to 100 MHz Vertical Scale Factor of 0.5 V to 5 V/Div Two channels Minimum Timebase Setting: <100 ns Digitizing display with pulse width and time interval measurement functions Delta –T measurement accuracy in 200 ns / div: <450 ps	54820A	T

Table 1-9 Recommended Test Equipment

Equipment	Critical Specifications for Equipment Substitution	Recommended HP/Agilent Model	Use [a]
Power Meter	Compatible with HP/Agilent 8480 series power sensors. dB relative mode. Resolution: 0.01 dB Reference Accuracy: ±1.2%	E4419A ✓ 1160-0126-935 10-31-01	P,A,T
RF Power Sensor (2 required)	Frequency Range: 100 kHz to 3 GHz Maximum SWR: 1.60 (100 kHz to 300 kHz) 1.20 (300 kHz to 1 MHz) 1.1 (1 MHz to 2.0 GHz) 1.18 (2.0 GHz to 3.0 GHz) Amplitude range: –25 dBm to 10 dBm	8482A 1160-0821-010 04-30-01	P,A,T
Microwave Power Sensor	Frequency Range: 50 MHz to 26.5 GHz Maximum SWR: 1.15 (50 MHz to 100 MHz) 1.10 (100 MHz to 2 GHz) 1.15 (2 GHz to 12.4 GHz) 1.20 (12.4 GHz to 18 GHz) 1.25 (18 GHz to 26.5 GHz) Amplitude range: –25 dBm to 0 dBm	8485A ✓ 1160-3134 04-30-05	P,A,T
Power Sensor, 75 Ω (Option 1DP)	Frequency Range: 1 MHz to 1500 MHz Maximum SWR: 1.18 (600 kHz to 1500 MHz) Impedance: 75 Ω Amplitude Range: –30 dBm to 20 dBm	8483A	P,A,T
Power Sensor, Low Power	Frequency Range: 50 MHz to 3.0 GHz Amplitude Range: –20 dBm to –70 dBm Maximum SWR: 1.4 (10 MHz to 30 MHz) 1.15 (30 MHz to 3.0 GHz)	8481D ✓ 1160-0049-552 11-30-04	P,A,T
Synthesized Signal Generator	Frequency Range: 100 kHz to 1500 MHz Amplitude Range: –35 to 16 dBm SSB Noise: <–120 dBc/Hz at 20 kHz offset	8663A ✓ 1160-0101-549 05-31-02	P,A

Table 1-9 Recommended Test Equipment

Equipment	Critical Specifications for Equipment Substitution	Recommended HP/Agilent Model	Use [a]
Spectrum Analyzer, Microwave	Frequency Range: 100 kHz to 7 GHz Relative Amplitude Accuracy: 100 kHz to 3.0 GHz: <±1.8 dB Frequency Accuracy: <±10 kHz at 7 GHz	8563E 8565E 460-0126-715 08 31-02	P,T
Synthesized Sweeper (2 required)	Frequency Range: E4407B or E4408B: 10 MHz to 26.5 GHz All others: 10 MHz to 13.2 GHz Frequency Accuracy (CW): ±0.02% Leveling Modes: Internal and External Modulation Modes: AM Power Level Range: –40 to 16 dBm	83630/40/50B or 83620/30/B 40/50B	P,A,T 460-0129-304 04-30-01 460-0126-370 11-30-01
Function Generator	Frequency Range: 0.1 Hz to 15 MHz Frequency Accuracy: ±0.02% Waveform: Triangle, Square, Sine	33120A or 3325B 460-0111-02 8-31-01	P,A,T
Attenuator/Switch Driver	Compatible with HP/Agilent 8494G and 8496G Programmable step attenuators	11713A 460-0102 921 NCR	P
Attenuator, 1 dB Step	Attenuation Range: 0 to 11 dB Frequency Range: 4 GHz Connectors: Type-N female Calibrated at 50 MHz with accuracy of 1 to 11 dB attenuation: ±0.010 dB.	8494A/G 0-13-227 3-31-01	P
Attenuator, 10 dB Step	Attenuation Range: 0 to 110 dB Frequency Range: 4 GHz Connectors: Type-N female Calibrated at 50 MHz with accuracy of: 0 to 40 dB attenuation: ±0.020 dB 50 to 100 dB attenuation: ±0.065 dB 110 dB attenuation: ±0.075 dB	8496A/G 460-0127-920 3-31-01	P
Attenuator, 10 dB Fixed	Nominal attenuation: 10 dB Frequency Range: dc to 3 GHz Connectors: Type-N(m) and Type-N(f)	8491A Option 010	P

Table 1-9 Recommended Test Equipment

Equipment	Critical Specifications for Equipment Substitution	Recommended HP/Agilent Model	Use [a]
Attenuator, 6 dB Fixed	Nominal attenuation: 6 dB Frequency Range: 50 MHz ±1 MHz VSWR: <1.1: 1 at 50 MHz	8491A Option 006	P
Attenuator, 20 dB Fixed	Nominal attenuation: 20 dB Frequency Range: 100 kHz to 3 GHz VSWR: <1.2: 1 at ≤3 GHz	8491A Option 020	P
Attenuator Interconnect Kit	Mechanically and electrically connects HP/Agilent 8494A/G and HP/Agilent 8496A/G	11716 Series	

a. P = Performance Test, A = Adjustment, T = Troubleshooting

Table 1-10 Recommended Accessories

Equipment	Critical Specifications for Accessory Substitution	Recommended HP/Agilent Model	Use [a]
Directional Bridge	Frequency Range: 5 MHz to 3 GHz Directivity: >40 dB Coupling factor: 16 dB nominal Insertion Loss: 2 dB maximum	86205A ? Wiltron 60G50 460-0125-559 8-31-01	P
Power Splitter (for E4401B/ 02B/03B/11B)	Frequency Range: 9 kHz to 13.2 GHz Insertion Loss: 6 dB nominal Output Tracking: <0.25 dB Equivalent Output SWR: <1.22:1	11667A 460-0113-945 3-31-02	P,A
Power Splitter (for E4404B/ 05B/07B/08B)	Frequency Range: 9 kHz to 26.5 GHz Insertion Loss: 6 dB nominal Output Tracking: <0.25 dB Equivalent Output SWR: <1.22:1	11667B 460-0108-189 05 31-05	
Directional Coupler (for E4404B/05B/ 07B/08B)	Frequency Range: 2 GHz to 15 GHz Directivity: >16 dB Max.VSWR: 1.35:1 Transmission Arm Loss: <1.5 dB (nominal) Coupled Arm Loss: ~ 10 dB (nominal)	87300B ? Narda 0203-10 460-0127-098 12-31-02	
Termination, 50 Ω (2 required for Option 1DN)	Impedance: 50 Ω nominal Connector: Type-N (m)	909A	P,T
Termination, 50 Ω	Impedance: 50 Ω (nominal) Connector: BNC (m)	11593A	P,A
Termination, 75 Ω (Option 1DQ, 1DP)	Impedance: 75 Ω (nominal) (2 required for Option 1DQ) (1 required for Option 1DP)	909E Option 201	P,T

a. P = Performance Test, A = Adjustment, T = Troubleshooting

Table 1-11 Recommended Adapters

Critical Specifications for Adapter Substitution	Recommended HP/Agilent Model	Use [a]
BNC (m) to BNC (m)	1250-0216	P,T
BNC tee (f,m,f)	1250-0781	A,T
Type-N (f) to APC 3.5 (f)	1250-1745	P,A,T
Type-N (f) to BNC (m)	1250-1477	P,T
Type-N (f) to BNC (m), 75 Ω (2 required for Option 1DQ) (1 required for Option 1DP)	1250-1534	P,A,T
Type-N (m) to BNC (f) (4 required)	1250-1476	P,A,T
Type-N (m) to BNC (m) (2 required)	1250-1473	P,T
Type-N (m) to BNC (m), 75 Ω (Option 1DP)	1250-1533	P,A,T
Type-N (m) to Type-N (m)	1250-1472	P,T
Type-N (m) to Type-N (m)	1250-1475	P,A,T
Type-N (f) to Type-N (f), 75 Ω (Option 1DP)	1250-1529	P,A,T
Type-N (f), 75 Ω, to Type-N (m), 50 Ω (Option 1DP)	1250-0597	P,A,T
Type-N (m) to SMA (m)	1250-1636	P
50 to 75 Ω Minimum Loss Frequency Range: dc to 1.5 GHz Insertion Loss: 5.7 dB, nominal (Option 1DP)	11852B	P,A,T
Type N(f) to Type N(f)	1250-0777	
Type N(f) to BNC(f), 75 ohm (Option 1DP only)	1250-1535	
Type N (m) to APC 3.5 (f) (3 required)	1250-1744	
APC 3.5 (f) to APC 3.5 (f)	1250-1749	
Dual Banana to BNC (f)	1251-2277	P,A,T
Type N (m) to BNC (f) (2 required)	1250-0780	

a. P = Performance Test, A = Adjustment, T = Troubleshooting

Table 1-12 Recommended Cables

Critical Specifications for Cable Substitution	Recommended HP/Agilent Model	Use [a]
Frequency Range: dc to 1 GHz Length: Š122 cm (48 in) Connectors: BNC (m) both ends (4 required)	10503A	P,A,T
Type-N, 62 cm (24 in)	11500C	P,T
Type-N, 152 cm (60 in) (2 required)	11500D	P,A,T
Frequency Range: dc to 310 MHz Length: 23 cm (9 in) Connectors: BNC (m) both ends	10502A	P,T
BNC, 75 Ω, 30 cm (12 in) (Option 1DP)	5062-6452	P,A,T
Cable, Test Length: Š91 cm (36 in) Connectors: SMB (f) to BNC (m) (2 required)	85680-60093	T
APC 3.5 Cable Frequency: 9 kHz to 26.5 GHz Connectors: APC 3.5 (m)	8120-4921	P,A,T

a. P = Performance Test, A = Adjustment, T = Troubleshooting

2 Performance Verification Tests

These tests verify the electrical performance of the analyzer. Allow the analyzer to warm up in accordance with the temperature stability specifications before performing the tests.

Tests included in this section:

1. 10 MHz Reference Accuracy
2. 10 MHz High-Stability Frequency Reference Accuracy: Agilent E4401B, E4402B, E4404B, E4405B, and E4407B (Option 1D5)
3. Frequency Readout and Marker Frequency Count Accuracy: Agilent E4401B, E4402B, E4403B, and E4411B
4. Frequency Readout and Marker Frequency Count Accuracy: Agilent E4404B, E4405B, E4407B, and E4408B
5. Frequency Span Readout Accuracy: Agilent E4401B and Agilent E4411B
6. Frequency Span Readout Accuracy: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B
7. Noise Sidebands
8. System-Related Sidebands
9. Residual FM
10. Sweep Time Accuracy
11. Display Scale Fidelity
12. Input Attenuation Switching Uncertainty
13. Reference Level Accuracy: Agilent E4401B and Agilent E4411B
14. Reference Level Accuracy: Agilent E4402B, E4403B, E4404B, E4407B, and E4408B.
15. Resolution Bandwidth Switching Uncertainty
16. Absolute Amplitude Accuracy (Reference Settings): Agilent E4401B and E4411B
17. Absolute Amplitude Accuracy (Reference Settings): Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B
18. Overall Amplitude Accuracy: Agilent E4401B and E4411B
19. Overall Amplitude Accuracy: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B
20. Resolution Bandwidth Accuracy
21. Frequency Response: Agilent E4401B and E4411B
22. Frequency Response, Agilent E4402B and E4403B
23. Frequency Response, Agilent E4404B, E4405B, E4407B, and E4408B

24. Frequency Response (Preamp On): Agilent E4401B

25. Frequency Response (Preamp On): Agilent E4402B

26. Frequency Response (Preamp On): Agilent E4404B, E4405B, and E4407B

27. Other Input-Related Spurious Responses: Agilent E4401B and E4411B

28. Other Input-Related Spurious Responses: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B

29. Spurious Responses: Agilent E4401B and E4411B

30. Spurious Responses: Agilent E4402B and E4403B

31. Spurious Responses: Agilent E4404B, E4405B, E4407B, and E4408B

32. Gain Compression: Agilent E4401B, E4402B, E4403B, and E4411B

33. Gain Compression: Agilent E4404B, E4405B, E4407B, and E4408B

34. Displayed Average Noise Level: Agilent E4401B and E4411B

35. Displayed Average Noise Level: Agilent E4402B and E4403B

36. Displayed Average Noise Level: Agilent E4404B and E4405B

37. Displayed Average Noise Level: Agilent E4407B and E4408B

38. Residual Responses

39. Fast Time Domain Amplitude Accuracy: Agilent E4401B, E4402B, E4404B, E4405B, and E4407B (Option AYX)

40. Tracking Generator Absolute Amplitude and Vernier Accuracy: Agilent E4401B and E4411B (Option 1DN or 1DQ)

41. Tracking Generator Absolute Amplitude and Vernier Accuracy: Agilent E4402B, E4403B, E4404B, E4405B, E4407B and E4408B (Option 1DN)

42. Tracking Generator Level Flatness:
Agilent E4401B and E4411B (Option 1DN or 1DQ)

43. Tracking Generator Level Flatness: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B (Option 1DN)

44. Tracking Generator Harmonic Spurious Outputs: Agilent E4401B and E4411B (Option 1DN or 1DQ)

45. Tracking Generator Harmonic Spurious Outputs: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B (Option 1DN)

46. Tracking Generator Non-Harmonic Spurious Outputs: Agilent E4401B and E4411B (Option 1DN or 1DQ)

47. Tracking Generator Non-Harmonic Spurious Outputs: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B (Option 1DN)

48. Tracking Generator LO Feedthrough Amplitude: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B (Option 1DN)

49. Gate Delay Accuracy and Gate Length Accuracy: Agilent E4401B, E4402B, E4404B, E4405B, and E4407B (Option 1D6)

50. Gate Mode Additional Amplitude Error: Agilent E4401B, E4402B, E4404B, E4405B, and E4407B (Option 1D6)

51. First LO OUTPUT Amplitude Accuracy (Option AYZ only)

52. IF INPUT Accuracy (Option AYZ only)

53. Comms Frequency Response (Option BAC or BAH)

55. Modulation Accuracy - Rho (Options BAC and B7E)

56. CDMA Modulation Accuracy - EVM (Options BAC and B7E)

57. CDMA - Code Domain Power (Options BAC and B7E)

58. GSM - Phase and Frequency (Options BAH and B7E)

59. Comms Absolute Amplitude Accuracy (Options BAC or BAH)

Calibration

To perform calibration:

1. Run all performance verification tests listed in column 1 of Table 2-1.
2. If any of the performance verification tests fail, perform the appropriate calibration adjustments listed in column 2 of Table 2-1 which corresponds to the failure.
3. Repeat all of the performance verification tests listed in column 1 of Table 2-1 if any calibration adjustments were made in step 2. This will confirm that there is no interaction between adjustments which could negatively impact analyzer performance.

Table 2-1 lists the performance verification tests and adjustments needed for calibration. The performance tests are located in the following pages of this chapter. Adjustment information is located in the service guide.

Table 2-1 Calibration Requirements

Test #	Performance Verification Tests	Calibration Adjustments
1.	10 MHz Reference Output Accuracy	10 MHz Frequency Reference Adjustment
2.	10 MHz High-Stability Frequency Reference Output Accuracy	10 MHz Frequency Reference Adjustment
3.	Frequency Readout and Marker Frequency Accuracy	None
4.	Frequency Readout and Marker Frequency Accuracy	None
5.	Frequency Span Readout Accuracy	None
6.	Frequency Span Readout Accuracy	None
7.	Noise Sidebands	IF Amplitude
8.	System-related Sidebands	IF Amplitude
9.	Residual FM	None
10.	Sweep Time Accuracy	None
11.	Display Scale Fidelity	IF Amplitude
12.	Input Attenuation Switching Uncertainty	50 MHz Amplitude Reference
13.	Reference Level Accuracy	IF Amplitude
14.	Reference Level Accuracy	IF Amplitude
15.	Resolution BW Switching Uncertainty	IF Amplitude
16.	Absolute Amplitude Accuracy (Reference Settings)	None
17.	Absolute Amplitude Accuracy (Reference Settings)	None
18.	Overall Absolute Amplitude Accuracy	Frequency Response Adjustment
19.	Overall Absolute Amplitude Accuracy	None
20.	Resolution Bandwidth Accuracy	IF Amplitude
21.	Frequency Response	Frequency Response
22.	Frequency Response	Frequency Response
23.	Frequency Response	Frequency Response
24.	Frequency Response (Preamp On)	Frequency Response

Table 2-1 Calibration Requirements

Test #	Performance Verification Tests	Calibration Adjustments
25.	Frequency Response (Preamp On)	Frequency Response
26.	Frequency Response (Preamp On)	Frequency Response
27.	Other Input-Related Spurious Responses	None
28.	Other Input-Related Spurious Responses	None
29.	Spurious Responses	None
30.	Spurious Responses	None
31.	Spurious Responses	None
32.	Gain Compression	None
33.	Gain Compression	None
34.	Displayed Average Noise Level	Frequency Response
35.	Displayed Average Noise Level	Frequency Response
36.	Displayed Average Noise Level	Frequency Response
37.	Displayed Average Noise Level	Frequency Response
38.	Residual Responses	None
39.	Fast Time Domain Amplitude Accuracy	None
40.	Tracking Generator Absolute Amplitude and Vernier Accuracy	Tracking Generator ALC and Tracking Generator Frequency Slope
41.	Tracking Generator Absolute Amplitude and Vernier Accuracy	Tracking Generator ALC and Tracking Generator Frequency Slope
42.	Tracking Generator Level Flatness	Tracking Generator ALC and Tracking Generator Frequency Slope
43.	Tracking Generator Level Flatness	Tracking Generator ALC and Tracking Generator Frequency Slope
44.	Tracking Generator Harmonic Spurious Outputs	None
45.	Tracking Generator Harmonic Spurious Outputs	None
46.	Tracking Generator Non-Harmonic Spurious Outputs	None
47.	Tracking Generator Non-Harmonic Spurious Outputs	None

Table 2-1 Calibration Requirements

Test #	Performance Verification Tests	Calibration Adjustments
48.	Tracking Generator L.O. Feedthrough Amplitude	LO Power
49.	Gate Delay Accuracy and Gate Length Accuracy	None
50.	Gate Mode Amplitude Error	None
51.	First LO OUTPUT Amplitude Accuracy	LO Power
52.	IF INPUT Accuracy	IF INPUT Correction

Manual use of HP/Agilent 8494G and HP/Agilent 8496G Attenuators with the HP/Agilent 11713A

When using the programmable versions of the 1 dB and 10 dB step attenuator (HP/Agilent 8494G and HP/Agilent 8496G), the HP/Agilent 11713A Attenuator/ Switch Driver must be used to control the attenuators. The HP/Agilent 8494G 1 dB step attenuator should be connected as Attenuator X and the HP/Agilent 8496G 10 dB step attenuator should be connected as Attenuator Y.

Use Table 2-2 to determine which of the Attenuator X and Attenuator Y settings are use to set the step attenuators to the desired value. In the columns labeled Attenuator X and Attenuator Y, a "1" indicates that section is on (the LED in the button will be lit), while a "0" indicates that section is off. For example, if the 1 dB step attenuator should be set to 2 dB and the 10 dB step attenuator should be set to 60 dB, sections 2, 6, and 7 should be on (lit) and all other sections should be off.

Table 2-2 HP/Agilent 11713A Settings for HP/Agilent 8494G and HP/Agilent 8496G

1 dB Step Atten (dB)	Attenuator X				10 dB Step Atten (dB)	Attenuator Y			
	1	2	3	4		5	6	7	8
0	0	0	0	0	0	0	0	0	0
1	1	0	0	0	10	1	0	0	0
2	0	1	0	0	20	0	1	0	0
3	1	1	0	0	30	1	1	0	0
4	0	0	1	0	40	0	0	1	0
5	1	0	1	0	50	1	0	1	0

Table 2-2 HP/Agilent 11713A Settings for HP/Agilent 8494G and HP/Agilent 8496G

1 dB Step Atten (dB)	Attenuator X				10 dB Step Atten (dB)	Attenuator Y			
	1	2	3	4		5	6	7	8
6	0	1	1	0	60	0	1	1	0
7	1	1	1	0	70	1	1	1	0
8	0	0	1	1	80	0	0	1	1
9	1	0	1	1	90	1	0	1	1
10	0	1	1	1	100	0	1	1	1
11	1	1	1	1	110	1	1	1	1

1. 10 MHz Reference Accuracy


The sensibility is measured by changing the settings of the digital-to-analog converter (DAC), which controls the frequency of the timebase. The difference in frequency for each DAC step is calculated and compared to the specification.

The related adjustment for this performance verification test is the "10 MHz Reference Frequency Adjustment."

Equipment Required

Universal counter (Instructions are for HP/Agilent 53132A. For HP/Agilent 5316B, refer to its user documentation.)
Frequency standard
Cable, BNC, 122-cm (48-in) *(2 required)*

Figure 2-1 10 MHz Reference Test Setup

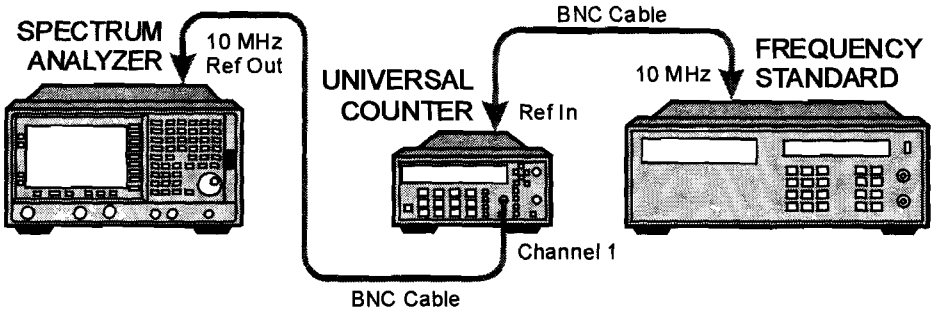

Procedure

1. Connect the equipment as shown in Figure 2-1. The frequency standard provides the reference for the universal counter.
2. Check that the analyzer is not in external reference mode. If `Ext Ref` appears on the screen, the analyzer is in external reference mode. If the analyzer is in external reference mode, disconnect the external reference.
3. Ensure that the analyzer has been on and in internal frequency mode for at least five minutes before proceeding.
4. Set the universal counter controls as follows:
   a. Press **Gate & ExtArm**.
   b. Press any one of the arrow keys until `TIME` is displayed.

c. Press **Gate & ExtArm** again. Using the arrow keys, set the time to 10 s.

d. Press **Enter**.

e. On Channel 1, press **50 Ω/1 MΩ** until the LED is lit.

f. On Channel 1, press **x10 Attenuator** until the LEd is extinguished.

g. On Channel 1, press **AC/DC** until the LED next to DC is extinguished.

h. On Channel 1, press **100 kHz Filter** until the LED is extinguished.

i. On Channel 1, press **Trigger/Sensitivity** until `Auto Trig` is displayed.

j. Use the arrow keys to toggle to off.

k. Press **Freq & Ratio**.

5. Wait for the universal counter reading to stabilize. Record the universal counter reading in Table 2-3 as Counter Reading 1 with 0.1 Hz resolution.

6. Set the analyzer by pressing the following keys:

   System, Alignments, Timebase, Fine

7. Record the number in the active function block of the analyzer in Table 2-3 as Timebase Fine.

8. Press the ↑ (up arrow) key on the analyzer.

9. Wait for the frequency counter reading to stabilize. Record the frequency counter reading in Table 2-3 as Counter Reading 2 with 0.1 Hz resolution.

10. Press the ↓ (down arrow) key on the analyzer 2 times.

11. Wait for the frequency counter reading to stabilize. Record the frequency counter reading in Table 2-3 as Counter Reading 3 with 0.1 Hz resolution.

12. Press **Preset** on the analyzer to return the DAC settings to their initial values. Press the **Factory Preset** softkey, if it is displayed.

13. Subtract Counter Reading 1 from Counter Reading 2 and record the difference in Table 2-3 as the Positive Frequency Change.

    Positive Frequency Change = Counter Reading 2 – Counter Reading 1

14. Subtract Counter Reading 3 from Counter Reading 1 and record the difference in Table 2-3 as the Positive Frequency Change.

    Negative Frequency Change = Counter Reading 1 – Counter Reading 3

15. Of the Positive Frequency Change and negative frequency change values recorded in Table 2-3, record the largest value in Table 2-3 as the maximum frequency change.

16. Divide the maximum frequency change by two and record the result as the settability.

Table 2-3 10 MHz Reference Accuracy Worksheet

Description	Measurement
Counter Reading 1	_____ Hz
Timebase Fine DAC	_____ Hz
Counter Reading 2	_____ Hz
Counter Reading 3	_____ Hz
Positive Frequency Change	_____ Hz
Negative Frequency Change	_____ Hz
Maximum Frequency Change	_____ Hz
Settability	_____ Hz

2. 10 MHz High-Stability Frequency Reference Accuracy: Agilent E4401B, E4402B, E4404B, E4405B, and E4407B (Option 1D5)

This test applies only to analyzers equipped with the high-stability frequency reference, Option 1D5. If your analyzer does not have Option 1D5, perform the "10 MHz Reference Output Accuracy" test instead.

This test measures the warmup characteristics of the 10 MHz reference oscillator. The ability of the 10 MHz oscillator to meet its warmup characteristics gives a high level of confidence that it will also meet its yearly aging specification.


The universal counter is connected to the 10 MHz REF OUT. After the analyzer has been allowed to cool for at least 60 minutes, the analyzer is powered on. A frequency measurement is made five minutes after power is applied and the frequency is recorded. Another frequency measurement is made 10 minutes later (15 minutes after power is applied) and the frequency is recorded. A final frequency measurement is made 60 minutes after power is applied. The difference between each of the first two frequency measurements and the last frequency measurement is calculated and recorded.

The related adjustment for this performance verification test is the "10 MHz Reference Frequency Adjustment."

Equipment Required

Universal counter (Instructions are for HP/Agilent 53132A. For HP/Agilent 5316B, refer to its user documentation.)
Frequency standard
Cable, BNC, 122-cm (48-in) (*2 required*)

Figure 2-2 Frequency Reference Test Setup

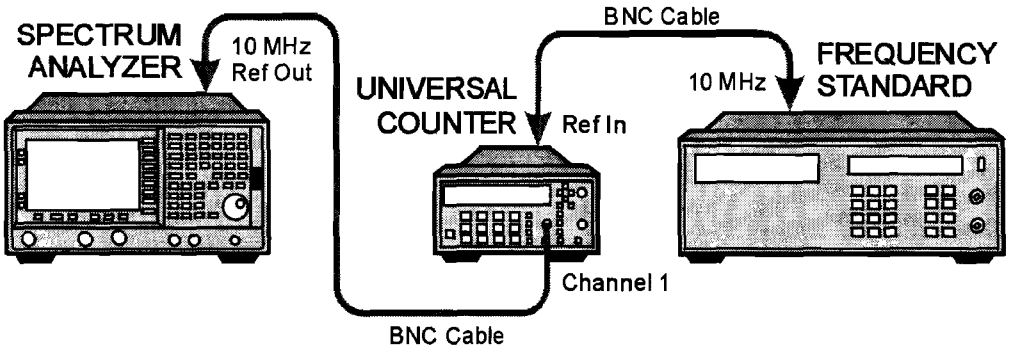

Procedure

The analyzer must have been allowed to sit with the power off for at least 60 minutes before performing this procedure. This adequately simulates a cold start.

1. Allow the analyzer to sit with the power off for at least 60 minutes before proceeding.
2. Switch the power to the analyzer on. Record the Power On Time below.

   Power On Time_____

3. Connect the equipment as shown in Figure 2-2. The frequency standard provides the reference for the universal counter. Disconnect any cable to the 10 MHz REF INPUT of the analyzer.
4. Check that the analyzer is not in external reference mode. `Ext Ref` will appear on the display if the analyzer is in external reference mode. If the analyzer is in external reference mode, disconnect the external reference.
5. Set the universal counter controls as follows:
   a. Press **Gate & ExtArm**.
   b. Press any one of the arrow keys until `TIME` is displayed.
   c. Press **Gate & ExtArm** again. Using the arrow keys, set the `TIME` to 10s.
   d. Press **Enter**
   e. On Channel 1, press **50 Ω/1 MΩ** to light the LED next to 50 Ω.
   f. On Channel 1, press **AC/DC** to extinguish the LED next to DC.
   g. On Channel 1, press **x10 Attenuator** to extinguish the LED next to x10 Attenuator.
   h. On Channel 1, press **100 kHz Filter** to extinguish the LED next to 100 kHz Filter.
   i. On Channel 1, press **Trigger/Sensitivity** until `Auto Trig` is displayed.
   j. Use the arrows keys to toggle to off.
   k. Press **Freq & Ratio**
6. Proceed with the next step 5 minutes after the Power On Time noted in step 2.
7. Wait for the universal counter reading to make at least two readings. Record the universal counter reading in Table 2-3 as Counter Reading 1 with 0.001 Hz resolution.

8. Proceed with next step 15 minutes after the Power On Time noted in step 2.
9. Wait for the universal counter reading to make at least two readings. Record the universal counter reading in Table 2-3 as Counter Reading 2 with 0.001 Hz resolution.
10. Proceed with next step 60 minutes after the Power On Time noted in step 2.
11. Wait for the universal counter reading to make at least two readings. Record the universal counter reading in Table 2-3 as Counter Reading 3 with 0.001 Hz resolution.
12. Calculate the 5 Minute Warm-up Error (in ppm) by subtracting Counter Reading 3 from Counter Reading 1 and dividing the result by 10.

    5 Minute Warm-up Error = (Counter Reading 1 – Counter Reading 3)/10

NOTE Dividing the frequency by 10 is equivalent to dividing the difference first by 10 MHz (to normalize the difference to the reference frequency) and then multiplying by 1×10^6 to convert the result to parts-per-million (ppm).

13. Record the 5 Minute Warm-up Error (in ppm) in the performance verification test record as TR Entry 1.
14. Calculate the 15 Minute Warm-up Error (in ppm) by subtracting Counter Reading 3 from Counter Reading 2 and dividing the result by 10.

    15 Minute Warm-up Error = (Counter Reading 2 – Counter Reading 3)/10

15. Record the 15 Minute Warm-up Error in the performance verification test record as TR Entry 2.

Table 2-4 10 MHz Reference Accuracy Worksheet

Description	Measurement
Counter Reading 1	_____ Hz
Counter Reading 2	_____ Hz
Counter Reading 3	_____ Hz

3. Frequency Readout and Marker Frequency Count Accuracy: Agilent E4401B, E4402B, E4403B, and E4411B

The frequency readout accuracy of the analyzer is tested with an input signal of known frequency. By using the same frequency standard for the analyzer and the synthesized sweeper, the frequency reference error is eliminated.

There is no related adjustment for this performance test.


Equipment Required

Synthesized sweeper
Adapter, Type N (f) to APC 3.5 (m)
Cable, Type N, 183 cm (72 in)
Cable, BNC, 122 cm (48 in)

Additional Equipment for 75 Ω Input

Pad, minimum loss
Adapter, Type N (f) to BNC (m), 75 Ω

Figure 2-3 Frequency Readout and Marker Frequency Accuracy Test Setup

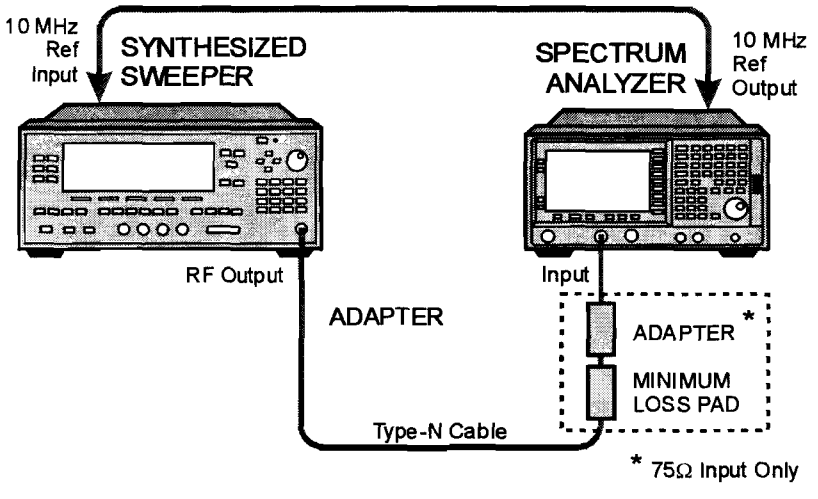

Procedure

This performance test consists of two parts:

"Part 1: Frequency Readout Accuracy"
"Part 2: Marker Count Accuracy"

Perform "Part 1: Frequency Readout Accuracy" before "Part 2: Marker Count Accuracy".

Part 1: Frequency Readout Accuracy

1. Connect the equipment as shown in Figure 2-3. Remember to connect the 10 MHz REF OUT of the analyzer to the 10 MHz REF INPUT of the synthesized sweeper.

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω inputs, or the input connector will be damaged.

2. Perform the following steps to set up the equipment:

   a. Press **INSTRUMENT PRESET** on the synthesized sweeper, then set the controls as follows:

      CW, 1.490 GHz (*E4401B and E4411B*)
      CW, 1.5 GHz (*E4402B and E4403B*)
      POWER LEVEL, –10 dBm

   b. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

      Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
      FREQUENCY, 1.5 GHz
      SPAN, 20 MHz

3. Press **Peak Search** (or **Search**) on the analyzer to measure the frequency readout accuracy.
4. Record the marker frequency reading in the performance verification test record.
5. Repeat step 3 and step 4 above for the remaining spans listed in Table 2-5.

Table 2-5 Frequency Readout Accuracy

Analyzer Span (MHz)	TR Entry, Actual Marker Frequency
20	1)
10	2)
1	3)

Part 2: Marker Count Accuracy

Perform "Part 1: Frequency Readout Accuracy" before performing this procedure.

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer to measure the marker count accuracy by pressing the following keys:

   FREQUENCY, 1.490 GHz (*E4401B and E4411B*)
   FREQUENCY, 1.5 GHz (*E4402B and E4403B*)
   SPAN, 10 MHz
   BW/Avg, Resolution BW, 100 kHz (Man)
   Freq Count, Marker Count (On)
   Resolution (Man), **1 Hz**

2. Press **Peak Search** (or **Search**), then wait for a count be taken (it may take several seconds).
3. Record the Cntr1 frequency reading as TR Entry 4 of the performance verification test record.
4. On the analyzer, press **SPAN, 1 MHz**.
5. Press **Peak Search** (or **Search**), then wait for a count be taken (it may take several seconds).
6. Record the Cntr1 frequency reading as TR Entry 5 of the performance verification test record.

4. Frequency Readout and Marker Frequency Count Accuracy: Agilent E4404B, E4405B, E4407B, and E4408B

The frequency readout accuracy of the analyzer is tested with an input signal of known frequency. By using the same frequency standard for the analyzer and the synthesized sweeper, the frequency reference error is eliminated.

There is no related adjustment for this performance test.


Equipment Required

Synthesized sweeper
Adapter, Type N (m) to APC 3.5 (f)
Adapter, APC 3.5 (f) to APC 3.5 (f)
Cable, APC 3.5, 91 cm (36 in)
Cable, BNC, 122 cm (48 in)

Additional Equipment for Option BAB

Adapter, APC 3.5 (f) to APC 3.5 (f)

Figure 2-4 Frequency Readout and Marker Count Accuracy Test Setup

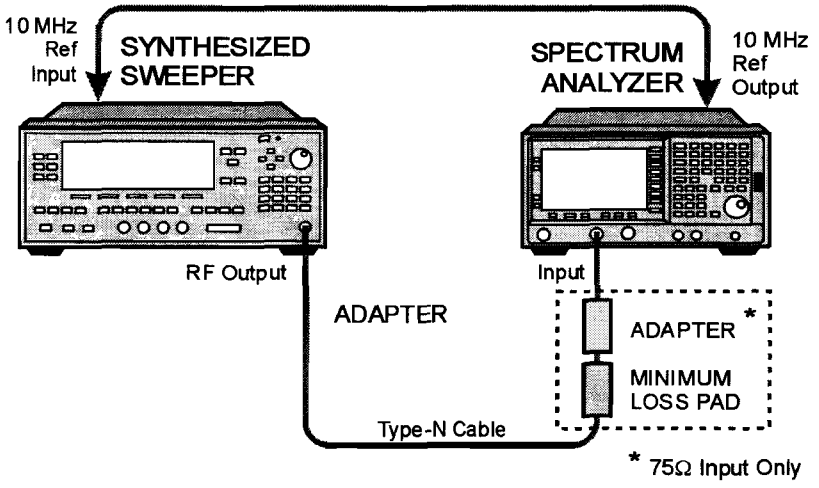

Procedure

This performance verification test consists of two parts:

"Part 1: Frequency Readout Accuracy"
"Part 2: Marker Count Accuracy"

Perform "Part 1: Frequency Readout Accuracy" before "Part 2: Marker Count Accuracy."

Part 1: Frequency Readout Accuracy

1. Connect the equipment as shown in Figure 2-4. Remember to connect the 10 MHz REF OUT of the analyzer to the 10 MHz REF INPUT of the synthesized sweeper.

   Option BAB only: Use the APC 3.5 adapter to connect the cable to the analyzer input.

2. Perform the following steps to set up the equipment:

   a. Press **INSTRUMENT PRESET** on the synthesized sweeper, then set the controls as follows:

      CW, 1.5 GHz
      POWER LEVEL, –10 dBm

   b. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

      Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
      FREQUENCY, 1.5 MHz
      SPAN, 20 MHz

3. Press **Peak Search** (or **Search**) on the analyzer to measure the frequency readout accuracy.

4. Record the Mkr1 frequency reading in the performance verification test record as indicated in Table 2-6.

5. Change to the next analyzer span setting listed in Table 2-6.

6. Repeat step 3 through step 5 for each analyzer frequency and span setting and synthesized sweeper CW frequency setting listed in Table 2-6 for the analyzer being tested.

Table 2-6 Frequency Readout Accuracy

Synthesized Sweeper CW Frequency (MHz)	Analyzer Span (MHz)	Analyzer Center Frequency (GHz)	TR Entry Frequency (GHz)
1500	20	1.5	1)
1500	10	1.5	2)
1500	1	1.5	3)
4000	20	4.0	4)
4000	10	4.0	5)

Table 2-6 **Frequency Readout Accuracy**

Synthesized Sweeper CW Frequency (MHz)	Analyzer Span (MHz)	Analyzer Center Frequency (GHz)	TR Entry Frequency (GHz)
4000	1	4.0	**6)**
Stop here for E4404B.			
9000	20	9.0	**7)**
9000	10	9.0	**8)**
9000	1	9.0	**9)**
Stop here for E4405B.			
16000	20	16.0	**10)**
16000	10	16.0	**11)**
16000	1	16.0	**12)**
21000	20	21.0	**13)**
21000	10	21.0	**14)**
21000	1	21.0	**15)**

Part 2: Marker Count Accuracy

Perform "Part 1: Frequency Readout Accuracy" before performing this procedure.

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer to measure the marker count accuracy by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, 1.5 GHz
   SPAN, 20 MHz
   BW/Avg, Resolution BW, 100 kHz (Man)
   Freq Count, Marker Count (On)
   Resolution (Man)

2. Press **Peak Search** (or **Search**), then wait for a count be taken (it may take several seconds).

3. Record the Cntr1 frequency reading in the performance verification test record as indicated in Table 2-7.

4. Repeat step 2 and step 3 for each analyzer center frequency and span setting and synthesized sweeper CW frequency setting listed in Table 2-7 for the analyzer being tested.

Performance verification test "Frequency Readout Accuracy and Marker Count Accuracy" is now complete.

Table 2-7 Marker Count Accuracy

Synthesized Sweeper CW Frequency	Analyzer Center Frequency	Analyzer Span	Cntr 1 Frequency
MHz	**GHz**	**MHz**	**TR Entry**
1500	1.5	20	**16)**
1500	1.5	1	**17)**
4000	4.0	20	**18)**
4000	4.0	1	**19)**
Stop here for E4404B.			
9000	9.0	20	**20)**
9000	9.0	1	**21)**
Stop here for E4405B.			
16000	16.0	20	**22)**
16000	16.0	1	**23)**
21000	21.0	20	**24)**
21000	21.0	1	**25)**

5. Frequency Span Readout Accuracy: Agilent E4401B and Agilent E4411B

For testing each frequency span, two synthesized sources are used to provide two precisely-spaced signals. The analyzer marker functions are used to measure this frequency difference.

There are no related adjustment procedures for this performance test.

Equipment Required

Synthesized sweeper
Synthesized signal generator
Power splitter
Adapter, Type-N (m) to Type-N (m)
Adapter, Type-N (f) to APC 3.5 (f)
Cable, Type-N, 152-cm (60-in) *(2 required)*
Cable, BNC, 122-cm (48-in)

Additional Equipment for 75 Ω Input

Pad, minimum loss
Adapter, Type-N (f), to BNC (m), 75 Ω

Procedure

Full Span Frequency Span Readout Accuracy


1. Connect the equipment as shown in Figure 2-5. Note that the power splitter is used as a combiner. The synthesized signal generator provides the frequency reference for the synthesized sweeper.
2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. If the firmware revision is A.04.00 or later, press **Sweep, Points, 401, Enter.**
3. Press **PRESET** on the synthesized sweeper and set the controls as follows:

   CW, 1350 MHz
   POWER LEVEL, –5 dBm

4. On the synthesized signal generator, set the controls as follows:

   FREQUENCY, 150 MHz
   AMPLITUDE, 0 dBm

Figure 2-5 Frequency Span Readout Accuracy Test Setup

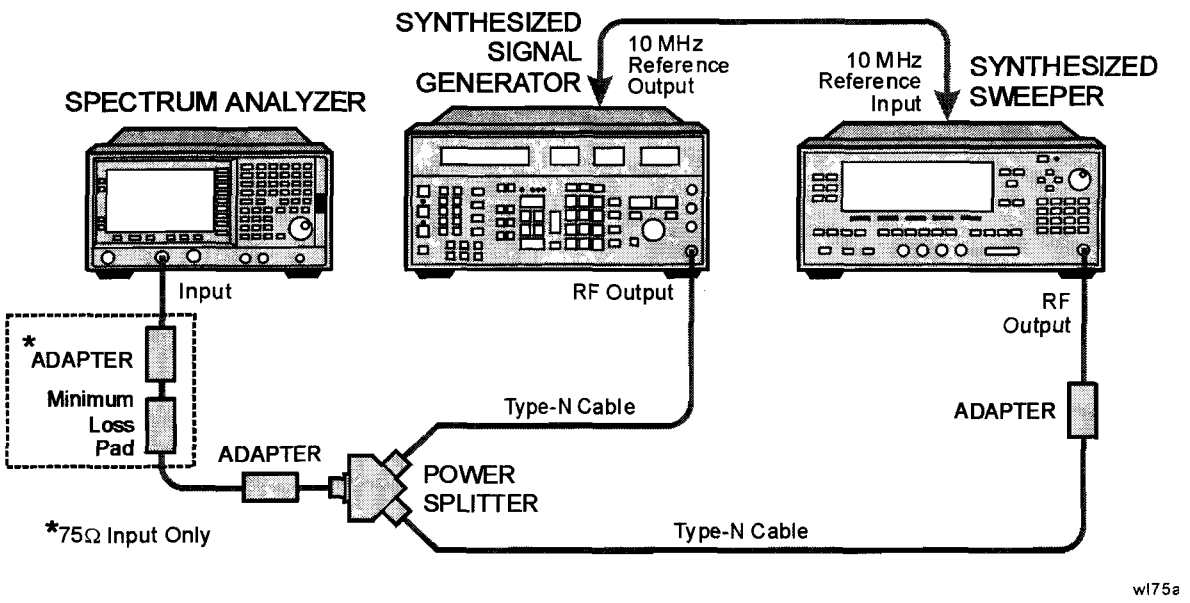

5. Adjust the analyzer center frequency, if necessary, to place the lower frequency on the second vertical graticule line (one division from the left-most graticule line).
6. On the analyzer, press **Single**. Wait for the completion of a new sweep, then press the following keys:

   Peak Search (or **Search**)
   Marker, Delta
   Next Peak

   The two markers should be on the signals near the second and tenth vertical graticule lines (the first graticule line is the left-most).
7. If necessary, continue pressing **Next Peak** until the active marker is on the right-most signal (1350 MHz).
8. Record the ΔMkr1 frequency reading as TR Entry 1 of the performance verification test record.

100 kHz and 100 MHz Frequency Span Readout Accuracy

1. Set the analyzer by pressing the following keys:

   FREQUENCY, Start Freq, 10 MHz
   Stop Freq, 110 MHz
   Sweep, Sweep (Cont)
2. On the synthesized sweeper set the controls as follows:

   CW, 100 MHz
   POWER LEVEL, –5 dBm

3. Set the synthesized signal generator controls as follows:

   FREQUENCY, 20 MHz
   AMPLITUDE, 0 dBm

4. Adjust the analyzer center frequency to center the two signals on the display.

5. On the analyzer, press **Single**. Wait for the completion of a new sweep, then press the following keys:

   Peak Search (or **Search**)
   Marker, Delta
   Next Peak

   The two markers should be on the signals near the second and tenth vertical graticule lines (the first graticule line is the left-most).

6. If necessary, continue pressing **Next Peak** until the active marker is on the right-most signal (100 MHz). Record the ΔMkr1 frequency reading in the performance test record as TR Entry 2.

7. Press **Marker, More, Marker All Off** on the analyzer.

8. Change to the next equipment settings listed in Table 2-8.

9. On the analyzer, press **Single**. Wait for the completion of a newsweep, then press the following keys:

   Peak Search (or **Search**)
   Marker, Delta
   Next Peak

10. If necessary, continue pressing **Next Peak** until the marker delta is on the right-most signal. Record the ΔMkr1 frequency reading in the performance test record.

11. Repeat step 7 through step 10 for the remaining analyzer span settings listed in Table 2-8.

Table 2-8 Frequency Span Readout Accuracy

Analyzer Start Frequency (MHz)	Analyzer Stop Frequency (MHz)	Synthesized Signal Generator Frequency (MHz)	Synthesized Sweeper Frequency (MHz)	TR Entry	Analyzer Span (MHz)
0	1500	150	1350	1)	1500
10	110	20	100	2)	100
10	10.1	10.01	10.09	3)	0.1
800	900	810	890	4)	100
800	800.1	800.01	800.09	5)	0.1
1400	1500	1410	1490	6)	100
1499	1499.1	1499.01	1499.09	7)	0.1

6. Frequency Span Readout Accuracy: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B

For testing each frequency span, two synthesized sources are used to provide two precisely-spaced signals. The analyzer marker functions are used to measure this frequency difference.

There are no related adjustment procedures for this performance test.

Equipment Required

Synthesized sweeper
Synthesized signal generator
Power splitter
Adapter, Type-N (m) to Type-N (m)
Adapter, Type-N (f) to APC 3.5 (f)
Cable, Type-N, 152-cm (60-in) *(2 required)*
Cable, BNC, 122-cm (48-in)

Additional Equipment for Option BAB

Adapter, Type-N (m), to APC 3.5 (f)

Procedure

Full Span Frequency Span Readout Accuracy

1. Connect the equipment as shown in Figure 2-5. Note that the power splitter is used as a combiner. The synthesized signal generator provides the frequency reference for the synthesized sweeper.
2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, Stop Freq, 3 GHz


3. Press **PRESET** on the synthesized sweeper and set the controls as follows:

   CW, 2700 MHz
   POWER LEVEL, –5 dBm

4. On the synthesized signal generator, set the controls as follows:

   FREQUENCY, 300 MHz
   AMPLITUDE, 0 dBm

Figure 2-6 Frequency Span Readout Accuracy Test Setup

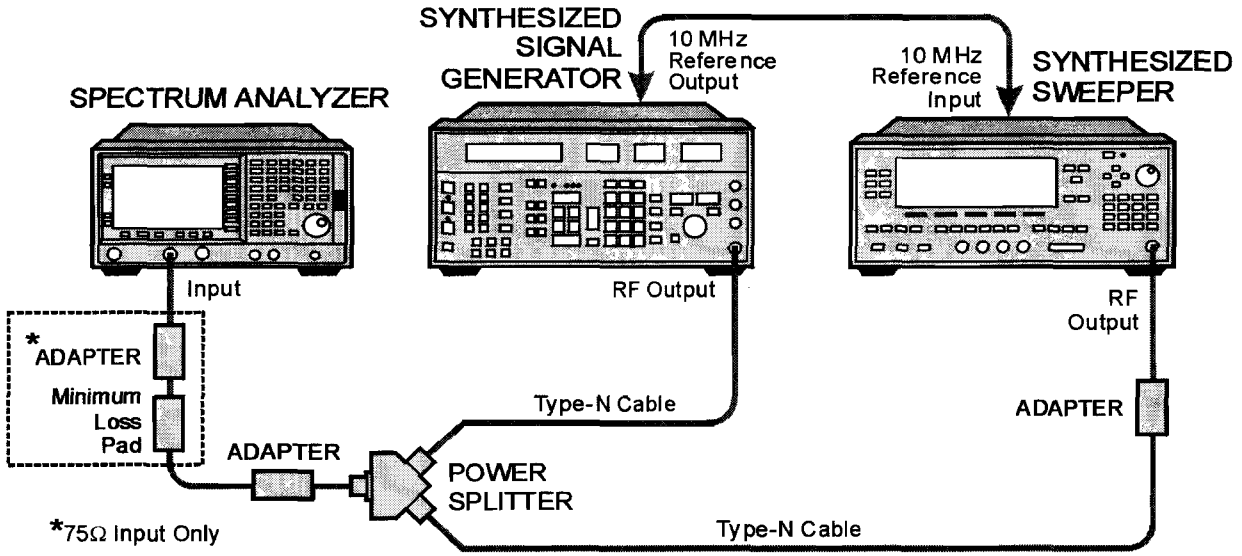

5. Adjust the analyzer center frequency, if necessary, to place the lower frequency on the second vertical graticule line (one division from the left-most graticule line).
6. On the analyzer, press **Single**. Wait for the completion of a new sweep, then press the following keys:

   Peak Search (or **Search**)
   Marker, Delta
   Next Peak

NOTE The two markers should be on the signals near the second and tenth vertical graticule lines (the first graticule line is the left-most).

7. If necessary, continue pressing **Next Peak** until the active marker is on the right-most signal (2700 MHz).
8. Record the ΔMkr1 frequency reading as TR Entry 1 of the performance verification test record.

100 kHz and 100 MHz Frequency Span Readout Accuracy

1. Set the analyzer by pressing the following keys:

   FREQUENCY, Start Freq, 10 MHz
   Stop Freq, 110 MHz
   Sweep, Sweep (Cont)

2. On the synthesized sweeper set the controls as follows:

   CW, 100 MHz
   POWER LEVEL, –5 dBm

3. Set the synthesized signal generator controls as follows:

   FREQUENCY, 20 MHz
   AMPLITUDE, 0 dBm

4. Adjust the analyzer center frequency to center the two signals on the display.

5. On the analyzer, press **Single**. Wait for the completion of a new sweep, then press the following keys:

   Peak Search (or **Search**)
   Marker, Delta
   Next Peak

   The two markers should be on the signals near the second and tenth vertical graticule lines (the first graticule line is the left-most).

6. If necessary, continue pressing **Next Peak** until the active marker is on the right-most signal (100 MHz). Record the ΔMkr1 frequency reading in the performance test record as TR Entry 2.

7. Press **Marker**, **More**, **Marker Off** on the analyzer.

8. Change to the next equipment settings listed in Table 2-9.

9. On the analyzer, press **Single.** Wait for the completion of a new sweep, then press the following keys:

   Peak Search (or **Search**)
   Marker, Delta
   Next Peak

10. If necessary, continue pressing **Next Peak** until the marker delta is on the right-most signal. Record the ΔMkr1 frequency reading in the performance test record.

11. Repeat step 7 through step 10 for the remaining analyzer span settings listed in Table 2-9.

Table 2-9 Frequency Span Readout Accuracy

Analyzer Start Frequency (MHz)	Analyzer Stop Frequency (MHz)	Synthesized Signal Generator Frequency (MHz)	Synthesized Sweeper Frequency (MHz)	TR Entry	Analyzer Span (MHz)
0	3000	300	2700	1)	3000
10	110	20	100	2)	100
10	10.1	10.01	10.09	3)	0.1
800	900	810	890	4)	100
800	800.1	800.01	800.09	5)	0.1
1400	1500	1410	1490	6)	100
1499	1499.1	1499.01	1499.09	7)	0.1

7. Noise Sidebands

A 1 GHz CW signal is applied to the input of the analyzer. The marker functions are used to measure the amplitude of the carrier and the noise level at 10 kHz, 20 kHz, 30 kHz, and 100 kHz above and below the carrier.

There are no related adjustment procedures for this performance test.

Equipment Required

Synthesized signal generator
Cable, Type-N, 152-cm (60-in)


Additional Equipment for 75 Ω Input

Pad, minimum loss
Adapter, Type-N (f), to BNC (m), 75 Ω

Additional Equipment for Option BAB

Adapter, Type-N (f), to APC 3.5 (f)

Figure 2-7 Noise Sidebands Test Setup

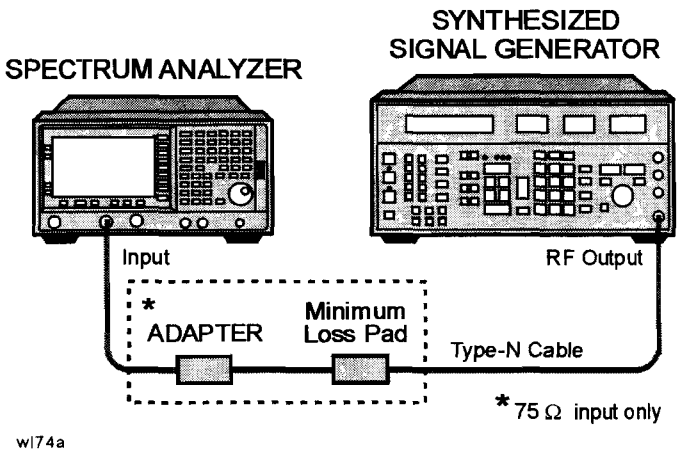

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω connectors, or the connectors will be damaged.

Procedure

This performance test consists of four parts:

Part 1: Noise Sideband Suppression at 10 kHz
Part 2: Noise Sideband Suppression at 20 kHz
Part 3: Noise Sideband Suppression at 30 kHz
Part 4: Noise Sideband Suppression at 100 kHz

Perform part 1 before performing parts 2-4 of this procedure.

A worksheet is provided at the end of this procedure for calculating the noise sideband suppression.

Part 1: Noise Sideband Suppression at 10 kHz

1. Perform the following steps to set up the equipment:

   a. Set the synthesized signal generator controls as follows:

      FREQUENCY, 1000 MHz
      AMPLITUDE, 0 dBm (50 Ω Input only)
      AMPLITUDE, to 6 dBm (75 Ω Input only)
      AM OFF
      FM OFF

   b. Connect the equipment as shown in Figure 2-7.

   c. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

      Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
      FREQUENCY, 1 GHz
      SPAN, 10 MHz
      AMPLITUDE, Attenuation 10 dB (Man)
      AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**

2. Press the following analyzer keys to measure the carrier amplitude:

   Peak Search (or **Search**)
   FREQUENCY, Signal Track (On)
   SPAN, 50 kHz
   BW/Avg, 1 kHz
   Video BW, 30 Hz (Man)
   FREQUENCY, Signal Track (Off)
   Sweep, Sweep Time, 5 sec
   Single

   Wait for the completion of a sweep, then press **Peak Search** (or **Search**).

3. Press the following analyzer keys to measure the noise sideband level at 10 kHz:

   Marker, Delta
   More, Function, Marker Noise (or **Noise**)
   AMPLITUDE, –10 dBm
   FREQUENCY, CF Step, 10 kHz
   Center Freq, ↑
   SPAN, Zero Span
   Single

   Record the marker delta amplitude reading in Table 2-10 as the Noise Sideband Level at 10 kHz.

4. Press the following analyzer keys to measure the noise sideband level at –10 kHz:

   FREQUENCY, ↓, ↓
   Single

   Record the marker amplitude reading in the Noise Sideband Worksheet as the Noise Sideband Level at –10 kHz.

5. Record the more positive value, either Noise Sideband Level at 10 kHz or Noise Sideband Level at –10 kHz from the Noise Sideband Worksheet as TR Entry 1 in the performance verification test record.

6. Press **FREQUENCY, ↑**

Part 2: Noise Sideband Suppression at 20 kHz

1. Press the following analyzer keys to measure the noise sideband level at 20 kHz:

   FREQUENCY, CF Step, 20 kHz
   Center Freq, ↑
   Single

   Record the marker amplitude reading in the Noise Sideband Worksheet as the Noise Sideband Level at 20 kHz.

2. Press the following analyzer keys to measure the noise sideband level at –20 kHz:

   FREQUENCY, ↓, ↓
   Single

   Record the marker amplitude reading in the Noise Sideband Worksheet as the Noise Sideband Level at –20 kHz.

3. Record the more positive value, either Noise Sideband Level at 20 kHz or Noise Sideband Level at –20 kHz from the Noise Sideband Worksheet as TR Entry 2 in the performance verification test record.

4. Press **FREQUENCY, ↑**.

Part 3: Noise Sideband Suppression at 30 kHz

1. Press the following analyzer keys to measure the noise sideband level at 30 kHz:

   FREQUENCY, CF Step, 30 kHz
   Center Freq, ↑
   Single

   Record the marker amplitude reading in the Noise Sideband Worksheet as the Noise Sideband Level at 30 kHz.

2. Press the following analyzer keys to measure the noise sideband level at -30 kHz:

   FREQUENCY, ↓, ↓
   Single

   Record the marker amplitude reading in the Noise Sideband Worksheet as the Noise Sideband Level at -30 kHz.

3. Record the more positive value, either Noise Sideband Level at 30 kHz or Noise Sideband Level at -30 kHz from the Noise Sideband Worksheet as TR Entry 3 in the performance verification test record.

4. Press **FREQUENCY, ↑**.

Part 4: Noise Sideband Suppression at 100 kHz

1. Press the following analyzer keys to measure the noise sideband level at 100 kHz:

   FREQUENCY, CF Step, 98 kHz
   Center Freq, ↑
   Single

   Record the marker amplitude reading in the Noise Sideband Worksheet as the Noise Sideband Level at 100 kHz.

2. Press the following analyzer keys to measure the noise sideband level at -100 kHz:

   FREQUENCY, ↓, ↓
   Single

NOTE A spur may exist at 100 kHz offset from the carrier. Measuring at ±98 kHz offset from the carrier will yield a noise sideband level worse than the reading at ±100 kHz offset.

Record the marker amplitude reading in the Noise Sideband Worksheet as the Noise Sideband Level at -100 kHz.

3. Record the more positive value; either Noise Sideband Level at 100 kHz or Noise Sideband Level at -100 kHz from the Noise Sideband Worksheet as TR Entry 4 in the performance test verification record.

Table 2-10 Noise Sideband Worksheet

Description	Measurement
Noise Sideband Level at 10 kHz	dBc/Hz
Noise Sideband Level at -10 kHz	dBc/Hz
Noise Sideband Level at 20 kHz	dBc/Hz
Noise Sideband Level at -20 kHz	dBc/Hz
Noise Sideband Level at 30 kHz	dBc/Hz
Noise Sideband Level at -30 kHz	dBc/Hz
Noise Sideband Level at 100 kHz	dBc/Hz
Noise Sideband Level at -100 kHz	dBc/Hz

8. System-Related Sidebands

A 500 MHz CW signal is applied to the input of the analyzer. The marker functions are used to measure the amplitude of the carrier and the amplitude of any system-related sidebands more than 30 kHz away from the carrier. System-related sidebands are any internally generated sidebands related to the line, power supply or local oscillator.

There are no related adjustment procedures for this performance test.

Equipment Required

Synthesized signal generator
Cable, Type-N, 152-cm (60-in)


Additional Equipment for 75 Ω Input

Pad, minimum loss
Adapter, Type-N (f), to BNC (m), 75 Ω

Additional Equipment for Option BAB

Adapter, Type-N (f), to APC 3.5 (f)

Figure 2-8 **System-related Sidebands Test Setup**

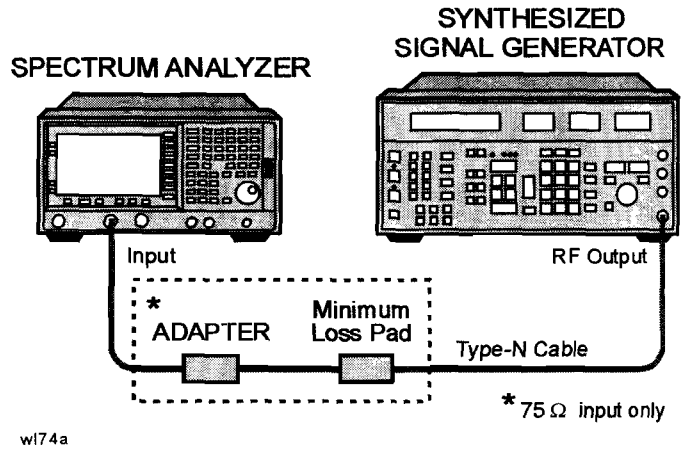

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω connectors, or the connectors will be damaged.

Procedure

1. Perform the following steps to set up the equipment:

   a. Set the synthesized signal generator controls as follows:

      FREQUENCY, 500 MHz
      AMPLITUDE, 0 dBm *(50 Ω Input only)*
      AMPLITUDE, 6 dBm (75 Ω *Input only)*
      AM Off
      FM Off

   b. Connect the equipment as shown in Figure 2-8.

   c. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

      Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
      FREQUENCY, 500 MHz
      SPAN, 10 MHz

2. Set the analyzer to measure the system-related sideband above the signal by performing the following steps:

   a. Press the following keys:

      Peak Search (or **Search**)
      FREQUENCY, Signal Track (On)
      SPAN, 200 kHz
      BW/Avg, 1 kHz
      Video BW, 30 Hz (Man)

      Allow the analyzer to take two complete sweeps. Then press the following keys:

      FREQUENCY, Signal Track (Off)
      CF Step, 130 kHz (Man)

   b. Press **Single** and wait for the completion of the sweep. Press **Peak Search** (or **Search**), then **Marker, Delta**.

   c. Press the following keys:

      FREQUENCY
      ↑(step-up key)

3. Measure the system-related sideband above the signal by pressing **Single** on the analyzer. Wait for the completion of a new sweep, then press **Peak Search** (or **Search**).

4. Record the marker delta amplitude as TR Entry 1 of the performance verification test record.

5. Set the analyzer to measure the system-related sideband below the signal by pressing the following keys:

   FREQUENCY
   ↓ (step-down key)
   ↓ (step-down key)

6. Measure the system-related sideband below the signal by pressing **Single**. Wait for the completion of a new sweep, then press **Peak Search** (or **Search**).

   Record the marker delta amplitude as TR Entry 2 of the performance verification test record.

9. Residual FM

This test measures the inherent short-term instability of the analyzer LO system. With the analyzer in zero span, a stable signal is applied to the input and slope detected on the linear portion of the IF bandwidth filter skirt. Any instability in the LO transfers to the IF signal in the mixing process. The test determines the slope of the IF filter in Hz/dB and then measures the signal amplitude variation caused by the residual FM. Multiplying these two values yields the residual FM in Hz.

Since the 10 Hz resolution bandwidth filter is digitally implemented, its slope is well known. The measured amplitude variation is simply multiplied by the known slope to yield the residual FM in a 10 Hz Res BW.

There are no related adjustment procedures for this performance test.

Equipment Required

Synthesized signal generator
Cable, Type-N, 152-cm (60-in)


Additional Equipment for 75 Ω Input

Pad, minimum loss
Adapter, Type-N (f), to BNC (m), 75 Ω

Additional Equipment for Option BAB

Adapter, Type-N (f), to APC 3.5 (f)

Figure 2-9 Residual FM Test Setup

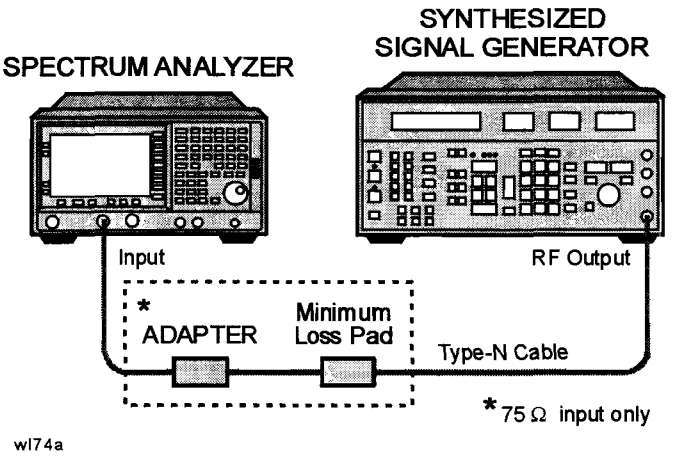

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω connectors, or the connectors will be damaged.

Procedure

This performance test consists of two parts:

"Part 1: Residual FM"
"Part 2: Residual FM for Option 1DR and 1D5"

Perform "Part 2: Residual FM for Option 1DR," and 1D5 in addition to Part 1, only if your analyzer is equipped with Option 1DR or 1D5.

Part 1: Residual FM

Determining the IF Filter Slope

1. Connect the equipment as shown in Figure 2-9.
2. Set the synthesized signal generator controls as follows:

   FREQUENCY, 1000 MHz
   AMPLITUDE, –10 dBm (50 Ω *Input only)*
   AMPLITUDE, –4 dBm (75 Ω *Input only)*
   AM OFF
   FM OFF

3. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, Center Freq, 1 GHz
   SPAN, 1 MHz
   AMPLITUDE, Ref Level, –9 dBm (50 Ω *Input only)*
   AMPLITUDE, 39.8 dBmV (75 Ω *Input only)*
   Scale/Div, 2 dB
   BW/Avg, Resolution BW, 1 kHz

4. On the analyzer, press the following keys:

   Peak Search (or **Search**)
   SPAN, Span Zoom, 5 kHz

   Wait for the Span 5kHz message to appear, then press:

   Peak Search (or **Search**), **More, Marker → Ref Lvl, Marker, Off**

5. On the analyzer, press the following keys:

   Single (Wait for the sweep to finish)
   Peak Search (or **Search**)
   Meas Tools, Delta

6. On the analyzer, rotate RPG knob counterclockwise until the ΔMkr1 amplitude reads –8 dB ±0.3 dB.
7. Press **Delta**, then rotate the knob counterclockwise until the ΔMkr1 reads –4 dB ±0.3 dB.

   If you have difficulty achieving the ±0.3 dB setting, then make the following analyzer settings:

   Sweep, Sweep (Cont)
   SPAN, 2 kHz
   BW/Avg, Video BW, 30 Hz (Man)
   Repeat step 5 through step 7.
8. Divide the ΔMkr1 frequency in Hertz by the ΔMkr1 amplitude in dB to obtain the slope of the resolution bandwidth filter. For example, if the ΔMkr1 frequency is 275 Hz and the ΔMkr1 amplitude is 3.92 dB, the slope would be equal to 94.2 Hz/dB. Record the result below:

   Slope _____ Hz/ dB

Measuring the Residual FM

9. On the analyzer, press:

   Marker, Off
   Peak Search (or **Search**)
   Meas Tools
   Delta
10. Rotate the RPG knob counterclockwise until the ΔMkr1 amplitude reads –10 dB ±0.3 dB.
11. On the analyzer, press the following keys:

    Marker, Normal
    Marker →, Mkr → CF
    Single
    BW/Avg, Video BW (Man), **1 kHz**
    SPAN, Zero Span
    Sweep, Sweep Time
    100 ms, Single

    The displayed trace should be about five divisions below the reference level. If it is not, press **Sweep, Sweep** (Cont), **FREQUENCY**, and use the RPG knob to place the displayed trace about five divisions below the reference level. Press **Single**.
12. On the analyzer, press **Peak Search** (or **Search**), **Pk-Pk Search**. Read the ΔMkr1 amplitude, take its absolute value, and record the result as the Deviation.

    Deviation _____ dB

13. Calculate the Residual FM by multiplying the Slope recorded in step 8 by the Deviation recorded in step 12.

    Record this value as TR Entry 1 (Residual FM (1 kHz Res BW) in the performance verification test record.

Part 2: Residual FM for Option 1DR and 1D5

Perform this additional procedure only if Option 1DR and Option 1D5 are present. Perform "Part 1: Residual FM" before performing this procedure.

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, Center Freq, 1 GHz
   SPAN, 1 MHz
   AMPLITUDE, Ref Level, –9 dBm (50 Ω *Input only)*
   AMPLITUDE, Ref Level, 39.8 dBmV (75 Ω *Input only)*
   Scale/Div, 2 dB

2. On the analyzer press the following keys:

   Peak Search (or **Search**)
   SPAN, Span Zoom, 5 kHz

   Wait for the "Span 5 kHz" message to appear. Press the following keys:

   BW/Avg, Resolution BW, 10 Hz (Man)
   SPAN, 100 Hz

3. On the analyzer, press the following keys:

   Peak Search (or **Search**)
   More, Mkr → Ref Lvl
   Marker, Off
   Peak Search (or **Search**)
   Meas Tools
   Delta

4. On the analyzer, rotate the RPG knob counterclockwise until the ΔMkr1 amplitude reads –10 dB ±0.3 dB.

5. On the analyzer, press the following keys:

   Marker, Normal
   Marker →, Mkr → CF
   Single
   BW/Avg, Video BW, 10 Hz (Man)
   SPAN, Zero Span
   Sweep, Sweep Time, 20 ms
   Single

   The displayed trace should be about five divisions below the reference level. If it is not, press **Sweep, Sweep** (Cont), **FREQUENCY**, and use the RPG knob to place the displayed trace about five divisions below the reference level. Press **Single**.

6. On the analyzer, press **Peak Search** (or **Search**), **Pk-Pk Search**. Read the ΔMkr1 amplitude, take its absolute value, and record the result as the Deviation.

   Deviation _____ dB

7. Calculate the Residual FM by multiplying the deviation recorded in step 6 by 0.426 Hz/dB. This is the slope of the 10 Hz Res BW filter at 10 dB below the peak of the filter.

   Record this value as TR Entry 2 (Residual FM (10 Hz RBW)) in the performance verification test record.

10. Sweep Time Accuracy

This test uses a function generator to amplitude-modulate a 500 MHz CW signal from another signal generator. The analyzer demodulates this signal in zero span to display the response in the time domain. The marker Δ function on the analyzer is used to read out the sweep time accuracy.

If the analyzer is equipped with Option AYX, also perform "Fast Time Domain Amplitude Accuracy" in addition to this procedure.

There are no related adjustment procedures for this performance test.

Equipment Required

Function generator
Synthesized signal generator
Cable, Type-N, 152-cm (60-in)
Cable, BNC, 120-cm (48-in)


Additional Equipment for 75 Ω Input

Pad, minimum loss
Adapter, Type-N (f), to BNC (m), 75 Ω

Additional Equipment for Option BAB

Adapter, Type-N (f), to APC 3.5 (f)

Figure 2-10 Sweep Time Accuracy Test Setup

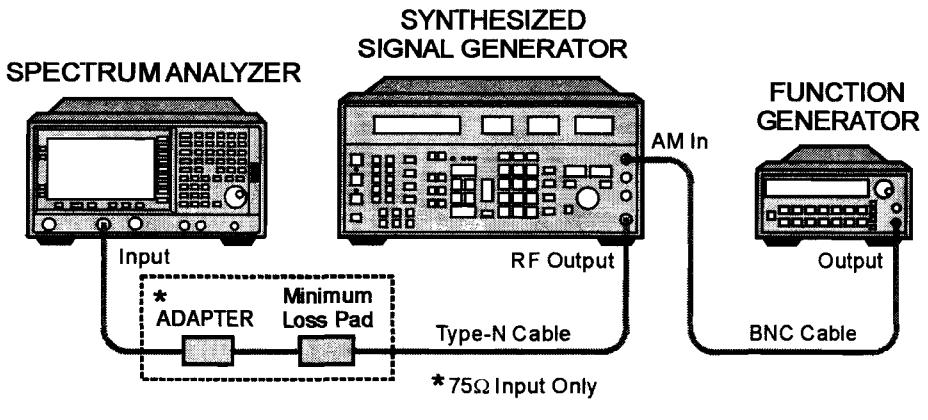

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω connectors, or the connectors will be damaged.

Procedure

1. Set the synthesized signal generator to output a 500 MHz, –10 dBm, CW signal. Set the AM and FM controls to off.

   75 Ω *Input only: Set output level to –4 dBm*.

2. Set the function generator to output a 2 kHz, 1.14 Vp-p triangle waveform signal.
3. Connect the equipment as shown in Figure 2-10.
4. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   Center Frequency, 500 MHz
   SPAN, 10 MHz
   SPAN, Span Zoom, 50 kHz

5. Wait for the `Span 50 kHz` message to appear. Set **Signal Track** (Off).
6. Set the span to 0 Hz and set the analyzer as follows:

   BW/Avg, Resolution BW, 3 MHz
   Sweep, Sweep Time, 5 ms
   AMPLITUDE, Scale Type (Lin)
   Peak Search (or **Search**)
   More, Search Parameters
   Peak Excursion, 3 dB

7. Adjust the synthesized signal generator amplitude as necessary for a mid-screen display (marker amplitude should read approximately 110 mV).
8. Set the synthesized signal generator modulation source to EXT DC. Set AM ON at 90% modulation.
9. On the analyzer, press **Trig** then **Video**. Set the video trigger level to 110 mV (mid-screen).
10. On the analyzer, press **Single**. After the completion of the sweep, press **Peak Search** (or **Search**), **0s**, **Meas Tools**, **Next Pk Right**. This is the marked signal.
11. Press **Marker, Delta**, then **Peak Search** (or **Search**) and press **Next Pk Right** eight times so the delta marker is on the eighth signal peak from the marked signal.

12.Read the ΔMkr1 time. Calculate the sweeptime accuracy as follows:

$$\text{Sweep Time Accuracy} = 100 \times \frac{\Delta\text{Mkr1} - (0.8 \times \text{Sweep Time})}{\text{Sweep Time}}$$

NOTE The sweep time accuracy is defined as a percentage of the indicated sweep time, not of the indicated signal separation. Therefore, it is appropriate to divide the difference between the ΔMkr1 reading and the nominal signal separation by the sweep time, rather than dividing by the nominal signal separation.

13.Record the calculated sweeptime accuracy in Table 2-11.

14.If the analyzer is not equipped with Option AYX, fast time domain sweeps, repeat step 10 through step 13 only for sweeptime settings between 5 ms and 10 s as indicated in Table 2-11. For each sweeptime setting, set the function generator to the frequency indicated in Table 2-11.

15.If the analyzer is equipped with Option AYX, fast time domain sweeps, Option B7D, DSP, or Fast ADC, repeat step 10 through step 13 for all sweeptime settings as indicated in Table 2-11. For each sweeptime setting, set the function generator to the frequency indicated in Table 2-11.

Table 2-11 Sweep Time Accuracy

Analyzer Sweep Time Setting	Synthesizer Function Generator Frequency	Δ Mkr 1 Reading	Sweep Time Accuracy (%)	TR Entry
5 ms	2.0 kHz			1)
20 ms	500.0 Hz			2)
100 ms	100.0 Hz			3)
1 s	10.0 Hz			4)
10 s	1.0 Hz			5)
The following entries only apply to analyzers equipped with Option AYX or B7D.				
1 ms	10.0 kHz			6)
500 µs	20.0 kHz			7)
100 µs	100.0 kHz			8)

11. Display Scale Fidelity

A 50 MHz CW signal is applied to the input of the analyzer through two calibrated step attenuators. The attenuators are the amplitude reference standard. The source is adjusted for a response at the reference level. The attenuators are then set to achieve a nominal amplitude below the reference level. The analyzer amplitude marker is compared to the actual total attenuation to determine the scale fidelity error.

The test is performed in both log and linear amplitude scales.

The related adjustment for this performance test is "IF Amplitude."

Equipment Required

Synthesized signal generator
1 dB step attenuator
10 dB step attenuator
Attenuator switch driver (if programmable step attenuators are used)
Cable, Type-N 152-cm (60-in)
Cable, BNC 122-cm (48-in) (*2 required*)
Attenuator interconnect kit
Adapter, Type-N (m) to BNC (f) (*2 required*)


Additional Equipment for 75 Ω Input

50 Ω to 75 Ω minimum loss pad
Adapter, Type-N (f), to BNC (m), 75 Ω

Additional Equipment for Option BAB

Adapter, Type-N (f), to APC 3.5 (f)

Figure 2-11 Scale Fidelity Test Setup

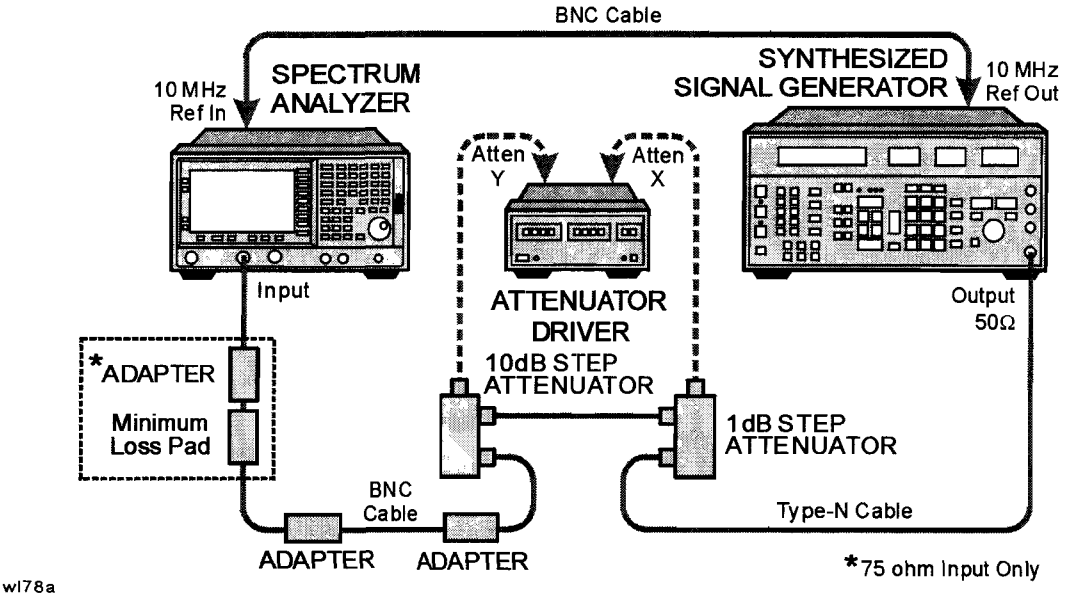

CAUTION Use only 75 Ω cables, connectors, and adapters on instruments with 75 Ω connectors, or the connectors will be damaged.

Procedure

Calculate the Actual Attenuation Errors

1. From the calibration data supplied with the 10 dB step attenuator, enter into column 4 of Table 2-12 and Table 2-13 the actual attenuation for the corresponding nominal attenuation settings.

   If the calibration data does not indicate an actual attenuation value for the 0 dB setting, enter 0 dB.

NOTE The HP/Agilent 8496G programmable attenuator has four attenuator sections consisting of 10 dB, 20 dB, and 40 dB attenuators. If using the HP/Agilent 8496G programmable attenuator, enter the calibration data for the section three, 40 dB step, rather than the section four, 40 dB step.

2. From the calibration data supplied with the 1 dB step attenuator, enter into column 5 of Table 2-12 and Table 2-13 the actual attenuation for the corresponding nominal attenuation settings.

   If the calibration data does not indicate an actual attenuation value for the 0 dB setting, enter 0 dB.

NOTE

The HP/Agilent 8494G programmable attenuator has four attenuator sections consisting of 1 dB, 2 dB, 4 dB, and 4 dB attenuators. If using the HP/Agilent 8494G programmable attenuator, enter the calibration data for the section three, 4 dB step, rather than the section four, 4 dB step.

3. For each row in Table 2-12 and Table 2-13, add the 10 dB and the 1 dB Step Attenuator Actual Attenuation values (columns 4 and 5) and place the results into the Total Actual Attenuation (column 6).

   Total Actual Attenuation = 1 dB Step Attenuator Actual Attenuation + 10 dB Step Attenuator Actual Attenuation

   Example for –36 dB from REF LVL setting:

   1 dB Step Attenuator Actual Attenuation (6 dB) = 5.998 dB

   10dB Step Attenuator Actual Attenuation (30 dB) = 30.012 dB

   Total Actual Attenuation = 5.998dB + 30.012 dB = 36.010 dB

4. Enter the total actual attenuation (0 dB from the reference level) below:

   Total actual attenuation (0 dB from Ref Level) = _____ dB

Section 1: Log Display Scale Fidelity, Analog Bandwidths

Setup for Log Scale Measurement

1. Connect the equipment as indicated in Figure 2-11.
2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   System, Alignments, Auto Align, Off
   FREQUENCY, 50 MHz
   SPAN, 45 kHz
   BW/Avg, 3 kHz
   BW/Avg, Video BW, 1 kHz

3. **Preset** the synthesized signal generator, then press **Blue Key, Special, 0.0**. Press the following keys:

   FREQUENCY, 50 MHz
   AMPLITUDE, –3 dBm (*50 Ω Input only*)
   AMPLITUDE, 4 dBm (*75 Ω Input only*)

4. Set the 1 dB step attenuator to 0 dB.

5. Set the 10 dB step attenuator to 0 dB.
6. Press **Peak Search** (or **Search**) on the analyzer.
7. Adjust the synthesized signal generator amplitude until the analyzer marker amplitude reads 0 dBm ±0.1 dB.

   75 Ω Input: Adjust the synthesized signal generator amplitude until the analyzer marker reads 48.75 dBmV ±±0.1 dB.

NOTE Do not adjust the synthesized signal generator amplitude after the reference is established.

8. On the analyzer, press **Marker**, **Delta**.

Measure the Cumulative Log Fidelity

1. Perform step 2 to step 4 for each measurement value in Table 2-12.
2. Set the 1 dB and 10 dB step attenuators as indicated in column 2 and column 3 of Table 2-12 for the ωαριουσ dB from REF LVL settings.

   For settings of –64 dB and lower, press the following keys:

   BW/Avg, Average (On)
   5, Enter

3. Press **Peak Search** (or **Search**) on the analyzer and record the ΔMkr reading in column 7 of Table 2-12.
4. Calculate the Cumulative Log Fidelity Error (CLFE) as follows, and record the result in the performance verification test record as indicated in column 8 of Table 2-12:

CLFE = Total Actual Attenuation + MkrΔ Reading – Total Actual Atten (0 dB from Ref Level)

Table 2-12 Cumulative and Incremental Log Scale Fidelity Worksheet, Analog Resolution Bandwidths Measured at 3 kHz

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6	Column 7	Column 8	Column 9
dB from REF LVL (dB)	10 dB Step Atten Nominal Attenu-ation (dB)	1 dB Step Atten Nominal Attenu-ation (dB)	10 dB Step Atten Actual Attenu-ation (dB)	1 dB Step Atten Actual Attenu-ation (dB)	Total Actual Attenu-ation (dB)	Mkr Δ Reading (dB)	TR Entry – CLFE (dB)	TR Entry – ILFE (dB)
0 (Ref)	0	0				0 (Ref)	0 (Ref)	NA
–4	0	4					1) _____	22)_____
–8	0	8					2) _____	23)_____
–12	10	2					3) _____	24)_____
–16	10	6					4) _____	25)_____
–20	20	0					5) _____	26)_____
–24	20	4					6) _____	27)_____
–28	20	8					7) _____	28)_____
–32	30	2					8) _____	29)_____
–36	30	6					9) _____	30)_____
–40	40	0					10)_____	31)_____
–44	40	4					11)_____	32)_____
–48	40	8					12)_____	33)_____
–52	50	2					13)_____	34)_____
–56	50	6					14)_____	35)_____
–60	60	0					15)_____	36)_____
–64	60	4					16)_____	37)_____
–68	60	8					17)_____	38)_____
–72	70	2					18)_____	39)_____
–76	70	6					19)_____	40)_____
–80	80	0					20)_____	41)_____
–84	80	4					21)_____	NA

Calculate Incremental Log Fidelity

1. Calculate the Incremental Log Fidelity Error (ILFE) for dB from REF LVL settings of – 4 dB to -80 dB using the current and previous Cumulative Log Fidelity Errors (CLFEs):

   ILFE= CLFE(current) – CLFE(previous)

   Example Calculation for ILFE at –20 dB from REFLVL setting:

   Previous CLFE(–16 dB from REF LVL)= –0.07 dB

   Current CLFE(–20 dB from REF LVL) = 0.02 dB

   ILFE(–20 dB)= 0.02 dB–(–0.07 dB)= 0.09 dB

2. Record the result in the performance verification test record as indicated in column 9 of Table 2-12.

Section 2: Log Display Scale Fidelity, Digital Bandwidths

This section is for analyzers with Option 1DR (narrow resolution bandwidths) only.

Setup for Log Scale Measurement

1. Set the following parameters on the analyzer:

   SPAN, 150 Hz
   BW/Avg, 10 Hz
   BW/Avg, Video BW, 3 Hz

2. Press **Peak Search** (or **Search**) on the analyzer.

3. Adjust the amplitude of the synthesized signal generator until the analyzer marker amplitude reads 0 dBm ±0.1 dB.

   75 Ω Input only: Adjust the amplitude of the synthesized signal generator until the analyzer marker amplitude reads 48.75 dBmV ±0.1 dB.

4. Set the 1 dB and the 10 dB step attenuators to 0 dB.

NOTE Do not adjust the synthesized signal generator amplitude after the reference is established.

5. On the analyzer, press **Marker, Delta.**

Measure the Cumulative Log Fidelity

1. Perform step 2 to step 4 for each measurement value in Table 2-13.
2. Set the 1 dB and 10 dB step attenuators as indicated in Table 2-13 for the various dB from REF LVL settings.

   For settings of –84 dB and lower, press the following keys:

   BW/Avg, Average (On)
   5, Enter
3. Press **Peak Search** (or **Search**) on the analyzer and record the ΔMkr reading in column 7 of Table 2-13.
4. Calculate the Cumulative Log Fidelity Error (CLFE) as follows and record the result in the performance verification test record as indicated in column 8 of Table 2-13:

CLFE = Total Actual Attenuation + MkrΔReading – Total Actual Atten(0 dB from Ref Level)

Table 2-13 Cumulative and Incremental Log Scale Fidelity Worksheet, Option 1DR Narrow Resolution Bandwidths Measured at 10 Hz

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6	Column 7	Column 8	Column 9
dB from REF LVL (dB)	10 dB Step Atten Nominal Attenuation (dB)	1 dB Step Atten Nominal Attenuation (dB)	10 dB Step Atten Actual Attenuation (dB)	1 dB Step Atten Actual Attenuation (dB)	Total Actual Attenuation (dB)	Mkr Δ Reading (dB)	TR Entry – CLFE (dB)	TR Entry – ILFE (dB)
0 (Ref)	0	0				0 (Ref)	0 (Ref)	NA
–4	0	4					**43)**____	**68)**____
–8	0	8					**44)**____	**69)**____
–12	10	2					**45)**____	**70)**____
–16	10	6					**46)**____	**71)**____
–20	20	0					**47)**____	**72)**____
–24	20	4					**48)**____	**73)**____
–28	20	8					**49)**____	**74)**____
–32	30	2					**50)**____	**75)**____
–36	30	6					**51)**____	**76)**____
–40	40	0					**52)**____	**77)**____
–44	40	4					**53)**____	**78)**____
–48	40	8					**54)**____	**79)**____

Table 2-13 Cumulative and Incremental Log Scale Fidelity Worksheet, Option 1DR Narrow Resolution Bandwidths Measured at 10 Hz

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6	Column 7	Column 8	Column 9
dB from REF LVL (dB)	10 dB Step Atten Nominal Attenu-ation (dB)	1 dB Step Atten Nominal Attenu-ation (dB)	10 dB Step Atten Actual Attenu-ation (dB)	1 dB Step Atten Actual Attenu-ation (dB)	Total Actual Attenu-ation (dB)	Mkr Δ Reading (dB)	TR Entry – CLFE (dB)	TR Entry – ILFE (dB)
–52	50	2					55)____	80)____
–56	50	6					56)____	81)____
–60	60	0					57)____	82)____
–64	60	4					58)____	83)____
–68	60	8					59)____	84)____
–72	70	2					60)____	85)____
–76	70	6					61)____	86)____
–80	80	0					62)____	87)____
–84	80	4					63)____	NA
–88	80	8					64)____	NA
–92	90	2					65)____	NA
–96	90	4					66)____	NA
–98	90	6					67)____	NA

Calculate incremental log fidelity:

Calculate the Incremental Log Fidelity Error (ILFE) for dB from REF LVL settings of – 4 dB to –80 dB using the current and previous Cumulative Log Fidelity Errors (CLFEs):

$$\text{ILFE} = \text{CLFE(current)} - \text{CLFE(previous)}$$

Record the result in the performance verification test record as indicated in column 9 of Table 2-13.

Section 3: Linear Display Scale Fidelity, Analog Bandwidths

Setup for linear scale measurement:

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   System, Alignments, Auto Align, Off
   FREQUENCY, 50 MHz
   SPAN, 10 kHz
   BW/Avg, 3 kHz
   AMPLITUDE, Scale Type (Lin)
   Input/Output (or **Input**), Input Z Corr (50) (*75 Ω Input only*)

2. Preset the synthesized signal generator, by pressing **Blue Key, Special, 0, 0**. Press the following keys:

   FREQUENCY, 50 MHz
   AMPLITUDE, –3 dBm (*50 Ω Input only*)
   AMPLITUDE, 4 dBm (*75 Ω Input only*)

3. Set the 1 dB step attenuator to 0 dB.
4. Set the 10 dB step attenuator to 0 dB.
5. Press **Peak Search** (or **Search**) on the analyzer.
6. Adjust the synthesized signal generator amplitude until the analyzer marker amplitude reads 223.6 mV ±±4 mV.

NOTE Do not adjust the amplitude of the synthesized signal generator after the reference is established.

Calculate ideal marker amplitude:

7. Considering Total Actual Attenuation at the 0 dB from REF LVL setting to be ATref, and the Total Actual Attenuation at any other dB from REF LVL setting to be ATmeas, calculate the Ideal Mkr Reading, in millivolts, as follows, and enter the result in column 7 of Table 2-14.

$$\text{Ideal Mkr Reading(mV)} = 1000\sqrt{0.05 \times 10^{(-\text{ATmeas} + \text{ATref})/10}}$$

For example, if ATref = 0.012 dB and ATmeas = 7.982, the Ideal Mkr Reading for the –8 dB from Ref Level setting would be:

$$\text{Ideal Mkr Reading(mV)} = 1000\sqrt{0.05 \times 10^{(-7.982 + 0.012)/10}} = 89.3 \text{ mV}$$

Measure linear fidelity:

8. Perform step 9 to step 11 for each measurement value in Table 2-14.
9. Set the 1 dB and 10 dB step attenuators as indicated in column 2 and column 3 of Table 2-14 for the dB from REF LVL settings.
10. Press **Peak Search** (or **Search**) on the analyzer and record the Mkr Δ amplitude reading as the actual Mkr reading in column 8 of Table 2-14.
11. Calculate the Linear Fidelity Error (LFE) as a percentage of reference level (RL), and record the result in the performance verification test record as indicated in column 9 of Table 2-14.

$$\text{LFE(\% of RL)} = 100 \times \frac{\text{Actual Mkr Reading} - \text{Ideal Mkr Reading}}{223.6\ \text{mV}}$$

Example calculation for LFE(% of RL):

$$\text{Actual Mkr Reading} = 85.0\ \text{mV}$$

$$\text{Ideal Mkr Reading} = 89.3\ \text{mV}$$

$$\text{LFE(\%of RL)} = 100 \times \frac{85.0 - 89.3}{223.6}$$

$$\text{LFE(\%of RL)} = 1.92\%\ \text{of RL}$$

Table 2-14 Linear Scale Fidelity Worksheet, Analog Resolution Bandwidths Measured at 3 kHz

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6	Column 7	Column 8	Column 9
dB from REF LVL (dB)	10 dB Step Atten Nominal Attenuation (dB)	1 dB Step Atten Nominal Attenuation (dB)	10 dB Step Atten Actual Attenuation (dB)	1 dB Step Atten Actual Attenuation (dB)	Total Actual Attenuation (dB)	Ideal Mkr Reading (mV)	Actual Mkr Reading (mV)	TR Entry – LFE (% of RL)
0 (Ref)	0	0				0 (Ref)	0 (Ref)	0 (Ref)
–4	0	4						**89)**____
–8	0	8						**90)**____
–12	10	2						**91)**____
–16	10	6						**92)**____
–20	20	0						**93)**____

Section 4: Linear Display Scale Fidelity, Digital Bandwidths

This section is for analyzers with Option 1DR (narrow resolution bandwidths) only.

Setup for linear scale measurement:

1. Set the following parameters on the analyzer:

   SPAN, 100, Hz
   BW/Avg, 10 Hz
   Video BW, 1 Hz

2. Press **Peak Search** (or **Search**) on the analyzer.
3. Set the 1 dB and 10 dB step attenuators to 0 dB.
4. Adjust the synthesized signal generator amplitude until the analyzer marker amplitude reads 223.6 mV ±4mV.

NOTE Do not adjust the synthesized signal generator amplitude after the reference is established.

Calculate ideal marker amplitude:

5. Considering Total Actual Attenuation at the 0 dB from REF LVL setting to be ATref and the Total Actual Attenuation at any other dB from REF LVL setting to be ATmeas, calculate the Ideal Mkr Reading, in millivolts, as follows and enter the result in column 7 of Table 2-15.

$$\text{Ideal Mkr Reading(mV)} = 1000\sqrt{0.05 \times 10^{(-\text{ATmeas} + \text{ATref})/10}}$$

Measure linear fidelity:

6. Perform step 7 to step 9 for each measurement value in Table 2-15.
7. Set the 1 dB and 10 dB step attenuators as indicated in Table 2-15 for the dB from REF LVL settings.
8. Press **Peak Search** (or **Search**) on the analyzer and record the Mkr Δ amplitude reading as the actual Mkr reading in column 8 of Table 2-15.
9. Calculate the Linear Fidelity Error (LFE) as a percentage of reference level (RL), and record the result in the performance verification test record as indicated in column 9 of Table 2-15.

$$\text{LFE(\%of RL)} = 100 \times \frac{\text{Actual Mkr Reading} - \text{Ideal Mkr Reading}}{223.6\ \text{mV}}$$

Table 2-15 Linear Scale Fidelity Worksheet, Option 1DR Narrow Resolution Bandwidths Measured at 10 Hz

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6	Column 7	Column 8	Column 9
dB from REF LVL (dB)	10 dB Step Atten Nominal Attenuation (dB)	1 dB Step Atten Nominal Attenuation (dB)	10 dB Step Atten Actual Attenuation (dB)	1 dB Step Atten Actual Attenuation (dB)	Total Actual Attenuation (dB)	Ideal Mkr Reading (mV)	Actual Mkr Reading (mV)	TR Entry – LFE (% of RL)
0 (Ref)	0	0				0 (Ref)	0 (Ref)	0 (Ref)
–4	0	4						94)____
–8	0	8						95)____
–12	10	2						96)____
–16	10	6						97)____
–20	20	0						98)____

10. If the analyzer has a 75Ω Input press:

    Input/Output (or Input)
    Input Z Corr (75)

Zero Span Log Fidelity, Digital Bandwidths

This section is for analyzers with Option 1DR (narrow resolution bandwidths) only.

Setup for zero span measurements

11. Set the 1 dB step attenuator to 11 dB and the 10 dB step attenuator to 110 dB.

12. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

    System, Alignments
    Align Now, All *(wait for the alignment sequence to complete)*

13. Set the 1 dB and 10 dB step attenuators to 0 dB.

14. Set the following parameters on the analyzer:

    FREQUENCY, 50 MHz
    SPAN, 100 Hz
    BW/Avg, 10 Hz

15. Press **Peak Search** (or **Search**), Marker –>, and Marker –> CF on the analyzer.

16. Press **SPAN, Zero Span** on the analyzer.

17. Adjust the synthesized signal generator amplitude until the analyzer marker amplitude reads 0 dBm ± 0.1 dB.

    75 Ω Input: Adjust the synthesized signal generator amplitude until the analyzer marker amplitude reads 48.75 dBmV ± 0.1 dB.

NOTE Do not adjust the synthesized signal generator amplitude after the reference is established.

18. On the analyzer, press **Marker, Delta**.

Measure the Cumulative Log Fidelity

19. On the analyzer, press **Single, BW/Avg, Average, 5, Enter**.

20. Perform step 22 to step 25 for each measurement value in Table 2-16.

21. Set the 1 dB and 10 dB step attenuators as indicated in column 2 and column 3 of Table 2-16 for the various dB from REF LVL settings.

22. Press **Single** and wait for "VAvg 5" to be displayed to the right of the graticule area.

23. Record the DMkr1 amplitude reading in column 7 of Table 2-16.

24. Calculate the Cumulative Log Fidelity Error (CLFE) as follows, and record the result in the performance verification test record as indicated in column 8 of Table 2-16.

    CLFE = Total Actual Attenuation + DMkr Reading – Total Actual Atten (0 dB from Ref Level)

Table 2-16 Zero Span Cumulative Log Fidelity Worksheet, Opt 1DR Narrow Resolution Bandwidths, (measured at 10 Hz)

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6	Column 7	Column 8
dB from REF LVL (dB)	10 dB Step Atten Nominal Attenu-ation (dB)	1 dB Step Atten Nominal Attenu-ation (dB)	10 dB Step Atten Actual Attenu-ation (dB)	1 dB Step Atten Actual Attenu-ation (dB)	Total Actual Attenu-ation (dB)	ΔMkr Reading (dB)	TR Entry-CLFE (dB)
0 (Ref)	0	0				0 (Ref)	0 (Ref)
–4	0	4					97)____
–8	0	8					98)____
–12	10	2					99)____
–16	10	6					100)____
–20	20	0					101)____
–24	20	4					102)____
–28	20	8					103)____
–32	30	2					104)____
–36	30	6					105)____
–40	40	0					106)____
–44	40	4					107)____
–48	40	8					108)____
–52	50	2					109)____
–56	50	6					110)____
–60	60	0					111)____
–64	60	4					112)____
–68	60	8					113)____
–70	70	0					114)____

Post Test Instrument Restoration

25.On the analyzer, press the following keys:

Preset
System, Alignments, Auto Align, All

12. Input Attenuation Switching Uncertainty

A 50 MHz CW signal is applied to the input of the analyzer through two calibrated step attenuators. The attenuators are the amplitude reference standard. The source is adjusted for a response at the reference level. The internal attenuators are then varied between settings and the external attenuators are changed accordingly to maintain the same input level at the mixer. The analyzer marker functions are used to measure the amplitude differences. The actual attenuation values of the step attenuators are used to correct the marker amplitude readings yielding the input attenuation switching error.

The related adjustment for this performance test is "Frequency Response."

Equipment Required

Synthesized signal generator
1 dB step attenuator
10 dB step attenuator
Attenuator switch driver (if programmable step attenuators are used)
10 dB fixed attenuator
Cable, Type-N 152-cm (60-in)
Cable, BNC 122-cm (48-in) (*2 required*)
Attenuator interconnect kit
Adapter, Type-N (m) to BNC (f) (*2 required*)


Additional Equipment for 75 Ω Input

50 Ω to 75 Ω minimum loss pad
Adapter, Type-N (f), to BNC (m), 75 Ω

Additional Equipment for Option BAB

Adapter, Type-N (f), to APC 3.5 (f)

Figure 2-12 Input Attenuator Switching Uncertainty Test Setup

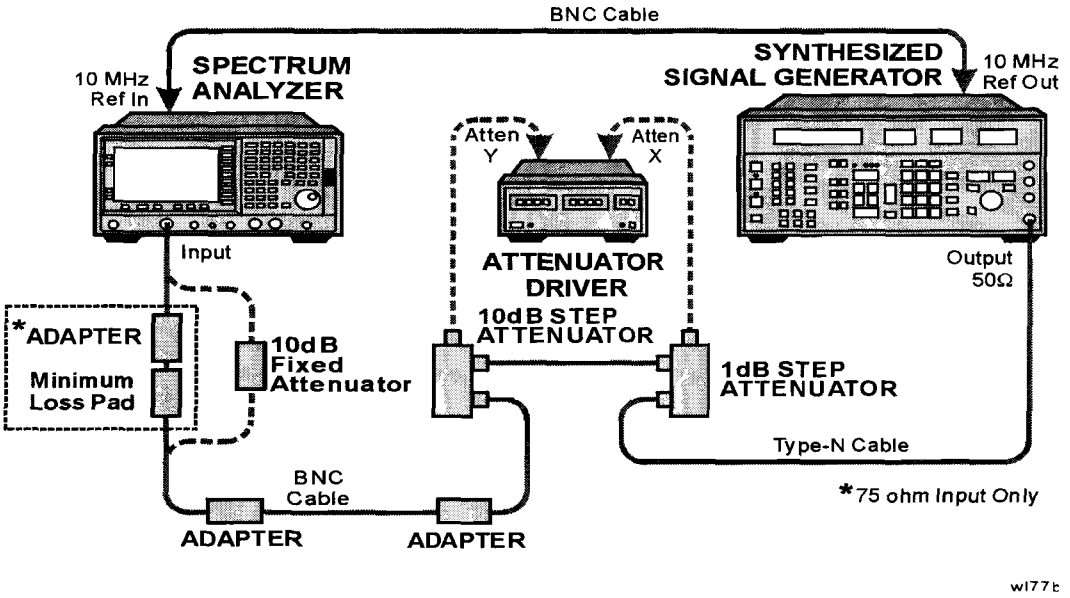

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω connectors, or the connectors will be damaged.

Procedure

Calculate Actual Attenuation Values

1. From the calibration data supplied with the 1 dB step attenuator, enter into column 2 of Table 2-17 the actual attenuation for the corresponding nominal attenuation settings. If the calibration data does not indicate an actual attenuation value for the 0 dB setting, enter 0 dB.

NOTE The HP/Agilent 8494G programmable attenuator has four attenuator sections consisting of 1 dB, 2 dB, 4 dB, and 4 dB attenuators. If using the HP/Agilent 8494G programmable attenuator, enter the calibration data for the section three 4 dB step rather than the section four 4 dB step.

2. From the calibration data supplied with the 10 dB step attenuator, enter into column 4 of Table 2-17 the actual attenuation for the corresponding nominal attenuation settings. If the calibration data does not indicate an actual attenuation value for the 0 dB setting, enter 0 dB.

NOTE The HP/Agilent 8496G programmable attenuator has four attenuator sections consisting of 10 dB, 20 dB, 40 dB, and 40 dB attenuators. If using the HP/Agilent 8496G programmable attenuator, enter the calibration data for the section three 40 dB step rather than the section four 40 dB step.

3. For each Total Nominal Attenuation setting indicated in Table 2-17, calculate the Total Actual Attenuation from the actual attenuation columns for the 1 dB and the 10 dB step attenuators and enter the result in Table 2-17.

   Total Actual Attenuation = 1 dB Step Attenuator Actual Attenuation + 10 dB Step Attenuator Actual Attenuation

   Example for 35 dB total nominal attenuation setting:

   1dB Step Attenuator Actual Attenuation (5 dB) = 5.021 dB

   10 dB Step Attenuator Actual Attenuation (30 dB) = 29.981 dB

   Total Actual Attenuation = 5.998 dB + 30.012 dB = 35.002 dB

Table 2-17 Actual Attenuation Worksheet

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6
1 dB step Attenuator Nominal Attenuation (dB)	**1 dB step Attenuator Actual Attenuation (dB)**	**10 dB step Attenuator Nominal Attenuation (dB)**	**10 dB step Attenuator Actual Attenuation (dB)**	**Total Nominal Atten-uation (dB)**	**Total Actual Atten-uation (dB)**
0		0		0	
5		0		5	
0		10		10	
5		10		15	
0		20		20	
5		20		25	
0		30		30	
5		30		35	
0		40		40	
5		40		45	
0		50		50	
5		50		55	
0		60		60	
5		60		65	

4. For each attenuation error value in column 4 of Table 2-18, calculate the attenuation errors by subtracting the difference between the Table 2-17 Total Actual Attenuation and Total Nominal Attenuation from the difference between the Total Actual Attenuation and Total Nominal Attenuation at 55 dB. Note that the total nominal attenuations listed in Table 2-18 are in a different order than those listed in Table 2-17.

AttenErr = (ActAtten(55 dB) - 55 dB) - (ActAtten(X dB) - NomAtten(X dB))

Where:

AttenErr = Attenuator Error between the X dB and 55 dB settings

ActAtten(55 dB) = Actual Attenuation of the 55 dB setting

ActAtten(X dB) = Actual Attenuation of the X dB setting

NomAtten(X dB) = Nominal Attenuation of the X dB setting

Example of attenuation error calculation for 35 dB nominal attenuation:

ActAtten (55 dB) = 55.15 dB
ActAtten (35 dB) = 35.002 dB
NomAtten (35 dB) = 35 dB

$$\text{AttenErr} = (55.15 - 55) - (35.002 - 35)$$
$$\text{AttenErr} = 0.15 - 0.002$$
$$\text{AttenErr} = 0.148 \text{ dB}$$

Setup for Switching Uncertainty Measurement

5. Connect the equipment as indicated in Figure 2-12. The 10 dB fixed attenuator (or minimum loss pad for 75 Ω input analyzers) should be connected directly to the input connector of the analyzer.

6. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System, Alignments, Auto Align, Off**. Set the controls as follows:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, 50 MHz
   SPAN, 100 kHz
   AMPLITUDE, –55 dBm (*50 Ω Input only*)
   AMPLITUDE, –6.2 dBmV (*75 Ω Input only*)
   AMPLITUDE, Attenuation, 10 dB
   AMPLITUDE, Scale/Div, 2 dB
   BW/Avg, 30 kHz
   BW/Avg, Video BW, 100 Hz

7. Preset the synthesized signal generator (**Blue Key, Special, 0, 0**) and set the controls as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, 10 dBm (*50 Ω Input only*)
   AMPLITUDE, 6 dBm (*75 Ω Input only*)

8. Set the 1 dB step attenuator to 5 dB attenuation. Set the 10 dB step attenuator to 50 dB. Refer to the HP/Agilent 11713A attenuator switch driver manual for information on manually controlling a programmable step attenuator.

9. Press **Peak Search** (or **Search**) on the analyzer.

10. Adjust the amplitude of the synthesized signal generator until the marker amplitude of the analyzer reads –57 dBm ± 0.1 dB.

    75 Ω Input only: Adjust the amplitude of the synthesized signal generator until the marker of the analyzer reads –8.2 dBmV ± 0.1 dB.

NOTE Do not adjust the amplitude of the synthesized signal generator after the reference is established.

11. On the analyzer, press **Peak Search** (or **Search**), **Marker, Delta**.

Table 2-18 Input Attenuation Switching Uncertainty Worksheet

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6	Column 7
Analyzer Internal Attenuation Setting	**Analyzer Reference Level Setting 50 Ω Input/ 75 Ω Input**	**Total Nominal Attenuation Setting**	**Attenuation Error (dB)**	**Ideal Marker Delta Reading**	**Marker Delta Reading (dB)**	**TR Entry – Switching Error (dB)**
10 dB	–55 dBm / –6.2 dBmV	55 dB	0	0 dB	0	Ref
0 dB	–65 dBm / –16.2 dBmV	65 dB		–10 dB		**1)**
5 dB	–60 dBm / –11.2 dBmV	60 dB		–5 dB		**2)**
15 dB	–50 dBm / –1.2 dBmV	50 dB		5 dB		**3)**
20 dB	–45 dBm / 3.8 dBmV	45 dB		10 dB		**4)**
25 dB	–40 dBm / 8.8 dBmV	40 dB		15 dB		**5)**
30 dB	–35 dBm / 13.8 dBmV	35 dB		20 dB		**6)**
35 dB	–30 dBm / 18.8 dBmV	30 dB		25 dB		**7)**
40 dB	–25 dBm / 23.8 dBmV	25 dB		30 dB		**8)**
45 dB	–20 dBm / 28.8 dBmV	20 dB		35 dB		**9)**
50 dB	–15 dBm / 33.8 dBmV	15 dB		40 dB		**10)**
55 dB	–10 dBm / 38.8 dBmV	10 dB		45 dB		**11)**
60 dB	–5 dBm / 43.8 dBmV	5 dB		50 dB		**12)**
65 dB[a]	0 dBm / 48.8 dBmV	0 dB		55 dB		**13)**

a. Does not apply to E4401B or E4411B.

Measure Switching Uncertainty

Perform step 12 to step 15 for each measurement value in Table 2-18.

12. Set the 1 dB and 10 dB step attenuators to the Total Nominal Attenuation setting value as indicated in column 3 of Table 2-18 for the various analyzer attenuation settings for each measurement. Table 2-17 may be used as a reference for setting the step attenuators to achieve the desired total nominal attenuation.
13. Similarly, set the corresponding analyzer attenuation and reference level settings as indicated in column 1 and column 2 of Table 2-18.
14. Press **Single**, then **Peak Search** (or **Search**) and record the marker amplitude reading as the Marker Delta Reading in column 6 of Table 2-18.
15. Calculate the Switching Error (Table 2-18, column 7) by subtracting the Ideal Marker Delta Reading and the Attenuation Error from the Marker Delta Reading. Record the result in the performance verification test record.

Switching Error = Marker Delta Reading – Ideal Marker Delta Reading – Attenuattion Error

Example for 25 dB analyzer internal attenuation setting:

Marker Delta Reading = 14.790 dB

Ideal Marker Delta Reading = 15 dB

Attenuation Error = –0.148 dB

Switching Error = 14.790 – 15 – (–0.148) = –0.062 dB

Post-test Instrument Restoration

16. On the analyzer, press **Preset, System, Alignments, Auto Align, All.**

13. Reference Level Accuracy: Agilent E4401B and Agilent E4411B

A 50 MHz CW signal is applied to the 50 Ω input of the analyzer through two step attenuators. The amplitude of the source is decreased in 10 dB steps and the analyzer marker functions are used to measure the amplitude difference between steps. The external attenuator is used as the reference standard. The test is performed in both log and linear amplitude scales.

It is only necessary to test reference levels as low as –90 dBm (with 10 dB internal attenuation) since lower reference levels are a function of the analyzer microprocessor manipulating the trace data. There is no error associated with the trace data manipulation.

The related adjustment for this performance test is "IF Amplitude."


Equipment Required

Synthesized signal generator
1 dB step attenuator
10 dB step attenuator
Attenuator switch driver (if programmable step attenuators are used)
Cable, Type-N 152-cm (60-in)
Cable, BNC 122-cm (48-in) (*2 required*)
Attenuator interconnect kit
Adapter, Type-N (m) to BNC (f) (*2 required*)

Additional Equipment for 75 Ω Input

Pad, minimum loss
Adapter, Type-N (f), to BNC (m), 75 Ω

Figure 2-13 Reference Level Accuracy Test Setup

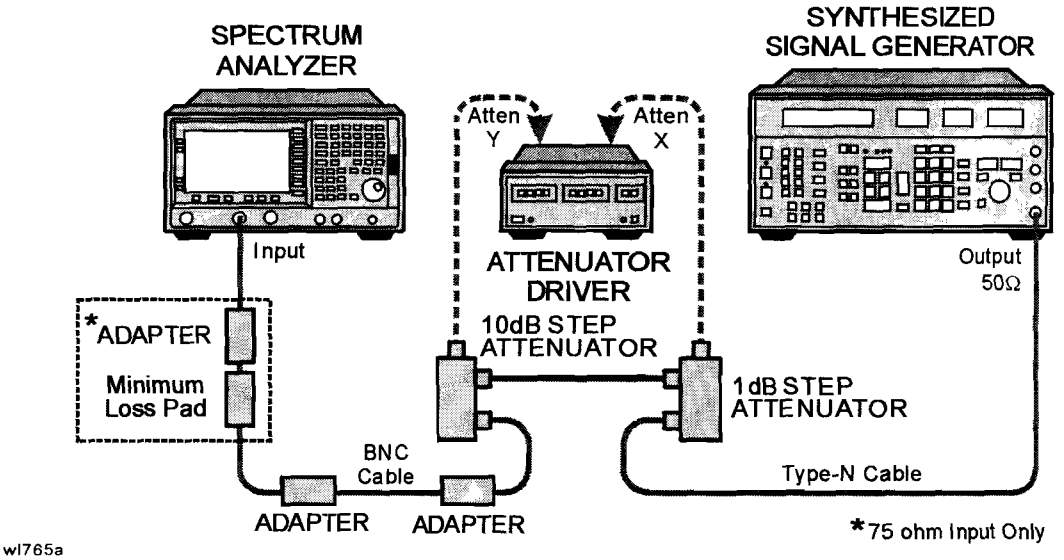

Procedure

Calculate the Actual Attenuation Errors

1. From the calibration data supplied with the 10 dB step attenuator, enter into column 2 of Table 2-19 and Table 2-20 the actual attenuation for the corresponding nominal attenuation settings. If no calibration data is supplied for 0 dB, enter zero.

NOTE The HP/Agilent 8496G programmable attenuator has four attenuator sections consisting of 10 dB, 20 dB, 40 dB and 40 dB attenuators. If using the HP/Agilent 8496G programmable attenuator, enter the calibration data for the section three 40 dB step rather than the section four 40 dB step.

2. Calculate the reference attenuation error by subtracting 20 dB from the actual attenuation for the 20 dB setting, and enter below.

   Reference Attenuator Error = Actual Attenuation(20 dB) – 20 dB

   Reference Attenuator Error _____ dB

3. To calculate the Attenuation Error at other nominal attenuator settings, subtract the Attenuation Error at the other settings from the Reference Attenuator Error and enter the result in column 3 of Table 2-19 and Table 2-20.

Attenuator Error (X dB) = (Actual Attenuation(X dB) – Nominal Attenuation (X dB)) – Reference Attenuation Error

Example for 50 dB attenuator setting:

Actual Attenuation (50 dB) = 50.08 dB

Actual Attenuation (20 dB) = 19.85 dB

Reference Attenuation Error = 19.85 dB – 20 dB = –0.15 dB

Attenuation Error (50 dB) = (50.08 dB – 50dB)–(–0.15) dB

= 0.23 dB

Log Scale, Analog Bandwidths

1. Set the synthesized signal generator controls as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, 2 dBm

2. Connect the equipment as shown in Figure 2-13. Set the 10 dB step attenuator to 20 dB attenuation and the 1 dB step attenuator to 5 dB attenuation.

3. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System, Alignments, Auto Align, Off**. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, 50 MHz
   AMPLITUDE, –25 dBm (*50 Ω Input only*)
   AMPLITUDE, 26.75 dBmV (*75 Ω Input only*)
   Attenuation, 10 dB (Man)
   Scale/Div, 1 dB
   SPAN, 50 kHz
   BW/Avg, 3 kHz
   Video BW, 30 Hz

4. Set the 1 dB step attenuator to place the signal peak 1 to 3 dB (1 to 3 divisions) below the reference level.

5. On the analyzer, press the following keys:

   Single
   Peak Search (or **Search**)
   Marker, Delta

6. Set the 10 dB step attenuator and analyzer reference level according to column 1 and column 4 of Table 2-19. At each setting, do the following:

   a. Press **Single** on the analyzer.

   b. Press **Peak Search** (or **Search**).

c. Record the marker delta amplitude reading in column 5 of Table 2-19.

d. Add the actual attenuation error to the analyzer marker delta amplitude and enter the result as the TR entry in the performance test record.

The following is an example for –35 dBm reference level:

Analyzer marker Δ amplitude = +0.17 dB

Attenuation Error (30 dB) = (–0.07) dB

Test Record Entry = 0.17 dB + (–0.07) dB = 0.10 dB

Table 2-19 Log Scale, Analog Bandwidths

Column 1	Column 2	Column 3	Column 4		Column 5	Column 6
10 dB Attenuator Nominal Attenuation (dB)	10 dB Attenuator Actual Attenuation (dB)	Attenuation Error (dB)	Analyzer Reference Level[a] (dBm)	(dBmV)	Analyzer Marker Delta Amplitude (dB)	TR Entry
20		0 (Ref)	–25	23.75	0 (Ref)	(Ref)
10			–15	33.75		1)
0			–5	43.75		2)
30			–35	13.75		3)
40			–45	3.75		4)
50			–55	–6.25		5)
60			–65	–16.25		6)
70			–75	–26.25		7)

a. Use the dBm column values for analyzers with a 50 Ω input and the dBmV column for analyzers with a 75 Ω input.

Log Scale, Digital Bandwidths, Option 1DR

NOTE If the analyzer is not equipped with Option 1DR (narrow resolution bandwidths), skip to the next section (Linear Scale, Analog Bandwidths).

1. On the analyzer, press the following keys:

   SPAN, 150 Hz
   BW/Avg, 10 Hz
   Video BW, 1 Hz

2. Set the 1 dB step attenuator to place the signal peak 1 to 3 dB (1 to 3 divisions) below the reference level.
3. On the analyzer, press the following keys:

   Single
   Peak Search (or **Search**)
   Marker, Delta

4. Set the 10 dB step attenuator and analyzer reference level according to column 1 and column 4 of Table 2-20. At each setting, do the following:
   a. Press **Single** on the analyzer.
   b. Press **Peak Search** (or **Search**).
   c. Record the Marker Delta Amplitude reading in column 5 of Table 2-20.
   d. Add the Actual Attenuation Error to the Analyzer Marker Delta Amplitude and enter the result as the TR Entry in the performance test record.

Table 2-20 Log Mode, Digital Bandwidths Worksheet, Option 1DR

Column 1	Column 2	Column 3	Column 4		Column 5	Column 6
10 dB Attenuator Nominal Attenuation (dB)	10 dB Attenuator Actual Attenuation (dB)	Attenuation Error (dB)	Analyzer Reference Level[a] (dBm)	(dBmV)	Analyzer Marker Delta Amplitude (dB)	TR Entry
20		0 (Ref)	-25	23.75	0 (Ref)	(Ref)
10			-15	33.75		**8)**
0			-5	43.75		**9)**
30			-35	13.75		**10)**
40			-45	3.75		**11)**
50			-55	-6.25		**12)**
60			-65	-16.25		**13)**
70			-75	-26.25		**14)**

a. Use the dBm column values for analyzers with a 50 Ω input and the dBmV column for analyzers with a 75 Ω input.

Linear Scale, Analog Bandwidths

1. Set the 10 dB step attenuator to 20 dB attenuation.
2. Set the 1 dB step attenuator to 5 dB attenuation.
3. Set the analyzer by pressing the following keys:

   AMPLITUDE, –25 dBm (*50 Ω input only*)
   AMPLITUDE, 26.76 dBmV (*75 Ω input only*)
   AMPLITUDE, Scale Type (Lin)
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm** (*50 Ω input only*)
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBmV** (*75 Ω input only*)
   SPAN, 50 kHz
   BW/Avg, 3 kHz
   Video BW, 30 Hz
   Sweep, Sweep Cont
   Marker, Off

4. Set the 1 dB step attenuator to place the signal peak one to three divisions below the reference level.

5. On the analyzer, press the following keys:

   Single
   Peak Search (or **Search**)
   Marker, Delta

6. Set the 10 dB step attenuator and analyzer reference level according to column 1 and column 4 of Table 2-21. At each setting, do the following:

   a. Press **Single** on the analyzer.

   b. Press **Peak Search** (or **Search**).

   c. Record the marker delta amplitude reading in column 5 of Table 2-21.

   d. Add the Attenuation Error to the Analyzer Marker Delta Amplitude and enter the result in the performance test record.

Table 2-21 Linear Mode, Analog Bandwidths Worksheet

Column 1	Column 2	Column 3	Column 4		Column 5	Column 6
10 dB Attenuator Nominal Attenuation (dB)	10 dB Attenuator Actual Attenuation (dB)	Attenuation Error (dB)	Analyzer Reference Level[a] (dBm)	(dBmV)	Analyzer Marker Delta Amplitude (dB)	TR Entry
20		0 (Ref)	-25	23.75	0 (Ref)	(Ref)
10			-15	33.75		**15)**
0			-5	43.75		**16)**
30			-35	13.75		**17)**
40			-45	3.75		**18)**
50			-55	-6.25		**19)**
60			-65	-16.25		**20)**
70			-75	-26.25		**21)**

a. Use the dBm column values for analyzers with a 50 Ω input and the dBmV column for analyzers with a 75 Ω input.

Linear Scale, Digital Bandwidths, Option 1DR

NOTE If the analyzer is not equipped with Option 1DR (narrow resolution bandwidths), skip to the next section (Post-Test Instrument Restoration).

1. On the analyzer, press the following keys:

   SPAN, 150 Hz
   BW/Avg, 10 Hz
   Video BW, 1 Hz

2. Set the 1 dB step attenuator to place the signal peak 1 to 3 divisions below the reference level.

3. On the analyzer, press the following keys:

   Single
   Peak Search (or **Search**)
   Marker, Delta

4. Set the 10 dB step attenuator and analyzer reference level according to Table 2-22. At each setting, do the following:

   a. Press **Single** on the analyzer.

   b. Press **Peak Search** (or **Search**).

   c. Record the marker delta amplitude reading in column 5 of Table 2-22.

   d. Add the actual attenuation error to the Analyzer Marker Delta Amplitude and enter the result as the TR Entry in the performance test record.

Table 2-22 Linear Mode, Digital Bandwidths, Option 1DR

Column 1	Column 2	Column 3	Column 4		Column 5	Column 6
10 dB Attenuator Nominal Attenuation (dB)	10 dB Attenuator Actual Attenuation (dB)	Attenuation Error (dB)	Analyzer Reference Level[a] (dBm)	(dBmV)	Analyzer Marker Delta Amplitude (dB)	TR Entry
20		0 (Ref)	–25	23.75	0 (Ref)	(Ref)
10			–15	33.75		**22)**
0			–5	43.75		**23)**
30			–35	13.75		**24)**
40			–45	3.75		**25)**
50			–55	–6.25		**26)**

Table 2-22 Linear Mode, Digital Bandwidths, Option 1DR

Column 1	Column 2	Column 3	Column 4		Column 5	Column 6
10 dB Attenuator Nominal Attenuation (dB)	10 dB Attenuator Actual Attenuation (dB)	Attenuation Error (dB)	Analyzer Reference Level[a] (dBm)	(dBmV)	Analyzer Marker Delta Amplitude (dB)	TR Entry
60			-65	-16.25		**27)**
70			-75	-26.25		**28)**

a. Use the dBm column values for analyzers with a 50 Ω input and the dBmV column for analyzers with a 75 Ω input.

Post-test Instrument Restoration

To restore the default settings on the analyzer, press **Preset, System, Alignments, Auto Align, All.**

14. Reference Level Accuracy: Agilent E4402B, E4403B, E4404B, E4407B, and E4408B.

A 50 MHz CW signal is applied to the 50 Ω Input of the analyzer through two step attenuators. The amplitude of the source is decreased in 10 dB steps and the analyzer marker functions are used to measure the amplitude difference between steps. The external attenuator is used as the reference standard. The test is performed in both log and linear amplitude scales.

It is only necessary to test reference levels as low as –90 dBm (with 10 dB internal attenuation) since lower reference levels are a function of the analyzer microprocessor manipulating the trace data. There is no error associated with the trace data manipulation.

The related adjustment for this performance test is "IF Amplitude."


Equipment Required

Synthesized signal generator
1 dB step attenuator
10 dB step attenuator
Attenuator switch driver (if programmable step attenuators are used)
Cable, Type-N 152-cm (60-in)
Cable, BNC 122-cm (48-in) (*2 required*)
Attenuator interconnect kit
Adapter, Type-N (m) to BNC (f) (*2 required*)

Additional Equipment for Option BAB

Adapter, Type-N (f) to APC 3.5 (f)

Figure 2-14 Reference Level Accuracy Test Setup

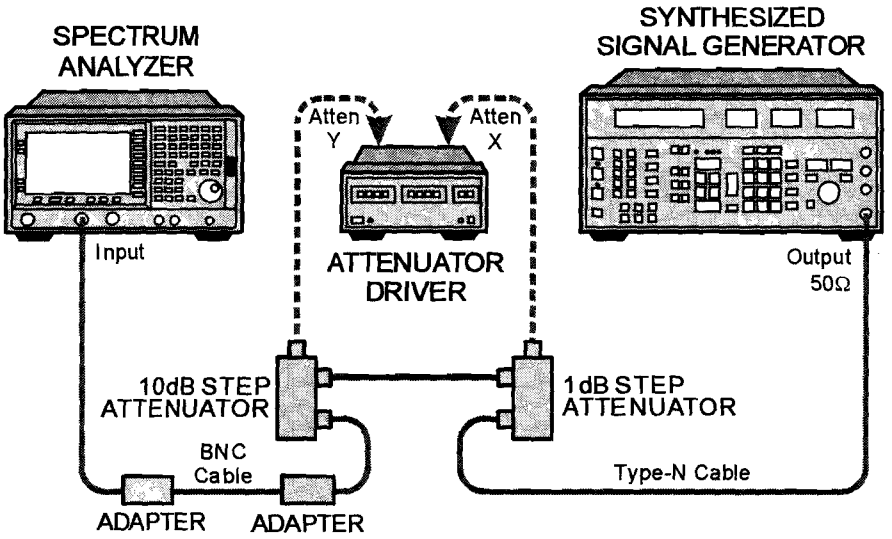

Procedure

Calculate the Actual Attenuation Errors

1. From the calibration data supplied with the 10 dB step attenuator, enter into column 2 of Table 2-23 and Table 2-24 the actual attenuation for the corresponding nominal attenuation settings. If no calibration data is supplied for 0 dB, enter zero.

NOTE The HP/Agilent 8496G programmable attenuator has four attenuator sections consisting of 10 dB, 20 dB, 40 dB and 40 dB attenuators. If using the HP/Agilent 8496G programmable attenuator, enter the calibration data for the section three 40 dB step rather than the section four 40 dB step.

2. Calculate the reference attenuation error by subtracting 20 dB from the actual attenuation for the 20 dB setting, and enter below.

   Reference Attenuator Error = Actual Attenuation(20 dB) – 20 dB

   Reference Attenuator Error _____ dB

3. To calculate the attenuation error at other nominal attenuator settings, subtract the attenuation error at the other settings from the reference attenuator error and enter the result in column 3 of Table 2-23 and Table 2-24.

Atten Error (X dB) = (Actual Attenuation(X dB) – Nominal Attenuation (X dB)) – Reference Attenuation Error

Example for 50 dB attenuator setting:

Actual Attenuation (50 dB) = 50.08 dB

Actual Attenuation (20 dB) = 19.85 dB

Reference Attenuation Error = 19.85 dB – 20 dB = –0.15 dB

Attenuation Error (50 dB) = (50.08 dB – 50dB)–(–0.15) dB

= 0.23 dB

Log Scale, Analog Bandwidths

1. Set the synthesized signal generator controls as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, 2 dBm

2. Connect the equipment as shown in Figure 2-14. Set the 10 dB step attenuator to 20 dB attenuation and the 1 dB step attenuator to 5 dB attenuation.

3. Press **Preset** on the analyzer. Press the Factory Preset softkey, if it is displayed. Press **System, Alignments, Auto Align, Off**. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, 50 MHz
   AMPLITUDE, –20 dBm
   Attenuation, 10 dB
   Scale/Div, 1 dB
   SPAN, 50 kHz
   BW/Avg, 3 kHz
   Video BW, 30 Hz

4. Set the 1 dB step attenuator to place the signal peak 1 to 3 divisions below the reference level.

5. On the analyzer, press the following keys:

   Single
   Peak Search (or **Search**)
   Marker, Delta

6. Set the 10 dB step attenuator and analyzer reference level according to Table 2-23. At each setting, do the following:

   a. Press **Single** on the analyzer.

   b. Press **Peak Search** (or **Search**).

   c. Record the marker delta amplitude reading in column 5 of Table 2-23.

d. Add the actual attenuation error to the analyzer marker delta amplitude and enter the result as the TR Entry in the performance test record.

Example, for –35 dBm reference level:

Analyzer marker Δ amplitude = 0.17 dB

Attenuation Error (30 dB) = (–0.07) dB

Test Record Entry = 0.17 dB + (–0.07) dB = 0.10 dB

Table 2-23 Log Mode, Analog Bandwidths Worksheet

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6
10 dB Attenuator Nominal Attenuation (dB)	10 dB Attenuator Actual Attenuation (dB)	Attenuation Error (dB)	Analyzer Reference Level (dBm)	Analyzer Marker Delta Amplitude (dB)	TR Entry
20		0 (Ref)	–20	0 (Ref)	(Ref)
10			–10		1)
0			0		2)
30			–30		3)
40			–40		4)
50			–50		5)
60			–60		6)
70			–70		7)
80			–80		8)

Log Scale, Digital Bandwidths, Option 1DR

NOTE If the analyzer is not equipped with Option 1DR (narrow resolution bandwidths), skip to the next section (Linear Scale, Analog Bandwidths).

7. On the analyzer, press the following keys:

   SPAN, 150 Hz
   BW/Avg, 10 Hz
   Video BW, 1 Hz

8. Set the 1 dB step attenuator to set the signal peak 1 to 3 divisions below the reference level.

9. On the analyzer, press the following keys:

   Single
   Peak Search (or **Search**)
   Marker, Delta

10. Set the 10 dB step attenuator and analyzer reference level according to Table 2-24. At each setting, do the following:

    a. Press **Single** on the analyzer.

    b. Press **Peak Search** (or **Search**).

    c. Record the marker delta amplitude reading in column 5 of Table 2-24.

    d. Add the actual attenuation error to the analyzer marker delta amplitude and enter the result as the TR Entry in the performance test record.

Table 2-24 Log Mode, Digital Bandwidths Worksheet, Option 1DR

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6
10 dB Attenuator Nominal Attenuation (dB)	**10 dB Attenuator Actual Attenuation, (dB)**	**Attenuation Error (dB)**	**Analyzer Reference Level (dBm)**	**Analyzer Marker Delta Amplitude (dB)**	**TR Entry**
20		0 (Ref)	–20	0 (Ref)	(Ref)
10			–10		**9)**
0			0		**10)**
30			–30		**11)**
40			–40		**12)**
50			–50		**13)**
60			–60		**14)**
70			–70		**15)**
80			–80		**16)**

Linear Scale, Analog Bandwidths

1. Set the 10 dB step attenuator to 20 dB attenuation.
2. Set the 1 dB step attenuator to 5 dB attenuation.
3. Set the analyzer by pressing the following keys:

   AMPLITUDE, –20 dBm
   AMPLITUDE, Scale Type (Lin)
   AMPLITUDE, More 1 of 2, Y Axis Units (or **Amptd Units**), **dBm**
   SPAN, 50 kHz
   BW/Avg, 3 kHz
   Video BW, 30 Hz
   Sweep, Sweep Cont
   Marker, Off

4. Set the 1 dB step attenuator to place the signal peak 1 to 3 divisions below the reference level.
5. On the analyzer, press the following keys:

   Single
   Peak Search (or **Search**)
   Marker, Delta

6. Set the 10 dB step attenuator and analyzer reference level according to Table 2-25, column 1 and column 4. At each setting, do the following:

   a. Press **Single** on the analyzer.

   b. Press **Peak Search** (or **Search**).

   c. Record the marker delta amplitude reading in column 5 of Table 2-25.

   d. Add the attenuation error to the Analyzer Marker Delta Amplitude and enter the result as the TR Entry in the performance test record.

Table 2-25 Linear Mode, Analog Bandwidths Worksheet

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6
10 dB Attenuator Nominal Attenuation (dB)	10 dB Attenuator Actual Attenuation (dB)	Attenuation Error (dB)	Analyzer Reference Level (dBm)	Analyzer Marker Delta Amplitude (dB)	TR Entry
20		0 (Ref)	–20	0 (Ref)	(Ref)
10			–10		**17)**
0			0		**18)**
30			–30		**19)**
40			–40		**20)**
50			–50		**21)**
60			–60		**22)**
70			–70		**23)**
80			–80		**24)**

Linear Scale, Digital Bandwidths, Option 1DR

NOTE If the analyzer is not equipped with Option 1DR (narrow resolution bandwidths), skip to the next section (Post-Test Instrument Restoration).

1. On the analyzer, press the following keys:

   SPAN, 150 Hz
   BW/Avg, 10 Hz
   Video BW, 1 Hz

2. Set the 1 dB step attenuator to place the signal peak 1 to 3 divisions below the reference level.

3. On the analyzer, press the following keys:

   Single
   Peak Search (or **Search**)
   Marker, Delta

4. Set the 10 dB step attenuator and analyzer reference level according to Table 2-26. At each setting, do the following:

   a. Press **Single** on the analyzer.

   b. Press **Peak Search** (or **Search**).

c. Record the marker delta amplitude reading in column 5 of Table 2-26.

d. Add the actual attenuation error to the analyzer marker delta amplitude and enter the result as the TR Entry in the performance test record.

Table 2-26 Linear Mode, Digital Bandwidths Worksheet, Option 1DR

Column 1	Column 2	Column 3	Column 4	Column 5	Column 6
10 dB Attenuator Nominal Attenuation (dB)	**10 dB Attenuator Actual Attenuation (dB)**	**Attenuation Error (dB)**	**Analyzer Reference Level (dBm)**	**Analyzer Marker Delta Amplitude (dB)**	**TR Entry**
20		0 (Ref)	–20	0 (Ref)	(Ref)
10			–10		**25)**
0			0		**26)**
30			–30		**27)**
40			–40		**28)**
50			–50		**29)**
60			–60		**30)**
70			–70		**31)**
80			–80		**32)**

Post-test Instrument Restoration

To restore the default settings on the analyzer, press **Preset, System, Alignments, Auto Align, All.**

15. Resolution Bandwidth Switching Uncertainty

To measure the resolution bandwidth switching uncertainty an amplitude reference is taken with the resolution bandwidth set to 3 kHz using the marker delta function. The resolution bandwidth is changed to settings between 5 MHz and 10 Hz and the amplitude variation is measured at each setting and compared to the specification. The span is changed as necessary to maintain approximately the same aspect ratio.

The related adjustment for this performance test is "IF Amplitude."


Equipment Required for E4402B, E4403B, E4404B, E4405B, E4407B and E4408B

Adapter, Type-N (m) to BNC (f)
BNC Cable

Additional Equipment for Option BAB

Adapter, Type-N (f) to APC 3.5 (f)

Figure 2-15 Resolution Bandwidth Switching Test Setup

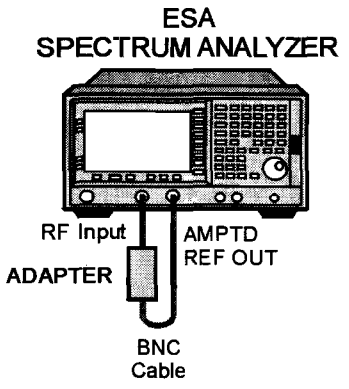

Procedure

1. On the E4402B, E4403B, E4404B, E4405B, E4407B, or E4408B connect a BNC cable from the AMPTD REF OUT to the 50 Ω Input using adapters as necessary. Refer to Figure 2-15.

2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer controls by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   Input/Output (or **Input**), **Amptd Ref** (On) *(E4411B, E4401B)*
   Input/Output (or **Input**), **Amptd Ref Out** (On) *(E4402B, E4403B, E4404B, E4405B, E4407, E4408B)*
   FREQUENCY, 50 MHz
   SPAN, 5 kHz
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
   AMPLITUDE, –25 dBm *(E4411B, E4401B)*
   AMPLITUDE, –19 dBm *(E4402B / 03B / 04B / 05B / 07B / 08B)*
   AMPLITUDE, Scale/Div, 1 dB
   BW/Avg, 1 kHz
   BW/Avg, Video BW, 1 kHz

3. Press **AMPLITUDE** and use the RPG to adjust the reference level until the signal appears five divisions below the reference level, then press the following keys:

   Peak Search (or **Search**)
   Marker→, Mkr →CF
   Marker, Delta

4. Set the analyzer span and resolution bandwidth according to Table 2-27.

5. Press **Peak Search** (or **Search**), **Marker→, Mkr →CF, Peak Search** (or **Search**) then record the marker delta amplitude reading in the performance verification test record as indicated in Table 2-27.

6. Repeat step 4 and step 5 for each of the remaining resolution bandwidth and span settings listed in Table 2-27.

Table 2-27 Resolution Bandwidth Switching Uncertainty

Analyzer		Marker Delta Amplitude Reading
RES BW Setting	**SPAN Setting**	**TR Entry**
1 kHz	5 kHz	0 (Ref)
3 kHz	10 kHz	**1)**
9 kHz[a]	50 kHz	**2)**
10 kHz	50 kHz	**3)**
30 kHz	100 kHz	**4)**
100 kHz	500 kHz	**5)**
120 kHz[a]	500 kHz	**6)**

Table 2-27 Resolution Bandwidth Switching Uncertainty

Analyzer		Marker Delta Amplitude Reading
RES BW Setting	**SPAN Setting**	**TR Entry**
300 kHz	1 MHz	**7)**
1 MHz	5 MHz	**8)**
3 MHz	10 MHz	**9)**
5 MHz	25 MHz	**10)**

a. These Res BW Settings must be entered from the keypad; they can not be accessed from the step keys or RPG.

7. If you are testing a analyzer equipped with Option 1DR, continue with step 8. If the analyzer is not equipped with Option 1DR, stop here.
8. Set the resolution bandwidth and span according to Table 2-28.
9. Press **Peak Search** (or **Search**), **Marker→**, **Mkr →CF**, **Peak Search** (or **Search**) then record the Marker Delta Amplitude Reading in the performance verification test record as indicated in Table 2-28.
10. Repeat step 8 and step 9 for each of the remaining resolution bandwidth and span settings listed in Table 2-28.

Table 2-28 Resolution Bandwidth Switching Uncertainty for Option 1DR

Analyzer		Marker Delta Amplitude Reading
RES BW Setting	**SPAN Setting**	**TR Entry**
300 Hz	1 kHz	**11)**
200 Hz[a]	1 kHz	**12)**
100 Hz	500 Hz	**13)**
30 Hz	100 Hz	**14)**
10 Hz	50 Hz	**15)**

a. These Res BW Settings must be entered from the keypad; they can not be accessed from the step keys or RPG.

16. Absolute Amplitude Accuracy (Reference Settings): Agilent E4401B and E4411B

Absolute Amplitude Accuracy

The level of a 50 MHz signal is measured with a power meter. A complete auto alignment is performed. The 50 MHz signal is then measured with the analyzer. The difference between the power meter and analyzer readings is calculated.

Equipment Required

Synthesized signal generator
Measuring receiver
Power sensor, low power
Cable, Type-N, 152-cm (60-in)
Adapter, Type-N (f) to Type-N (f)

Additional Equipment for 75 Ω Input

Power sensor, 75 Ω
Adapter, mechanical, Type-N (f), 75 Ω to Type-N (m) 50 Ω
Pad, minimum loss
Adapter, Type-N (f), to BNC (m), 75 Ω

Procedure

This performance test consists of two parts:

Part 1. Absolute Amplitude Accuracy, Preamp Off

Part 2. Absolute Amplitude Accuracy, Preamp On (Option 1DS)

Part 1 should be performed on all ESA Spectrum Analyzers. Part 2 should be performed only on ESA-E Series Spectrum Analyzers equipped with Option 1DS, Preamplifier.

Part 1. Absolute Amplitude Accuracy, Preamp Off

1. On the synthesized signal generator set the controls as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, –27 dBm (50 Ω *Input only)*
   AMPLITUDE, –18 dBm (75 Ω *Input only*)
   RF ON
   AM OFF
   FM OFF

2. Calibrate the power meter and low-power power sensor.

   75 Ω *Input: Calibrate the power meter and 75 Ω power sensor.*

3. Connect the signal generator output to the low-power power sensor through the Type-N cable, using an adapter.

   75 Ω *Input: Connect the signal generator output to the 75 Ω power sensor through the Type-N cable using the minimum loss pad and other adapters as necessary.*

4. Adjust the signal generator power level for a power meter reading of –25 dBm.

   75 Ω *Input: Adjust the power level of the signal generator for a power meter reading of –24 dBm. Allow the power sensor adequate time to settle; the 75 Ω power sensor is being used on its lowest range.*

   Record the power meter reading here.

   Power Meter Reading _____ dBm

5. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   System, Alignments, Align Now, All (wait for alignment to finish)
   System, Alignments, Auto Align (Off)
   FREQUENCY, Center Freq, 50 MHz
   SPAN, 2 kHz
   BW/Avg, Resolution BW (Man), **1 kHz**
   Video BW (Man), **1 kHz**

6. Press **AMPLITUDE, –25 dBm, Attenuation** (Man), **10 dB, Scale Type** (Log).

   75 Ω *Input: Set the reference level to 28.75 dBmV.*


7. On the analyzer, press the following:

   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **Volts**
   Det/Demod, Detector, Sample, Return

8. Disconnect the power sensor from the Type-N cable. Connect the Type-N cable to the analyzer 50 Ω input.

   75 Ω *Input: Connect the Type-N cable to the analyzer 75 Ω input using a minimum loss adapter.*

Figure 2-16 Absolute Amplitude Accuracy Test Setup

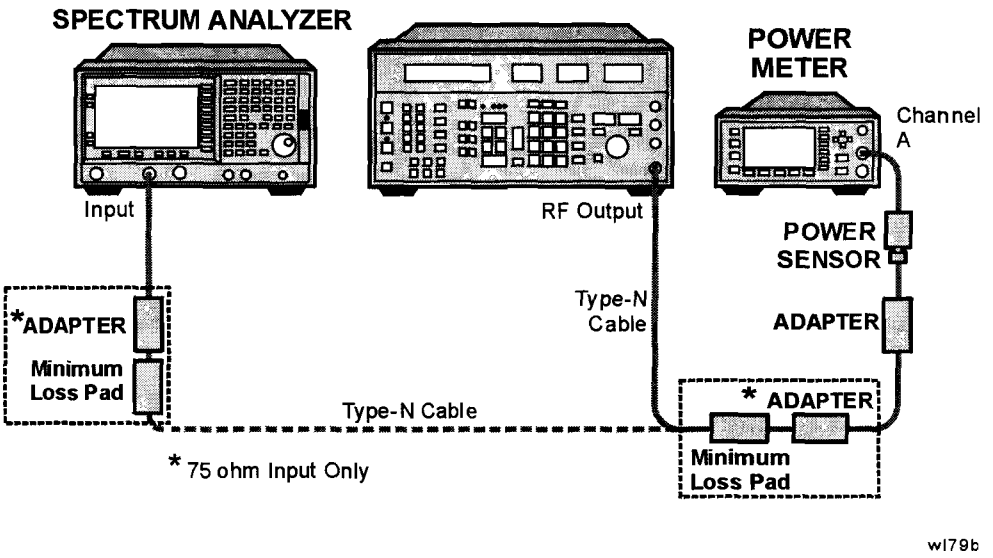

9. Press **Peak Search** (or **Search**).

10. Convert the marker amplitude reading from volts to dBm using the following equation:

$$50\Omega \text{ Input Marker Amptd (dBm)} = 10 \times \log(\text{Mkr}(V^2/0.05))$$

$$75\Omega \text{ Input Marker Amptd (dBm)} = 10 \times \log(\text{Mkr}(V^2/0.075))$$

Marker Amptd (dBm) _____ dBm

11. Subtract the power meter reading noted in step 4 from the Marker Amptd recorded in step 10. Record the difference as TR Entry 1 in the performance verification test record.

Absolute Amplitude Accuracy (Log) = Marker Amptd (dBm) – Power Meter Reading (dBm)

12. On the analyzer, press the following:

AMPLITUDE, Scale Type (Lin)
Peak Search (or **Search**)

13. Convert the marker amplitude reading from volts to dBm using the following equation:

$$50\Omega \text{ Input Marker Amptd (dBm)} = 10 \times \log(\text{Mkr}(V^2/0.05))$$

$$75\Omega \text{ Input Marker Amptd (dBm)} = 10 \times \log(\text{Mkr}(V^2/0.075))$$

Marker Amptd (dBm) _____ dBm

14. Subtract the power meter reading noted in step 4 from the Marker Amptd recorded in step 13. Record the difference, Absolute Amplitude Accuracy (Lin), as TR Entry 2 in the performance verification test record.

Absolute Amplitude Accuracy (Lin) = Marker Amptd (dBm) – Power Meter Reading (dBm)

15. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System**, **Alignments**, **Auto Align**, **All**.

16. If the analyzer is equipped with Option 1DS, preamplifier, proceed to Part 2: Absolute Amplitude Accuracy, Preamp On.

Part 2. Absolute Amplitude Accuracy, Preamp On (Option 1DS)

1. On the synthesized signal generator set the controls as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, –30 dBm (50 Ω *Input only)*
   AMPLITUDE, –24 dBm (75 Ω *Input only*)
   RF ON
   AM OFF
   FM OFF

2. Calibrate the power meter and low-power power sensor.

   75 Ω *Input: Calibrate the measuring receiver and 75* Ω power sensor.

3. Connect the signal generator output to the power sensor through the Type-N cable, using an adapter.

   75 Ω Input: Connect the signal generator output to the 75 Ω power sensor through the Type-N cable using the minimum loss pad and other adapters as necessary.

4. Adjust the signal generator power level for a power meter reading of –30 dBm.

   75 Ω Input: Adjust the power level of the signal generator for a power meter reading of –30 dBm. Allow the power sensor adequate time to settle; the 75 Ω power sensor is being used on its lowest range.

   Record the power meter reading here:

   Power Meter Reading _____ dBm

5. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   System, Alignments, Align Now, All (wait for alignment to finish)
   Done, Auto Align, Off.
   FREQUENCY, Center Freq, 50 MHz
   SPAN, 2 kHz
   BW/Avg, Resolution BW Auto Man, 1 kHz
   Video BW Auto Man 1 kHz

6. Press **AMPLITUDE –30 dBm, Atten** (Man) **0 dB, Scale Type** (Log).

   75 Ω *Input: Set the reference level to 18.75 dBmV.*

7. Press **AMPLITUDE, More, Int Preamp** (On).

8. Press **AMPLITUDE, More, Y Axis Units** (or **Amptd Units**), **Volts, Det/Demod, Detector, Sample, Return.**

9. Disconnect the power sensor from the Type-N cable. Connect the Type-N cable to the analyzer 50 Ω input.

   75 Ω *Input: Connect the Type-N cable to the analyzer 75 Ω input using a minimum loss adapter.*

10. Press **Peak Search** (or **Search**).

11. Convert the marker amplitude reading from volts to dBm using the following equation:

    $$50\Omega \text{ Input Marker Amptd (dBm)} = 10 \times \log(\text{Mkr}(V^2/0.05))$$

    $$75\Omega \text{ Input Marker Amptd (dBm)} = 10 \times \log(\text{Mkr}(V^2/0.075))$$

    Marker Amptd (dBm) _____ dBm

12. Subtract the power meter reading noted in step 4 from the Marker Amptd recorded in step 11. Record the difference, Absolute Amplitude Accuracy (Log), as TR Entry 3 in the performance verification test record.

Absolute Amplitude Accuracy (Log) = Marker Amptd (dBm) – Power Meter Reading (dBm)

13. On the analyzer, press the following keys:

    AMPLITUDE, Scale Type (Lin)
    Peak Search (or **Search**)

14. Convert the marker amplitude reading from volts to dBm using the following equation:

$$50\Omega \text{ Input Marker Amptd (dBm)} = 10 \times \log(\text{Mkr}(V^2/0.05))$$

$$75\Omega \text{ Input Marker Amptd (dBm)} = 10 \times \log(\text{Mkr}(V^2/0.075))$$

Marker Amptd (dBm) _____ dBm

15. Subtract the power meter reading noted in step 4 from the Marker Amptd recorded in step 14. Record the difference, Absolute Amplitude Accuracy (Lin), as TR Entry 4 in the performance verification test record.

Absolute Amplitude Accuracy (Lin) = Marker Amptd (dBm) – Power Meter Reading (dBm)

16. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System, Alignments, Auto Align, All**.

17. Absolute Amplitude Accuracy (Reference Settings): Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B

Absolute Amplitude Accuracy

The level of a 50 MHz signal is measured with a power meter. A complete auto alignment is performed. The 50 MHz signal is then measured with the analyzer. The difference between the power meter and analyzer readings is calculated.

Equipment Required

Synthesized signal generator
Measuring receiver
RF power sensor
Low-power power sensor *(Option 1DS only)*
Cable, Type-N, 152-cm (60-in)
Adapter, Type-N (f) to Type-N (f)

Additional Equipment for Option BAB

Adapter, Type-N (f) to APC 3.5 (f)

Procedure

This performance test consists of two parts:

Part 1. Absolute Amplitude Accuracy, Preamp Off

Part 2. Absolute Amplitude Accuracy, Preamp On (Option 1DS)

Part 1 should be performed on all ESA Series Spectrum Analyzers. Part 2 should be performed only on ESA-E Series Spectrum Analyzers equipped with Option 1DS, Preamplifier.

Part 1. Absolute Amplitude Accuracy, Preamp Off

1. On the synthesized signal generator set the controls as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, –20 dBm
   RF ON
   AM OFF
   FM OFF

2. Calibrate the power meter and RF power sensor.


3. Connect the signal generator output to the power sensor through the Type-N cable, using an adapter.
4. Adjust the signal generator power level for a power meter reading of –20 dBm.

   Record the power meter reading here:

   Power Meter Reading _____ dBm
5. On the analyzer, connect the AMPTD REF OUT to the 50 Ω Input using a BNC Cable and adapter as shown in Figure 2-17.
6. Press the following **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   System, Alignments
   Align Now, All (wait for alignment to finish)
   Return, Auto Align, Off
   FREQUENCY, Center Freq, 50 MHz
   SPAN, 2 kHz
   BW/Avg, Resolution BW Auto Man, 1 kHz
   Video BW Auto Man 1 kHz
   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
7. Press **AMPLITUDE –20 dBm, Atten Auto Man 10 dB, Scale Type** (Log).
8. If the analyzer is an E4402B with OptionUKB, E4404B or E4405B, press **Input/Output (or Input), Coupling** (DC).
9. Press **AMPLITUDE, More, Y Axis Units** (or **Amptd Units**), **Volts, Det/Demod, Detector, Sample, Return.**
10. Disconnect the power sensor from the Type-N cable. Connect the Type-N cable to the analyzer 50 Ω input.

Figure 2-17 Absolute Amplitude Accuracy Test Setup

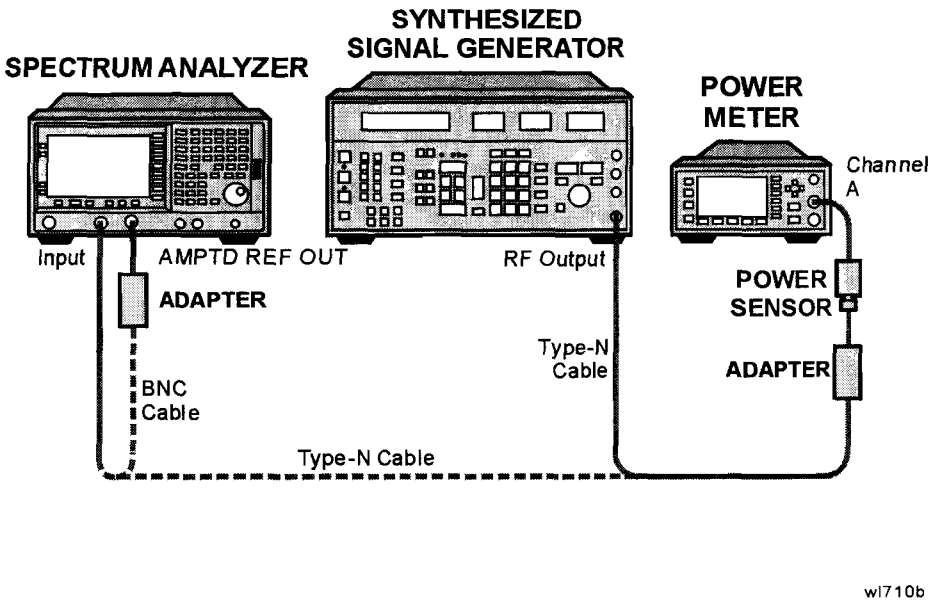

11. Press **Peak Search** (or **Search**).

12. Convert the marker amplitude reading from volts to dBm using the following equation:

$$50\Omega \text{ Input Marker Amptd (dBm)} = 10 \times \log(\text{Mkr}(V^2/0.05))$$

Marker Amptd (dBm) _____ dBm

13. Subtract the power meter reading noted in step 4 from the Marker Amptd recorded in step 12. Record the difference, Absolute Amplitude Accuracy (Log), as TR Entry 1 in the performance verification test record.

Absolute Amplitude Accuracy (Log) = Marker Amptd (dBm) – Power Meter Reading (dBm)

14. On the analyzer, press the following keys:

AMPLITUDE, Scale Type (Lin)
Peak Search (or **Search**)

15. Convert the marker amplitude reading from volts to dBm using the following equation:

$$50\Omega \text{ Input Marker Amptd (dBm)} = 10 \times \log(\text{Mkr}(V^2/0.05))$$

Marker Amptd (dBm) _____ dBm

16. Subtract the power meter reading noted in step 4 from the Marker Amptd recorded in step 15. Record the difference, Absolute Amplitude Accuracy (Lin), as TR Entry 2 in the performance verification test record.

Absolute Amplitude Accuracy (Lin) = Marker Amptd (dBm) – Power Meter Reading (dBm)

17. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System**, **Alignments**, **Auto Align**, **All**.

18. If the analyzer is equipped with Option 1DS, preamplifier, proceed to Part 2: Absolute Amplitude Accuracy, Preamp On.

Part 2. Absolute Amplitude Accuracy, Preamp On (Option 1DS)

1. On the synthesized signal generator set the controls as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, –30 dBm
   RF ON
   AM OFF
   FM OFF

2. Calibrate the power meter and low-power power sensor.
3. Connect the signal generator output to the power sensor through the Type-N cable, using an adapter.
4. Adjust the signal generator power level for a power meter reading of –30 dBm.

   Record the power meter reading here:

   Power Meter Reading _____ dBm

5. On the analyzer, connect the AMPTD REF OUT to the 50 Ω INPUT using a BNC Cable and adapter as shown in Figure 2-17.
6. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   System, Alignments, Align Now, All (wait for alignment to finish)
   System, Alignments, Auto Align (Off)
   FREQUENCY, Center Freq, 50 MHz
   SPAN, 2 kHz
   BW/Avg, Resolution BW (Man), **1 kHz**
   Video BW (Man), **1 kHz**

7. Press **AMPLITUDE –30 dBm, Attenuation** (Man) **0 dB, Scale Type** (Log).
8. If the analyzer is an E4402B with OptionUKB, E4404B or E4405B, press **Input/Output (or Input), Coupling** (DC).
9. Press **AMPLITUDE, More, Internal Preamp** (On).

10. On the analyzer, press the following:

    AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **Volts**
    Det/Demod, Detector, Sample, Return

11. Disconnect the power sensor from the Type-N cable. Connect the Type-N cable to the analyzer 50 Ω input.

12. Press **Peak Search** (or **Search**).

13. Convert the marker amplitude reading from volts to dBm using the following equation:

$$50\Omega \text{ Input Marker Amptd (dBm)} = 10 \times \log(\text{Mkr}(V^2/0.05))$$

    Marker Amptd (dBm)_____ dBm

14. Subtract the power meter reading noted in step 4 from the Marker Amptd recorded in step 13. Record the difference, Absolute Amplitude Accuracy (Log), as TR Entry 3 in the performance verification test record.

Absolute Amplitude Accuracy (Log) = Marker Amptd (dBm) – Power Meter Reading (dBm)

15. On the analyzer, press the following:

    AMPLITUDE, Scale Type (Lin)
    Peak Search (or **Search**)

16. Convert the marker amplitude reading from volts to dBm using the following equation:

$$50\Omega \text{ Input Marker Amptd (dBm)} = 10 \times \log(\text{Mkr}(V^2/0.05))$$

    Marker Amptd (dBm) _____ dBm

17. Subtract the power meter reading noted in step 4 from the Marker Amptd recorded in step 16. Record the difference, Absolute Amplitude Accuracy (LIN), as TR Entry 1 in the performance verification test record.

Absolute Amplitude Accuracy (Lin) = Marker Amptd (dBm) – Power Meter Reading (dBm)

18. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System, Alignments, Auto Align, All.**

18. Overall Amplitude Accuracy: Agilent E4401B and E4411B

This test measures the absolute amplitude of the analyzer at 50 MHz. A synthesized signal generator and attenuators are used as the signal source to the analyzer. A power meter is used to measure this signal source with the attenuators set to 0 dB. The value measured is recorded as the source amplitude. The attenuators are used to adjust the signal levels applied to the analyzer between the initial signal amplitude (set with the power meter) and –50 dBm. The amplitude measured by the analyzer is compared to the actual signal level and the amplitude error is calculated.

There are no related adjustments for this performance test.

Equipment Required

Synthesized signal generator
10 dB step attenuator
1 dB step attenuator
Attenuator interconnection kit
Attenuator driver (if programmable step attenuators are used)
6 dB fixed attenuator
Power meter
Power sensor
Cable, Type-N, 62-cm (24 in.) (m) (2 *required*)
Cable, BNC
Adapter, Type-N (f) to Type-N (f)

Additional Equipment for 75 Ω Input

Power sensor, 75 Ω
Pad, minimum loss
Adapter, mechanical, Type-N (f), 75 Ω to Type-N (m) 50 Ω
Adapter, Type-N (f), to BNC (m), 75 Ω
Adapter, Type-N (f) to Type-N (f), 75 Ω

Procedure


Measuring 0 dBm Reference Level

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. If the firmware revision is A.04.00 or later, press **Sweep, Points, 401, Enter**.
2. Perform a complete self-alignment and set Auto Align Off. Press **System, Alignments, Align Now, All**, and wait for the alignment routine to finish. Then, press **Return, Auto Align, Off**.

3. Zero and calibrate the power meter and power sensor connected to Channel A of the power meter.

   75 Ω Inputs: Zero and calibrate the power meter and 75 Ω power sensor connected to Channel A of the power meter.

Figure 2-18 Measure Source Test Setup

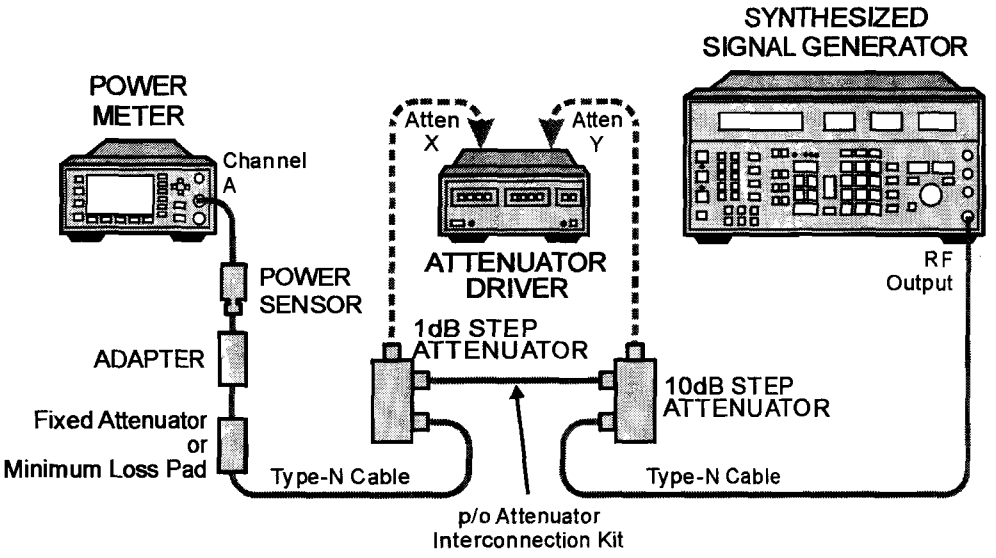

4. Connect the equipment as shown in Figure 2-18. The power sensor should connect directly to the 6 dB fixed attenuator using an adapter.

   75 Ω Inputs: Use the minimum loss pad in place of the 6 dB fixed attenuator and a 75 Ω Type-N (f) to Type-N (f) adapter.

5. Preset the synthesized signal generator. Manually press **Blue Key, Special, 0, 0**. Set the signal generator as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, 6 dBm

6. Set the 10 dB and 1 dB step attenuators to 0 dB.

7. From the metrology data for the step attenuators at 50 MHz, obtain the actual attenuation for the 0 dB setting of each attenuator (in some cases, this might be zero by definition). Add the two actual attenuations to obtain the 0 dB reference attenuation.

$$\text{RefAtten}_{0dB} = 10\text{ dB Actual}_{0dB} + 1\text{ dB Actual}_{0dB}$$

   For example, if the actual attenuation for the 10 dB step attenuator is 0.03 dB, 10 dB Actual_{0dB} is 0.03 dB. If the actual attenuation for the 1 dB step attenuator is 0.02 dB, 1 dB Actual_{0dB} is 0.02 dB. In this case RefAtten_{0dB} is 0.05 dB.

8. Retrieve metrology data for the step attenuators at 50 MHz. Enter the actual attenuation values for each attenuator setting as indicated in Table 2-29. If using a programmable attenuator, the section three 40 dB step should be used for the 40 dB setting on the 10 dB step attenuator. Similarly, the section three 4 dB step should be used for the 4 dB setting on the 1 dB step attenuator.

Table 2-29 Amplitude Accuracy Worksheet, 0 dBm Reference Level

1 dB Step Attenuator		10 dB Step Attenuator		Total Attenuation		Nominal Amptd.	Meas. Amptd.	Amptd. Accuracy TR Entry
Setting	Actual	Setting	Actual	Setting	Actual			
0 dB		0 dB		0 dB		0 dBm		1)
0 dB		10 dB		10 dB		–10 dBm		2)
0 dB		20 dB		20 dB		–20 dBm		3)
0 dB		30 dB		30 dB		–30 dBm		4)
0 dB		40 dB		40 dB		–40 dBm		5)
0 dB		50 dB		50 dB		–50 dBm		6)

9. Calculate the actual total attenuation by adding the actual attenuation for the 1 dB step attenuator to the actual attenuation for the 10 dB step attenuator for each total attenuation setting listed in Table 2-29.

NOTE The external attenuators and cables are now part of the "source."


10. Adjust the signal generator amplitude for a power meter reading of 0 dBm ±0.2 dB. Record the power meter reading here:

    $Amptd_{0dBm}$ = _____ dBm

11. Connect the equipment as indicated in Figure 2-19. The fixed attenuator must connect directly to the analyzer input.

    75 Ω Inputs: The minimum loss pad should be connected to the analyzer input using a Type N (f) to BNC (m) 75 Ω adapter.

Figure 2-19 Amplitude Accuracy Test Setup

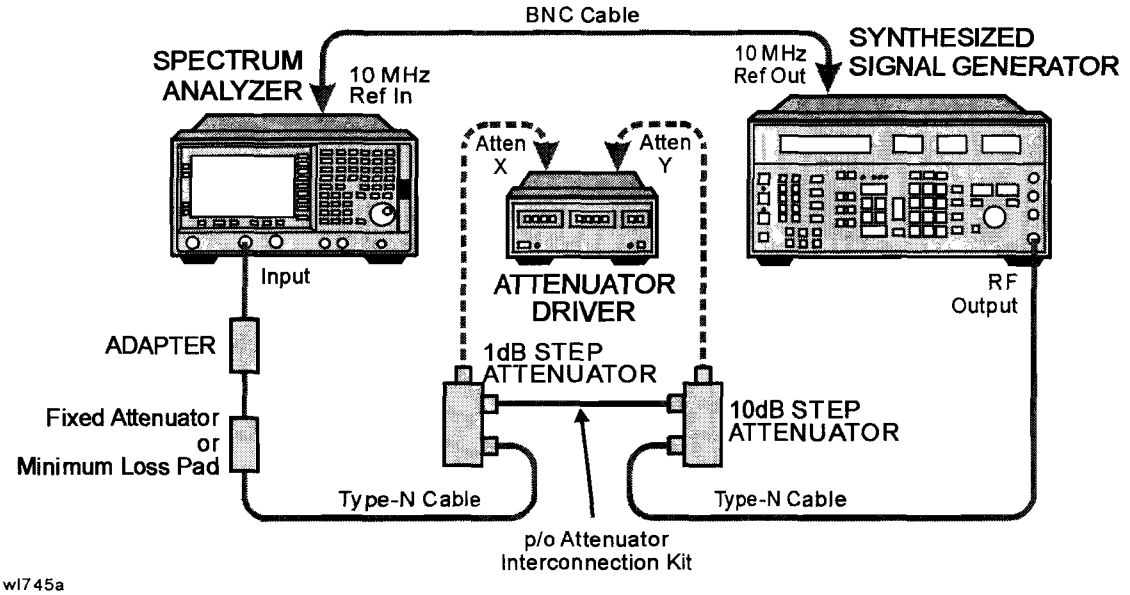

12. Set the analyzer as follows:

FREQUENCY, Center Freq, 50 MHz
SPAN, 6 kHz
BW/Avg, Resolution BW, 1 kHz
AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
AMPLITUDE, Ref Level, 0 dBm
Attenuation, 10 dB (Man)

13. Perform the following steps for each of the nominal amplitude values listed in Table 2-29:

a. Set the 1 dB step attenuator as indicated in Table 2-29.
b. Set the 10 dB step attenuator as indicated in Table 2-29.
c. Press **Single** and wait for the sweep to finish.
d. Press **Peak Search** (or **Search**). Even though the signal may be slightly above the reference level for the first nominal amplitude setting, the marker can still make a valid measurement.
e. Record the Mkr 1 amplitude value as the measured amplitude in Table 2-29.
f. If the nominal amplitude is 0 dBm, calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - \text{Amptd0dBm}$$

g. If the amplitude is less than 0 dBm, calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - (\text{Amptd}_{0\text{dBm}} - \text{ActualTotalAtten} + \text{RefAtten}_{0\text{dB}})$$

h. Record the amplitude accuracy in the performance verification test record as indicated in Table 2-29.

Measuring –20 dBm Reference Level

1. Press **AMPLITUDE, Ref Level, –20 dBm.**
2. Copy the actual total attenuation values from Table 2-29 into the actual total attenuation column in Table 2-30. Not all values in Table 2-29 will be required in Table 2-30.

Table 2-30 Amplitude Accuracy Worksheet, –20 dBm Reference Level

1 dB Step Attenuator	10 dB Step Attenuator	Total Attenuation		Nominal Amplitude	Measured Amplitude	Amplitude Accuracy
Setting	Actual	Setting	Actual			(TR Entry)
0 dB	20 dB	20 dB		–20 dB		7)
0 dB	30 dB	30 dB		–30 dB		8)
0 dB	40 dB	40 dB		–40 dB		9)
0 dB	50 dB	50 dB		–50 dB		10)

3. Perform the following steps for each of the nominal amplitude values listed in Table 2-30:
   a. Set the 1 dB step attenuator as indicated in Table 2-30.
   b. Set the 10 dB step attenuator as indicated in Table 2-30.
   c. Press **Single** and wait for the sweep to finish.
   d. Press **Peak Search** (or **Search**). Even though the signal may be slightly above the reference level for the first nominal amplitude setting, the marker can still make a valid measurement.
   e. Record the Mkr 1 amplitude value as the measured amplitude in Table 2-30.
   f. Calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - (\text{Amptd}_{0\text{dBm}} - \text{ActualTotalAtten} + \text{RefAtten}_{0\text{dB}})$$

   g. Record the amplitude accuracy in the performance verification test record as indicated in Table 2-30.

Measuring –40 dBm Reference Level

1. Press **AMPLITUDE, Ref Level, –40 dBm.**
2. Copy the actual total attenuation values from Table 2-30 into the actual total attenuation column in Table 2-31. Not all values in Table 2-30 will be required in Table 2-31.

Table 2-31 Amplitude Accuracy Worksheet, –40 dBm Reference Level

1 dB Step Attenuator	10 dB Step Attenuator	Total Attenuation		Nominal Amplitude	Measured Amplitude	Amplitude Accuracy
Setting	Actual	Setting	Actual			(TR Entry)
0 dB	40 dB	40 dB		–40 dB		11)
0 dB	50 dB	50 dB		–50 dB		12)

3. Perform the following steps for each of the nominal amplitude values listed in Table 2-31:
   a. Set the 1 dB step attenuator as indicated in Table 2-31.
   b. Set the 10 dB step attenuator as indicated in Table 2-31.
   c. Press **Single** and wait for the sweep to finish.
   d. Press **Peak Search** (or **Search**). Even though the signal may be slightly above the reference level for the first nominal amplitude setting, the marker can still make a valid measurement.
   e. Record the Mkr 1 amplitude value as the measured amplitude in Table 2-31.
   f. Calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - (\text{Amptd}_{0\text{dBm}} - \text{ActualTotalAtten} + \text{RefAtten}_{0\text{dB}})$$

   g. Record the amplitude accuracy in the performance verification test record as indicated in Table 2-31.

Measuring –50 dBm Reference Level

1. Press **AMPLITUDE, Ref Level, –50 dBm**.
2. Copy the actual total attenuation values from Table 2-31 into the actual total attenuation column in Table 2-32. Not all values in Table 2-31 will be required in Table 2-32.

Table 2-32 Amplitude Accuracy Worksheet, –50 dBm Reference Level

1 dB Step Attenuator	10 dB Step Attenuator	Total Attenuation		Nominal Amplitude	Measured Amplitude	Amplitude Accuracy
Setting	Actual	Setting	Actual			(TR Entry)
0 dB	50 dB	50 dB		–50 dB		13)

3. Perform the following steps for each of the nominal amplitude values listed in Table 2-32:
   a. Set the 1 dB step attenuator as indicated in Table 2-32.
   b. Set the 10 dB step attenuator as indicated in Table 2-32.
   c. Press **Single** and wait for the sweep to finish.

d. Press **Peak Search** (or **Search**). Even though the signal may be slightly above the reference level for the first nominal amplitude setting, the marker can still make a valid measurement.
e. Record the Mkr 1 amplitude value as the measured amplitude in Table 2-32.
f. Calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - (\text{Amptd}_{0\text{dBm}} - \text{ActualTotalAtten} + \text{RefAtten}_{0\text{dB}})$$

g. Record the amplitude accuracy in the performance verification test record as indicated in Table 2-32.

19. Overall Amplitude Accuracy: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B

This test measures the absolute amplitude of the analyzer at 50 MHz. A synthesized signal generator and attenuators are used as the signal source to the analyzer. A power meter is used to measure this signal source with the attenuators set to 0 dB. The value measured is recorded as the source amplitude. The attenuators are used to adjust the signal levels applied to the analyzer from the initial signal amplitude (set with the power meter) and –50 dBm. The amplitude measured by the analyzer is compared to the actual signal level and the amplitude error is calculated.

There are no related adjustments for this performance test.

Equipment Required

Synthesized signal generator
10 dB step attenuator
1 dB step attenuator
Attenuator interconnection kit
Attenuator driver (if programmable step attenuators are used)
6 dB fixed attenuator
Power meter
Power sensor
Cable, Type-N, 62 cm (24 in.) (m) (2 *required*)
Cable, BNC
Adapter, Type-N (f) to Type-N (f)

Additional Equipment for Option BAB

Adapter, Type N (f) to APC 3.5 (f)


Procedure

Measuring 0 dBm Reference Level

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. If the firmware revision is A.04.00 or later, press **Sweep, Points, 401, Enter**.
2. Connect a BNC cable from AMPTD REF OUT to the 50 Ω Input connector using a Type N (m) to BNC (f) adapter.
3. Perform a complete self-alignment and set Auto Align Off. Press **System, Alignments, Align Now, All**, and wait for the alignment routine to finish. Then, press **Return, Auto Align, Off**.

4. Zero and calibrate the power meter and power sensor connected to Channel A of the power meter.
5. Connect the equipment as shown in Figure 2-20. The power sensor should connect directly to the 6 dB fixed attenuator using an adapter.

Figure 2-20 Measure Source Test Setup

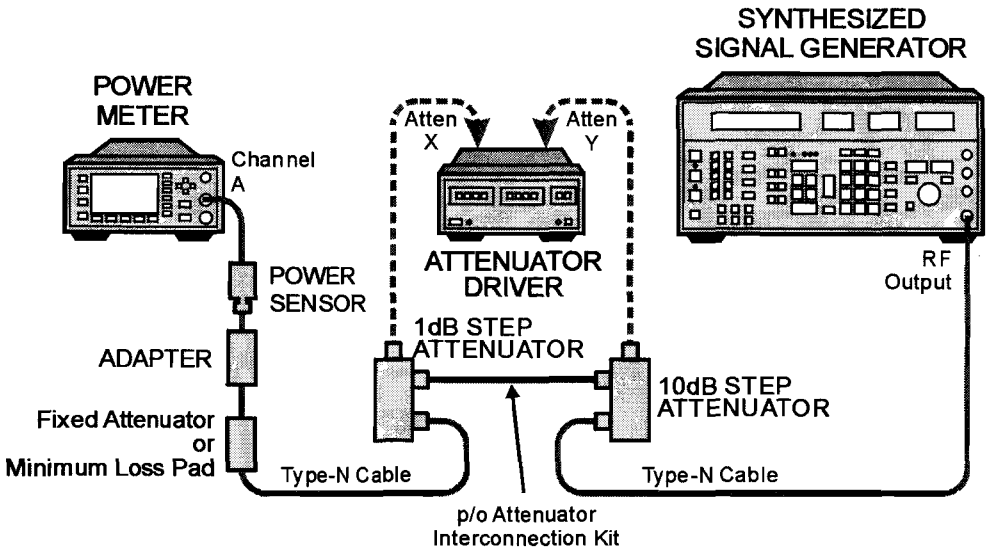

wl713a

6. **Preset** the synthesized signal generator. Manually press **Blue Key, Special, 0, 0**. Set the signal generator as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, 6 dBm

7. Set the 10 dB and 1 dB step attenuators to 0 dB.
8. From the metrology data for the step attenuators at 50 MHz, obtain the actual attenuation for the 0 dB setting of each attenuator (in some cases, this might be zero by definition). Add the two actual attenuations to obtain the 0 dB reference attenuation.

$$\text{RefAtten}_{0\text{dB}} = 10\text{ dB Actual}_{0\text{dB}} + 1\text{ dB Actual}_{0\text{dB}}$$

   For example, if the actual attenuation for the 10 dB step attenuator is 0.03 dB, 10 dB $\text{Actual}_{0\text{dB}}$ is 0.03 dB. If the actual attenuation for the 1 dB step attenuator is 0.02 dB, 1 dB $\text{Actual}_{0\text{dB}}$ is 0.02 dB. In this case $\text{RefAtten}_{0\text{dB}}$ is 0.05 dB.

9. Retrieve metrology data for the step attenuators at 50 MHz. Enter the actual attenuation values for each attenuator setting as indicated in Table 2-33. If using a programmable attenuator, the section three 40 dB step should be used for the 40 dB setting on the 10 dB step attenuator. Similarly, the section three 4 dB step should be used for the 4 dB setting on the 1 dB step attenuator.

Table 2-33 Amplitude Accuracy Worksheet, 0 dBm Reference Level

1 dB Step Attenuator		10 dB Step Attenuator		Total Attenuation		Nominal Amptd.	Meas. Amptd.	Amptd. Accuracy
Setting	Actual	Setting	Actual	Setting	Actual			(TR Entry)
0 dB		0 dB		0 dB		0 dBm		1)
0 dB		10 dB		10 dB		–10 dBm		2)
0 dB		20 dB		20 dB		–20 dBm		3)
0 dB		30 dB		30 dB		–30 dBm		4)
0 dB		40 dB		40 dB		–40 dBm		5)
0 dB		50 dB		50 dB		–50 dBm		6)

10. Calculate the actual total attenuation by adding the actual attenuation for the 1 dB step attenuator to the actual attenuation for the 10 dB step attenuator for each total attenuation setting listed in Table 2-33.


NOTE The external attenuators and cables are now part of the "source."

11. Adjust the signal generator amplitude for a power meter reading of 0 dBm ±0.2 dB. Record the power meter reading here:

$Amptd_{0dBm}$ = _____ dBm

12. Connect the equipment as indicated in Table 2-33. The fixed attenuator must connect directly to the analyzer input.

Figure 2-21 Amplitude Accuracy Test Setup

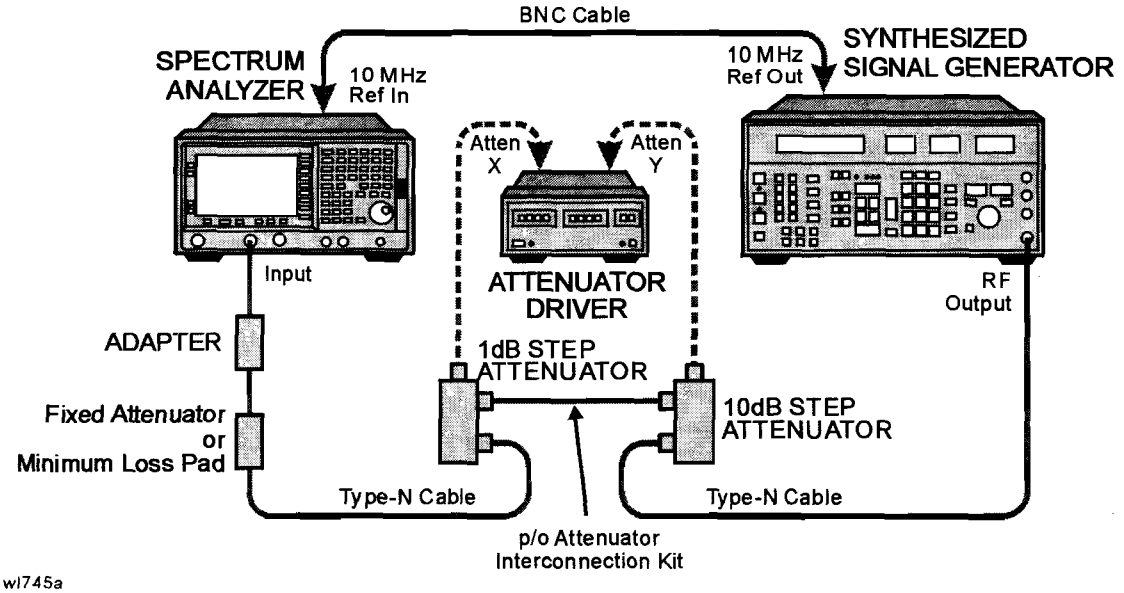

13.Set the analyzer as follows:

FREQUENCY, Center Freq, 50 MHz
SPAN, 6 kHz
BW/Avg, Resolution BW, 1 kHz
AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
AMPLITUDE, Ref Level, 0 dBm
Attenuation, 10 dB (Man)

14.Perform the following steps for each of the nominal amplitude values listed in Table 2-33:

a. Set the 1 dB step attenuator as indicated in Table 2-33.
b. Set the 10 dB step attenuator as indicated in Table 2-33.
c. Press **Single** and wait for the sweep to finish.
d. Press **Peak Search** (or **Search**). Even though the signal may be slightly above the reference level for the first nominal amplitude setting, the marker can still make a valid measurement.
e. Record the Mkr 1 amplitude value as the measured amplitude in Table 2-33.
f. If the nominal amplitude is 0 dBm, calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - \text{Amptd}_{0\text{dBm}}$$

g. If the amplitude is less than 0 dBm, calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - (\text{Amptd}_{0\text{dBm}} - \text{ActualTotalAtten} + \text{RefAtten}_{0\text{dB}})$$

h. Record the amplitude accuracy in the performance verification test record as indicated in Table 2-33.

Measuring –20 dBm Reference Level

1. Press **AMPLITUDE, Ref Level, –20 dBm.**
2. Copy the actual total attenuation values from Table 2-33 into the actual total attenuation column in Table 2-34. Not all values in Table 2-33 will be required in Table 2-34.

Table 2-34 Amplitude Accuracy Worksheet, –20 dBm Reference Level

1 dB Step Attenuator	10 dB Step Attenuator	Total Attenuation		Nominal Amplitude	Measured Amplitude	Amplitude Accuracy
Setting	Actual	Setting	Actual			(TR Entry)
0 dB	20 dB	20 dB		–20 dB		7)
0 dB	30 dB	30 dB		–30 dB		8)
0 dB	40 dB	40 dB		–40 dB		9)
0 dB	50 dB	50 dB		–50 dB		10)

3. Perform the following steps for each of the nominal amplitude values listed in Table 2-34:

   a. Set the 1 dB step attenuator as indicated in Table 2-34.
   b. Set the 10 dB step attenuator as indicated in Table 2-34.
   c. Press **Single** and wait for the sweep to finish.
   d. Press **Peak Search** (or **Search**). Even though the signal may be slightly above the reference level for the first nominal amplitude setting, the marker can still make a valid measurement.
   e. Record the Mkr 1 amplitude value as the measured amplitude in Table 2-34.
   f. Calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - (\text{Amptd}_{0\text{dBm}} - \text{ActualTotalAtten} + \text{RefAtten}_{0\text{dB}})$$

   g. Record the amplitude accuracy in the performance verification test record as indicated in Table 2-34.

Measuring –40 dBm Reference Level

1. Press **AMPLITUDE, Ref Level, –40 dBm**.
2. Copy the actual total attenuation values from Table 2-34 into the actual total attenuation column in Table 2-35. Not all values in Table 2-34 will be required in Table 2-35.

Table 2-35 Amplitude Accuracy Worksheet, –40 dBm Reference Level

1 dB Step Attenuator	10 dB Step Attenuator	Total Attenuation		Nominal Amplitude	Measured Amplitude	Amplitude Accuracy
Setting	Actual	Setting	Actual			(TR Entry)
0 dB	40 dB	40 dB		–40 dB		11)
0 dB	50 dB	50 dB		–50 dB		12)

3. Perform the following steps for each of the nominal amplitude values listed in Table 2-35:

   a. Set the 1 dB step attenuator as indicated in Table 2-35.
   b. Set the 10 dB step attenuator as indicated in Table 2-35.
   c. Press **Single** and wait for the sweep to finish.
   d. Press **Peak Search** (or **Search**). Even though the signal may be slightly above the reference level for the first nominal amplitude setting, the marker can still make a valid measurement.
   e. Record the Mkr 1 amplitude value as the measured amplitude in Table 2-35.
   f. Calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - (\text{Amptd}_{0\text{dBm}} - \text{ActualTotalAtten} + \text{RefAtten}_{0\text{dB}})$$

   g. Record the amplitude accuracy in the performance verification test record as indicated in Table 2-35.

Measuring –50 dBm Reference Level

1. Press **AMPLITUDE, Ref Level, –50 dBm.**
2. Copy the actual total attenuation values from Table 2-34 into the actual total attenuation column in Table 2-36. Not all values in Table 2-34 will be required in Table 2-36.

Table 2-36 Amplitude Accuracy Worksheet, –50 dBm Reference Level

1 dB Step Attenuator	10 dB Step Attenuator	Total Attenuation		Nominal Amplitude	Measured Amplitude	Amplitude Accuracy
Setting	Actual	Setting	Actual			(TR Entry)
0 dB	50 dB	50 dB		–50 dB		13)

3. Perform the following steps for each of the nominal amplitude values listed in Table 2-36:
   a. Set the 1 dB step attenuator as indicated in Table 2-36.
   b. Set the 10 dB step attenuator as indicated in Table 2-36.
   c. Press **Single** and wait for the sweep to finish.
   d. Press **Peak Search** (or **Search**). Even though the signal may be slightly above the reference level for the first nominal amplitude setting, the marker can still make a valid measurement.
   e. Record the Mkr 1 amplitude value as the measured amplitude in Table 2-36.
   f. Calculate the amplitude accuracy as follows:

Amplitude Accuracy = Measured Amplitude – (Amptd0dBm – ActualTotalAtten + RefAtten0d

   g. Record the amplitude accuracy in the performance verification test record as indicated in Table 2-36.

20. Resolution Bandwidth Accuracy

The output of a synthesized signal generator is connected to the Input of the analyzer, characterized through a 1 dB step attenuator set to 3 dB. The amplitude of the synthesized signal generator is set to a reference amplitude 5 dB below the top of the screen. A marker reference is set and the attenuator is set to 0 dB.

The markers of the analyzer are then used to measure the 3 dB bandwidth. The first marker is set on the left filter skirt so that the marker delta amplitude is 1 dB plus the attenuator error for the 3 dB setting. The second marker is similarly set on the right filter skirt. The frequency difference between the two markers is the 3 dB bandwidth.

Resolution bandwidth settings ≤300 Hz (Option 1DR) are not measured. These bandwidths are digitally derived; therefore, their accuracy is verified by design.

The related adjustment for this performance test is "IF Amplitude."

Equipment Required

Synthesized signal generator
Cable, BNC, 122-cm (48-in)
Cable, Type-N, 152-cm (60-in) (*2 required*)
1 dB step attenuator
Attenuator/switch driver (if programmable step attenuators are used)


Additional Equipment for 75 Ω Input

Pad, minimum loss
Adapter, Type-N (f), to BNC (m), 75 Ω

Additional Equipment for Option BAB

Adapter, Type-N (f), to APC 3.5 (f)

Figure 2-22 Resolution Bandwidth Accuracy Test Setup

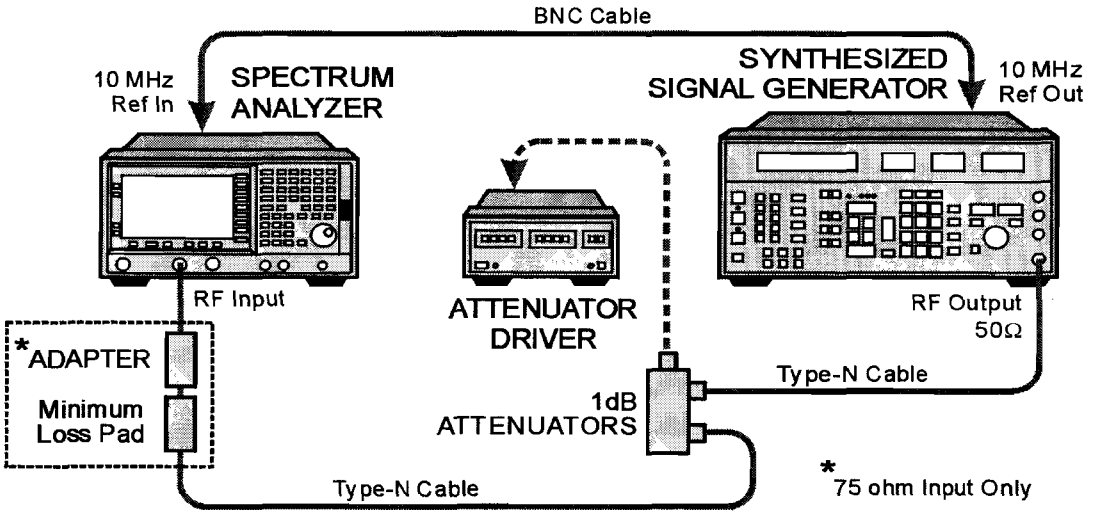

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω connectors, or the connectors will be damaged.

Procedure

1. Connect the equipment as shown in Figure 2-22.
2. On the synthesized signal generator, press **Blue Key, Special, 0, 0** and set the controls as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, 0 dBm (50 Ω *Input only)*
   AMPLITUDE, 6 dBm (75 Ω *Input only)*

3. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System, Alignments, Auto Align, Off.** Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, 50 MHz
   SPAN, 7.5 MHz
   AMPLITUDE, Scale/Div 1 dB
   AMPLITUDE, Y Axis Units (or **Amptd Units**), **dBm**
   BW/Avg, 5 MHz
   BW/Avg, Video BW, 30 Hz

4. Set the 1 dB step attenuator to 3 dB.

5. Note the error of the external 1 dB step attenuator at 3 dB and 6 dB below using its calibration records.

   Attenuator Error (3 dB) _____ dB

   Attenuator Error (6 dB) _____ dB

3 dB Resolution Bandwidth Accuracy

6. Press **Peak Search** (or **Search**), **Meas Tools**, **Mkr→ CF** on the analyzer.
7. Adjust the amplitude of the synthesized signal generator for a marker amplitude reading of –5 dBm ±0.2 dB.
8. Press **Peak Search** (or **Search**), **Marker**, **Delta** on the analyzer.
9. Set the attenuator to 0 dB.
10. On the analyzer, press **Marker**. Lower the marker frequency by adjusting the knob until the marker delta amplitude is 0 dB plus the attenuator error (3 dB) noted in step 5 to a tolerance of ±0.05 dB.
11. Record the marker frequency readout in column 3 of Table 2-37.
12. Using the analyzer knob, raise the marker frequency so that the marker delta amplitude is maximum. Continue increasing the marker frequency until the marker reads 0.0 dB plus the attenuator error (3 dB) noted in step 5 to a tolerance of ±0.05 dB.
13. Record the marker frequency readout in column 4 of Table 2-37.
14. Set the attenuator to 3 dB.
15. Press **Marker**, **Normal** on the analyzer.
16. Repeat step 6 through step 15 for each of the analyzer Res BW and Analyzer Span settings listed in Table 2-37.
17. Subtract the Lower Marker Frequency from the Upper Marker Frequency. Record the difference as the 3 dB Bandwidth, in the performance verification test record as indicated in Table 2-37.

    3 db Bandwidth = Upper Marker Frequency – Lower Marker Frequency

Table 2-37 3 dB Resolution Bandwidth Accuracy

Column 1	Column 2	Column 3	Column 4	Column 5
Analyzer Res BW	**Analyzer Span**	**Lower Marker Frequency**	**Upper Marker Frequency**	**TR Entry 3 dB Bandwidth**
5 MHz	7.5 MHz			**1)**
3 MHz	4.5 MHz			**2)**
1 MHz	1.5 MHz			**3)**
300 kHz	450 kHz			**4)**
100 kHz	150 kHz			**5)**
30 kHz	45 kHz			**6)**
10 kHz	15 kHz			**7)**
3 kHz	4.5 kHz			**8)**
1 kHz	1.5 kHz			**9)**

6 dB Resolution Bandwidth Accuracy

18. Set the analyzer Res BW to 120 kHz and the analyzer Span to 180 kHz as shown in Table 2-38.
19. On the analyzer, press **Peak Search** (or **Search**), **Meas Tools, Mkr→ CF**.
20. Set the external 1 dB step attenuator to 6 dB and adjust the amplitude of the synthesized signal generator for a marker amplitude reading of –7 dBm ±0.2 dB.
21. Press **Peak Search** (or **Search**), **Marker, Delta** on the analyzer.
22. Set the attenuator to 0 dB.
23. On the analyzer, press **Marker**. Lower the marker frequency by adjusting the knob until the marker delta amplitude is 0 dB plus the attenuator error (6 dB) noted in step 5 to tolerance of ±0.05 dB.
24. Record the marker frequency readout in column 3 of Table 2-38.
25. Using the analyzer knob, raise the marker frequency so that the marker delta amplitude is maximum. Continue increasing the marker frequency until the marker reads 0.0 dB plus the attenuator error (6 dB) noted in step 5 to a tolerance of ± 0.05 dB.
26. Record the marker frequency readout in column 4 of Table 2-38.
27. Set the attenuator to 6 dB.
28. Press **Marker, Normal** on the analyzer.

29. Repeat step 19 through step 28 for each of the Analyzer Res BW and Analyzer Span settings listed in Table 2-38.

30. Subtract the Lower Marker Frequency from the Upper Marker Frequency. Record the difference as the 6 dB bandwidth, in the performance verification test record as indicated in Table 2-38.

    6 dB Bandwidth = Upper Marker Frequency – Lower Marker Frequency

Table 2-38 6 dB Resolution Bandwidth Accuracy

Column 1	Column 2	Column 3	Column 4	Column 5
Analyzer Res BW	**Analyzer Span**	**Lower Marker Frequency**	**Upper Marker Frequency**	**TR Entry 3 dB Bandwidth**
120 kHz	180 kHz			**10)**
9 kHz	13.5 kHz			**11)**

Post-test Instrument Restoration

31. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press System, **Alignments, Auto Align, All**.

21. Frequency Response: Agilent E4401B and E4411B

This test measures the amplitude error of the analyzer as a function of frequency. To measure frequencies of 100 kHz and greater, the output of a signal generator is fed through a power splitter to a power sensor and the analyzer.

To measure frequencies below 100 kHz, a digital voltmeter (DVM) with a 50 Ω load replaces the power sensor and a function generator is used as the source.

For improved amplitude accuracy, the power splitter is characterized using a power sensor (the "reference" sensor) connected to one power splitter output port. The other power splitter output port connects to the "buried" sensor; it is not removed from the power splitter. Once the characterization is done, the reference sensor is removed and replaced by the analyzer.

This procedure does not test frequency response with the optional preamplifier (Option 1DS) turned on. If the analyzer is equipped with Option 1DS, also perform the "Frequency Response, Preamp On" procedure.

The related adjustment for this performance test is "Frequency Response."

Analyzers with 75 Ω inputs are tested down to 1 MHz only.

Equipment Required

Synthesized signal generator
Function generator
Power meter
RF power sensor, (*2 required*)
RF Power splitter
Digital multimeter
Adapter, Type-N (m) to Type-N (m)
Adapter, Type-N (m) to BNC (f)
Dual banana plug to BNC (f)
BNC Tee (BNC f,m,f)
Cable, BNC, 120-cm (48-in) (*2 required*)
Cable, Type-N, 183-cm (72-in)
Termination, 50 Ω, BNC (m)

Additional Equipment for 75 Ω Input

Power sensor, 75 Ω
Adapter, mechanical, Type-N (f) 75 Ω to Type-N (m) 50 Ω
Adapter, Type-N (m) to BNC (m), 75 Ω

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω connectors, or damage to the connectors will occur.


Procedure

Source/Splitter Characterization

1. Refer to Figure 2-23. Connect one of the HP/Agilent 8482A power sensors to Channel A of the power meter. This will be the "reference" sensor. Connect the other HP/Agilent 8482A power sensor to Channel B of the power meter. This will be the "buried" sensor.

   75 Ω Inputs, Option 1DP: Connect the HP/Agilent 8483A power sensor to Channel A of the power meter. This will be the "reference" sensor.

Figure 2-23 Source/Splitter Characterization Setup

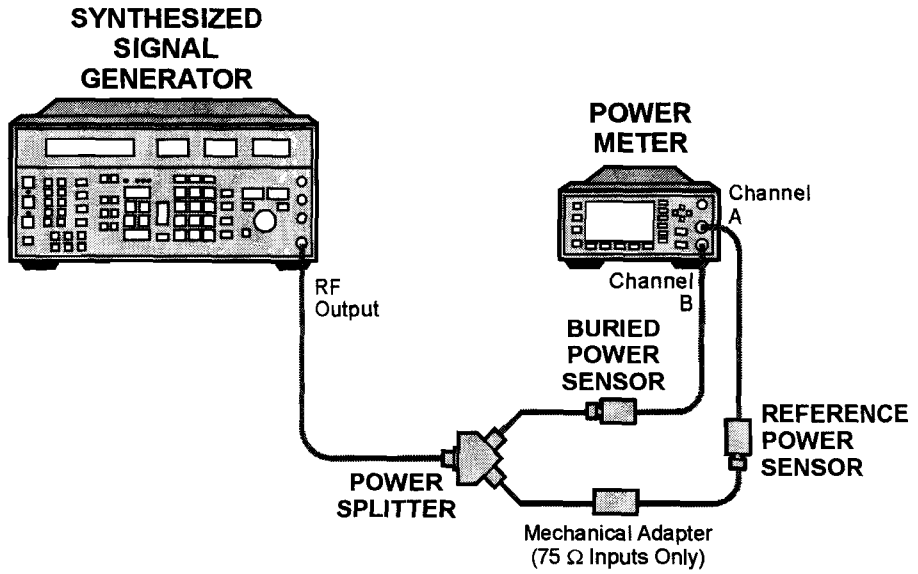

wl768a

2. Zero and calibrate both power sensors.

3. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor for 100 kHz.

   75 Ω Inputs, Option 1DP: Use the calibration factor of the reference sensor for 1 MHz.

4. On the power meter, set the Channel B calibration factor to 100%. Do not change this calibration factor during this test.

5. Connect the equipment as shown in Figure 2-23. Use the synthesized signal generator as the source.

   75 Ω Inputs, Option 1DP: Connect the reference sensor to the power splitter using the mechanical adapter.

6. Set the source frequency to 100 kHz and amplitude to –4 dBm.

   75 Ω Inputs, Option 1DP: Set the source frequency to 1 MHz.

7. Adjust the source amplitude to obtain a Channel A power meter reading of –10 dBm ±0.1 dB.

8. Record the source amplitude setting, and both the Channel A and Channel B power meter readings in Table 2-39.

9. Tune the source to the next frequency in Table 2-39.

10. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor for the current source frequency.

11. Adjust the source amplitude to obtain a Channel A power meter reading of –10 dBm ±0.1 dB.

12. Record the source amplitude setting, and both the Channel A and Channel B power meter readings in Table 2-39.

13. Repeat step 9 through step 12 for each frequency in Table 2-39.

14. For each entry in Table 2-39, calculate the Splitter Tracking Error as follows:

    Splitter Tracking Error = Channel A Power – Channel B Power

    For example, if Channel A Power is –10.05 dBm and Channel B Power is –10.23 dBm, the Splitter Tracking Error is 0.18 dB.

Table 2-39 Source/Splitter Characterization


Frequency	Power Meter Reading		Splitter Tracking Error	Source Power Setting
	Channel A	Channel B		
100 kHz[a]				
500 kHz[a]				
1 MHz				
5 MHz				
10 MHz				
20 MHz				
50 MHz				
75 MHz				
175 MHz				
275 MHz				
375 MHz				
475 MHz				
575 MHz				
675 MHz				
775 MHz				
825 MHz				
875 MHz				
925 MHz				
975 MHz				
1025 MHz				
1075 MHz				
1175 MHz				
1275 MHz				
1375 MHz				
1500 MHz				

a. These values do not apply to analyzers with 75 Ω inputs (Option 1DP).

Measuring Frequency Response, 100 kHz to 1.5 GHz

1. Refer to Figure 2-24. Remove the reference sensor (Channel A sensor) from the power splitter. Connect the power splitter to the analyzer 50 Ω Input using an adapter. Do not use a cable.

Figure 2-24 Frequency Response Test Setup, 100 kHz to 1.5 GHz

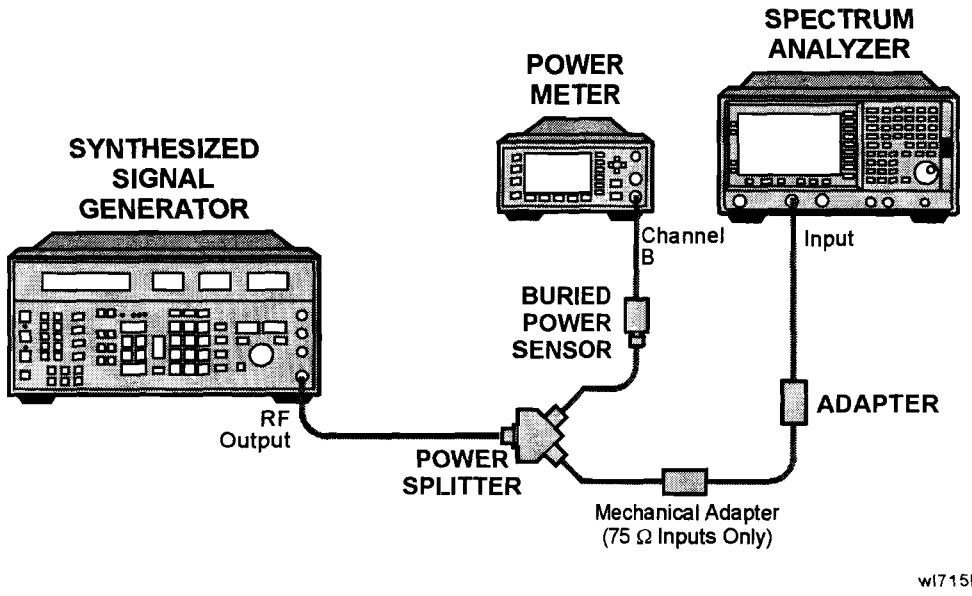

75 Ω inputs, Option 1DP: Connect the power splitter to the analyzer 75 Ω Input using a mechanical adapter and a 75 Ω, Type-N(m) to BNC(m) adapter.

2. Set the source frequency to 100 kHz:

   75 Ω inputs, Option 1DP: Set the source frequency to 1 MHz.

3. Set the source amplitude to the value corresponding to the source power setting in Table 2-40 for the current source frequency (100 kHz or 1 MHz).

4. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

   FREQUENCY, Center Freq, 100 kHz (*50 Ω Input*)
   FREQUENCY, Center Freq, 1 MHz (*75 Ω Input*)
   CF Step, 100 MHz
   SPAN, 20 kHz
   AMPLITUDE, More, Int Preamp (Off) (*Option 1DS only*)
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
   AMPLITUDE, Ref Level, –5 dBm
   Attenuation, 10 dB (Man)
   Scale/Div, 1 dB
   BW/Avg, Resolution BW, 3 kHz (Man)

Video BW, 3 kHz (Man)

5. Adjust the source AMPLITUDE to obtain the Channel B power meter reading recorded in Table 2-39 ±0.1 dB.
6. Record the current Channel B power reading in Table 2-40 as the Current Channel B reading.
7. On the analyzer, press **Single** then **Peak Search** (or **Search**).
8. Record the Mkr1 amplitude reading in Table 2-40.
9. Set the source to the next frequency listed in Table 2-40.
10. Set the analyzer center frequency to the next frequency listed in Table 2-40.
11. Adjust the source AMPLITUDE to obtain the Channel B power meter reading recorded in Table 2-39 ±0.1 dB for the current frequency.
12. Record the current Channel B power meter reading in Table 2-40 as the Current Channel B Reading.
13. On the analyzer, press **Single** then **Peak Search** (or **Search**).
14. Record the Mkr1 amplitude reading in Table 2-40.
15. Repeat step 9 through step 14 for each frequency in Table 2-40.
16. Copy the splitter tracking errors from Table 2-39 into Table 2-40.
17. Calculate the Flatness Error for each frequency in Table 2-40 as follows:

Flatness Error = Mkr1 Amptd – Current Channel B – Splitter Tracking Error

For example, if Mkr1 Amptd is –10.32 dBm, Current Channel B is –10.2 and Splitter Tracking Error is 0.18 dB, Flatness Error would be –0.30 dB.

18. Record the Flatness Error for 50 MHz below as the 50 MHz Ref Amptd:

    50 MHz Ref Amptd _____

19. Calculate the Flatness Relative to 50 MHz for each frequency in Table 2-40 as follows:

    Flatness Relative to 50 MHz = Flatness Error – 50 MHz Ref Amptd

    For example, if Flatness Error is –0.30 dB and 50 MHz Ref Amptd is 0.15 dB, Flatness Relative to 50 MHz would be –0.45 dB.

Table 2-40 Frequency Response Worksheet, 100 kHz to 1.5 GHz

Frequency	Current Channel B Reading	Mkr1 Amptd	Splitter Tracking Error	Flatness Error	Flatness Relative to 50 MHz
100 kHz[a]					
500 kHz[a]					
1 MHz					
5 MHz					
10 MHz					
20 MHz					
50 MHz					
75 MHz					
175 MHz					
275 MHz					
375 MHz					
475 MHz					
575 MHz					
675 MHz					
775 MHz					
825 MHz					
875 MHz					
925 MHz					
975 MHz					
1025 MHz					
1075 MHz					
1175 MHz					
1275 MHz					
1375 MHz					
1500 MHz					


a. These values do not apply to analyzers with 75 Ω inputs (Option 1DP).

Measuring Frequency Response, ≤100 kHz

If the analyzer has Option 1DP, skip to the Test Results section.

1. Connect the equipment as shown in Figure 2-25.

Figure 2-25 Frequency Response Test Setup, ≤100 kHz

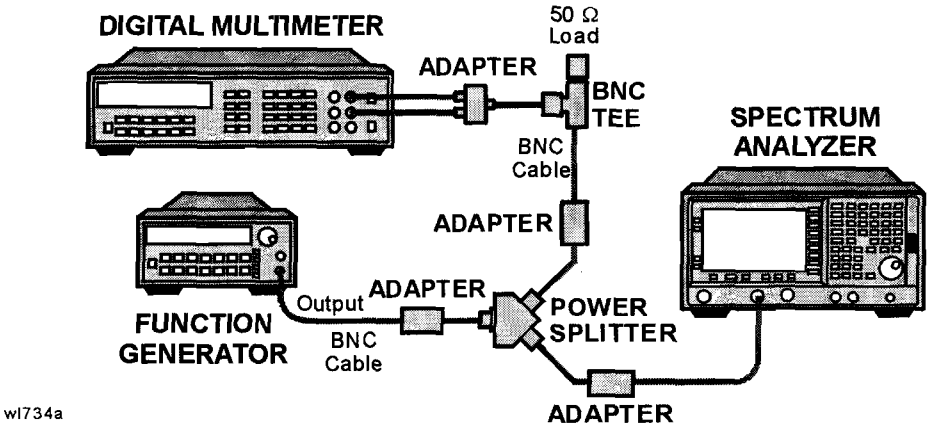

2. Set the function generator controls as follows:

   FREQUENCY, 100 kHz
   AMPLITUDE, –4 dBm

3. Set the DVM as follows:

Function	Synchronous ac Volts
Math	dBm
RES Register	50 Ω
Front/Rear Terminals	Front
Range	Auto

4. On the analyzer, press **FREQUENCY, 100 kHz.**
5. Adjust the function generator amplitude until the DVM reading is –10 dBm ±0.1 dB.
6. Record the actual DVM reading in Table 2-41 as the DVM amplitude reading.
7. On the analyzer, press **Peak Search** (or **Search**), **Marker, Delta.**
8. Set the analyzer center frequency to the next frequency listed in Table 2-41.

9. Set the function generator frequency to the next frequency listed in Table 2-41.
10. On the analyzer, press **Peak Search** (or **Search**).
11. Adjust the function generator amplitude until the ΔMkr1 amplitude reads 0 dB ±0.05 dB.
12. Record the DVM reading in Table 2-41 as the DVM amplitude reading.
13. Repeat step 8 through step 12 for each frequency in Table 2-41.
14. For each of the frequencies in Table 2-41, subtract the DVM amplitude from the DVM Amplitude at 100 kHz recorded in step 6. Record the result as the Response Relative to 100 kHz in Table 2-41.
15. From Table 2-40, note the Flatness Relative to 50 MHz for the 100 kHz frequency. Record this below as the 100 kHz error relative to 50 MHz:

    100 kHz Error Relative to 50 MHz _____ dB
16. Add the 100 kHz error relative to 50 MHz that was recorded in step 15 above to each of the Response Relative to 100 kHz entries in Table 2-41. Record the results as the Response Relative to 50 MHz in Table 2-41.

Table 2-41 Frequency Response Worksheet, ≤100 kHz

Frequency	DVM Amplitude	Response Relative to 100 kHz	Response Relative to 50 MHz
100 kHz		0 dB (Ref)	
75 kHz			
50 kHz			
20 kHz			
9 kHz			

Test Results

1. Enter the most positive number from the Flatness Relative to 50 MHz column of Table 2-40:

   _____ dB
2. Enter the most positive number from the Response Relative to 50 MHz column of Table 2-41:

   _____ dB

   75 Ω inputs, Option 1DP: The frequency range below 100 kHz was not tested; no entry from Table 2-41 is necessary.

3. Record the more positive of numbers from step 1 and step 2 in Table 2-42 as the Maximum Response for Band 0.
4. Enter the most negative number from the Flatness Relative to 50 MHz column of Table 2-40:

   _____ dB
5. Enter the most negative number from the Response Relative to 50 MHz column of Table 2-41:

   _____ dB

   75 Ω inputs, Option 1DP: The frequency range below 100 kHz was not tested; no entry from Table 2-41 is necessary.
6. Record the more negative of numbers from step 4 and step 5 in Table 2-42 as the Minimum Response for Band 0.
7. Subtract the Minimum Response for Band 0 from the Maximum Response for Band 0 and record the result as the Peak-to-Peak Response for Band 0 in Table 2-42.

Table 2-42 Frequency Response Results

Band	Maximum Response		Minimum Response		Peak-to-Peak Response	
	dB	Test Record Entry	dB	Test Record Entry	dB	Test Record Entry
0		1		2		3

22. Frequency Response, Agilent E4402B and E4403B

This test measures the amplitude error of the analyzer as a function of frequency. To measure frequencies of 100 kHz and greater, the output of a source is fed through a power splitter to a power sensor and the analyzer. A function generator is used as the source from 100 kHz to 10 MHz, and a synthesized sweeper at 10 MHz and greater. To measure frequencies below 100 kHz, a DVM with a 50Ω load replaces the power sensor.

For improved amplitude accuracy the power splitter is characterized using a "reference" sensor connected to one power splitter output port. The other power splitter output port connects to the "buried" sensor; it is not removed from the power splitter. Once the characterization is done, the reference sensor is removed and replaced by the analyzer. Measurements are made at the same frequencies used in the characterization. The analyzer marker amplitude measurements are corrected using the characterization data to determine the absolute flatness error and the flatness error relative to 50 MHz.

This procedure does not test frequency response with the optional preamplifier (Option 1DS) turned on. If the analyzer is equipped with Option 1DS, also perform the "Frequency Response, Preamp On" procedure. Analyzers with Option UKB are tested down to 100 Hz in dc coupled mode.

The related adjustment for this performance test is "Frequency Response."

Equipment Required


Synthesized sweeper
Function generator
Power meter
RF power sensor (*2 required*)
RF Power splitter
Digital multimeter
Adapter, Type-N (m) to Type-N (m)
Adapter, Type-N (m) to BNC (f)
Dual banana plug to BNC (f)
BNC Tee (BNC f,m,f)
Cable, BNC, 122-cm (48-in) (*2 required*)
Cable, Type-N, 183-cm (72-in)
Termination, 50 Ω, BNC (m)

Procedure

Source/Splitter Characterization

1. Refer to Figure 2-26. Connect one of the HP/Agilent 8482A power sensors to Channel A of the power meter. This will be the "reference" sensor. Connect the other HP/Agilent 8482A power sensor to Channel B of the power meter. This will be the "buried" sensor.

Figure 2-26 Source/Splitter Characterization Setup

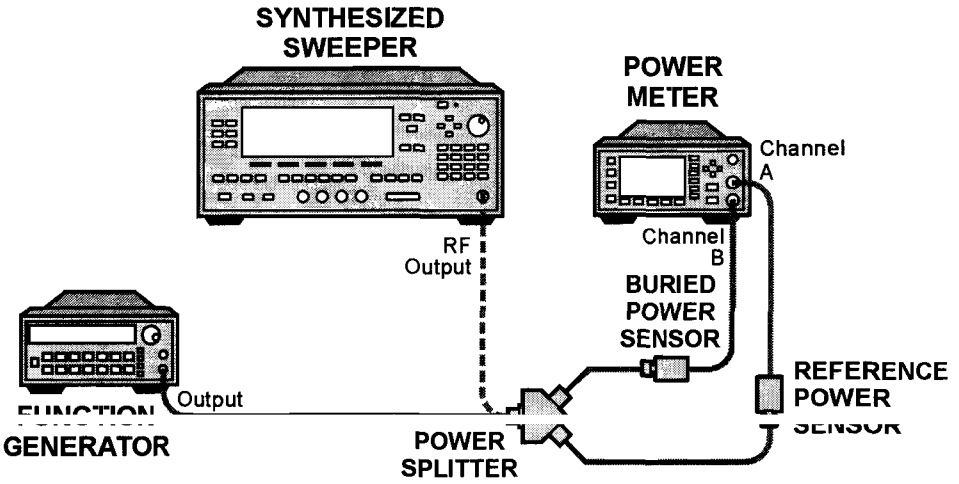

wl713b

2. Zero and calibrate both power sensors.
3. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor for 100 kHz.
4. On the power meter, set the Channel B calibration factor to 100%. Do not change this calibration factor during this test.
5. Connect the equipment as shown in Figure 2-26. Use the function generator as the source.
6. Set the function generator frequency to 100 kHz and amplitude to –4 dBm.
7. Adjust the function generator amplitude to obtain a Channel A power meter reading of –10 dBm ±0.1 dB.
8. Record the function generator amplitude setting, and both the Channel A and Channel B power meter readings in Table 2-43.
9. Tune the source to the next frequency in Table 2-43.
10. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor for the current source

frequency.

11. Adjust the source amplitude to obtain a Channel A power meter reading of –10 dBm ±0.1 dB.

12. Record the source amplitude setting, and both the Channel A and Channel B power meter readings in Table 2-43.

13. Repeat step 9 through step 12 for frequencies up through 10 MHz.

14. Replace the function generator with the synthesized sweeper.

15. Set the synthesized sweeper CW frequency to 10 MHz and the amplitude to –4 dBm.

16. Adjust the synthesized sweeper power level to obtain a Channel A power meter reading of –10 dBm ±0.1 dB.

17. Record the synthesized sweeper power level and both the Channel A and Channel B power meter readings in Table 2-43.

18. Repeat step 9 through step 12 for each remaining frequency in Table 2-43.

19. For each entry in Table 2-43, calculate the Splitter Tracking Error as follows:

    Splitter Tracking Error = Channel A Power – Channel B Power

    For example, if Channel A Power is –10.05 dBm and Channel B Power is –10.23 dBm, the Splitter Tracking Error is 0.18 dB.

Table 2-43 Source/Splitter Characterization

Frequency	Power Meter Reading		Splitter Tracking Error	Source Power Setting
	Channel A	Channel B		
100 kHz				
500 kHz				
1 MHz				
5 MHz				
10 MHz[a]				
10 MHz[b]				
20 MHz				0 dB (Ref)
50 MHz				
75 MHz				
175 MHz				
275 MHz				

Table 2-43 Source/Splitter Characterization

Frequency	Power Meter Reading		Splitter Tracking Error	Source Power Setting
	Channel A	Channel B		
375 MHz				
475 MHz				
575 MHz				
675 MHz				
775 MHz				
825 MHz				
875 MHz				
925 MHz				
975 MHz				
1025 MHz				
1075 MHz				
1175 MHz				
1275 MHz				
1375 MHz				
1500 MHz				
1525 MHz				
1625 MHz				
1675 MHz				
1725 MHz				
1775 MHz				
1825 MHz				
1875 MHz				
1925 MHz				
1975 MHz				
2025 MHz				
2125 MHz				
2325 MHz				
2525 MHz				

Table 2-43 Source/Splitter Characterization


Frequency	Power Meter Reading		Splitter Tracking Error	Source Power Setting
	Channel A	Channel B		
2725 MHz				
2925 MHz				
2999 MHz				

a. This entry is for data taken with the function generator as source.
b. This entry is for data taken with the synthesized sweeper as source.

Measuring Frequency Response, 100 kHz to 3.0 GHz

1. Refer to Figure 2-27. Remove the reference sensor (Channel A sensor) from the power splitter. Connect the power splitter to the 50 Ω Input of the analyzer using an adapter. Do not use a cable.

Figure 2-27 Frequency Response Test Setup, 100 kHz to 3.0 GHz

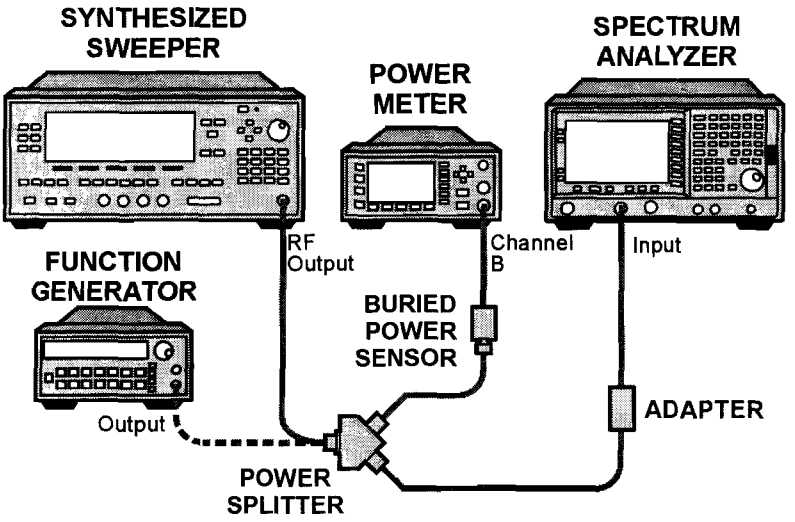

2. Set the source frequency to 10 MHz.
3. Set the source power level to the value corresponding to the source power setting in Table 2-43 for the current source frequency (10 MHz).
4. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

   FREQUENCY, Center Freq, 10 MHz
   CF Step, 100 MHz
   SPAN, 20 kHz
   Input/Output (or Input), Coupling (DC) *(Option UKB only)*
   AMPLITUDE, More, Int Preamp, (Off) (*Option 1DS only*)
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
   AMPLITUDE, Ref Level, –5 dBm
   Attenuation, 10 dB (Man)
   Scale/Div, 1 dB
   BW/Avg, Resolution BW, 3 kHz (Man)
   Video BW, 3 kHz (Man)

5. Adjust the source power level to obtain the Channel B power meter reading recorded in Table 2-43 ±0.1 dB.

6. Record the current Channel B power reading in Table 2-44 as the Current Channel B Reading for dc (coupling).
7. On the analyzer, press **Single** then **Peak Search** (or **Search**).
8. Record the Mkr1 amplitude reading in Table 2-44 for dc (coupling).
9. Set the source to the next frequency listed in Table 2-44.
10. Set the analyzer center frequency to the next frequency listed in Table 2-44.
11. Adjust the source power level to obtain the Channel B power meter reading recorded in Table 2-44 ±0.1 dB for the current frequency.
12. Record the current Channel B power reading in Table 2-44 as the current Channel B reading.
13. On the analyzer, press **Single** then **Peak Search** (or **Search**).
14. Record the Mkr1 amplitude reading in Table 2-44.
15. Repeat step 9 through step 14 for each remaining frequency in Table 2-44.
16. Replace the synthesized sweeper with the function generator.
17. Set the function generator amplitude to –4 dBm.
18. Set the function generator frequency to 100 kHz.
19. On the analyzer, press **FREQUENCY, Center Freq, 100 kHz**.
20. Adjust the function generator amplitude to obtain the Channel B power meter reading recorded in Table 2-43 ±0.1 dB for 100 kHz.
21. Record the current Channel B power reading in Table 2-44 as the current Channel B reading.
22. On the analyzer, press **Single** then **Peak Search** (or **Search**).
23. Record the analyzer Mkr1 Amplitude Reading in Table 2-44 as Mkr1 Amplitude.
24. Repeat step 18 through step 23 for frequencies between 100 kHz and 10 MHz.
25. Copy the Splitter Tracking Errors from Table 2-43 into Table 2-44.
26. Calculate the Flatness Error for each frequency in Table 2-44 as follows:

Flatness Error = Mkr1 Amptd – Current Channel B – Splitter Tracking Error

For example, if Mkr1 Amptd is –10.32 dBm, Current Channel B is –10.2 and Splitter Tracking Error is 0.18 dB, Flatness Error would be –0.30 dB.

27. Record the Flatness Error for 50 MHz below as the 50 MHz Ref Amptd:

    50 MHz Ref Amptd: _____

28. Calculate the setup change error (error due to changing the test setup from using a synthesized sweeper to using a function generator) as follows:

    a. Record the Flatness Error from Table 2-44 at 10 MHz using the function generator as FlatError_{FG}:

       FlatError_{FG}=_____ dB

    b. Record the Flatness Error from Table 2-44 at 10 MHz using the synthesized sweeper as FlatError_{SS}:

       FlatError_{SS}=_____ dB

    c. Subtract FlatError_{SS} from FlatError_{FG} and record the result as the Setup Change Error:

       $$\text{Setup Change Error} = \text{FlatError}_{FG} - \text{FlatError}_{SS}$$

       Setup Change Error =_____ dB

29. For frequencies less than 10 MHz calculate the Flatness Relative to 50 MHz for each frequency in Table 2-44 as follows:

Flatness Relative to 50 MHz = Flatness Error – 50 MHz Ref Amptd – Setup Change Error

For example, if Flatness Error is –0.30 dB, 50 MHz Ref Amptd is 0.15 dB and Setup Change Error is –0.19 dB, Flatness Relative to 50 MHz would be –0.26 dB.

30. For frequencies 10 MHz and greater, calculate the Flatness Relative to 50 MHz for each frequency in Table 2-44 as follows:

Flatness Relative to 50 MHz = Flatness Error – 50 MHz Ref Amptd

For example, if Flatness Error is –0.30 dB and 50 MHz Ref Amptd is 0.15 dB, Flatness Relative to 50 MHz would be –0.45 dB.

31. If the analyzer has Option UKB, continue with this procedure. Otherwise, perform the procedure in "Measuring Frequency Response, £100 kHz."

32. Replace the function generator with the synthesized sweeper.

33. Set the source frequency to 10 MHz and the source power level to the value corresponding to the source power setting in Table 2-43 for the current source frequency (10 MHz).

34.On the analyzer, press **Input/Output** (or **Input**), **Coupling** (AC).

35.Repeat step 5 through step 30 for ac coupling.

36. Perform the procedure in "Measuring Frequency Response, £100 kHz."

Table 2-44 Frequency Response Worksheet, 100 kHz to 3.0 GHz

Freq. (MHz)	Splitter Tracking Error	Current Channel B Reading		Mkr1 Amptd		Flatness Error		Flatness Relative to 50 MHz	
		dc	ac	dc	ac	dc	ac	dc	ac
0.1									
0.5									
1									
5									
10[a]									
10[b]									
20									
50								0 dB (ref)	0 dB (ref)
75									
175									
275									
375									
475									
575									
675									
775									
825									
875									
925									
975									
1025									
1075									
1175									
1275									
1375									
1500									

Table 2-44 Frequency Response Worksheet, 100 kHz to 3.0 GHz


Freq. (MHz)	Splitter Tracking Error	Current Channel B Reading		Mkr1 Amptd		Flatness Error		Flatness Relative to 50 MHz	
		dc	ac	dc	ac	dc	ac	dc	ac
1525									
1625									
1675									
1725									
1775									
1825									
1875									
1925									
1975									
2025									
2125									
2325									
2525									
2725									
2925									
2999									

a. This entry is for data taken with the function generator as source.
b. This entry is for data taken with the synthesized sweeper as source.

Measuring Frequency Response, ≤100 kHz

1. Connect the equipment as shown in Figure 2-28.

Figure 2-28 Frequency Response Test Setup, ≤100 kHz

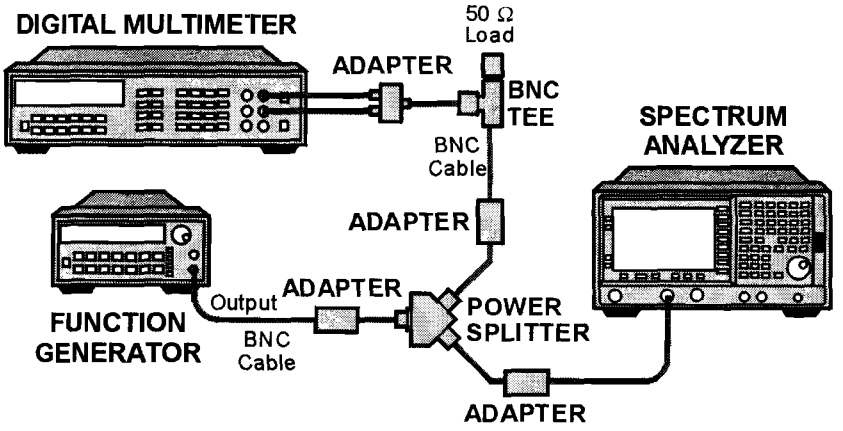

2. Set the function generator controls as follows:

   FREQUENCY, 100 kHz
   AMPLITUDE, –4 dBm
   Amptd Increment, 0.05 dB

3. Set the DVM as follows:

Function	Synchronous AC Volts
Math	dBm
RES Register	50 Ω
Front/Rear Terminals	Front
Range	Auto

4. On the analyzer, press **FREQUENCY, 100 kHz.**
5. If the analyzer has Option UKB, press **Input/Output** (or **Input**), **Coupling** (DC). Then press **SPAN, 100 Hz, BW/Avg, Resolution BW, 10 Hz, Video BW, 10 Hz.**
6. Adjust the function generator amplitude until the DVM reading is –10 dBm ±0.1 dB.
7. Record the actual DVM reading in Table 2-45 as the DVM Amplitude reading.
8. On the analyzer, press **Peak Search** (or **Search**), **Marker, Delta.**
9. Set the analyzer center frequency to the next frequency listed in Table 2-45.

10. Set the function generator frequency to the next frequency listed in Table 2-45. Frequencies less than 9 kHz only apply to analyzers with Option UKB.
11. On the analyzer, press **Peak Search** (or **Search**).
12. Adjust the function generator amplitude until the ΔMkr1 amplitude reads 0 dB ±0.05 dB.
13. Record the DVM reading in Table 2-45 as the DVM Amplitude reading.
14. Repeat step 9 through step 13 for each frequency setting listed in Table 2-45.
15. For each of the frequencies in Table 2-45, subtract the DVM Amplitude from the DVM Amplitude at 100 kHz recorded in step 7. Record the result as the Response Relative to 100 kHz in Table 2-45.
16. From Table 2-44, note the Flatness Relative to 50 MHz for the 100 kHz frequency. Record this below as the 100 kHz Error Relative to 50 MHz:

    100 kHz Error Relative to 50 MHz =_____ dB
17. Add the 100 kHz Error Relative to 50 MHz that was recorded in step 16 above to each of the Response Relative to 100 kHz entries in Table 2-45. Record the results as the Response Relative to 50 MHz in Table 2-45.

Table 2-45 Frequency Response Worksheet, ≤100 kHz

Frequency	DVM Amplitude	Response Relative to 100 kHz	Response Relative to 50 MHz
100 kHz		0 dB (Ref)	
75 kHz			
50 kHz			
20 kHz			
9 kHz			
5 kHz[a]			
2 kHz[a]			
1 kHz[a]			
500 Hz[a]			
200 Hz[a]			
100 Hz[a]			

a. These frequencies apply only to analyzers with Option UKB.

Test Results

Perform the following steps to verify the frequency response of the analyzer.

1. Enter the most positive number from the Flatness Relative to 50 MHz (dc) column of Table 2-44:

   _____ dB

2. Enter the most positive number from the Response Relative to 50 MHz column of Table 2-45:

   _____ dB

3. Record the most positive of numbers from step 1 and step 2 in Table 2-46 as the Maximum Response for Band 0.

4. Enter the most negative number from the Flatness Relative to 50 MHz (dc) column of Table 2-44:

   _____ dB

5. Enter the most negative number from the Response Relative to 50 MHz column of Table 2-45:

   _____ dB

6. Record the most negative of numbers from step 4 and step 5 in Table 2-46 as the Minimum Response for Band 0.

7. For Band 0 in Table 2-46, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

8. If the analyzer is an ESA E4403B or an ESA E4402B with a serial number less than US39441006 then transfer the values in Table 2-46 into the test record in this guide. The frequency response test is complete for those instruments only.

9. If the analyzer has Option UKB then perform step 18 through step 27. Otherwise, perform step 10 through step 16.

10. Note the most positive number from the Flatness Relative to 50 MHz (dc) column of Table 2-44 for frequencies between 800 MHz and 1.0 GHz. Record this number in Table 2-46 as the Maximum Response for Band 0A.

11. Note the most negative number from the Flatness Relative to 50 MHz (dc) column of Table 2-44 for frequencies between 800 MHz and 1.0 GHz. Record this number in Table 2-46 as the Minimum Response for Band 0A.

12. For Band 0A in Table 2-46, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

13. Note the most positive number from the Flatness Relative to 50 MHz (dc) column of Table 2-44 for frequencies between 1.7 GHz and 2.0 GHz. Record this number in Table 2-46 as the Maximum Response for Band 0B.

14. Note the most negative number from the Flatness Relative to 50 MHz (dc) column of Table 2-44 for frequencies between 1.7 GHz and 2.0 GHz. Record this number in Table 2-46 as the Minimum Response for Band 0B.

15. For Band 0B in Table 2-46, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

16. Transfer the values entered in Table 2-46 to the test record in this guide.

17. The frequency response test for analyzers without Option UKB is now complete. The following steps apply only to analyzers having Option UKB.

18. Record the most positive number from the Flatness Relative to 50 MHz (ac) column of Table 2-44 as the Maximum Response for Band 0 in Table 2-47.

19. Record the most negative number from the Flatness Relative to 50 MHz (ac) column of Table 2-44 as the Minimum Response for Band 0 in Table 2-47.

20. For Band 0 in Table 2-47, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

21. Note the most positive number from the Flatness Relative to 50 MHz (ac) column of Table 2-44 for frequencies between 800 MHz and 1.0 GHz. Record this number in Table 2-47 as the Maximum Response for Band 0A.

22. Note the most negative number from the Flatness Relative to 50 MHz (ac) column of Table 2-44 for frequencies between 800 MHz and 1.0 GHz. Record this number in Table 2-47 as the Minimum Response for Band 0A.

23. For Band 0A in Table 2-47, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

24. Note the most positive number from the Flatness Relative to 50 MHz (ac) column of Table 2-44 for frequencies between 1.7 GHz and 2.0 GHz. Record this number in Table 2-47 as the Maximum Response for Band 0B.

25. Note the most negative number from the Flatness Relative to 50 MHz (ac) column of Table 2-44 for frequencies between 1.7 GHz and 2.0 GHz. Record this number in Table 2-47 as the Minimum Response for Band 0B.

26. For Band 0B in Table 2-47, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

27. Transfer the values entered in Table 2-47 to the test record in this guide.

28. The frequency response test for analyzers with Option UKB is now complete.

Table 2-46 Frequency Response Results, dc Coupled

Band	Maximum Response		Minimum Response		Peak-to-Peak Response	
	dB	Test Record Entry	dB	Test Record Entry	dB	Test Record Entry
0		1		2		3
0A		4		5		6
0B		7		8		9

Table 2-47 Frequency Response Results, ac Coupled

Band	Maximum Response		Minimum Response		Peak-to-Peak Response	
	dB	Test Record Entry	dB	Test Record Entry	dB	Test Record Entry
0		10		11		12
0A		13		14		15
0B		16		17		18

23. Frequency Response, Agilent E4404B, E4405B, E4407B, and E4408B

This test measures the amplitude error of the analyzer as a function of frequency. To measure frequencies of 100 kHz and greater, the output of a source is fed through a power splitter to a power sensor and the analyzer. A function generator is used as the source from 100 kHz to 10 MHz, and a synthesized sweeper at 10 MHz and greater. To measure frequencies below 100 kHz, a DVM with a 50Ω load replaces the power sensor.

For improved amplitude accuracy the power splitter is characterized using a "reference" sensor connected to one power splitter output port. The other power splitter output port connects to the "buried" sensor; it is not removed from the power splitter. Once the characterization is done, the reference sensor is removed and replaced by the analyzer. Measurements are made at the same frequencies used in the characterization. The analyzer marker amplitude measurements are corrected using the characterization data to determine the absolute flatness error and the flatness error relative to 50 MHz.

To measure frequencies greater than 3 GHz, the source power level is adjusted at 50 MHz to place the displayed signal at the ESA center horizontal graticule line. The power meter is then set to measure dB relative to the power at 50 MHz. At each new source frequency and ESA center frequency, the source power level is adjusted to place the signal at the center horizontal graticule line. The power meter displays the inverse of the frequency response relative to 50 MHz.

This procedure does not test frequency response with the optional preamplifier (Option 1DS) turned on. If the analyzer is equipped with Option 1DS, also perform the "Frequency Response, Preamp On" procedure. Analyzers with Option UKB are tested down to 100 Hz in dc coupled mode.

The related adjustment for this performance test is "Frequency Response."

Equipment Required

Synthesized sweeper
Function generator
Power meter
RF Power sensor (*2 required*)
Microwave power sensor
Microwave power splitter
Digital multimeter
Adapter, APC 3.5 (f) to APC 3.5 (f)
Adapter, Type-N (m) to Type-N (m)


Adapter, Type-N (m) to BNC (f)
Dual banana plug to BNC (f)
BNC Tee (BNC f,m,f)
Cable, BNC, 122-cm (48-in) (*2 required*)
Cable, APC 3.5
Termination, 50 Ω, BNC (m)

Procedure

Source/Splitter Characterization

1. Refer to Figure 2-29. Connect one of the HP/Agilent 8482A power sensors to Channel A of the power meter. This will be the "reference" sensor. Connect the other HP/Agilent 8482A power sensor to Channel B of the power meter. This will be the "buried" sensor.

Figure 2-29 Source/Splitter Characterization Setup

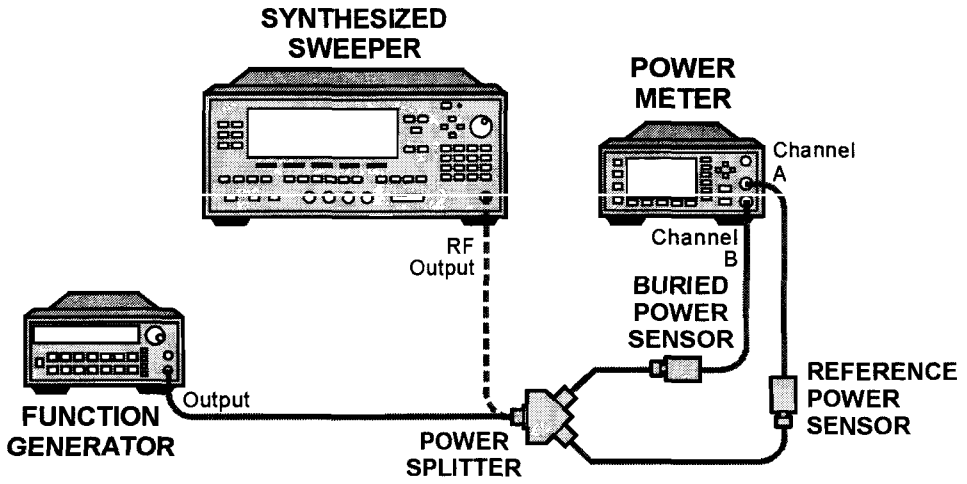

wl713b

2. Zero and calibrate both power sensors.
3. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor for 100 kHz.
4. On the power meter, set the Channel B calibration factor to 100%. Do not change this calibration factor during this test.
5. Connect the equipment as shown in Figure 2-29. Use the function generator as the source.
6. Set the function generator frequency to 100 kHz and amplitude to –4 dBm.
7. Adjust the function generator amplitude to obtain a Channel A power meter reading of –10 dBm ±0.1 dB.

8. Record the function generator amplitude setting, and both the Channel A and Channel B power meter readings in Table 2-48.
9. Tune the source to the next frequency in Table 2-48.
10. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor for the current source frequency.
11. Adjust the source amplitude to obtain a Channel A power meter reading of –10 dBm ±0.1 dB.
12. Record the source amplitude setting, and both the Channel A and Channel B power meter readings in Table 2-48.
13. Repeat step 9 through step 12 for frequencies up through 10 MHz.
14. Replace the function generator with the synthesized sweeper.
15. Set the synthesized sweeper CW frequency to 10 MHz and the amplitude to –4 dBm.
16. Adjust the synthesized sweeper power level to obtain a Channel A power meter reading of –10 dBm ±0.1 dB.
17. Record the synthesized sweeper power level and both the Channel A and Channel B power meter readings in Table 2-48.
18. Repeat step 9 through step 9 for each remaining frequency in Table 2-48.
19. For each entry in Table 2-48, calculate the Splitter Tracking Error as follows:

    Splitter Tracking Error = Channel A Power – Channel B Power

    For example, if Channel A Power is –10.05 dBm and Channel B Power is –10.23 dBm, the Splitter Tracking Error is 0.18 dB.

Table 2-48 Source/Splitter Characterization

Frequency	Power Meter Reading		Splitter Tracking Error	Source Power Setting
	Channel A	Channel B		
100 kHz				
500 kHz				
1 MHz				
5 MHz				
10 MHz[a]				
10 MHz[b]				
20 MHz				0 dB (Ref)

Table 2-48 Source/Splitter Characterization

Frequency	Power Meter Reading		Splitter Tracking Error	Source Power Setting
	Channel A	Channel B		
50 MHz				
75 MHz				
175 MHz				
275 MHz				
375 MHz				
475 MHz				
575 MHz				
675 MHz				
775 MHz				
825 MHz				
875 MHz				
925 MHz				
975 MHz				
1025 MHz				
1075 MHz				
1175 MHz				
1275 MHz				
1375 MHz				
1500 MHz				
1525 MHz				
1625 MHz				
1675 MHz				
1725 MHz				
1775 MHz				
1825 MHz				
1875 MHz				
1925 MHz				
1975 MHz				

Table 2-48 Source/Splitter Characterization


Frequency	Power Meter Reading		Splitter Tracking Error	Source Power Setting
	Channel A	Channel B		
2025 MHz				
2125 MHz				
2325 MHz				
2525 MHz				
2725 MHz				
2925 MHz				
2999 MHz				

a. This entry is for data taken with the function generator as source.
b. This entry is for data taken with the synthesized sweeper as source.

Measuring Frequency Response, 100 kHz to 3.0 GHz

1. Refer to Figure 2-30. Remove the reference sensor (Channel A sensor) from the power splitter. Connect the power splitter to the 50 Ω Input of the analyzer using an adapter. Do not use a cable.

Figure 2-30 Frequency Response Test Setup, 100 kHz to 3.0 GHz

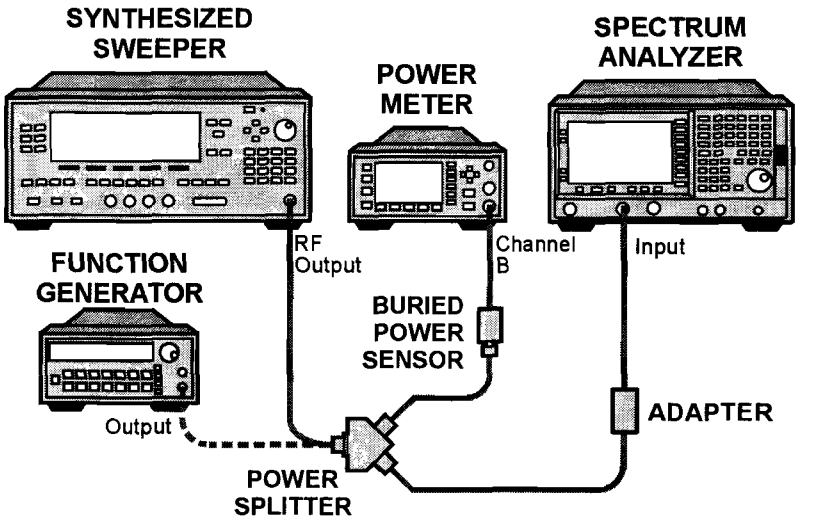

2. Set the source frequency to 10 MHz.
3. Set the source power level to the value corresponding to the source power setting in Table 2-48 for the current source frequency (10 MHz).
4. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

   FREQUENCY, Center Freq, 10 MHz
   CF Step, 100 MHz
   SPAN, 20 kHz
   Input/Output (or Input), Coupling (DC) *(ESA E4404B or E4405B only)*
   AMPLITUDE, More, Int Preamp, (Off) (*Option 1DS only*)
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
   AMPLITUDE, Ref Level, –5 dBm
   Attenuation, 10 dB (Man)
   Scale/Div, 1 dB
   BW/Avg, Resolution BW, 3 kHz (Man)
   Video BW, 3 kHz (Man)

5. Adjust the source power level to obtain the Channel B power meter reading recorded in Table 2-48 ±0.1 dB.

6. Record the current Channel B power reading in Table 2-49 as the Current Channel B Reading for dc (coupling).
7. On the analyzer, press **Single** then **Peak Search** (or **Search**).
8. Record the Mkr1 amplitude reading in Table 2-49 for dc (coupling).
9. Set the source to the next frequency listed in Table 2-49.
10. Set the analyzer center frequency to the next frequency listed in Table 2-49.
11. Adjust the source power level to obtain the Channel B power meter reading recorded in Table 2-48 ±0.1 dB for the current frequency.
12. Record the current Channel B power reading in Table 2-49 as the current Channel B reading.
13. On the analyzer, press **Single** then **Peak Search** (or **Search**).
14. Record the Mkr1 amplitude reading in Table 2-49.
15. Repeat step 9 through step 14 for each remaining frequency in Table 2-49.
16. Replace the synthesized sweeper with the function generator.
17. Set the function generator amplitude to –4 dBm.
18. Set the function generator frequency to 100 kHz.
19. On the analyzer, press **FREQUENCY, Center Freq, 100 kHz.**
20. Adjust the function generator amplitude to obtain the Channel B power meter reading recorded in Table 2-48 ±0.1 dB for 100 kHz.
21. Record the current Channel B power reading in Table 2-49 as the current Channel B reading.
22. On the analyzer, press **Single** then **Peak Search** (or **Search**).
23. Record the analyzer Mkr1 Amplitude Reading in Table 2-49 as Mkr1 Amplitude.
24. Repeat step 18 through step 23 for frequencies between 100 kHz and 10 MHz.
25. Copy the Splitter Tracking Errors from Table 2-48 into Table 2-49.
26. Calculate the Flatness Error for each frequency in Table 2-49 as follows:

Flatness Error = Mkr1 Amptd – Current Channel B – Splitter Tracking Error

For example, if Mkr1 Amptd is –10.32 dBm, Current Channel B is –10.2 and Splitter Tracking Error is 0.18 dB, Flatness Error would be –0.30 dB.

27. Record the Flatness Error for 50 MHz below as the 50 MHz Ref Amptd:

    50 MHz Ref Amptd: _____

28. Calculate the setup change error (error due to changing the test setup from using a synthesized sweeper to using a function generator) as follows:

    a. Record the Flatness Error from Table 2-49 at 10 MHz using the function generator as FlatError_{FG}:

       FlatError_{FG}=_____ dB

    b. Record the Flatness Error from Table 2-49 at 10 MHz using the synthesized sweeper as FlatError_{SS}:

       FlatError_{SS}=_____ dB

    c. Subtract FlatError_{SS} from FlatError_{FG} and record the result as the Setup Change Error:

       $$\text{Setup Change Error} = \text{FlatError}_{FG} - \text{FlatError}_{SS}$$

       Setup Change Error =_____ dB

29. For frequencies less than 10 MHz calculate the Flatness Relative to 50 MHz for each frequency in Table 2-49 as follows:

Flatness Relative to 50 MHz = Flatness Error – 50 MHz Ref Amptd – Setup Change Error

For example, if Flatness Error is –0.30 dB, 50 MHz Ref Amptd is 0.15 dB and Setup Change Error is –0.19 dB, Flatness Relative to 50 MHz would be –0.26 dB.

30. For frequencies 10 MHz and greater, calculate the Flatness Relative to 50 MHz for each frequency in Table 2-49 as follows:

Flatness Relative to 50 MHz = Flatness Error – 50 MHz Ref Amptd

For example, if Flatness Error is –0.30 dB and 50 MHz Ref Amptd is 0.15 dB, Flatness Relative to 50 MHz would be –0.45 dB.

31. If the analyzer has Option UKB, continue with this procedure. Otherwise, perform the procedure in "Measuring Frequency Response, £100 kHz."

32. Replace the function generator with the synthesized sweeper.

33. Set the source frequency to 10 MHz and the source power level to the value corresponding to the source power setting in Table 2-48 for the current source frequency (10 MHz).

34. On the analyzer, press **Input/Output** (or **Input**), **Coupling** (AC).

35.Repeat step 5 through step 30 for ac coupling.

36. Perform the procedure in "Measuring Frequency Response, £100 kHz."

Table 2-49 Frequency Response Worksheet, 100 kHz to 3.0 GHz

Freq. (MHz)	Splitter Tracking Error	Current Channel B Reading		Mkr1 Amptd		Flatness Error		Flatness Relative to 50 MHz	
		dc	ac	dc	ac	dc	ac	dc	ac
0.1									
0.5									
1									
5									
10[a]									
10[b]									
20									
50								0 dB (ref)	0 dB (ref)
75									
175									
275									
375									
475									
575									
675									
775									
825									
875									
925									
975									
1025									
1075									
1175									
1275									
1375									
1500									
1525									

Table 2-49 Frequency Response Worksheet, 100 kHz to 3.0 GHz


Freq. (MHz)	Splitter Tracking Error	Current Channel B Reading		Mkr1 Amptd		Flatness Error		Flatness Relative to 50 MHz	
		dc	ac	dc	ac	dc	ac	dc	ac
1625									
1675									
1725									
1775									
1825									
1875									
1925									
1975									
2025									
2125									
2325									
2525									
2725									
2925									
2999									

a. This entry is for data taken with the function generator as source.
b. This entry is for data taken with the synthesized sweeper as source.

Measuring Frequency Response, ≤100 kHz

1. Connect the equipment as shown in Figure 2-31.

Figure 2-31 Frequency Response Test Setup, ≤100 kHz

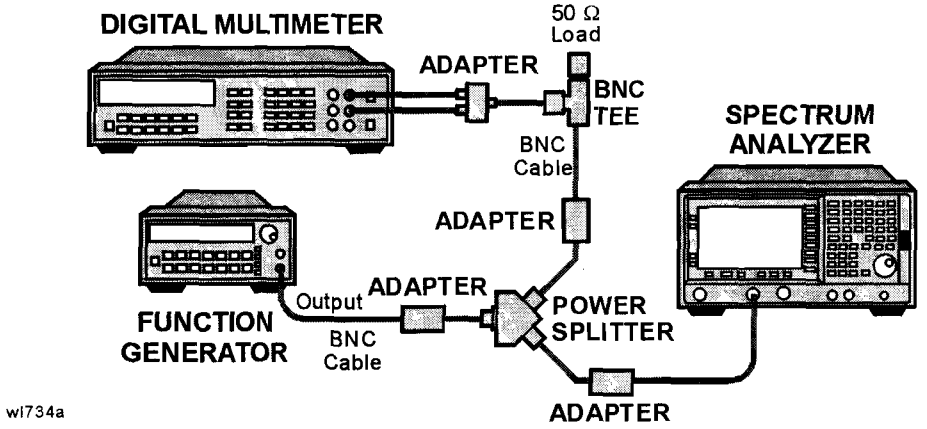

2. Set the function generator controls as follows:

   FREQUENCY, 100 kHz
   AMPLITUDE, –4 dBm
   Amptd Increment, 0.05 dB

3. Set the DVM as follows:

Function	Synchronous AC Volts
Math	dBm
RES Register	50 Ω
Front/Rear Terminals	Front
Range	Auto

4. On the analyzer, press **FREQUENCY, 100 kHz.**
5. If the analyzer has Option UKB, press **Input/Output** (or **Input**), **Coupling** (DC). Then press **SPAN, 100 Hz, BW/Avg, Resolution BW, 10 Hz, Video BW, 10 Hz.**
6. Adjust the function generator amplitude until the DVM reading is –10 dBm ±0.1 dB.
7. Record the actual DVM reading in Table 2-50 as the DVM Amplitude reading.
8. On the analyzer, press **Peak Search** (or **Search**), **Marker, Delta.**
9. Set the analyzer center frequency to the next frequency listed in Table 2-50.

10. Set the function generator frequency to the next frequency listed in Table 2-50. Frequencies less than 9 kHz only apply to analyzers with Option UKB.
11. On the analyzer, press **Peak Search** (or **Search**).
12. Adjust the function generator amplitude until the ΔMkr1 amplitude reads 0 dB ±0.05 dB.
13. Record the DVM reading in Table 2-50 as the DVM Amplitude reading.
14. Repeat step 9 through step 13 for each frequency setting listed in Table 2-50.
15. For each of the frequencies in Table 2-50, subtract the DVM Amplitude from the DVM Amplitude at 100 kHz recorded in step 7. Record the result as the Response Relative to 100 kHz in Table 2-50.
16. From Table 2-49, note the Flatness Relative to 50 MHz for the 100 kHz frequency. Record this below as the 100 kHz Error Relative to 50 MHz:

    100 kHz Error Relative to 50 MHz =_____ dB
17. Add the 100 kHz Error Relative to 50 MHz that was recorded in step 16 above to each of the Response Relative to 100 kHz entries in Table 2-50. Record the results as the Response Relative to 50 MHz in Table 2-50.

Table 2-50 Frequency Response Worksheet, ≤100 kHz


Frequency	DVM Amplitude	Response Relative to 100 kHz	Response Relative to 50 MHz
100 kHz		0 dB (Ref)	
75 kHz			
50 kHz			
20 kHz			
9 kHz			
5 kHz[a]			
2 kHz[a]			
1 kHz[a]			
500 Hz[a]			
200 Hz[a]			
100 Hz[a]			

a. These frequencies apply only to analyzers with Option UKB.

Measuring Frequency Response, >3 GHz

1. Replace the Channel B power sensor with the microwave power sensor. Zero and calibrate the power sensor and power meter in log mode. Enter the 50 MHz calibration factor of the power sensor into the power meter.
2. Connect the equipment as shown in Figure 2-32.

Figure 2-32 Frequency Response Test Setup, >3 GHz

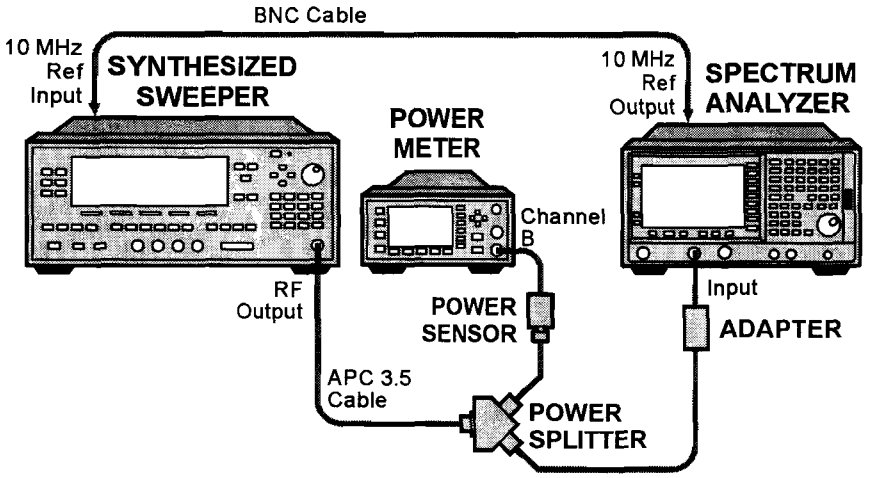

3. If the analyzer is an ESA E4404B or E4405B, then press **Input/Output (or Input), Coupling** (DC). This sets the analyzer to dc coupled mode.
4. On the analyzer, press **FREQUENCY, 50 MHz, CF Step 200 MHz.**
5. Set the synthesized sweeper CW frequency to 50 MHz and FREQ STEP to 200 MHz.
6. Adjust the synthesized sweeper power level for a power meter reading of –10 dBm ±0.05 dB.
7. On the analyzer, press **Peak Search** (or **Search**).
8. On the analyzer, press **Marker, Delta.**
9. Activate the dB relative mode on the power meter. Power meter readings will now be displayed relative to the power meter reading at 50 MHz.
10. Set the synthesized sweeper CW frequency to the next frequency listed in Table 2-51.
11. Enter the appropriate power sensor calibration factor into the power meter.
12. On the analyzer, press **Peak Search** (or **Search**), **Amplitude, Presel Center.**

13. Adjust the synthesized sweeper power level until the analyzer ΔMkr1 amplitude reading is 0 dB ±0.05 dB.

14. Record the *negative of the* power meter reading in Table 2-51 as the Flatness Relative to 50 MHz for dc coupled mode.

NOTE Record this power meter reading as the negative, or opposite polarity from the measured value. For example, a measured value of –0.75 dB is recorded as +0.75 dB; a measured value of +0.25 dB is recorded as –0.25 dB.

If the analyzer is an ESA E4407B, make all entries in the dc coupled column.

15. Repeat step 10 through step 14 for frequencies up through 6.699 GHz in Table 2-51. On the analyzer, pressing **FREQUENCY, ↑** will allow you to step through most of the frequencies. Similarly, on the synthesized sweeper, pressing **CW, ↑** will allow you to step through most of the frequencies.

16. If the spectrum analyzer is an ESA E4404B, continue with the next step. Otherwise, continue with step 20.

17. On the analyzer, press **Input/Output (or Input), Coupling** (AC). This sets the analyzer to ac coupled mode.

18. Repeat step 4 through step 15, making entries in the ac Coupled column of Table 2-51.

19. Continue with "ESA E4404B/E4405B Test Results" (for an ESA E4404B only). The following steps apply to the ESA E4405B, E4407B, and E4408B only.

20. Set the synthesized sweeper FREQ STEP to 400 MHz.

Set the analyzer center frequency by manually pressing **FREQUENCY, CF Step, 400 MHz.**

21. Repeat step 10 through step 14 for frequencies up through 13.199 GHz in Table 2-51.

22. If the analyzer is an ESA E4405B, continue with the next step. If the analyzer is an ESA E4407B or E4408B, continue with step 26.

23. On the analyzer, press **Input/Output (or Input), Coupling** (AC). This sets the analyzer to ac coupled mode.

24. Repeat step 4 through step 15, making entries in the ac Coupled column of Table 2-51.

25. Repeat step 10 through step 14 for frequencies up through 13.199 GHz in Table 2-51.

26. Continue with "ESA E4404B/E4405B Test Results" (for an ESA E4405B only). The following steps apply to the ESA E4407B and

E4408B only.

27. Repeat step 10 through step 14 for the remaining frequencies in Table 2-51. Continue with "ESA E4407B/E4408B Test Results" (for an ESA E4407B or E4408B only).

Table 2-51 Frequency Response Worksheet, >3 GHz

Frequency	Flatness Relative to 50 MHz, dB	
	dc Coupled	ac Coupled
3.05 GHz		
3.1 GHz		
3.3 GHz		
3.5 GHz		
3.7 GHz		
3.9 GHz		
4.1 GHz		
4.3 GHz		
4.5 GHz		
4.7 GHz		
4.9 GHz		
5.1 GHz		
5.3 GHz		
5.5 GHz		
5.7 GHz		
5.9 GHz		
6.1 GHz		
6.3 GHz		
6.5 GHz		
6.699 GHz		
End of worksheet recording for E4404B		
6.8 GHz		
7.0 GHz		
7.4 GHz		
7.8 GHz		

Table 2-51 Frequency Response Worksheet, >3 GHz

Frequency	Flatness Relative to 50 MHz, dB	
	dc Coupled	ac Coupled
8.2 GHz		
8.6 GHz		
9.0 GHz		
9.4 GHz		
9.8 GHz		
10.2 GHz		
10.6 GHz		
11.0 GHz		
11.4 GHz		
11.8 GHz		
12.2 GHz		
12.6 GHz		
12.8 GHz		
13.199 GHz		
End of worksheet recording for E4405B		
13.3 GHz		
13.7 GHz		
14.1 GHz		
14.5 GHz		
14.9 GHz		
15.3 GHz		
15.7 GHz		
16.1 GHz		
16.5 GHz		
16.9 GHz		
17.3 GHz		
17.7 GHz		
18.1 GHz		

Table 2-51 Frequency Response Worksheet, >3 GHz

Frequency	Flatness Relative to 50 MHz, dB	
	dc Coupled	ac Coupled
18.5 GHz		
18.9 GHz		
19.3 GHz		
19.7 GHz		
20.1 GHz		
20.5 GHz		
20.9 GHz		
21.3 GHz		
21.7 GHz		
22.1 GHz		
22.5 GHz		
22.9 GHz		
23.3 GHz		
23.7 GHz		
24.1 GHz		
24.5 GHz		
24.9 GHz		
25.1 GHz		
25.3 GHz		
25.7 GHz		
26.1 GHz		
26.5 GHz		

ESA E4404B/E4405B Test Results

Perform the following steps to verify the frequency response of the analyzer.

1. Enter the most positive number from the Flatness Relative to 50 MHz (dc) column of Table 2-49:

   _____ dB

2. Enter the most positive number from the Response Relative to

50 MHz column of Table 2-50:

_____ dB

3. Record the most positive of numbers from step 1 and step 2 in Table 2-52 as the Maximum Response for Band 0.
4. Enter the most negative number from the Flatness Relative to 50 MHz (dc) column of Table 2-49:

   _____ dB
5. Enter the most negative number from the Response Relative to 50 MHz column of Table 2-50:

   _____ dB
6. Record the most negative of numbers from step 4 and step 5 in Table 2-52 as the Minimum Response for Band 0.
7. For Band 0 in Table 2-52, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.
8. Note the most positive number from the Flatness Relative to 50 MHz (dc) column of Table 2-51 for frequencies between 3.0 GHz and 6.7 GHz. Record this number in Table 2-52 as the Maximum Response for Band 1.
9. Note the most negative number from the Flatness Relative to 50 MHz (dc) column of Table 2-51 for frequencies between 3.0 GHz and 6.7 GHz. Record this number in Table 2-52 as the Minimum Response for Band 1.
10. For Band 1 in Table 2-52, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.
11. If the analyzer is an ESA E4404B, then continue with step 15.
12. Note the most positive number from the Flatness Relative to 50 MHz (dc) column of Table 2-51 for frequencies between 6.7 GHz and 13.2 GHz. Record this number in Table 2-52 as the Maximum Response for Band 2.
13. Note the most negative number from the Flatness Relative to 50 MHz (dc) column of Table 2-51 for frequencies between 6.7 GHz and 13.2 GHz. Record this number in Table 2-52 as the Minimum Response for Band 2.
14. For Band 2 in Table 2-52, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.
15. Record the most positive number from the Flatness Relative to 50 MHz (ac) column of Table 2-49 as the Maximum Response for

Band 0 in Table 2-53.

16. Record the most negative number from the Flatness Relative to 50 MHz (ac) column of Table 2-49 as the Minimum Response for Band 0 in Table 2-53.

17. For Band 0 in Table 2-53, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

18. If the analyzer is an ESA E4404B with a serial number less than US39440498 or an E4405B with a serial number less than US39440327, then continue with step 25.

19. Note the most positive number from the Flatness Relative to 50 MHz (ac) column of Table 2-49 for frequencies between 800 MHz and 1.0 GHz. Record this number in Table 2-53 as the Maximum Response for Band 0A.

20. Note the most negative number from the Flatness Relative to 50 MHz (ac) column of Table 2-49 for frequencies between 800 MHz and 1.0 GHz. Record this number in Table 2-53 as the Minimum Response for Band 0A.

21. For Band 0A in Table 2-53, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

22. Note the most positive number from the Flatness Relative to 50 MHz (ac) column of Table 2-49 for frequencies between 1.7 GHz and 2.0 GHz. Record this number in Table 2-53 as the Maximum Response for Band 0B.

23. Note the most negative number from the Flatness Relative to 50 MHz (ac) column of Table 2-49 for frequencies between 1.7 GHz and 2.0 GHz. Record this number in Table 2-53 as the Minimum Response for Band 0B.

24. For Band 0B in Table 2-53, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

25. Note the most positive number from the Flatness Relative to 50 MHz (ac) column of Table 2-51 for frequencies between 3.0 GHz and 6.7 GHz. Record this number in Table 2-53 as the Maximum Response for Band 1.

26. Note the most negative number from the Flatness Relative to 50 MHz (ac) column of Table 2-51 for frequencies between 3.0 GHz and 6.7 GHz. Record this number in Table 2-53 as the Minimum Response for Band 1.

27. For Band 1 in Table 2-53, subtract the Minimum Response value from the Maximum Response value and record the result in the

Peak-to-Peak Response column.

28. If the analyzer is an ESA E4404B then the frequency response test is complete; transfer the values entered in Table 2-53 to the test record in this guide. If the analyzer is an ESA E4405, continue this procedure.

29. Note the most positive number from the Flatness Relative to 50 MHz (ac) column of Table 2-51 for frequencies between 6.7 GHz and 13.2 GHz. Record this number in Table 2-53 as the Maximum Response for Band 2.

30. Note the most negative number from the Flatness Relative to 50 MHz (ac) column of Table 2-51 for frequencies between 6.7 GHz and 13.2 GHz. Record this number in Table 2-53 as the Minimum Response for Band 2.

31. For Band 2 in Table 2-53, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

32. Transfer the values entered in Table 2-53 to the test record in this guide.

33. The frequency response test for ESA E4405B analyzers is now complete.

Table 2-52 Frequency Response Results, ESA E4404B/E4405B, dc Coupled

Band	Maximum Response		Minimum Response		Peak-to-Peak Response	
	dB	Test Record Entry	dB	Test Record Entry	dB	Test Record Entry
0		1		2		3
1		4		5		6
2		7		8		9

Table 2-53 Frequency Response Results, E4404B/E4405B, ac Coupled

Band	Maximum Response		Minimum Response		Peak-to-Peak Response	
	dB	Test Record Entry	dB	Test Record Entry	dB	Test Record Entry
0		10		11		12
0A		13		14		15
0B		16		17		18
1		19		20		21

Table 2-53 Frequency Response Results, E4404B/E4405B, ac Coupled

Band	Maximum Response		Minimum Response		Peak-to-Peak Response	
	dB	Test Record Entry	dB	Test Record Entry	dB	Test Record Entry
2		22		23		24

ESA E4407B/E4408B Test Results

Perform the following steps to verify the frequency response of the analyzer.

1. Enter the most positive number from the Flatness Relative to 50 MHz (dc) column of Table 2-49:

   _____ dB

2. Enter the most positive number from the Response Relative to 50 MHz column of Table 2-50:

   _____ dB

3. Record the most positive of numbers from step 1 and step 2 in Table 2-54 as the Maximum Response for Band 0.

4. Enter the most negative number from the Flatness Relative to 50 MHz (dc) column of Table 2-49:

   _____ dB

5. Enter the most negative number from the Response Relative to 50 MHz column of Table 2-50:

   _____ dB

6. Record the most negative of numbers from step 4 and step 5 in Table 2-54 as the Minimum Response for Band 0.

7. For Band 0 in Table 2-54, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

8. If the analyzer is an ESA E4408B or is an ESA E4407B with a serial number less than US39440871, then continue with step 15.

9. Note the most positive number from the Flatness Relative to 50 MHz (dc) column of Table 2-49 for frequencies between 800 MHz and 1.0 GHz. Record ths number in Table 2-54 as the Maximum Response for Band 0A.

10. Note the most negative number from the Flatness Relative to 50 MHz (dc) column of Table 2-49 for frequencies between 800 MHz and 1.0 GHz. Record this number in Table 2-54 as the Minimum

Response for Band 0A.

11. For Band 0A in Table 2-54, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

12. Note the most positive number from the Flatness Relative to 50 MHz (dc) column of Table 2-49 for frequencies between 1.7 GHz and 2.0 GHz. Record this number in Table 2-54 as the Maximum Response for Band 0B.

13. Note the most negative number from the Flatness Relative to 50 MHz (dc) column of Table 2-49 for frequencies between 1.7 GHz and 2.0 GHz. Record this number in Table 2-54 as the Minimum Response for Band 0B.

14. For Band 0B in Table 2-54, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

15. Note the most positive number from the Flatness Relative to 50 MHz (dc) column of Table 2-51 for frequencies between 3.0 GHz and 6.7 GHz. Record this number in Table 2-54 as the Maximum Response for Band 1.

16. Note the most negative number from the Flatness Relative to 50 MHz (dc) column of Table 2-51 for frequencies between 3.0 GHz and 6.7 GHz. Record this number in Table 2-54 as the Minimum Response for Band 1.

17. For Band 1 in Table 2-54, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

18. Note the most positive number from the Flatness Relative to 50 MHz (dc) column of Table 2-51 for frequencies between 6.7 GHz and 13.2 GHz. Record this number in Table 2-54 as the Maximum Response for Band 2.

19. Note the most negative number from the Flatness Relative to 50 MHz (dc) column of Table 2-51 for frequencies between 6.7 GHz and 13.2 GHz. Record this number in Table 2-54 as the Minimum Response for Band 2.

20. For Band 2 in Table 2-54, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.

21. Note the most positive number from the Flatness Relative to 50 MHz (dc) column of Table 2-51 for frequencies between 13.2 GHz and 26.5 GHz. Record this number in Table 2-54 as the Maximum Response for Band 3.

22. Note the most negative number from the Flatness Relative to 50 MHz (dc) column of Table 2-51 for frequencies between 13.2 GHz and 26.5 GHz. Record this number in Table 2-54 as the Minimum Response for Band 3.
23. For Band 3 in Table 2-54, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.
24. Transfer the values entered in Table 2-54 to the test record in this guide.
25. The frequency response test for ESA E4407B or E4408B analyzers is now complete.

Table 2-54 Frequency Response Results, E4407B/E4408B

Band	Maximum Response		Minimum Response		Peak-to-Peak Response	
	dB	Test Record Entry	dB	Test Record Entry	dB	Test Record Entry
0		1		2		3
0A		4		5		6
0B		7		8		9
1		10		11		12
2		13		14		15
3		16		17		18

24. Frequency Response (Preamp On): Agilent E4401B

This test measures the amplitude error of the analyzer as a function of frequency. The output of a source is fed through a power splitter to a power sensor and the analyzer. The power level of the source is adjusted at 50 MHz to place the displayed signal at approximately –32 dBm. At each new source frequency and analyzer center frequency, the power level of the source is adjusted to place the signal at approximately –32 dBm.

For improved amplitude accuracy the power splitter is characterized using a power sensor (the "reference" sensor) connected to one power splitter output port. The other power splitter output port connects to the "buried" sensor; it is not removed from the power splitter. Once the characterization is done, the reference sensor is removed and replaced by the analyzer.

Analyzers with 75 Ω inputs are tested down to 1 MHz only.

This procedure only tests frequency response with the optional preamplifier (Option 1DS) turned on. Perform the "Frequency Response" procedure to test all other frequency response specifications.

The related adjustment for this performance test is "Frequency Response."

Equipment Required

Synthesized signal generator
Power meter
RF power sensor (*2 required for 50 Ω inputs*)
20 dB fixed attenuator
Power splitter
Cable, Type-N (m), 183 cm
Cable, BNC, 120 cm
Adapter, Type-N (m) to Type-N (m)
Adapter, Type-N (m) to BNC (f)

Additional Equipment for 75 Ω Input

Power sensor, 75 Ω
Adapter, Type-N (m) 50 Ω to Type-N (f) 75 Ω, mechanical
Adapter, Type-N (m) to BNC (m), 75 Ω


Procedure

Source/Splitter Characterization

1. Refer to Figure 2-33. Connect one RF power sensor to Channel A of the power meter. This will be the "reference" sensor. Connect the other RF power sensor to Channel B of the power meter. This will be the "buried" sensor.

   75 Ω inputs: Connect the 75 Ω power sensor to Channel A of the power meter. This will be the "reference" sensor.

Figure 2-33 Source/Splitter Characterization Setup

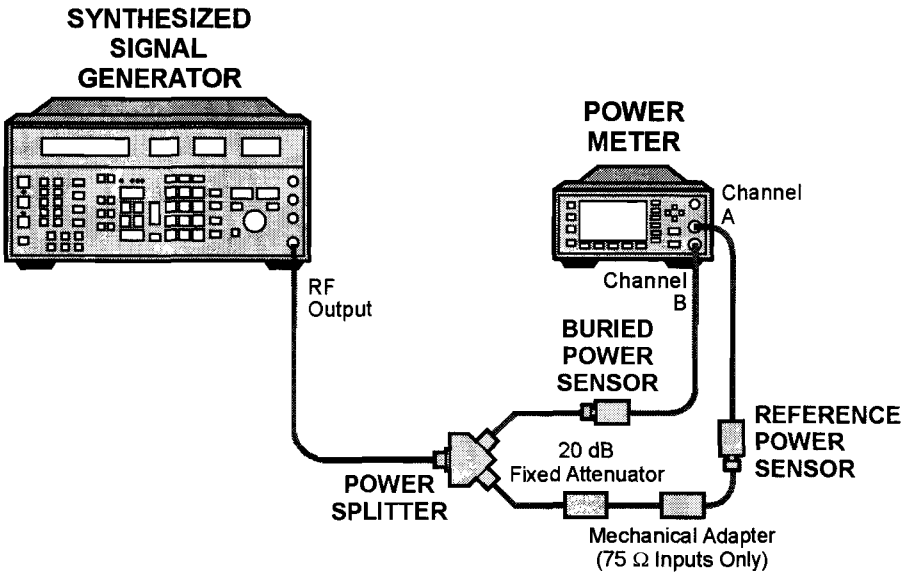

wl712b

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω connectors, or damage to the connectors will occur.

2. Zero and calibrate both power sensors.
3. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor at 100 kHz.

   75 Ω inputs: Set the Channel A calibration factor to the calibration factor of the reference sensor at 1 MHz.

4. On the power meter, set the Channel B calibration factor to 100%. Do not change this calibration factor during this test.
5. Connect the equipment as shown in Figure 2-33. Note that the reference sensor connects to the 20 dB fixed attenuator.

75 Ω inputs: Connect the reference sensor to the power splitter using the mechanical adapter.

6. Set the source frequency to 100 kHz and amplitude to 6 dBm.

   75 Ω inputs: Set the source frequency to 1 MHz and amplitude to 6 dBm.

7. Adjust the source amplitude to obtain a Channel A power meter reading of –20 dBm ±0.1 dB.
8. Record the Channel A and Channel B power meter readings in Table 2-55.
9. Tune the source to the next frequency in Table 2-55.
10. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor for the current source frequency.
11. Adjust the source amplitude to obtain a Channel A power meter reading of –20 dBm ±0.1 dB.
12. Record the Channel A and Channel B power meter readings in Table 2-55.
13. Repeat step 9 through step 12 for each frequency in Table 2-55.
14. For each entry in Table 2-55, calculate the Splitter Tracking Error as follows:

    Splitter Tracking Error = Channel A Power – Channel B Power

    For example, if Channel A Power is –20.3 dBm and Channel B power is –0.23 dBm, the splitter tracking error is –20.07 dB.

Table 2-55 Source/Splitter Characterization


Frequency	Power Meter Reading		Splitter Tracking Error
	Channel A	Channel B	
100 kHz[a]			
500 kHz[a]			
1 MHz			
5 MHz			
10 MHz			
20 MHz			
50 MHz			
75 MHz			
175 MHz			
275 MHz			
375 MHz			
475 MHz			
575 MHz			
675 MHz			
775 MHz			
825 MHz			
875 MHz			
925 MHz			
975 MHz			
1025 MHz			
1075 MHz			
1175 MHz			
1275 MHz			
1375 MHz			
1500 MHz			

a. These values do not apply to analyzers with 75 Ω inputs (Option 1DP).

Measuring Frequency Response, Preamp On

1. Refer to Figure 2-34. Remove the reference sensor (Channel A sensor) from the 20 dB fixed attenuator. Connect the 20 dB fixed attenuator to the analyzer 50 Ω Input using an adapter. Do not use a cable.

Figure 2-34 Frequency Response Test Setup, Preamp On

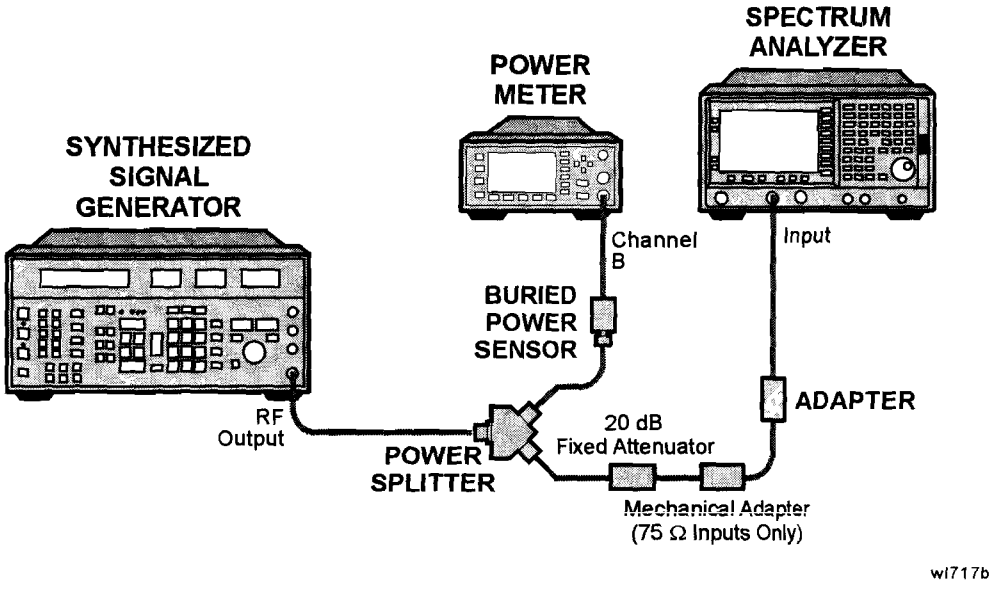

75 Ω inputs: Connect the 20 dB fixed attenuator to the analyzer 75 Ω Input using a mechanical adapter and a 75 Ω, Type-N(m) to BNC(m) adapter.

2. Set the source frequency to 100 kHz:

   75 Ω inputs: Set the source frequency to 1 MHz.

3. Set the source amplitude to –6 dBm.

4. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

   FREQUENCY, Center Freq, 100 kHz (*50 Ω Input*)
   FREQUENCY, Center Freq, 1 MHz (*75 Ω Input*)
   CF Step, 100 MHz
   SPAN, 20 kHz
   AMPLITUDE, More, Int Preamp (On)
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
   AMPLITUDE, Ref Level, –30 dBm
   Attenuation, 0 dB (Man)
   Scale/Div, 2 dB
   BW/Avg, Resolution BW, 3 kHz (Man)

Video BW, 3 kHz (Man)

5. On the analyzer, press **Peak Search** (or **Search**).
6. Adjust the source amplitude to obtain a marker amplitude reading on the analyzer of –32.00 dBm ±0.2 dB.
7. Record the current Channel B power reading in Table 2-56 as the Current Channel B reading.
8. Record the Mkr1 amplitude reading in Table 2-56.
9. Set the source to the next frequency listed in Table 2-56.
10. Set the analyzer center frequency to the next frequency listed in Table 2-56.
11. On the analyzer, press **Peak Search** (or **Search**).
12. Adjust the source amplitude to obtain a marker amplitude reading on the analyzer of –32.00 dBm ±0.2 dB.
13. Record the current Channel B power reading in Table 2-56 as the Current Channel B reading.
14. Record the Mkr1 amplitude reading in Table 2-56 as Mkr1 Amptd.
15. Repeat step 9 through step 14 for each frequency in Table 2-56.
16. Copy the splitter tracking errors from Table 2-55 into Table 2-56.
17. Calculate the Flatness Error for each frequency in Table 2-56 as follows:

Flatness Error = Mkr1 Amptd – Current Channel B – Splitter Tracking Error

For example, if Mkr1 Amptd is –33.32 dBm, Current Channel B is –12.4 dBm, and Splitter Tracking Error is –20.07 dB, Flatness Error would be –0.85 dB.

18. Record the Flatness Error for 50 MHz below as the 50 MHz Ref Amptd:

    50 MHz Ref Amptd _____

19. Calculate the Flatness Relative to 50 MHz for each frequency in Table 2-56 as follows:

    Flatness Relative to 50 MHz = Flatness Error – 50 MHz Ref Amptd

    For example, if Flatness Error is –0.30 dB and 50 MHz Ref Amptd is 0.15 dB, Flatness Relative to 50 MHz would be –0.45 dB.

Table 2-56 Frequency Response Worksheet, Preamp On

Frequency	Current Channel B Reading	Mkr1 Amptd	Splitter Tracking Error	Flatness Error	Flatness Relative to 50 MHz
100 kHz[a]					
500 kHz[a]					
1 MHz					
5 MHz					
10 MHz					
20 MHz					
50 MHz					0 dB (Ref)
75 MHz					
175 MHz					
275 MHz					
375 MHz					
475 MHz					
575 MHz					
675 MHz					
775 MHz					
825 MHz					
875 MHz					
925 MHz					
975 MHz					
1025 MHz					
1075 MHz					
1175 MHz					
1275 MHz					
1375 MHz					
1500 MHz					

a. These values do not apply to analyzers with 75 Ω inputs (Option 1DP).

Test Results

1. Record the most positive number from the Flatness Relative to 50 MHz column of Table 2-56 as the Maximum Response in Table 2-57 and as Entry 1 in the performance verification test record.
2. Record the most negative number from the Flatness Relative to 50 MHz column of Table 2-56 as the Minimum Response in Table 2-57 and as Entry 2 in the performance verification test record.
3. In Table 2-57, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column, and as Entry 3 in the performance verification test record.

Table 2-57 Frequency Response Results

Maximum Response		Minimum Response		Peak-to-Peak Response	
dB	Test Record Entry	dB	Test Record Entry	dB	Test Record Entry
	1		2		3

25. Frequency Response (Preamp On): Agilent E4402B

This test measures the amplitude error of the analyzer as a function of frequency. The output of a source is fed through a power splitter to a power sensor and the analyzer. The power level of the source is adjusted at 50 MHz to place the displayed signal at approximately –32 dBm. At each new source frequency and analyzer center frequency, the power level of the source is adjusted to place the signal at approximately –32 dBm.

For improved amplitude accuracy the power splitter is characterized using a power sensor (the "reference" sensor) connected to one power splitter output port. The other power splitter output port connects to the "buried" sensor; it is not removed from the power splitter. Once the characterization is done, the reference sensor is removed and replaced by the analyzer.

This procedure only tests frequency response with the optional preamplifier (Option 1DS) turned on. Perform the "Frequency Response" procedure to test all other frequency response specifications.

The related adjustment for this performance test is "Frequency Response."

Equipment Required

Function generator
Synthesized sweeper
Power meter
RF power sensor (*2 required*)
20 dB fixed attenuator
Power splitter
Cable, Type-N (m), 183 cm
Cable, BNC, 120 cm
Adapter, Type-N (m) to Type-N (m)
Adapter, Type-N (m) to BNC (f)


Procedure

Source/Splitter Characterization

1. Connect one RF power sensor to Channel A of the power meter. This will be the "reference" sensor. Connect the other RF power sensor to Channel B of the power meter. This will be the "buried" sensor.
2. Zero and calibrate both power sensors.

3. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor at 1 MHz.
4. On the power meter, set the Channel B calibration factor to 100%. Do not change this calibration factor during this test.
5. Connect the equipment as shown in Figure 2-35. Use the function generator as the source. Note that the reference sensor connects to the 20 dB fixed attenuator.

Figure 2-35 Source/Splitter Characterization Setup

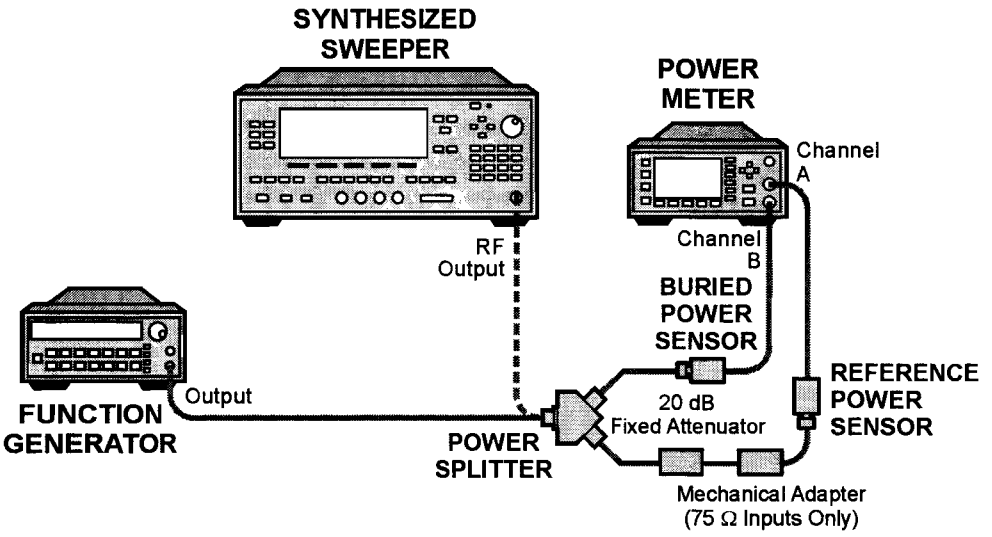

6. Set the function generator frequency to 1 MHz and amplitude to 450 mV rms (approximately 6 dBm).
7. Adjust the source amplitude to obtain a Channel A power meter reading of –20 dBm ±0.1 dB.
8. Record the Channel A and Channel B power meter readings in Table 2-58.
9. Tune the source to the next frequency in Table 2-58.
10. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor for the current source frequency.
11. Adjust the source amplitude to obtain a Channel A power meter reading of –20 dBm ±0.1 dB.
12. Record the Channel A and Channel B power meter readings in Table 2-58.
13. Repeat step 9 through step 12 for frequencies up through 10 MHz.

14. Replace the function generator with the synthesized sweeper.
15. Set the synthesized sweeper CW frequency to 10 MHz and the amplitude to 6 dBm.
16. Adjust the synthesized sweeper power level to obtain a Channel A power meter reading of –20 dBm ±0.1 dB.
17. Record both Channel A and Channel B power meter readings in Table 2-58.
18. Repeat step 9 through step 12 for each remaining frequency in Table 2-58.
19. For each entry in Table 2-58, calculate the Splitter Tracking Error as follows:

    Splitter Tracking Error = Channel A Power – Channel B Power

    For example, if Channel A Power is –20.3 dBm and Channel B power is –0.23 dBm, the splitter tracking error is –20.07 dB.

Table 2-58 Source/Splitter Characterization

Frequency	Power Meter Reading		Splitter Tracking Error
	Channel A	Channel B	
1 MHz			
5 MHz			
10 MHz[a]			
10 MHz[b]			
20 MHz			
50 MHz			
75 MHz			
175 MHz			
275 MHz			
375 MHz			
475 MHz			
575 MHz			
675 MHz			
775 MHz			
825 MHz			
875 MHz			

Table 2-58 Source/Splitter Characterization

Frequency	Power Meter Reading		Splitter Tracking Error
	Channel A	Channel B	
925 MHz			
975 MHz			
1025 MHz			
1075 MHz			
1175 MHz			
1275 MHz			
1375 MHz			
1500 MHz			
1525 MHz			
1675 MHz			
1725 MHz			
1775 MHz			
1825 MHz			
1875 MHz			
1925 MHz			
1975 MHz			
2025 MHz			
2125 MHz			
2325 MHz			
2525 MHz			
2725 MHz			
2925 MHz			
2999 MHz			

a. This entry is for data taken with the function generator as source.
b. This entry is for data taken with the synthesized sweeper as source.


Measuring Frequency Response, Preamp On

1. Refer to Figure 2-36. Remove the reference sensor (Channel A sensor) from the 20 dB fixed attenuator. Connect the 20 dB fixed

attenuator to the 50 Ω Input of the analyzer using an adapter. Do not use a cable.

2. Set the source frequency to 10 MHz.
3. Set the source power level to –6 dBm.

Figure 2-36 Frequency Response Test Setup, Preamp On

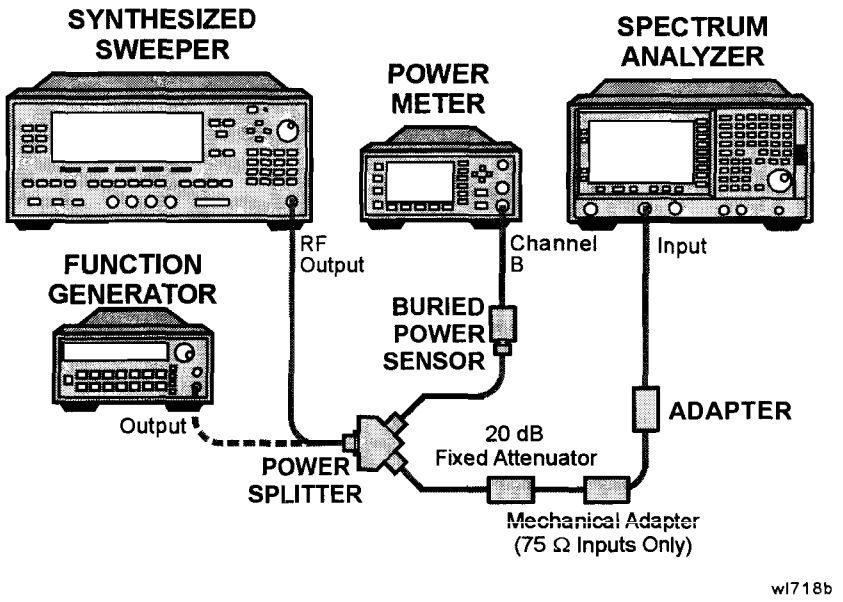

4. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

   FREQUENCY, Center Freq, 10 MHz
   CF Step, 100 MHz
   SPAN, 20 kHz
   Input/Output (or Input), Coupling (DC) *(Option UKB only)*
   AMPLITUDE, More, Int Preamp, On
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
   AMPLITUDE, Ref Level, –30 dBm
   Attenuation, 0 dB (Man)
   Scale/Div, 2 dB
   BW/Avg, Resolution BW, 3 kHz (Man)
   Video BW, 3 kHz (Man)

5. On the analyzer, press **Peak Search** (or **Search**).
6. Adjust the source power level to obtain a marker amplitude reading on the analyzer of –32.00 dBm ±0.2 dB.
7. Record the current Channel B power reading in Table 2-59 as the Current Channel B Reading.
8. Record the Mkr1 amplitude reading in Table 2-59.

9. Set the source to the next frequency listed in Table 2-59.
10. Set the analyzer center frequency to the next frequency listed in Table 2-59.
11. On the analyzer, press **Peak Search** (or **Search**).
12. Adjust the source power level to obtain a marker amplitude reading on the analyzer of –32.00 dBm ±0.2 dB.
13. Record the current Channel B power reading in Table 2-59 as the current Channel B reading.
14. Record the Mkr1 amplitude reading in Table 2-59.
15. Repeat step 9 through step 14 for each remaining frequency in Table 2-59.
16. Replace the synthesized sweeper with the function generator.
17. Set the function generator amplitude to 112 mV rms (–6 dBm, or –12 dBm plus nominal power splitter insertion loss).
18. Set the function generator frequency to 1 MHz.
19. Set the analyzer center frequency to 1 MHz.
20. On the analyzer, press **Peak Search** (or **Search**).
21. Adjust the function generator amplitude to obtain a marker amplitude reading of –32.00 dBm ±0.2 dB.
22. Record the current Channel B power reading in Table 2-59 as the current Channel B reading.
23. Record the analyzer Mkr1 amplitude reading in Table 2-59 as Mkr1 amplitude.
24. Repeat step 18 through step 23 for frequencies between 100 kHz and 10 MHz.
25. Copy the Splitter Tracking Error values from Table 2-58 into Table 2-59.
26. Calculate the Flatness Error for each frequency in Table 2-59 as follows:

Flatness Error = Mkr1 Amptd – Current Channel B – Splitter Tracking Error

For example, if Mkr1 Amptd is –33.32 dBm, Current Channel B is –12.4 dBm, and Splitter Tracking Error is –20.07 dB, Flatness Error would be –0.85 dB.

27. Record the Flatness Error for 50 MHz below as the 50 MHz Ref Amptd:

50 MHz Ref Amptd: _____ dB

28. Calculate the Setup Change Error (error due to changing the test setup from using a synthesized sweeper to using a function generator) as follows:

    a. Record the Flatness Error from Table 2-59 at 10 MHz using the function generator as FlatError_{FG}:

    FlatError_{FG}=_____ dB

    b. Record the Flatness Error from Table 2-59 at 10 MHz using the synthesized sweeper as FlatError_{SS}:

    FlatError_{SS}=_____ dB

    c. Subtract FlatError_{SS} from FlatError_{FG} and record the result as the Setup Change Error:

    $$\text{Setup Change Error} = \text{FlatError}_{FG} - \text{FlatError}_{SS}$$

    Setup Change Error =_____ dB

29. For frequencies less than 10 MHz calculate the Flatness Relative to 50 MHz for each frequency in Table 2-59 as follows:

Flatness Relative to 50 MHz = Flatness Error – 50 MHz Ref Amptd – Setup Change Error

For example, if Flatness Error is –0.30 dB, 50 MHz Ref Amptd is 0.15 dB, and Setup Change Error is –0.19 dB, Flatness Relative to 50 MHz would be –0.26 dB.

30. For frequencies 10 MHz and greater, calculate the Flatness Relative to 50 MHz for each frequency in Table 2-59 as follows:

Flatness Relative to 50 MHz = Flatness Error – 50 MHz Ref Amptd

For example, if Flatness Error is –0.30 dB and 50 MHz Ref Amptd is 0.15 dB, Flatness Relative to 50 MHz would be –0.45 dB.

Table 2-59 Frequency Response Worksheet, Preamp On

Frequency	Current Channel B Reading	Mkr1 Amptd	Splitter Tracking Error	Flatness Error	Flatness Relative to 50 MHz
1 MHz					
5 MHz					
10 MHz[a]					
10 MHz[b]					
20 MHz					
50 MHz					0 dB (Ref)

Table 2-59 Frequency Response Worksheet, Preamp On

Frequency	Current Channel B Reading	Mkr1 Amptd	Splitter Tracking Error	Flatness Error	Flatness Relative to 50 MHz
75 MHz					
175 MHz					
275 MHz					
375 MHz					
475 MHz					
575 MHz					
675 MHz					
775 MHz					
825 MHz					
875 MHz					
925 MHz					
975 MHz					
1025 MHz					
1075 MHz					
1175 MHz					
1275 MHz					
1375 MHz					
1500 MHz					
1525 MHz					
1675 MHz					
1725 MHz					
1775 MHz					
1825 MHz					
1875 MHz					
1925 MHz					
1975 MHz					
2025 MHz					
2125 MHz					

Table 2-59 Frequency Response Worksheet, Preamp On

Frequency	Current Channel B Reading	Mkr1 Amptd	Splitter Tracking Error	Flatness Error	Flatness Relative to 50 MHz
2325 MHz					
2525 MHz					
2725 MHz					
2925 MHz					
2999 MHz					

a. This entry is for data taken with the function generator as source.
b. This entry is for data taken with the synthesized sweeper as source.

Test Results

1. Record the most positive number from the Flatness Relative to 50 MHz column of Table 2-59 as the Maximum Response for Band 0 in Table 2-60.
2. Record the most negative number from the Flatness Relative to 50 MHz column of Table 2-59 as the Minimum Response for Band 0 in Table 2-60.
3. For Band 0 in Table 2-60, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.
4. If the analyzer is an ESA E4402B with a serial number greater than or equal to US39441006 then continue with the next step. Otherwise, transfer the values entered in Table 2-60 to the test record in this guide; the frequency response test is now complete.
5. Note the most positive number from the Flatness Relative to 50 MHz column of Table 2-59 for frequencies between 800 MHz and 1.0 GHz. Record this number in Table 2-60 as the Maximum Response for Band 0A.
6. Note the most negative number from the Flatness Relative to 50 MHz column of Table 2-59 for frequencies between 800 MHz and 1.0 GHz. Record this number in Table 2-60 as the Minimum Response for Band 0A.
7. For Band 0A in Table 2-60, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.
8. Note the most positive number from the Flatness Relative to 50 MHz column of Table 2-59 for frequencies between 1.7 GHz and 2.0 GHz. Record this number in Table 2-60 as the Maximum Response for Band 0B.

9. Note the most negative number from the Flatness Relative to 50 MHz column of Table 2-59 for frequencies between 1.7 GHz and 2.0 GHz. Record this number in Table 2-60 as the Minimum Response for Band 0B.
10. For Band 0B in Table 2-60, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.
11. Transfer the values entered in Table 2-60 to the test record in this guide.
12. The frequency response test is now complete.

Table 2-60 Frequency Response Results

Band	Maximum Response		Minimum Response		Peak-to-Peak Response	
	dB	Test Record Entry	dB	Test Record Entry	dB	Test Record Entry
0		1		2		3
0A		4		5		6
0B		7		8		9

26. Frequency Response (Preamp On): Agilent E4404B, E4405B, and E4407B

This test measures the amplitude error of the analyzer as a function of frequency. The output of a source is fed through a power splitter to a power sensor and the analyzer. The power level of the source is adjusted at 50 MHz to place the displayed signal at approximately –32 dBm. At each new source frequency and analyzer center frequency, the power level of the source is adjusted to place the signal at approximately –32 dBm.

For improved amplitude accuracy the power splitter is characterized using a power sensor (the "reference" sensor) connected to one power splitter output port. The other power splitter output port connects to the "buried" sensor; it is not removed from the power splitter. Once the characterization is done, the reference sensor is removed and replaced by the analyzer.

This procedure only tests frequency response with the optional preamplifier (Option 1DS) turned on. Perform the "Frequency Response" procedure to test all other frequency response specifications.

The related adjustment for this performance test is "Frequency Response."

Equipment Required

Function generator
Synthesized sweeper
Power meter
RF power sensor (*2 required*)
20 dB fixed attenuator
Power splitter
Cable, Type-N (m), 183 cm
Cable, BNC, 120 cm
Adapter, Type-N (m) to Type-N (m)
Adapter, Type-N (m) to BNC (f)

Additional Equipment for Option BAB


Adapter, Type-N (m) to APC 3.5 (f)

Procedure

Source/Splitter Characterization

1. Connect one RF power sensor to Channel A of the power meter. This will be the "reference" sensor. Connect the other RF power sensor to Channel B of the power meter. This will be the "buried" sensor.
2. Zero and calibrate both power sensors.
3. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor at 1 MHz.
4. On the power meter, set the Channel B calibration factor to 100%. Do not change this calibration factor during this test.
5. Connect the equipment as shown in Figure 2-37. Use the function generator as the source. Note that the reference sensor connects to the 20 dB fixed attenuator.

Figure 2-37 Source/Splitter Characterization Setup

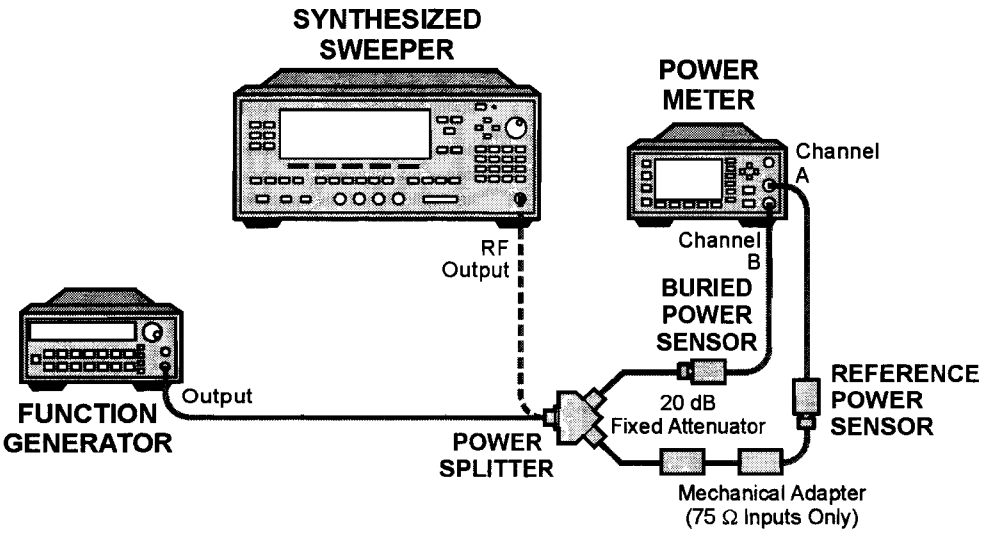

6. Set the function generator frequency to 1 MHz and amplitude to 446 mV rms (approximately 6 dBm).
7. Adjust the source amplitude to obtain a Channel A power meter reading of –20 dBm ±0.1 dB.
8. Record the Channel A and Channel B power meter readings in Table 2-61.
9. Tune the source to the next frequency in Table 2-61.

10. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor for the current source frequency.
11. Adjust the source amplitude to obtain a Channel A power meter reading of –20 dBm ±0.1 dB.
12. Record the Channel A and Channel B power meter readings in Table 2-61.
13. Repeat step 9 through step 12 for frequencies up through 10 MHz.
14. Replace the function generator with the synthesized sweeper.
15. Set the synthesized sweeper CW frequency to 10 MHz and the amplitude to 6 dBm.
16. Adjust the synthesized sweeper power level to obtain a Channel A power meter reading of –20 dBm ±0.1 dB.
17. Record the synthesized sweeper power level and both Channel A and Channel B power meter readings in Table 2-61.
18. Repeat step 9 through step 12 for each remaining frequency in Table 2-61.
19. For each entry in Table 2-61, calculate the Splitter Tracking Error as follows:

    Splitter Tracking Error = Channel A Power – Channel B Power

    For example, if Channel A Power is –20.3 dBm and Channel B power is –0.23 dBm, the splitter tracking error is –20.07 dB.

Table 2-61 Source/Splitter Characterization

Frequency	Power Meter Reading		Splitter Tracking Error
	Channel A	Channel B	
1 MHz			
5 MHz			
10 MHz[a]			
10 MHz[b]			
20 MHz			
50 MHz			
75 MHz			
175 MHz			

Table 2-61 Source/Splitter Characterization

Frequency	Power Meter Reading		Splitter Tracking Error
	Channel A	Channel B	
275 MHz			
375 MHz			
475 MHz			
575 MHz			
675 MHz			
775 MHz			
825 MHz			
875 MHz			
925 MHz			
975 MHz			
1025 MHz			
1075 MHz			
1175 MHz			
1275 MHz			
1375 MHz			
1500 MHz			
1525 MHz			
1675 MHz			
1725 MHz			
1775 MHz			
1825 MHz			
1875 MHz			
1925 MHz			
1975 MHz			
2025 MHz			
2125 MHz			
2325 MHz			
2525 MHz			

Table 2-61 Source/Splitter Characterization


Frequency	Power Meter Reading		Splitter Tracking Error
	Channel A	Channel B	
2725 MHz			
2925 MHz			
2999 MHz			

a. This entry is for data taken with the function generator as source.
b. This entry is for data taken with the synthesized sweeper as source.

Measuring Frequency Response, Preamp On

1. Refer to Figure 2-38. Remove the reference sensor (Channel A sensor) from the 20 dB fixed attenuator. Connect the 20 dB fixed attenuator to the 50 Ω Input of the analyzer using an adapter. Do not use a cable.

Figure 2-38 Frequency Response Test Setup, Preamp On

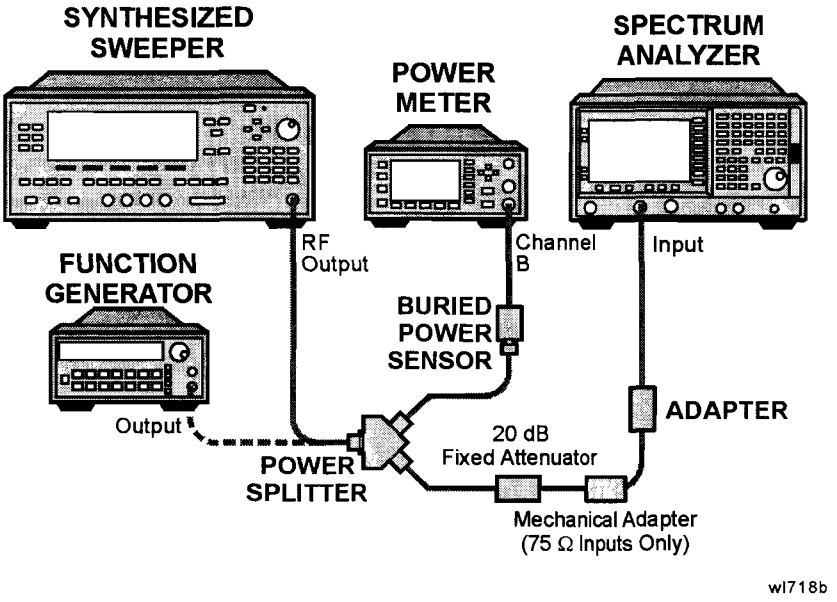

2. Set the source frequency to 10 MHz.
3. Set the source power level to –6 dBm.
4. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

   FREQUENCY, Center Freq, 10 MHz
   CF Step, 100 MHz
   SPAN, 20 kHz
   Input/Output (or **Input**), **Coupling**, (DC) *(E4404B and E4405B)*
   AMPLITUDE, More, Int Preamp, On
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
   AMPLITUDE, Ref Level, –30 dBm
   Attenuation, 0 dB (Man)
   Scale/Div, 2 dB
   BW/Avg, Resolution BW, 3 kHz (Man)
   Video BW, 3 kHz (Man)

5. On the analyzer, press **Peak Search** (or **Search**).
6. Adjust the source power level to obtain a marker amplitude reading on the analyzer of –32.00 dBm ±0.2 dB.

7. Record the current Channel B power reading in Table 2-62 as the Current Channel B Reading.
8. Record the Mkr1 amplitude reading in Table 2-62.
9. Set the source to the next frequency listed in Table 2-62.
10. Set the analyzer center frequency to the next frequency listed in Table 2-62.
11. On the analyzer, press **Peak Search** (or **Search**).
12. Adjust the source power level to obtain a marker amplitude reading on the analyzer of –32.00 dBm ±0.2 dB.
13. Record the current Channel B power reading in Table 2-62 as the current Channel B reading.
14. Record the Mkr1 amplitude reading in Table 2-62.
15. Repeat step 9 through step 14 for each remaining frequency in Table 2-62.
16. Replace the synthesized sweeper with the function generator.
17. Set the function generator amplitude to 112 mV rms (–6 dBm, or –12 dBm plus nominal power splitter insertion loss).
18. Set the function generator frequency to 1 MHz.
19. Set the analyzer center frequency to 1 MHz.
20. On the analyzer, press **Peak Search** (or **Search**).
21. Adjust the function generator amplitude to obtain a marker amplitude reading of –32.00 dBm ±0.2 dB.
22. Record the current Channel B power reading in Table 2-62 as the current Channel B reading.
23. Record the analyzer Mkr1 amplitude reading in Table 2-62 as Mkr1 amplitude.
24. Repeat step 18 through step 23 for frequencies between 100 kHz and 10 MHz.
25. Copy the Splitter Tracking Error values from Table 2-61 into Table 2-62.
26. Calculate the Flatness Error for each frequency in Table 2-62 as follows:

Flatness Error = Mkr1 Amptd – Current Channel B – Splitter Tracking Error

For example, if Mkr1 Amptd is –33.32 dBm, Current Channel B is –12.4 dBm, and Splitter Tracking Error is –20.07 dB, Flatness Error would be –0.85 dB.

27. Record the Flatness Error for 50 MHz below as the 50 MHz Ref Amptd:

    50 MHz Ref Amptd: _____

28. Calculate the Setup Change Error (error due to changing the test setup from using a synthesized sweeper to using a function generator) as follows:

    a. Record the Flatness Error from Table 2-62 at 10 MHz using the function generator as $FlatError_{FG}$:

       $FlatError_{FG}$=_____ dB

    b. Record the Flatness Error from Table 2-62 at 10 MHz using the synthesized sweeper as $FlatError_{SS}$:

       $FlatError_{SS}$=_____ dB

    c. Subtract $FlatError_{SS}$ from $FlatError_{FG}$ and record the result as the Setup Change Error:

       $$\text{Setup Change Error} = FlatError_{FG} - FlatError_{SS}$$

       Setup Change Error =_____ dB

29. For frequencies less than 10 MHz calculate the Flatness Relative to 50 MHz for each frequency in Table 2-62 as follows:

Flatness Relative to 50 MHz = Flatness Error – 50 MHz Ref Amptd – Setup Change Error

For example, if Flatness Error is –0.30 dB, 50 MHz Ref Amptd is 0.15 dB, and Setup Change Error is –0.19 dB, Flatness Relative to 50 MHz would be –0.26 dB.

30. For frequencies 10 MHz and greater, calculate the Flatness Relative to 50 MHz for each frequency in Table 2-62 as follows:

Flatness Relative to 50 MHz = Flatness Error – 50 MHz Ref Amptd

For example, if Flatness Error is –0.30 dB and 50 MHz Ref Amptd is 0.15 dB, Flatness Relative to 50 MHz would be –0.45 dB.

Table 2-62 Frequency Response Worksheet, Preamp On

Frequency	Current Channel B Reading	Mkr1 Amptd	Splitter Tracking Error	Flatness Error	Flatness Relative to 50 MHz
1 MHz					
5 MHz					
10 MHz[a]					
10 MHz[b]					
20 MHz					
50 MHz					0 dB (Ref)
75 MHz					
175 MHz					
275 MHz					
375 MHz					
475 MHz					
575 MHz					
675 MHz					
775 MHz					
825 MHz					
875 MHz					
925 MHz					
975 MHz					
1025 MHz					
1075 MHz					
1175 MHz					
1275 MHz					
1375 MHz					
1500 MHz					
1525 MHz					
1675 MHz					
1725 MHz					
1775 MHz					

Table 2-62 Frequency Response Worksheet, Preamp On

Frequency	Current Channel B Reading	Mkr1 Amptd	Splitter Tracking Error	Flatness Error	Flatness Relative to 50 MHz
1825 MHz					
1875 MHz					
1925 MHz					
1975 MHz					
2025 MHz					
2125 MHz					
2325 MHz					
2525 MHz					
2725 MHz					
2925 MHz					
2999 MHz					

b. This entry is for data taken with the synthesized sweeper as source.

Test Results

1. Record the most positive number from the Flatness Relative to 50 MHz column of Table 2-62 as the Maximum Response for Band 0 in Table 2-63.
2. Record the most negative number from the Flatness Relative to 50 MHz column of Table 2-62 as the Minimum Response for Band 0 in Table 2-63.
3. For Band 0 in Table 2-63, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.
4. If the analyzer is an ESA E4404B with a serial number greater than or equal to US39440498 then continue with the next step. Otherwise, transfer the values entered in Table 2-63 to the test record in this guide; the frequency response test is now complete.
5. If the analyzer is an ESA E4405B with a serial number greater than or equal to US39440327 then continue with the next step. Otherwise, transfer the values entered in Table 2-63 to the test record in this guide; the frequency response test is now complete.
6. If the analyzer is an ESA E4407B with a serial number greater than or equal to US39440871 then continue with the next step.

Otherwise, transfer the values entered in Table 2-63 to the test record in this guide; the frequency response test is now complete.

7. Note the most positive number from the Flatness Relative to 50 MHz column of Table 2-62 for frequencies between 800 MHz and 1.0 GHz. Record the number in Table 2-63 as the Maximum Response for Band 0A.
8. Note the most negative number from the Flatness Relative to 50 MHz column of Table 2-62 for frequencies between 800 MHz and 1.0 GHz. Record the number in Table 2-63 as the Minimum Response for Band 0A.
9. For Band 0A in Table 2-63, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.
10. Note the most positive number from the Flatness Relative to 50 MHz column of Table 2-62 for frequencies between 1.7 GHz and 2.0 GHz. Record the number in Table 2-63 as the Maximum Response for Band 0B.
11. Note the most negative number from the Flatness Relative to 50 MHz column of Table 2-62 for frequencies between 1.7 GHz and 2.0 GHz. Record the number in Table 2-63 as the Minimum Response for Band 0B.
12. For Band 0B in Table 2-63, subtract the Minimum Response value from the Maximum Response value and record the result in the Peak-to-Peak Response column.
13. Transfer the values entered in Table 2-63 to the test record in this guide.
14. The frequency response test is now complete.

Table 2-63 Frequency Response Results

Band	Maximum Response		Minimum Response		Peak-to-Peak Response	
	dB	Test Record Entry	dB	Test Record Entry	dB	Test Record Entry
0		1		2		3
0A		4		5		6
0B		7		8		9

27. Other Input-Related Spurious Responses: Agilent E4401B and E4411B

This test measures the ability of the analyzer to reject image and multiple responses. A synthesized source and the analyzer are set to the same frequency and the amplitude of the source is set to –20 dBm. A marker amplitude reference is set on the analyzer. The source is then tuned to several different frequencies which should generate image and multiple responses. At each source frequency, the source amplitude is set to –20 dBm and the amplitude of the response, if any, is measured using the analyzer marker functions.

There are no related adjustment procedures for this performance test.

Equipment Required

Synthesized signal generator
Power meter
RF power sensor
Adapter, Type-N (f) to APC 3.5 (f)
Adapter, Type-N (f) to Type-N (f)
Cable, Type-N, 152-cm (60-in)

Additional Equipment for 75 Ω Input

Power sensor, 75 Ω
Adapter, Type-N (f), to BNC (m), 75 Ω
Adapter, BNC (m), to BNC (m), 75 Ω
Pad, minimum loss

Procedure

1. Zero and calibrate the power meter and RF power sensor in log mode (power reads out in dBm), as described in the power meter operation manual. Enter the 500 MHz calibration factor of the power sensor into the power meter.

   75 Ω *Input only: Use a 75 Ω power sensor.*

2. Press **Preset** on the synthesized sweeper and set the controls as follows:


   CW, 542.8 MHz
   POWER LEVEL, –10 dBm

3. Connect the equipment as shown in Figure 2-39 with the output of the synthesized sweeper connected to the power sensor using an adapter between the cable and the power sensor.

75 Ω Input only: Use the minimum loss pad and 75 Ω adapters to connect to the 75 Ω power sensor.

4. Adjust the power level of the synthesized sweeper for a –10 dBm ±0.1 dB reading on the power meter.
5. On the synthesized sweeper, press **SAVE**, 1.

Figure 2-39 Other Input Related Spurious Responses Power Setting Setup

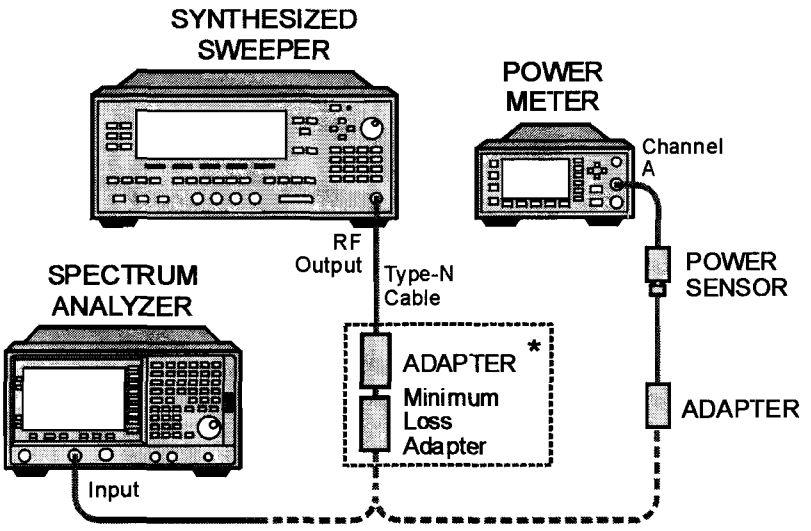


6. Set the CW frequency on the synthesized sweeper to 510.7 MHz.
7. Adjust the synthesized sweeper power level for a –10 dBm ±0.1 dB reading on the power meter.
8. On the synthesized sweeper, press **SAVE 2**.
9. Enter the 1 GHz calibration factor for the power sensor into the power meter.
10. Set the CW frequency on the synthesized sweeper to 1310.7 MHz.
11. Adjust the synthesized sweeper power level for a –10 dBm ±0.1 dB reading on the power meter.
12. On the synthesized sweeper, press **SAVE 3.**
13. Enter the 100 MHz calibration factor of the power sensor into the power meter.
14. Set the CW frequency of the synthesized sweeper to 100 MHz.
15. Adjust the synthesized sweeper power level for a –10 dBm ±0.1 dB reading on the power meter.
16. On the synthesized sweeper, press **SAVE 4.**

17. Set the CW frequency on the synthesized sweeper to 500 MHz.
18. Adjust the power level of the synthesized sweeper for a -10 dBm ±0.1 dB reading on the power meter.
19. Connect the synthesized sweeper to the Input of the analyzer using the appropriate cable and adapters. See Figure 2-40.

    75 Ω Input only: Use the minimum loss pad and a 75 Ω adapter as shown in Figure 2-40.

Figure 2-40 Other Input Related Spurious Responses Measurement Setup

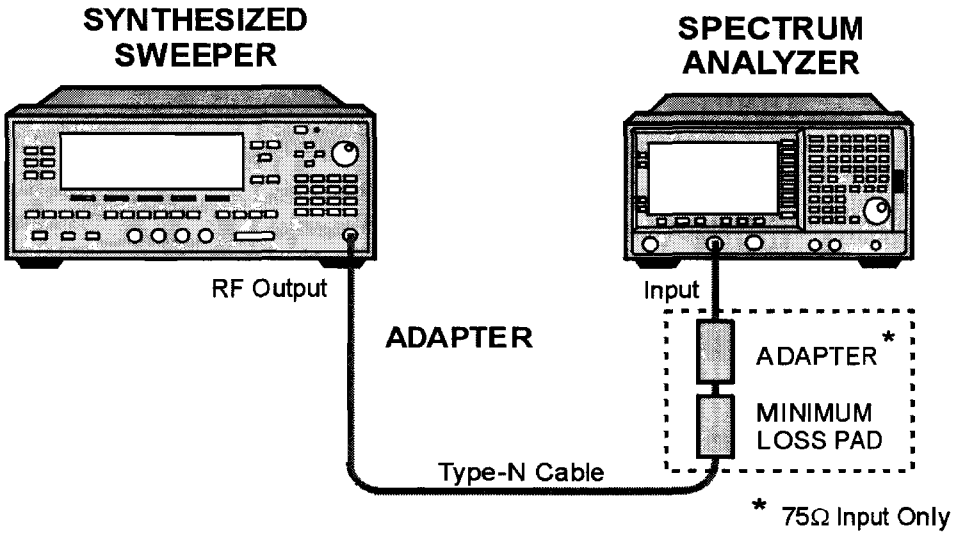

20. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

    Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
    FREQUENCY, Center Freq, 500 MHz
    SPAN, 200 kHz
    AMPLITUDE, Attenuation, 10 dB (Man)
    Peak Search (or **Search**), **Meas Tools, Mkr → Ref Lvl**
    Peak Search (or **Search**), **Meas Tools, Delta**
    Single

21. On the synthesized sweeper, press **RECALL, 1**.

22. On the analyzer, press **Single** and wait for the completion of a new sweep.

23. On the analyzer, press **Peak Search** (or **Search**), and record the ΔMkr1 amplitude in the performance verification test record as indicated in Table 2-64.

24. On the synthesized sweeper, press **RECALL, 2**.

25. On the analyzer, press **Single** and wait for the completion of a new sweep.

26. On the analyzer, press **Peak Search** (or **Search**), record the ΔMkr1 amplitude in the performance verification test record as indicated in Table 2-64.

27. On the synthesized sweeper, press **RECALL, 4.**

28. On the analyzer press the following keys:

    FREQUENCY, 100 MHz
    AMPLITUDE, –5 dBm *(50 Ω Input)*
    AMPLITUDE, 48.75 dBmV *(75 Ω Input)*
    Marker, Normal
    Sweep, Sweep (Cont)
    Peak Search (or **Search**), **Meas Tools, Mkr → Ref Lvl**
    Peak Search (or **Search**), **Meas Tools, Delta**
    Single

29. On the synthesized sweeper, press **RECALL 3** for a CW frequency of 1310.7 MHz.

30. Press **Single** on the analyzer and wait for a completion of a new sweep.

31. On the analyzer, press **Peak Search** (or **Search**) and record the ΔMkr1

amplitude in the performance test record as indicated in Table 2-64.

Table 2-64 Other Input-Related Spurious Responses Worksheet

Synthesized Sweeper CW Frequency			Test Record Entry (Mkr Δ)
Save Register	CW	Power Level	
1	542.8 MHz[a]	542.8 MHz	**1**
2	510.7 MHz[b]	510.7 MHz	**2**
3	1310.7 MHz[b]	1310.7 MHz	**3**
4	100 MHz	1310.7 MHz	N/A

a. Image response
b. Multiple response

28. Other Input-Related Spurious Responses: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B


This test measures the ability of the analyzer to reject image, multiple, and out-of-band responses. A synthesized source and the analyzer are set to the same frequency and the amplitude of the source is set to –10 dBm and –20 dBm. A marker amplitude reference is set on the analyzer for each source amplitude setting. The source is then tuned to several different frequencies which should generate image, multiple, and out-of-band responses. At each source frequency, the source amplitude is set to the appropriate amplitude and the amplitude of the response, if any, is measured using the analyzer marker functions.

There are no related adjustment procedures for this performance test.

Equipment Required

Synthesized sweeper
Power meter
RF power sensor, (*E4402B, E4403B*)
Microwave power sensor (*E4404B, E4405B, E4407B, E4408B*)
RF power splitter (*E4402B, E4403B*)
Microwave power splitter (*E4404B, E4405B, E4407B, E4408B*)
Adapter, Type-N (m) to Type-N (m)
Adapter, Type-N (m) to APC 3.5 (m)
Adapter, APC 3.5 (f) to APC 3.5 (f)
Cable, APC 3.5, 91 cm (36 in)

Figure 2-41 Other Input-Related Spurious Responses Test Setup

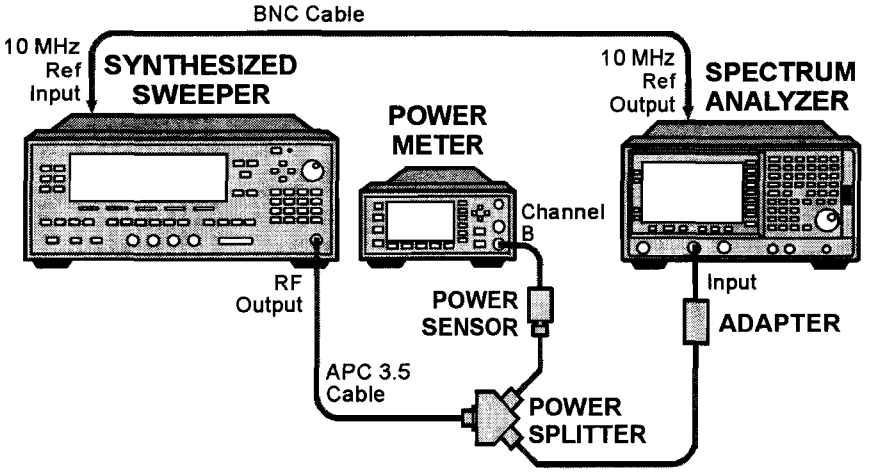

wi736a

Procedure

Band 0

1. Zero and calibrate the power meter and power sensor in log mode (power reads out in dBm), as described in the power meter operation manual. Enter the power sensor 2 GHz calibration factor into the power meter.
2. Preset the synthesized sweeper and set the controls as follows:

   CW, 2000 MHz
   POWER LEVEL, –4 dBm

3. Connect the equipment as shown in Figure 2-41. The analyzer provides the 10 MHz reference for the synthesized sweeper.
4. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, Center Freq, 2 GHz
   SPAN, 200 kHz
   AMPLITUDE, Ref Level –10 dBm
   AMPLITUDE, Attenuation 0 dBm (Man)

5. Adjust the synthesized sweeper power level for a –10 dBm ±0.1 dB reading on the power meter.
6. On the analyzer, press **Single**, and wait for the sweep to finish. Then press following keys:

   Marker, Select Marker (1)
   Peak Search (or **Search**)
   Meas Tools
   Delta

   The signal peak might be slightly above the reference level, but the marker function can still make an accurate measurement.
7. Adjust the synthesized sweeper power level for a –20 dBm ±0.1 dB reading on the power meter.
8. On the analyzer, press **Single**, and wait for the sweep to finish. Press following keys:

   Marker, Select Marker (2)
   Peak Search (or **Search**)
   Meas Tools
   Delta

9. On the analyzer, press **AMPLITUDE, Ref Level, –30 dBm**.
10. Repeat step a through step h using the data in Table 2-65 for Band 0.
    a. Set the synthesized sweeper to the listed CW frequency.

Do not set the synthesized sweeper to frequencies outside the frequency range of the analyzer.

b. Enter the appropriate power sensor calibration factor into the power meter.

c. Adjust the synthesized sweeper power level until the power meter reading is equal to the Mixer Level in Table 2-65, ±0.1 dB.

d. On the analyzer, press **Single** and wait for the completion of a new sweep. Then, press **Peak Search** (or **Search**).

e. If the Mixer Level in Table 2-65 is –20 dBm, press **Marker, Select Marker** (2).

f. If the Mixer Level in Table 2-65 is –10 dBm, press **Marker, Select Marker** (1).

g. On the analyzer, press **Peak Search** (or **Search**).

h. Record the ΔMkr amplitude reading in Table 2-65.

11. On the analyzer, press the following keys:

Marker, More, Marker All Off
Auto Couple
SPAN, 1 MHz
AMPLITUDE, Ref Level, 10 dBm
AMPLITUDE, Attenuation, 0 dB
Sweep, Sweep (Cont)

NOTE End of procedure for E4402B and E4403B.

Band 1

12. On the analyzer, press the following keys:

FREQUENCY
Center Freq, 4 GHz

13. On the synthesized sweeper, press **CW, 4 GHz.**

14. Enter the power sensor 4 GHz calibration factor into the power meter.

15. On the analyzer, press the following keys:

Marker, More, Marker All Off
Amplitude, Presel Center

16. Repeat step 5 through step 11 for the synthesized sweeper CW frequencies listed in Table 2-65 for Band 1.

NOTE End of procedure for E4404B.

Band 2

17. On the analyzer, press the following keys:

    FREQUENCY, Center Freq, 9 GHz

18. On the synthesized sweeper, press **CW, 9 GHz.**

19. Enter the power sensor 9 GHz calibration factor into the power meter.

20. On the analyzer press the following keys:

    AMPLITUDE, Presel Center
    Marker, More, Marker All Off

21. Repeat step 5 through step 11 for the synthesized sweeper CW frequencies listed in Table 2-65 for Band 2.

NOTE End of procedure for E4405B.

Band 3

22. On the analyzer, press the following keys:

    FREQUENCY
    Center Freq, 15 GHz

23. On the synthesized sweeper, press: **CW, 15 GHz.**

24. Enter the power sensor 15 GHz calibration factor into the power meter.

25. On the analyzer press the following keys:

    AMPLITUDE, Presel Center
    Marker, More, Marker All Off

26. Repeat step 5 through step 11 for the synthesized sweeper CW frequencies listed in Table 2-65 for Band 3 for the 15 GHz analyzer center frequency.

Band 4

27. On the analyzer, press:

    FREQUENCY, Center Freq, 21 GHz

28. On the synthesized sweeper, press: **CW, 21 GHz.**

29. Enter the power sensor 21 GHz calibration factor into the power meter.

30. On the analyzer, press **AMPLITUDE, Presel Center.**

31. On the analyzer, press the following:

Marker, More, Marker All Off

32. Repeat step 5 through step 11 for the synthesized sweeper CW frequencies listed in Table 2-65 for Band 4 for the 21 GHz analyzer center frequency.

Table 2-65 Other Input-Related Spurious Responses

Band	Analyzer Center Frequency (GHz)	Synthesized Sweeper CW Frequency (MHz)	Mixer Level (dBm)	ΔMkr1 or ΔMkr2 Amplitude
0	2.0	2042.8[a]	–20	
	2.0	2642.8[a]	–20	
	2.0	1820.8[b]	–20	
	2.0	278.5[c]	–20	
Note: The following data applies only to the E4404B, E4405B, E4407B and E4408B				
0	2.0	5600.0[c]	–10	
	2.0	6242.8[b]	–10	
1	4.0	4042.8[a]	–20	
	4.0	4642.8[a]	–20	
	4.0	3742.9[b]	–20	
	4.0	2242.8[c]	–10	
Note: The following data applies only to the E4405B, E4407B and E4408B				
2	9.0	9042.8[a]	–20	
	9.0	9642.8[a]	–20	
	9.0	4982.1[b]	–20	
	9.0	9342.8[c]	–10	
Note: The following data applies only to the E4407B and E4408B				
3	15.0	15042.8[a]	–20	
	15.0	15642.8[a]	–20	

28. Other Input-Related Spurious Responses: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B

Table 2-65 Other Input-Related Spurious Responses

Band	Analyzer Center Frequency (GHz)	Synthesized Sweeper CW Frequency (MHz)	Mixer Level (dBm)	ΔMkr1 or ΔMkr2 Amplitude
	15.0	18830.35[b]	–20	
	15.0	4151.75[c]	–10	
4	21.0	21042.8[a]	–20	
	21.0	21642.8[a]	–20	
	21.0	21342.8[b]	–20	
	21.0	5008.95[c]	–10	

a. Image response
b. Multiple response
c. Out-of-band response

29. Spurious Responses: Agilent E4401B and E4411B

This test is performed in two parts. Part 1 measures third order intermodulation distortion. Part 2 measures second harmonic distortion.

To test second harmonic distortion, a low pass filter is used to filter the source output, ensuring that harmonics read by the analyzer are internally generated and not coming from the source. To measure the distortion products, the power at the mixer is set 25 dB higher than specified.

For example, the specification states that with –40 dBm at the input mixer, the distortion products should be suppressed by >75 dBc, the equivalent second harmonic intercept (SHI) is >35 dBm (–40 dBm + 75 dBc). Measuring with –15 dBm at the mixer and verifying the distortion products suppressed by >50 dBc also ensures the SHI is >35 dBm (–15 dBm + 50 dBc).

For third order intermodulation distortion, two signals are combined in a directional bridge to provide isolation. These two signals are applied to the analyzer input. The power level of the two signals is several dB higher than specified, so the distortion products should be suppressed by less than the amount specified. In this manner, the equivalent third order intercept (TOI) is measured.

For example, the specification states that with two –30 dBm signals at the input mixer, the distortion products should be suppressed by >80 dBc, which yields a third order intercept of >10 dBm (–30 dBm + (80 dBc/2)). Measuring with –20 dBm at the mixer and verifying the distortion products are suppressed by >60 dBc, the equivalent TOI is also >10 dBm (–20 dBm + (60 dBc/2)).

There are no related adjustment procedures for this performance test.

Equipment Required

Synthesized signal generator
Synthesized sweeper
Power meter, dual channel
RF power sensor
Power splitter
Directional bridge
50 MHz low pass filter
Cable, BNC, 120-cm
Cable, APC 3.5, 91-cm *(2 required)*
Adapter, Type-N (m) to APC 3.5 (f) *(3 required)*
Adapter, Type-N (m) to SMA (m)

Adapter, Type-N (m) to BNC (f)
Adapter, Type-N (m) to Type-N (m)
Adapter, SMA (f) to BNC (m)
Adapter, APC 3.5 (f) to APC 3.5 (f)

Additional Equipment for 75 Ω Input

Power sensor, 75 Ω
Adapter, mechanical, Type-N (m) 50 Ω, to Type-N (m), 75 Ω
Adapter, Type-N (m), to BNC (m), 75 Ω

Procedure

This performance test consists of two parts:

Part 1: Third Order Intermodulation Distortion

Part 2: Second Harmonic Distortion


Perform Part 1 before Part 2.

Part 1: Third Order Intermodulation Distortion

1. Zero and calibrate the power meter and RF power sensor in log mode (power reads out in dBm), as described in the power meter operation manual.

   75 Ω *Input only: Use a* 75 Ω *power sensor.*

Figure 2-42 Third Order Intermodulation Distortion Test Setup

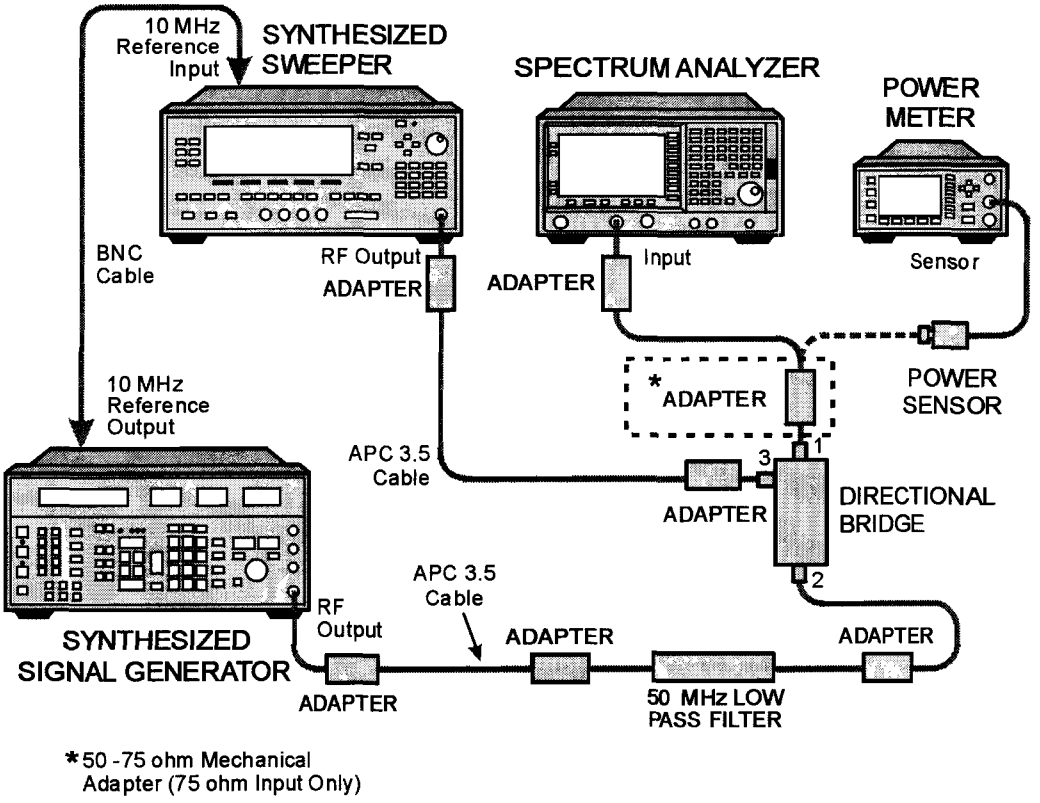

wl753a

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω connectors, or damage to the connectors will occur.

2. Connect the equipment as shown in Figure 2-42 with the output of the directional bridge connected to the power sensor.

   75 Ω Input only: Use the 75 Ω power sensor with the 50 Ω to 75 Ω mechanical adapter.

Table 2-66 Test Equipment Settings for

TOI Test	F1 (MHz)	F2 (MHz)	Low Pass Filter (MHz)
1	50.0	50.05	50
Option 1DR	50.0	50.05	50

3. Perform step 4 through step 29 using the information and entries from Table 2-66. Then continue on with step 30 through step 38.

4. Press **Blue Key, Special, 0, 0** on the signal generator. Set the frequency to the F1 value for TOI Test 1 in Table 2-66. Set the amplitude to –10 dBm.
5. Press **PRESET** on the synthesized sweeper. Set the CW frequency of the synthesized sweeper to the F2 value for TOI Test 1 in Table 2-66. Then press the following:

   POWER LEVEL, 4 dBm
   RF Off
6. Enter the power sensor calibration factor for the signal generator frequency into the power meter.
7. Adjust the amplitude of the signal generator until the power meter reads –12 dBm ±0.1 dB.

   75 Ω Input only: The power measured at the output of the 50 Ω directional bridge by the 75 Ω power sensor is the equivalent power "seen" by the 75 Ω analyzer.
8. Disconnect the power sensor from the directional bridge. Connect the directional bridge directly to the analyzer input using an adapter (do not use a cable).

   75 Ω Input only: Use a 50 Ω to 75 Ω mechanical adapter and a 75 Ω Type-N(m) to BNC(m) adapter.

CAUTION Support the directional bridge and low pass filter to minimize stress on the analyzer input connector.

9. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System, Alignments, Auto Align, Off.** Set the analyzer center frequency to the F1 value for TOI Test 1 in Table 2-66. Then, set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, CF Step, 50 kHz (Man)
   SPAN, 20 kHz
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
   AMPLITUDE, Ref Level, –5 dBm (50 Ω *Input only*)
   AMPLITUDE, Ref Level, –10 dBm (*75 Ω Input only*)
   AMPLITUDE, Attenuation, 5 dB (Man) (50 Ω *Input only*)
   AMPLITUDE, Attenuation, 0 dB(Man) (*75 Ω Input only*)
   BW/Avg, 1 kHz (Man)
   BW/Avg, Video BW, 300 Hz (Man)
   Peak Search (or **Search**), **More, Search Param, Peak Excursn, 3 dB**
10. On the analyzer, press the following keys:

    Peak Search (or **Search**)
    Meas Tools
    Mkr → CF, Delta

11. On the analyzer, press **FREQUENCY**, ↑.
12. If the resolution bandwidth is ≥1kHz, press **SPAN**, **4 kHz**.
13. On the synthesized sweeper, set the RF On.
14. On the analyzer, press **Peak Search** (or **Search**).
15. On the synthesized sweeper, adjust the power level until the ΔMkr1 amplitude reads 0 dB ±0.05 dB.
16. On the analyzer, press: **FREQUENCY**, ↓, ↓. The center frequency should now be lower than the signal generator frequency by the CF Step value.
17. Set the analyzer reference level to –15 dBm.

    75 Ω *Input only: Set the reference level to –20 dBm.*

18. On the analyzer, press **BW/Avg**, **Average**, **20**, and wait for "Vavg 20" to appear along the left side of the display.
19. On the analyzer, press **Peak Search** (or **Search**) and record the marker amplitude reading in Table 2-67 as the Lower Distortion Amplitude.
20. On the analyzer, press **BW/Avg**, **Average Off**.
21. On the analyzer, increment the center frequency by three times the CF Step value. Press **FREQUENCY**, ↑, ↑, ↑. The center frequency should now be one CF Step value above the synthesized sweeper frequency.
22. Set the synthesized signal generator frequency to F2 as indicated in Table 2-66.
23. Set the synthesized sweeper CW frequency to F1 as indicated in Table 2-66.
24. On the analyzer, press **BW/Avg**, **Average**, **20**, and wait for Vavg 20 to appear along the left side of the display.
25. On the analyzer, press **Peak Search** (or **Search**) and record the marker amplitude reading in Table 2-67 as the Upper Distortion Amplitude.
26. On the analyzer, press **BW/Avg**, **Average Off**.
27. Of the Lower Distortion Amplitude and Upper Distortion Amplitudes recorded in Table 2-67, enter the most positive value as the Worst Distortion Amplitude in Table 2-67. For example, if the Upper Distortion Amplitude is –62 dBc and the Lower Distortion Amplitude is –63 dBc, enter –62 dBc as the Worst Distortion Amplitude.

28. If the analyzer has a 50 Ω input, enter –17 dBm as the Mixer Level in Table 2-67 (–12 dBm input power – 5 dB input attenuation). If the analyzer has a 75 Ω input, enter 36.75 dBmV as the Mixer Level in Table 2-67 (–12 dBm = 36.75 dBmV).

29. Calculate the equivalent TOI by subtracting one half of the Worst Distortion Amplitude (in dB) from the Mixer Level (in dBm or dBmV). Enter the result in Table 2-67 as the Calculated TOI. For example, if the Worst Distortion Amplitude is –62 dBc and the Mixer Level is –17 dBm, the Calculated TOI would be:

Table 2-67 Third Order Intermodulation Distortion Worksheet

TOI Test	Lower Distortion Amplitude	Upper Distortion Amplitude	Worst Distortion Amplitude	Mixer Level	Calculated TOI
1					
Option 1DR					

$$TOI = -17\ dBm - (-62\ dB/2) = -17\ dBm + 31\ dB = 14\ dBm$$

30. If the analyzer is equipped with Option 1DR, Narrow Resolution Bandwidth, perform step 31 through step 36. Otherwise, continue with step 37.

31. Set synthesized signal generator frequency to the F1 value used in TOI Test 1 of Table 2-66.

32. Set synthesized sweeper CW frequency to the F2 value used in TOI Test 1 of Table 2-66.

33. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System, Alignments, Auto Align, Off.** Set the analyzer to the F1 value for TOI Test Option 1DR in Table 2-66. Then set the analyzer by pressing the following keys:

FREQUENCY, CF Step, 50 kHz (Man)
SPAN, 20 kHz
AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
AMPLITUDE, Ref Level, –5 dBm (50 Ω *Input only*)
AMPLITUDE, Ref Level, –10 dBm (*75 Ω Input only*)
AMPLITUDE, Attenuation, 5 dB (Man) (50 Ω *Input only*)
AMPLITUDE, Attenuation, 0 dB (Man) (*75 Ω Input only*)
BW/Avg, 1 kHz (Man)
BW/Avg, Video BW, 300 Hz (Man)
Peak Search (or **Search**), **More**
Search Param, Peak Excursn, 3 dB

34.On the analyzer, press the following keys:

Peak Search (or **Search**)
Meas Tools
Mkr → CF

35.Set the analyzer as follows:

SPAN, 500 Hz
BW/Avg, Resolution BW, 30 Hz
BW/Avg, Video BW, 10 Hz

36.Repeat step 10 through step 29. This is the TOI test for Option 1DR.

37.On the analyzer, press **System, Alignments, Auto Align, On.**

38.Part 1: Third Order Intermodulation Distortion is complete. Proceed to Part 2: Second Harmonic Distortion.


Part 2: Second Harmonic Distortion

1. Set the synthesized signal generator controls as follows:

FREQUENCY, 40 MHz
AMPLITUDE, –10 dBm (50 Ω *Input only)*
AMPLITUDE, –4.3 dBm (75 Ω *Input only*)

2. Connect the equipment as shown in Figure 2-43.

Figure 2-43 Second Harmonic Distortion Test Setup

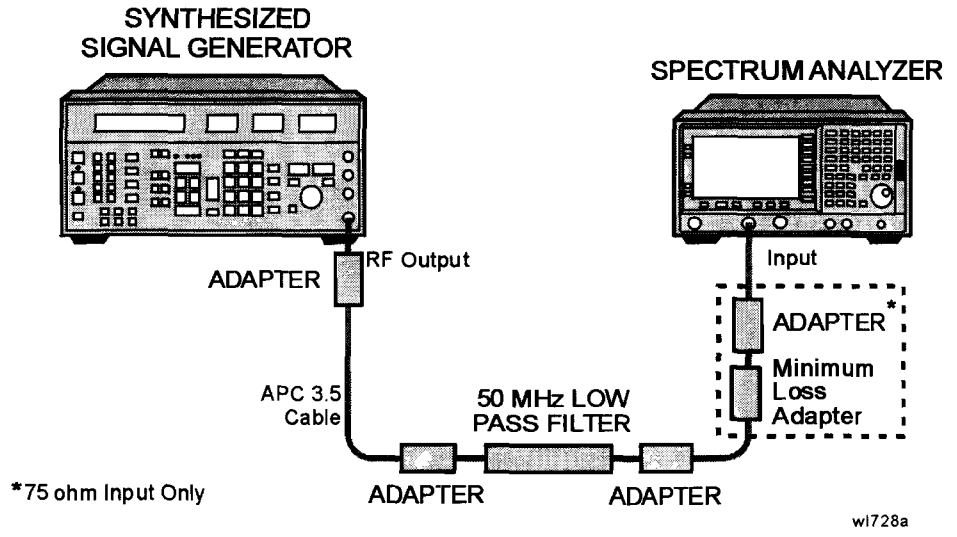

75 Ω Input only: Connect the minimum loss adapter between the LPF and INPUT 75 Ω.

3. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

   FREQUENCY, 40 MHz
   SPAN, 1 MHz
   AMPLITUDE, –10 dBm (50 Ω *Input only*)
   AMPLITUDE, 44 dBmV (75 Ω *Input only*)
   Attenuation Auto Man 10 dB
   BW/Avg, 30 kHz

4. Adjust the synthesized signal generator amplitude to place the peak of the signal at the reference level.

5. Set the analyzer control as follows:

   SPAN, 50 kHz
   BW/Avg, 1 kHz
   Video BW Auto Man, 100 Hz

6. Wait for two sweeps to finish, then press the following analyzer keys:

   Peak Search (or **Search**)
   Mkr →, Mkr → CF Step
   Marker, Delta
   FREQUENCY, ↑

7. Press **Peak Search** (or **Search**). The ΔMkr1 amplitude reading is the second harmonic suppression.

8. If the analyzer has a 50 Ω input, calculate the second harmonic intercept (SHI) using the second harmonic suppression value read in step 7 as follows:

   $$\text{SHI} = -20\ \text{dBm} - \text{Second Harmonic Suppression}$$

   For example, if the second harmonic suppression is –62 dB, the SHI would be 42 dBm:

   $$42\ \text{dBm} = -20\ \text{dBm} - (-62\ \text{dB})$$

9. If the analyzer has a 75 Ω input, calculate the second harmonic intercept (SHI) using the second harmonic suppression value read in step 7 as follows:

   $$\text{SHI} = 34\ \text{dBmV} - \text{Second Harmonic Suppression}$$

   For example, if the second harmonic suppression is –65 dB, the SHI would be 99 dBmV:

   $$99\ \text{dBmV} = 34\ \text{dBmV} - (-65\ \text{dB})$$

30. Spurious Responses: Agilent E4402B and E4403B

This test is performed in two parts. Part 1 measures third order intermodulation distortion; Part 2 measures second harmonic distortion.

To test second harmonic distortion, a low pass filter is used to filter the source output, ensuring that harmonics read by the analyzer are internally generated and not coming from the source. To measure the distortion products, the power at the mixer is set 25 dB higher than specified.

For example, the specification states that with –30 dBm at the input mixer, the distortion products should be suppressed by >75 dBc, the equivalent second harmonic intercept (SHI) is >45 dBm (–30 dBm + 75 dBc). Measuring with –15 dBm at the mixer and verifying the distortion products suppressed by >60 dBc also ensures the SHI is >45 dBm (–15 dBm + 60 dBc).

For third order intermodulation distortion, two signals are combined in a directional bridge to provide isolation. These two signals are applied to the analyzer input. The power level of the two signals is several dB higher than specified, so the distortion products should be suppressed by less than the amount specified. In this manner, the equivalent third order intercept (TOI) is measured.

For example, the specification states that with two –30 dBm signals at the input mixer, the distortion products should be suppressed by >82 dBc, which yields a third order intercept of >11 dBm (–30 dBm + (82 dBc/2)). Measuring with –20 dBm at the mixer and verifying the distortion products are suppressed by >62 dBc, the equivalent TOI is also >11 dBm (–20 dBm + (62 dBc/2)).

There are no related adjustment procedures for this performance test.

Equipment Required

Synthesized signal generator
Synthesized sweeper
Power meter, dual channel
RF power sensor
Power splitter
Directional bridge
300 MHz low pass filter
Cable, APC 3.5, 91-cm (2 required)
Cable, BNC, 120-cm
Adapter, Type-N (m) to APC 3.5 (f) *(3 required)*
Adapter, Type-N (m) to SMA (m)

Adapter, Type-N (m) to BNC (f)
Adapter, Type-N (m) to Type-N (m)
Adapter, SMA (f) to BNC (m)
Adapter, APC 3.5 (f) to APC 3.5 (f)

Procedure

This performance test consists of two parts:

Part 1: Third Order Intermodulation Distortion


Part 2: Second Harmonic Distortion

Perform Part 1 before Part 2.

Part 1: Third Order Intermodulation Distortion

1. Zero and calibrate the power meter and RF power sensor in log mode (power reads out in dBm), as described in the power meter operation manual.

Figure 2-44 Third Order Intermodulation Distortion Test Setup

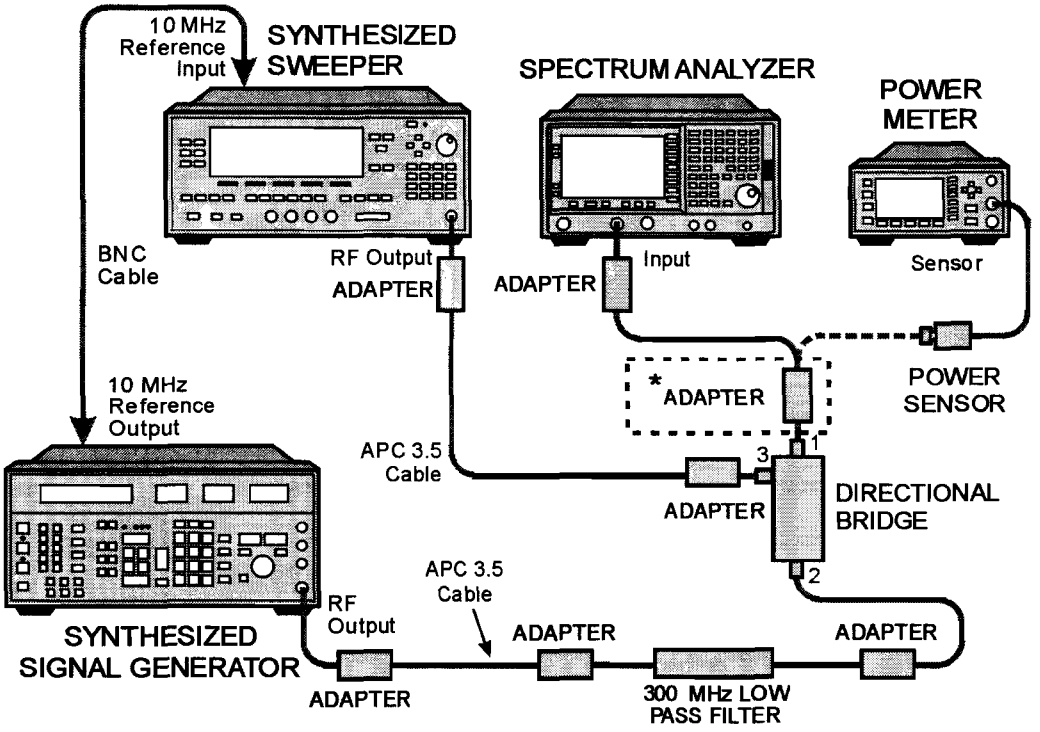

wl761a

2. Connect the equipment as shown in Figure 2-44 with the output of the directional bridge connected to the power sensor.

3. Perform step 4 through step 29 using the information and entries from Table 2-68. Then continue on with step 30 through step 38.

Table 2-68 Test Equipment Settings for TOI

TOI Test	F1 (MHz)	F2 (MHz)	Low Pass Filter (MHz)
1	300.0	300.05	300
Option 1DR	300.0	300.05	300

4. Press **Blue Key, Special, 0, 0** on the signal generator. Set the frequency to F1 in Table 2-68 for TOI Test 1. Set the amplitude to –10 dBm.
5. Press **PRESET** on the synthesized sweeper, and set the frequency to F2 in Table 2-68 for TOI Test 1. Set the synthesized sweeper controls as follows:

   POWER LEVEL, 4 dBm
   RF Off

6. Enter the power sensor calibration factor for the signal generator frequency into the power meter.
7. Adjust the amplitude of the signal generator until the power meter reads –12 dBm ±0.1 dB.
8. Disconnect the power sensor from the directional bridge. Connect the directional bridge directly to the analyzer input using an adapter (do not use a cable).

CAUTION Support the directional bridge and low pass filter to minimize stress on the analyzer input connector.

9. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System, Alignments, Auto Align, Off.** Set the analyzer center frequency to the F1 value for TOI Test 1 in Table 2-68. Then, set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, CF Step, 50 kHz (Man)
   SPAN, 20 kHz
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
   AMPLITUDE, Ref Level, –5 dBm
   AMPLITUDE, Attenuation, 5 dB (Man)
   BW/Avg, 1 kHz (Man)
   BW/Avg, Video BW, 300 Hz (Man)
   Peak Search (or **Search**), **More**
   Search Param, Peak Excursn, 3 dB

10. On the analyzer, press the following keys:

    Peak Search (or **Search**)
    Meas Tools
    Mkr → CF
    Delta

11. On the analyzer, press: **FREQUENCY**, ↑.

12. If the resolution bandwidth is ≥1 kHz, press: **SPAN**, **4 kHz**.

13. On the synthesized sweeper, set the RF on.

14. On the analyzer, press **Peak Search** (or **Search**).

15. On the synthesized sweeper, adjust the power level until the ΔMkr1 amplitude reads 0 dB ±0.05 dB.

16. On the analyzer, press **FREQUENCY**, ↓, ↓. The center frequency should now be lower than the signal generator frequency by the CF Step value.

17. Set the analyzer reference level to –15 dBm.

18. On the analyzer, press: **BW/Avg**, **Average**, **20**, and wait for "Vavg 20" to appear along the left side of the display.

19. On the analyzer, press **Peak Search** (or **Search**) and record the marker amplitude reading in Table 2-69 as the Lower Distortion Amplitude.

20. On the analyzer, press: **BW/Avg**, **Average Off**.

21. On the analyzer, press **FREQUENCY**, ↑, ↑, ↑. The center frequency should now be one CF Step value above the synthesized sweeper frequency.

22. Set the synthesized signal generator frequency to F2 as indicated in Table 2-68.

23. Set the synthesized sweep CW frequency to F1 as indicated in Table 2-68.

24. On the analyzer, press **BW/Avg**, **Average**, **20**, and wait for "Vavg 20" to appear along the left side of the display.

25. On the analyzer, press **Peak Search** (or **Search**) and record the marker amplitude reading in Table 2-69 as the Upper Distortion Amplitude.

26. On the analyzer, press **BW/Avg**, **Average Off**.

27. Of the Lower Distortion Amplitude and Upper Distortion Amplitudes recorded in Table 2-69, enter the most positive value as the Worst Distortion Amplitude in Table 2-69. For example, if the Upper Distortion Amplitude is –62 dBc and the Lower Distortion Amplitude is –63 dBc, enter –62 dBc as the Worst Distortion Amplitude.

28. Enter –17 dBm as the Mixer Level in Table 2-69 (–12 dBm input power –5 dB input attenuation).

29. Calculate the equivalent TOI by subtracting one half of the Worst Distortion Amplitude (in dB) from the Mixer Level (in dBm). Enter the result in Table 2-69 as the Calculated TOI. For example, if the Worst Distortion Amplitude is –62 dBc and the Mixer Level is –17 dBm, the Calculated TOI would be:

$$TOI = -17\ dBm - (-62\ dB/2) = -17\ dBm + 31\ dBm = +14\ dBm$$

Table 2-69 Third Order Intermodulation Distortion Worksheet

TOI Test	Lower Distortion Amplitude	Upper Distortion Amplitude	Worst Distortion Amplitude	Mixer Level	Calculated TOI
1					
Option 1DR					

30. If the analyzer is equipped with Option 1DR, Narrow Resolution Bandwidth, perform step 31 through step 36. Otherwise, continue with step 37.

31. Set synthesized signal generator frequency to F1 as indicated in Table 2-68 for TOI Test 1.

32. Set synthesized sweeper CW frequency to F2 as indicated in Table 2-68 for TOI Test 1.

33. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System, Alignments, Auto Align, Off.** Set the analyzer center frequency to the F1 value for TOI Test Option 1DR in Table 2-68. Then, set the analyzer by pressing the following keys:

    FREQUENCY, CF Step, 50 kHz (Man)
    SPAN, 20 kHz
    AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
    AMPLITUDE, Ref Level, –5 dBm
    AMPLITUDE, Attenuation, 5 dB (Man)
    BW/Avg, 1 kHz (Man)
    BW/Avg, Video BW, 300 Hz (Man)
    Peak Search (or **Search**), **More,**
    Search Param, Peak Excursn, 3 dB

34. On the analyzer, press the following keys:

    Peak Search (or **Search**)
    Meas Tools
    Mkr → CF

35.Set the analyzer as follows:

SPAN, 500 Hz
BW/Avg, Resolution BW, 30 Hz
Video BW, 10 Hz

36.Repeat step 10 through step 29. This is the TOI test for Option 1DR.

37.On the analyzer, press **System, Alignments, Auto Align, On.**

38.Part 1: Third Order Intermodulation Distortion is complete. Proceed to Part 2: Second Harmonic Distortion.

Part 2: Second Harmonic Distortion

1. Zero and calibrate the power meter and RF power sensor. Enter the power sensor 300 MHz calibration factor into the power meter.


Measuring the 300 MHz Frequency Response Error

2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

FREQUENCY, 300 MHz
SPAN, 10 MHz

3. Connect the equipment as shown in Figure 2-45, with the output of the synthesized sweeper connected to the power splitter input and the power splitter outputs connected to the analyzer and power sensor.

Figure 2-45 Second Harmonic Distortion Test Setup

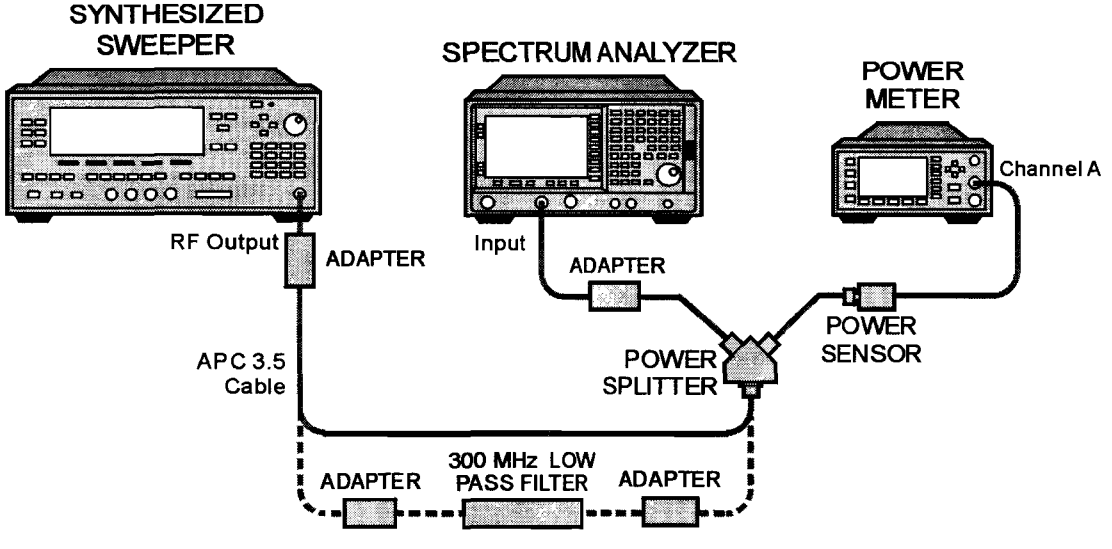

4. Preset the synthesized sweeper and set the controls as follows:

   CW, 300 MHz
   POWER LEVEL, 0 dBm

5. On the analyzer, press **Peak Search** (or **Search**), **Marker, Delta**.
6. Record the power meter reading at 300 MHz in Table 2-70.
7. Set the synthesized sweeper CW to 600 MHz.
8. On the analyzer, press **FREQUENCY, 600 MHz**, then **Peak Search** (or **Search**).
9. Adjust the synthesized sweeper power level until the ΔMkr1 amplitude reads 0 dB ±0.10 dB.
10. Enter the power sensor 600 MHz calibration factor into the power meter.
11. Record the power meter reading at 600 MHz in Table 2-70.
12. Subtract the power meter reading at 600 MHz from the power meter reading at 300 MHz. Record this difference as the 300 MHz Frequency Response Error in Table 2-70. For example, if the power meter reading at 600 MHz is –6.45 dBm and the power meter reading at 300 MHz is –7.05 dBm, the 300 MHz Frequency Response Error would be –0.60 dB:

$$-0.60\ \text{dB} = -7.05\ \text{dBm} - (-6.45\ \text{dBm})$$

Table 2-70 Second Harmonic Distortion Worksheet

Description	Measurement
Power Meter Reading at 300 MHz	_____ dBm
Power Meter Reading at 600 MHz	_____ dBm
300 MHz Frequency Response Error (FRE)	_____ dB

Measuring the 300 MHz Second Harmonic Distortion

1. Connect the equipment as shown in Figure 2-45 using the 300 MHz Low Pass Filter.
2. On the synthesized sweeper, press:

   CW, 300 MHz
   POWER LEVEL, –10 dBm

3. Enter the power sensor 300 MHz calibration factor into the power meter.

4. On the analyzer, press the following:

   FREQUENCY, 300 MHz
   SPAN, 100 kHz
   AMPLITUDE, Ref Level, –10 dBm
   AMPLITUDE, Attenuation, 10 dB (Man)
   BW/Avg, Resolution BW 1 kHz (Man)
   Video BW, 1 kHz (Man)
   Markers, Off

5. Adjust the synthesized sweeper power level until the power meter reading is –10 dBm ±0.2 dB.

6. On the analyzer, press the following:

   Peak Search (or **Search**), Marker, Delta
   FREQUENCY, 600 MHz
   BW/Avg, 10

   Wait for the "Vavg 10" to appear along the left side of the display.

7. On the analyzer, press **Peak Search** (or **Search**). The ΔMkr1 amplitude is the second harmonic suppression.

8. Calculate the 300 MHz Second Harmonic Intercept (SHI) using the second harmonic suppression value read in step 7 and the 300 MHz Frequency Response Error (FRE) from Table 2-70 as follows:

300 MHz SHI = –20 dBm – Second Harmonic Suppression + 300 MHz FRE

For example, if the second harmonic suppression is –59 dB, and the 300 MHz FRE is –0.60 dB, the SHI would be 38.4 dBm:

38.4 dBm = –20 dBm – (–59 dB) + (–0.60 dB)

9. On the synthesized sweeper, press **Marker, Off**.

31. Spurious Responses: Agilent E4404B, E4405B, E4407B, and E4408B

This test is performed in two parts. Part 1 measures third order intermodulation distortion. Part 2 measures second harmonic distortion.

To test second harmonic distortion, a low pass filter is used to filter the source output, ensuring that harmonics read by the analyzer are internally generated and not coming from the source. To measure the distortion products, the power at the mixer is set 25 dB higher than specified.

A power meter, power sensor, and power splitter are used to characterize the frequency response of the analyzer so this uncertainty can be eliminated.

For example, the specification states that with –30 dBm at the input mixer, the distortion products should be suppressed by >75 dBc, the equivalent second harmonic intercept (SHI) is >45 dBm (–30 dBm + 75 dBc). Measuring with –15 dBm at the mixer and verifying the distortion products suppressed by >60 dBc also ensures the SHI is >45 dBm (–15 dBm + 60 dBc).

For third order intermodulation distortion, two signals are combined in a directional bridge or directional coupler to provide isolation. These two signals are applied to the analyzer input. The power level of the two signals is several dB higher than specified, so the distortion products should be suppressed by less than the amount specified. In this manner, the equivalent third order intercept (TOI) is measured.

For example, the specification states that with two –30 dBm signals at the input mixer, the distortion products should be suppressed by >75 dBc, which yields a third order intercept of >7.5 dBm (–30 dBm + (75 dBc/2)). Measuring with –20 dBm at the mixer and verifying the distortion products are suppressed by >55 dBc, the equivalent TOI is also >7.5 dBm (–20 dBm + (55 dBc/2)).

There are no related adjustment procedures for this performance test.

Equipment Required

Synthesized sweeper (2 required)
Power meter, dual channel
Microwave power sensor
Microwave power splitter
Directional bridge
Directional coupler
300 MHz low pass filter
1 GHz low pass filter

1.8 GHz low pass filter *(2 required)*
4.4 GHz low pass filter *(2 required)*
Cable, BNC, 120-cm (48-in)
Cable, APC 3.5, 91-cm (48-in) *(2 required)*
Adapter, Type-N (m) to APC 3.5 (f) *(3 required)*
Adapter, Type-N (m) to SMA (m)
Adapter, Type-N (m) to BNC (f)
Adapter, Type-N (m) to Type-N (m)
Adapter, SMA (f) to BNC (m)
Adapter, APC 3.5 (f) to APC 3.5 (f)

Procedure

This performance test consists of two parts:

Part 1: Third Order Intermodulation Distortion


Part 2: Second Harmonic Distortion

Perform Part 1 before Part 2.

Part 1: Third Order Intermodulation Distortion

1. Zero and calibrate the power meter and microwave power sensor in log mode (power reads out in dBm), as described in the power meter operation manual.

Figure 2-46 Third Order Intermodulation Distortion Test Setup

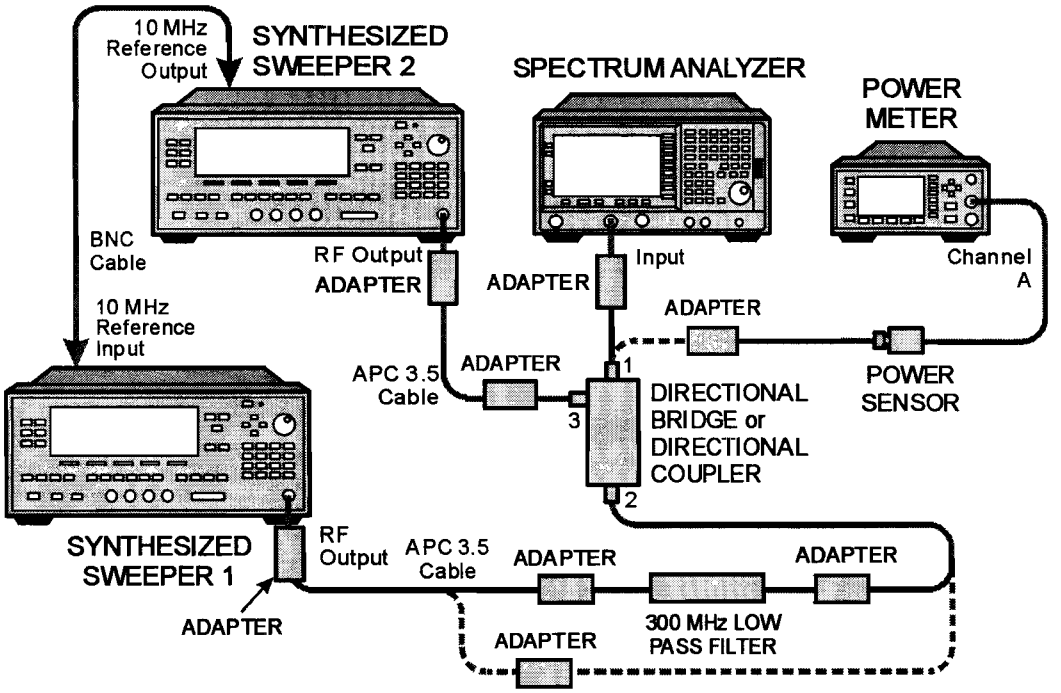

wl725a

2. Connect the equipment as shown in Figure 2-46 using the 300 MHz low pass filter with the output of the directional bridge connected to the power sensor.
3. Perform step 4 through step 29 using the information and entries from Table 2-71. Then continue on with step 31 through step 43.

Table 2-71 Test Equipment Settings for TOI

TOI Test	F1 (MHz)	F2 (MHz)	Low Pass Filter (MHz)	Bridge or Coupler	Presel Center
1	300.0	300.05	300	Bridge	No
Option 1DR	300.0	300.05	300	Bridge	No
2	5000.0	5000.05	None	Coupler	Yes
3	8000.0	8000.05	None	Coupler	Yes

4. Press **PRESET** on synthesized sweeper 1. Set the CW frequency to F1 as indicated in Table 2-71, and set the power level to –10 dBm.
5. Press **PRESET** on synthesized sweeper 2. Set the CW frequency to F2 as indicated in Table 2-71, and set the controls as follows:

   POWER LEVEL, 4 dBm
   RF Off

6. Enter the power sensor calibration factor for F1 into the power meter.
7. Adjust the power level of synthesized sweeper 1 until the power meter reads –12 dBm ±0.1 dB.
8. Disconnect the power sensor from the directional bridge (or directional coupler). Connect the directional bridge (or directional coupler) directly to the analyzer input using an adapter (do not use a cable).

CAUTION Support the directional bridge (or directional coupler) and low pass filter to minimize stress on the analyzer input connector.

9. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System, Alignments, Auto Align, Off.** Set the analyzer to the F1 value for TOI Test 1 in Table 2-68. Then set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, CF Step, 50 kHz (Man)
   SPAN, 20 kHz
   AMPLITUDE, Ref Level, –5 dBm
   AMPLITUDE, Attenuation, 5 dB (Man)

BW/Avg, 1 kHz (Man)
BW/Avg, Video BW, 300 Hz (Man)
Peak Search (or **Search**), **More**
Search Param, Peak Excursn, 3 dB

10. On the analyzer, press the following keys:

Peak Search (or **Search**)
Meas Tools
Mkr → CF
Delta

11. On the analyzer, Press **FREQUENCY**, ↑. The center frequency should now be equal to synthesized sweeper 2 frequency.

12. If the resolution bandwidth is ≥1 kHz, press **SPAN, 4 kHz.**

13. On the synthesized sweeper 2, set the RF On.

14. On the analyzer, press **Peak Search** (or **Search**).

15. Adjust the power level of synthesized sweeper 2 until the ΔMkr1 amplitude reads 0 dB ±0.05 dB.

16. On the analyzer, press **FREQUENCY**, ↓, ↓. The center frequency should now be lower than synthesized sweeper 1 by the CF Step value.

17. Set the analyzer reference level to –15 dBm.

18. On the analyzer, press **BW/Avg, Average, 20**, and wait for "Vavg 20" to appear along the left side of the display.

19. On the analyzer, press **Peak Search** (or **Search**) and record the marker amplitude reading in Table 2-72 as the Lower Distortion Amplitude.

20. On the analyzer, press **BW/Avg, Average Off**.

21. On the analyzer, press **FREQUENCY**, ↑, ↑, ↑. The center frequency should now be one CF Step value above synthesized sweeper 2 frequency.

22. Set synthesized sweeper 1 CW to F2 as indicated in Table 2-71.

23. Set synthesized sweeper 2 CW to F1 as indicated in Table 2-71.

24. On the analyzer, press **BW/Avg, Average, 20**, and wait for "Vavg 20" to appear along the left side of the display.

25. On the analyzer, press **Peak Search** (or **Search**) and record the marker amplitude reading in Table 2-72 as the Upper Distortion Amplitude.

26. On the analyzer, press **BW/Avg, Average Off**.

27. Of the Lower Distortion Amplitude and Upper Distortion Amplitudes recorded in Table 2-72, enter the most positive value as the Worst Distortion Amplitude in Table 2-72. For example, if the Upper Distortion Amplitude is –62 dBc and the Lower Distortion Amplitude is –63 dBc, enter –62 dBc as the Worst Distortion Amplitude.

28. Enter –17 dBm as the Mixer Level in Table 2-72 (–12 dBm input power – 5 dB input attenuation).

29. Calculate the equivalent TOI by subtracting one half of the Worst Distortion Amplitude (in dB) from the Mixer Level (in dBm). Enter the result in Table 2-72 as the Calculated TOI. For example, if the Worst Distortion Amplitude is –62 dBc and the Mixer Level is –17 dBm, the Calculated TOI would be:

$$TOI = -17\ dBm - (-62\ dB/2) = -17\ dBm + 31\ dBm = +14\ dBm$$

30. Record the Calculated TOI in the performance verification test record as specified in Table 2-72.

Table 2-72 Third Order Intermodulation Distortion Worksheet

TOI Test	Lower Distortion Amplitude	Upper Distortion Amplitude	Worst Distortion Amplitude	Mixer Level	Calculated TOI Test Record Entry
1					**1**
Option 1DR					**2**
2					**3**
3					**4**

31. If the analyzer is equipped with Option 1DR, Narrow Resolution Bandwidth, perform step 32 through step 36. Otherwise, continue with step 37.

32. Set synthesized sweeper 1 CW frequency to F1 as indicated in TOI Test 1 of Table 2-71.

33. Set synthesized sweeper 2 CW frequency to F2 as indicated in TOI Test 1 of Table 2-71.

34. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System, Alignments, Auto Align, Off.** Set the analyzer center frequency to the F1 value for TOI Test Option 1DR in Table 2-71. Then, set the analyzer by pressing the following keys:

FREQUENCY, CF Step, 50 kHz (Man)
SPAN, 20 kHz

AMPLITUDE, Ref Level, –5 dBm
AMPLITUDE, Attenuation, 5 dB (Man)
BW/Avg, 1 kHz (Man)
BW/Avg, Video BW, 300 Hz (Man)
Peak Search (or **Search**), **More**
Search Param, Peak Excursn, 3 dB

35. On the analyzer, press the following keys:

Peak Search (or **Search**)
Meas Tools
Mkr → CF
SPAN, 500 Hz
BW/Avg, Resolution BW, 30 Hz
BW/Avg, Video BW, 10 Hz

36. Repeat step 9 through step 26. This is the TOI test for Option 1DR.

37. Replace the directional bridge with the directional coupler. The cable from synthesized sweeper 1 should be connected directly to the input of the directional coupler; no low pass filter is required when testing frequencies >3 GHz. See Figure 2-46.

38. Connect the output of the directional coupler to the power sensor.

39. Repeat step 4 through step 29 using information and entries for TOI Test 2 in Table 2-71 and Table 2-72.

40. Connect the output of the directional bridge to the power sensor.

41. Repeat step 4 through step 29 using information and entries for TOI Test 3 in Table 2-71 and Table 2-72.

42. On the analyzer, press **System, Alignments, Auto Align, All.**

43. Part 1: Third Order Intermodulation Distortion is complete. Proceed to Part 2: Second Harmonic Distortion.

Part 2: Second Harmonic Distortion

1. Zero and calibrate the power meter and microwave power sensor. Enter the power sensor 300 MHz calibration factor into the power meter.

Measuring the Noise Level at 6.2 GHz

2. Remove any cables or adapters from the analyzer Input.

3. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

FREQUENCY, 6.2 GHz
SPAN, 0 Hz
AMPLITUDE, Ref Level, –40 dBm
AMPLITUDE, Attenuation, 10 dB

BW/Ave, Resolution BW 1 kHz
Video BW, 30 Hz
Sweep, Sweep time, 5 s

4. Wait until "VAvg 10" is displayed along the left side of the display.
5. Press **Peak Search** (or **Search**) and record the marker amplitude reading as the 6.2 GHz Noise Level in Table 2-73.


Measuring 300 MHz Frequency Response Error

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

   FREQUENCY, 300 MHz
   SPAN, 10 MHz

2. Connect the equipment as shown in Figure 2-47, with the output of the synthesized sweeper connected to the power splitter input and the power splitter outputs connected to the analyzer and power sensor.

Figure 2-47 Second Harmonic Distortion Test Setup

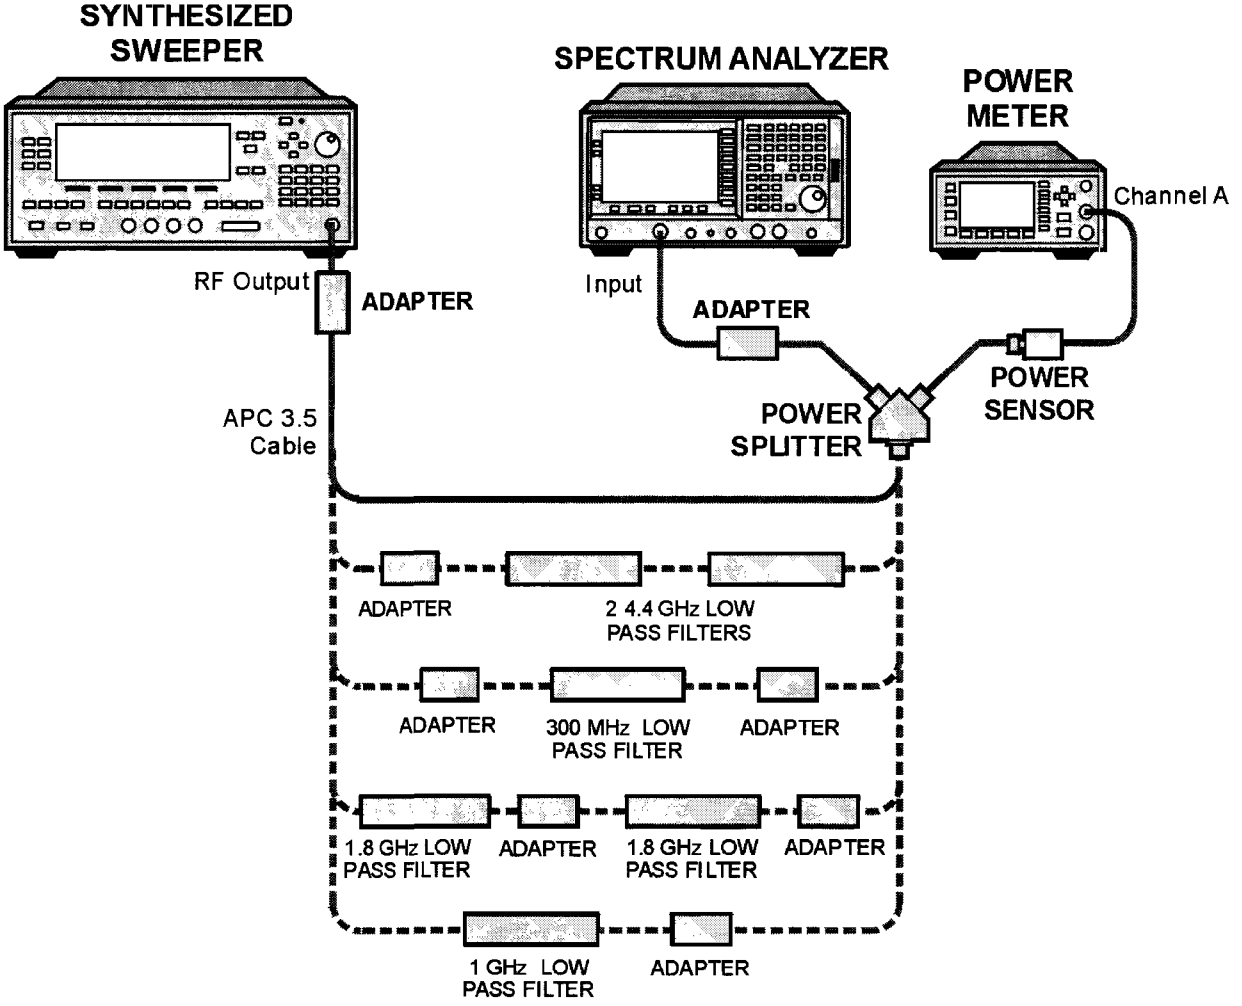

3. Preset the synthesized sweeper and set the controls as follows:

   CW, 300 MHz
   POWER LEVEL, 0 dBm

4. On the analyzer, press **Peak Search** (or **Search**), **Marker, Delta**.
5. Record the power meter reading at 300 MHz in Table 2-73.
6. Set the synthesized sweeper CW to 600 MHz.
7. On the analyzer, press **FREQUENCY, 600 MHz**, then **Peak Search** (or **Search**).
8. Adjust the synthesized sweeper power level until the ΔMkr1 amplitude reads 0 dB ±0.10 dB.
9. Enter the power sensor 600 MHz calibration factor into the power meter.
10. Record the power meter reading at 600 MHz in Table 2-73.
11. Subtract the power meter reading at 600 MHz from the power meter reading at 300 MHz. Record this difference as the 300 MHz Frequency Response Error in Table 2-73. For example, if the power meter reading at 600 MHz is –6.45 dBm and the power meter reading at 300 MHz is –7.05 dBm, the 300 MHz Frequency Response Error would be –0.60 dB:

$$-0.60 \text{ dB} = -7.05 \text{ dBm} - (-6.45 \text{ dBm})$$

Measuring 900 MHz Frequency Response Error

12. On the synthesized sweeper, press the following:

    CW, 900 MHz
    POWER LEVEL, 0 dBm

13. On the analyzer, press **FREQUENCY, 900 MHz**.
14. Enter the power sensor 1 GHz calibration factor into the power meter.
15. On the analyzer, press

    Marker, Off
    Peak Search (or **Search**).
    Marker, Delta

16. Record the power meter reading in Table 2-73 as the 900 MHz power meter reading.
17. On the synthesized sweeper, press **CW, 1.8 GHz**.

18. On the analyzer, press the following:

    FREQUENCY, 1.8 GHz
    Peak Search (or **Search**)
    AMPLITUDE
    Presel Center

19. On the analyzer, press **Peak Search** (or **Search**).

20. Adjust the synthesized sweeper power level until the ΔMkr1 amplitude reads 0 dB ±0.1 dB.

21. Enter the power sensor 2 GHz calibration factor into the power meter.

22. Record the power meter reading in Table 2-73 as the 1.8 GHz power meter reading.

23. On the analyzer, press **Marker, Off**.

24. Subtract the power meter reading at 1.8 GHz from the power meter reading at 900 MHz. Record this difference as the 900 MHz Frequency Response Error in Table 2-73. For example, if the power meter reading at 1.8 GHz is –6.35 dBm and the power meter reading at 900 MHz is –7.05 dBm, the 900 MHz Frequency Response Error would be –0.7 dB:

$$-0.70 \text{ dB} = -7.05 \text{ dBm} - (-6.35 \text{ dBm})$$

Measuring 1.55 GHz Frequency Response Error

1. On the synthesized sweeper, press the following:

   CW, 1.55 GHz
   POWER LEVEL, 0 dBm

2. On the analyzer, press **FREQUENCY, 1.55 GHz**.

3. Enter the power sensor 2 GHz calibration factor into the power meter.

4. On the analyzer, press the following:

   Marker, Off
   Peak Search (or **Search**)
   AMPLITUDE
   Presel Center

5. On the analyzer, press **Peak Search** (or **Search**), **Marker, Delta**.

6. Record the power meter reading in Table 2-73 as the 1.55 GHz power meter reading.

7. On the synthesized sweeper, press **CW, 3.1 GHz**.

8. On the analyzer, press **FREQUENCY, 3.1 GHz**.

9. On the analyzer, press the following:

   Peak Search (or **Search**)
   AMPLITUDE
   Presel Center

10. On the analyzer, press **Peak Search** (or **Search**).

11. Adjust the synthesized sweeper power level until the ΔMkr1 amplitude reads 0 dB ±0.1 dB.

12. Enter the power sensor 3 GHz calibration factor into the power meter.

13. Record the power meter reading in Table 2-73 as the 3.1 GHz power meter reading.

14. On the analyzer, press **Marker, Off**.

15. Subtract the power meter reading at 3.1 GHz from the power meter reading at 1.55 GHz. Record this difference as the 1.55 GHz Frequency Response Error in Table 2-73. For example, if the power meter reading at 3.1 GHz is –6.05 dBm and the power meter reading at 1.55 GHz is –7.35 dBm, the 3.1 GHz Frequency Response Error would be –1.2 dB:

$$-1.2\ \text{dB} = -7.35\ \text{dBm} - (-6.15\ \text{dBm})$$

Measuring 3.1 GHz Frequency Response Error

1. On the synthesized sweeper, press the following:

   CW, 3.1 GHz
   POWER LEVEL, 0 dBm

2. On the analyzer, press **FREQUENCY, 3.1 GHz**.

3. Enter the power sensor 3 GHz calibration factor into the power meter.

4. On the analyzer, press the following:

   Marker, Off
   Peak Search (or **Search**)
   AMPLITUDE
   Presel Center

5. On the analyzer, press **Peak Search** (or **Search**), **Marker, Delta**.

6. Record the power meter reading in Table 2-73 as the 3.1 GHz power meter reading.

7. On the synthesized sweeper, press **CW, 6.2 GHz**.

8. On the analyzer, press the following:

   FREQUENCY, 6.2 GHz
   Peak Search (or **Search**)
   AMPLITUDE
   Presel Center

9. On the analyzer, press **Peak Search** (or **Search**).

10. Adjust the synthesized sweeper power level until the ΔMkr1 amplitude reads 0 dB ±0.1 dB.

11. Enter the power sensor 6 GHz calibration factor into the power meter.

12. Record the power meter reading in Table 2-73 as the 6.2 GHz power meter reading.

13. On the analyzer, press **Marker, Off**.

14. Subtract the power meter reading at 6.2 GHz from the power meter reading at 3.1 GHz. Record this difference as the 3.1 GHz Frequency Response Error in Table 2-73. For example, if the power meter reading at 6.2 GHz is –6.05 dBm and the power meter reading at 3.1 GHz is –7.25 dBm, the 3.1 GHz Frequency Response Error would be –1.2 dB:

$$-1.2\ \text{dB} = -7.25\ \text{dBm} - (-6.05\ \text{dBm})$$

Table 2-73 Second Harmonic Distortion Worksheet

Description	Measurement
6.2 GHz Noise Level	_____ dBm
Power Meter Reading at 300 MHz	_____ dBm
Power Meter Reading at 600 MHz	_____ dBm
300 MHz Frequency Response Error (FRE)	_____ dB
Power Meter Reading at 900 MHz	_____ dBm
Power Meter Reading at 1.8 GHz	_____ dBm
900 MHz Frequency Response Error (FRE)	_____ dB
Power Meter Reading at 1.55 GHz	_____ dBm
Power Meter Reading at 3.1 GHz	_____ dBm
1.55 GHz Frequency Response Error (FRE)	_____ dB
Power Meter Reading at 3.1 GHz	_____ dBm
Power Meter Reading at 6.2 GHz	_____ dBm
3.1 GHz Frequency Response Error (FRE)	_____ dB

Measuring 300 MHz Second Harmonic Distortion

1. Connect the equipment as shown in Figure 2-47 using the 300 MHz Low Pass Filter.
2. On the synthesized sweeper, press the following:

   CW, 300 MHz
   POWER LEVEL, –10 dBm
3. Enter the power sensor 300 MHz calibration factor into the power meter.
4. On the analyzer, press the following:

   FREQUENCY, 300 MHz
   SPAN, 100 kHz
   AMPLITUDE, Ref Level, –10 dBm
   AMPLITUDE, Attenuation, 10 dB (Man)
   BW/Avg, Resolution BW 1 kHz (Man)
   Video BW, 1 kHz (Man)
   Markers, Off
5. Adjust the synthesized sweeper power level until the power meter reading is –10 dBm ±0.2 dB.
6. On the analyzer, press the following:

   Peak Search (or **Search**), Marker, Delta
   FREQUENCY, 600 MHz
   BW/Avg, 10

   Wait for the "VAvg 10" to appear along the left side of the display.
7. On the analyzer, press **Peak Search** (or **Search**). The ΔMkr1 amplitude is the second harmonic suppression.
8. Calculate the 300 MHz Second Harmonic Intercept (SHI) using the second harmonic suppression value read in step 7 and the 300 MHz Frequency Response Error (FRE) from Table 2-73 as follows:

300 MHz SHI = –20 dBm – Second Harmonic Suppression + 300 MHz FRE

For example, if the second harmonic suppression is –59 dB, and the 300 MHz FRE is –0.60 dB, the SHI would be 38.4 dBm:

$$38.4 \text{ dBm} = -20 \text{ dBm} - (-59 \text{ dB}) + (-0.60 \text{ dB})$$

9. Record the 300 MHz SHI as Entry 5 in the performance verification test record.

Measuring 900 MHz Second Harmonic Distortion

1. Replace the 300 MHz low pass filter with the 1 GHz low pass filters as shown in Figure 2-47.
2. On the synthesized sweeper, press the following:

   CW, 900 MHz
   POWER LEVEL, –10 dBm
3. Enter the power sensor 1 GHz calibration factor into the power meter.
4. On the analyzer, press **FREQUENCY, Center Freq, 900 MHz**.
5. On the analyzer, press **Peak Search** (or **Search**).
6. Adjust the synthesized sweeper power level until the power meter reading is –10 dBm ±0.1 dB.
7. On the analyzer, press the following:

   Peak Search (or **Search**)
   Marker, Delta
   FREQUENCY, Center Freq, 1.8 GHz
8. On the analyzer, press the following:

   AMPLITUDE, Ref Level, –20 dBm
   Video BW, 30 Hz (Man)
9. On the analyzer, press **BW/Avg, Average, 10 Hz**. Wait until "VAvg 10" is displayed along the left side of the display.
10. On the analyzer, press **Peak Search** (or **Search**). The ΔMkr1 amplitude reading is the second harmonic suppression.
11. Calculate the 900 MHz Second Harmonic Intercept (SHI) using the second harmonic suppression value read in step 10 and the 300 MHz Frequency Response Error (FRE) from Table 2-73 as follows:

900 MHz SHI = –20 dBm – Second Harmonic Suppression + 900 GHz FRE

For example, if the second harmonic suppression is –73 dB, and the 900 MHz FRE is 0.70 dB, the SHI would be 52.3 dBm:

52.3 dBm = –20 dBm–(–73 dB) + (–0.70 dB)

12. Record the 900 MHz SHI as Entry 6 in the performance verification test record.

Measuring 1.55 GHz Second Harmonic Distortion

1. Replace the 1.GHz low pass filter with the two 1.8 GHz low pass filters as shown in Figure 2-47. Two filters are necessary to reduce the second harmonics from the source to less than –100 dBc.
2. On the synthesized sweeper, press the following:

   CW, 1.55 GHz
   POWER LEVEL, 6 dBm
3. Enter the power sensor 2 GHz calibration factor into the power meter.
4. On the analyzer, press the following:

   FREQUENCY, 1.55 GHz
   AMPLITUDE, Ref Level, 0 dBm
   AMPLITUDE, Attenuation, 10 dB (Man)
   Peak Search (or **Search**).
5. Adjust the synthesized sweeper power level until the power meter reading is 0 dBm ±0.1 dB.
6. On the analyzer, press the following:

   Peak Search (or **Search**)
   Marker, Delta
   FREQUENCY, Center Freq, 3.1 GHz
7. Remove the 1.8 GHz low pass filters and connect the synthesized sweeper output directly to the power splitter input. See Figure 2-47.
8. On the analyzer, press the following:

   Peak Search (or **Search**)
   AMPLITUDE
   Presel Center
9. Reinstall the filters between the synthesized sweeper and the power splitter.
10. On the analyzer, press the following:

    AMPLITUDE, Ref Level, –40 dBm
    Video BW, 30 Hz (Man)
11. On the analyzer, press **BW/Avg, Average, 10 Hz**. Wait until "VAvg 10" is displayed along the left side of the display.
12. On the analyzer, press **Peak Search** (or **Search**). The ΔMkr1 amplitude reading is the second harmonic suppression.

13. Calculate the 1.55 GHz Second Harmonic Intercept (SHI) using the second harmonic suppression value read in step 12 and the 300 MHz Frequency Response Error (FRE) from Table 2-73 as follows:

1.55 GHz SHI = –10 dBm – Second Harmonic Suppression + 1.55 GHz FRE

For example, if the second harmonic suppression is –93 dB, and the 1.55 GHz FRE is –1.05 dB, the SHI would be 81.95 dBm:

81.95 dBm = –10 dBm–(–93 dB) + (–1.05 dB)

14. Record the 1.55 GHz SHI as Entry 7 in the performance verification test record.

Measuring 3.1 GHz Second Harmonic Distortion

1. Replace the 300 MHz low pass filter with the two 4.4 GHz low pass filters as shown in Figure 2-47. Two filters are necessary to reduce the second harmonics from the source to less than –110 dBc.
2. On the synthesized sweeper, press the following:

   CW, 3.1 GHz
   POWER LEVEL, 6 dBm
3. Enter the power sensor 3 GHz calibration factor into the power meter.
4. On the analyzer, press the following:

   FREQUENCY, 3.1 GHz
   AMPLITUDE, Ref Level, 0 dBm
   AMPLITUDE, Attenuation, 10 dB (Man)
5. On the analyzer, press the following:

   Peak Search (or **Search**)
   AMPLITUDE
   Presel Center
6. Adjust the synthesized sweeper power level until the power meter reading is 0 dBm ±0.1 dB.
7. On the analyzer, press the following:

   Peak Search (or **Search**)
   Marker
   Delta
8. On the analyzer, press the following:

   FREQUENCY
   Center Freq, 6.2 GHz

9. Remove the 4.4 GHz low pass filters and connect the synthesized sweeper output directly to the power splitter input. See Figure 2-47.

10. On the analyzer, press the following:

    Peak Search (or **Search**)
    AMPLITUDE
    Presel Center

11. Reinstall the filters between the synthesized sweeper and the power splitter.

12. On the analyzer, press the following:

    AMPLITUDE, Ref Level, –40 dBm
    Video BW, 30 Hz (Man)

13. On the analyzer, press **BW/Avg, Average, 10 Hz**. Wait until "VAvg 10" is displayed along the left side of the display.

14. On the analyzer, press **Peak Search** (or **Search**). The ΔMkr1 amplitude reading is the second harmonic suppression.

15. If the marker does not appear to be on a signal, do the following:

    a. Press **Marker, Select Marker (2)**

    b. Compare the Mkr2 and the 6.2 GHz Noise Level recorded in Table 2-73.

    c. If the difference between Mkr2 and the 6.2 GHz Noise Level recorded in Table 2-73 is less than 2 dB, check the box on the performance verification test record that the 3.1 GHz SHI test was noise limited.

16. If the measurement is not noise limited, calculate the 3.1 GHz Second Harmonic Intercept (SHI) using the second harmonic suppression value read in step 14 and the 3.1 GHz Frequency Response Error (FRE) from Table 2-73 as follows:

    3.1 GHz SHI = –10 dBm – Second Harmonic Suppression + 3.1 GHz FRE

    For example, if the second harmonic suppression is –103 dB, and the 3.1 GHz FRE is –1.20 dB, the SHI would be 91.8 dBm:

    $$91.8 \text{ dBm} = -10 \text{ dBm} - (-103 \text{ dB}) + (-1.20 \text{ dB})$$

17. Record the 3.1 GHz SHI as Entry 8 in the performance verification test record.

32. Gain Compression: Agilent E4401B, E4402B, E4403B, and E4411B

This test verifies the ability of the analyzer to measure relatively low-amplitude signals in the presence of higher-amplitude signals. Gain compression is measured by applying two signals, separated by a defined amount in frequency. The higher-amplitude signal is set to yield the specified total power at the input mixer (the power at the input mixer is defined as the input power level minus the input attenuation). The lower-amplitude signal is set at least 35 dB below the higher-amplitude signal, such that its power does not significantly add to the total power. The higher-amplitude signal is turned off and the lower-amplitude signal level is measured. This is the uncompressed amplitude.

The higher-amplitude signal is turned on and the amplitude of the lower-amplitude signal is again measured. This is the compressed amplitude. The difference between the uncompressed and compressed amplitude is the measured gain compression.

There are no adjustments related to this performance test.

Equipment Required

Synthesized sweeper
Synthesized signal generator
Power meter, dual channel
RF power sensor
Directional bridge
Cable, BNC, 120-cm (48-in)
Cable, APC 3.5 (m) (*2 required*)
Adapter, Type-N (m) to Type-N (m)
Adapter, Type-N (m) to APC 3.5 (f) (3 *required*)
Adapter, Type-N (m) to SMA (m)

Additional Equipment for 75 Ω Input

Power sensor, 75 Ω
Adapter, Type-N (m), to BNC (m), 75 Ω
Adapter, mechanical, Type-N (m), 50 Ω to Type-N (f), 75 Ω


Procedure

1. Zero and calibrate the power meter and power sensor combination in log mode (power reads out in dBm) as described in the power meter operation manual.

2. Connect the equipment as shown in Figure 2-48, with port 1 of the directional bridge connected to the power sensor.

   75 Ω Input only: Use the 75 Ω power sensor with the mechanical adapter. The power measured at the output of the 50 Ω directional bridge by the 75 Ω power sensor is the equivalent power "seen" by the 75 Ω analyzer.

Figure 2-48 Gain Compression Test Setup

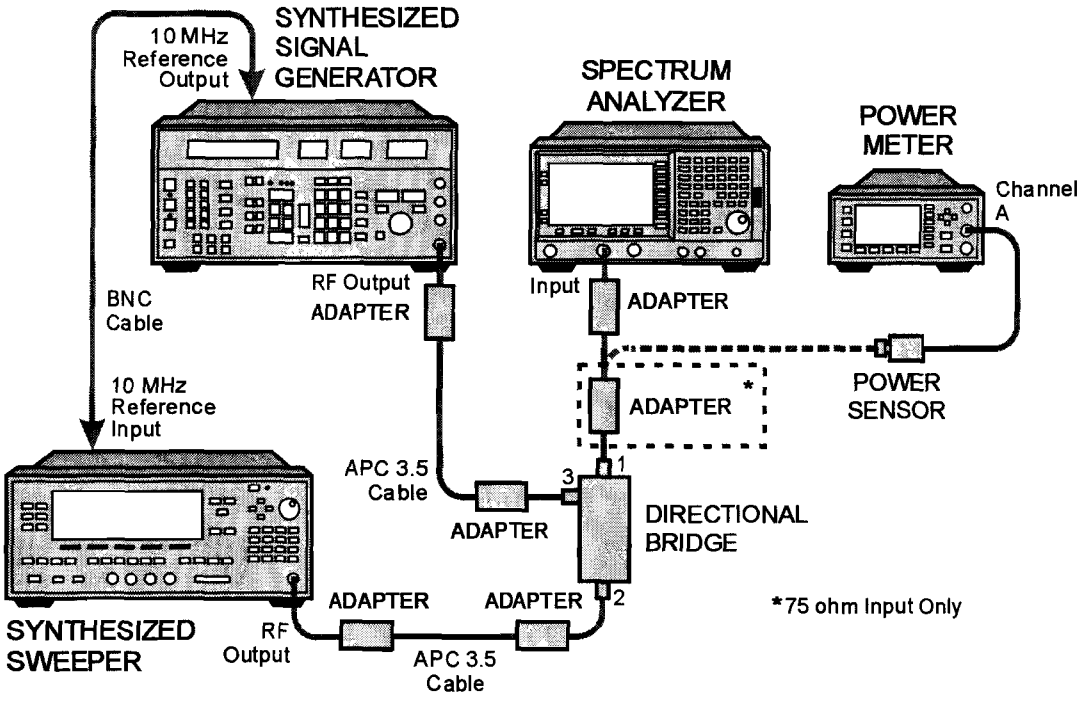

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω connectors, or damage to the connectors will occur.

3. Set the synthesized signal generator controls as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, –100 dBm

4. On the synthesized sweeper press **INSTRUMENT PRESET**, then set the controls as follows:

   CW, 53 MHz
   POWER LEVEL, –3 dBm

5. Enter the power sensor calibration factor for the synthesizer frequency into the power meter.

6. Adjust the synthesized sweeper power level setting until the power meter reading is the same as indicated in Table 2-74.
7. Record the actual synthesized sweeper power level setting in Table 2-74 for each frequency indicated.

Table 2-74 Source Frequency and Amplitude Settings

Synthesized Signal Generator		Synthesized Sweeper		
Frequency (GHz)	Amplitude (dBm)	CW Frequency (MHz)	Desired Power Level (dBm)	Actual Power Level (dBm)
0.05	–40	53	0.0	
0.05	–40	50.004	0.0	
1.40	–40	1403	0.0	
2.50[a]	–40[a]	2503[a]	0.0[a]	

a. E4402B and E4403B only.

Table 2-75 Analyzer Settings

Test Frequency	Analyzer							Test Record Entry
(MHz)	Center Freq (GHz)	Span (kHz)	RBW (kHz)	VBW (kHz)	Ref Lvl (dBm)	Scale (dB)	Atten (dB)	
53	0.05	150	30	0.300	–10.0	10	0.0	**1**
50.004[a]	0.05[a]	1.0[a]	0.030[a]	0.030[a]	–10.0[a]	10[a]	0.0[a]	**2**
1403	1.40	150	30	0.300	–10.0	10	0.0	**3**
2503[b]	2.50[b]	150[b]	30[b]	0.300[b]	–10.0[b]	10[b]	0.0[b]	**4**

a. Option 1DR only.
b. E4402B and E4403B only.

8. Repeat step 3 through step 7 for each of the settings listed in Table 2-74.
9. Disconnect the power sensor from the directional bridge and connect the directional bridge to the input of the analyzer using an adapter. Do not use a cable.

   75 Ω *Input only: Use a 75 Ω adapter, Type-N (m) to BNC (m) and a mechanical adapter, Type-N (m) 50 Ω to Type-N (f) 75 Ω*
10. Set the synthesized sweeper amplitude Off.

11. Set the synthesized signal generator amplitude to –24 dBm.

12. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System, Alignments, Auto Align, Off.** Set the analyzer by pressing the following keys:

    Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
    FREQUENCY, Center Freq, 50 MHz (*or as indicated in* Table 2-75)
    SPAN, 150 kHz (*or as indicated in* Table 2-75)
    AMPLITUDE, More 1 of 2, Y Axis Units (or **Amptd Units**), **dBm**
    AMPLITUDE, Ref Level, –10 dBm, Attenuation 0 dB
    AMPLITUDE, Scale/Div, 10 dB
    BW/Avg, Resolution BW, 30 kHz (*or as indicated in* Table 2-75)
    BW/Avg, Video BW, 300 Hz (*or as indicated in* Table 2-75)

13. On the synthesized sweeper, set the appropriate power level to the setting recorded in Table 2-74. Then set RF to Off.

    75 Ω *Input only: Adjust the power level for a 2.0 dBm reading.*

14. On the analyzer, press **Peak Search** (or **Search**).

15. Adjust the amplitude of the synthesized signal generator to achieve a marker amplitude reading within 0.5 dB of the value indicated in Table 2-74. The marker amplitude is the uncompressed amplitude.

16. On the analyzer, press the following keys:

    Peak Search (or **Search**)
    Marker
    Delta

17. On the synthesized sweeper, set RF to On. The amplitude should be the same as recorded in Table 2-74.

18. On the analyzer, press **Peak Search** (or **Search**). This is the compressed amplitude. The ΔMkr1 amplitude is the measured gain compression.

19. Record the measured gain compression in the performance test record as the Entry listed in Table 2-75.

20. Repeat step 6 through step 19 for each set of settings in Table 2-74 and Table 2-75.

33. Gain Compression: Agilent E4404B, E4405B, E4407B, and E4408B

This test verifies the ability of the analyzer to measure relatively low-amplitude signals in the presence of higher-amplitude signals. Gain compression is measured by applying two signals, separated by a defined amount in frequency. The higher-amplitude signal is set to yield the specified total power at the input mixer (the power at the input mixer is defined as the input power level minus the input attenuation). The lower-amplitude signal is set at least 35 dB below the higher-amplitude signal, such that its power does not significantly add to the total power. The higher-amplitude signal is turned off and the lower-amplitude signal level is measured. This is the uncompressed amplitude.

The higher-amplitude signal is turned on and the amplitude of the lower-amplitude signal is again measured. This is the compressed amplitude. The difference between the uncompressed and compressed amplitude is the measured gain compression.

There are no adjustments related to this performance test.

Equipment Required

Synthesized sweeper (*2 required*)
Power meter, dual channel
Microwave power sensor
Directional bridge
Directional coupler
Cable, BNC, 120-cm (48-in)
Cable, APC 3.5 (m) (*2 required*)
Adapter, Type-N (m) to Type-N (m)
Adapter, Type-N (m) to APC 3.5 (f) (3 *required*)
Adapter, Type-N (m) to SMA (m)

Additional Equipment for Option BAB


Adapter, Type-N (m), to APC 3.5 (f)

Procedure

1. Zero and calibrate the power meter and power sensor combination in log mode (power reads out in dBm) as described in the power meter operation manual.

2. Connect the equipment as shown in Figure 2-49, with the load port of the directional bridge connected to the power sensor. The directional bridge should be used for measurements of frequencies less than or equal to 2.5 GHz. Use the directional coupler for higher frequency measurements.

Figure 2-49 Gain Compression Test Setup

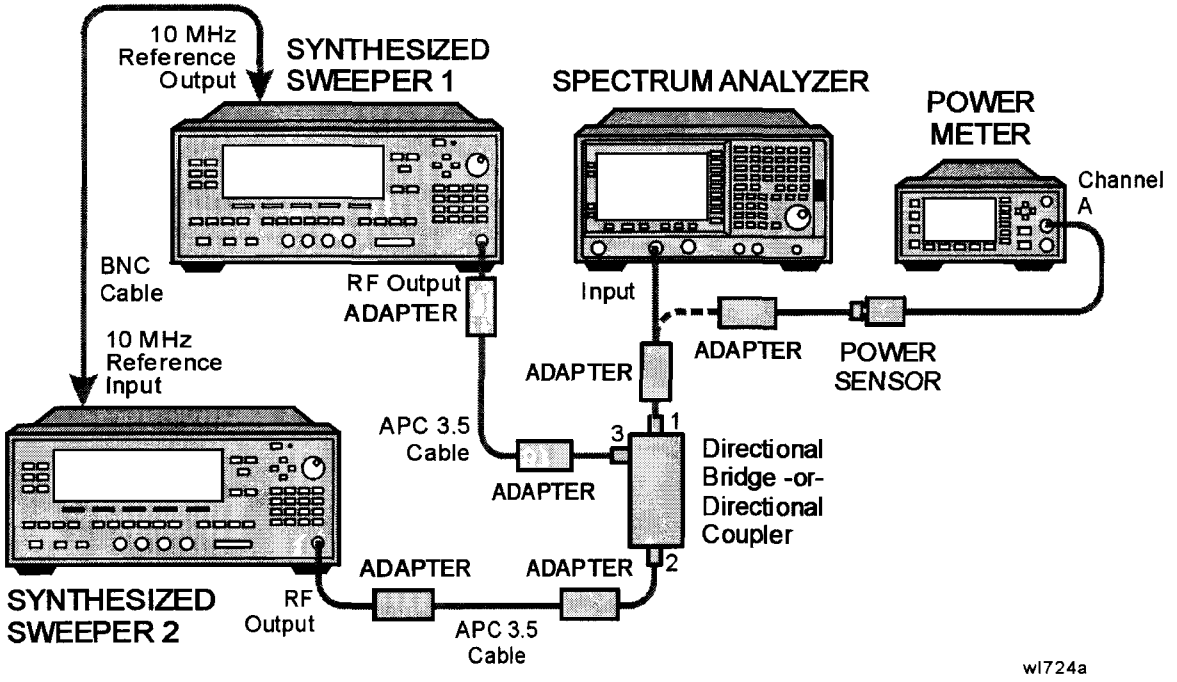

3. On the synthesized sweeper 1 press **PRESET**, then set the controls as follows:

   CW, 50 MHz
   POWER LEVEL, –100 dBm

4. On the synthesized sweeper 2 press **PRESET**, then set the controls as follows:

   CW, 53 MHz
   POWER LEVEL, –3 dBm

5. Enter the power sensor calibration factor for the synthesized sweeper 2 frequency into the power meter.

6. Adjust the synthesized sweeper 2 power level setting until the power meter reading is the same as indicated in Table 2-77.

7. Record the actual synthesized sweeper 2 power level setting in Table 2-77 for each frequency indicated.

Table 2-76 Source Frequency and Amplitude Settings

First Synthesized Sweeper		Second Synthesized Sweeper		
CW Frequency (MHz)	Power Level (dBm)	CW Frequency (MHz)	Desired Power Level (dBm)	Actual Power Level (dBm)
50	–40	53	–5.0	
50	–40	50.004	–5.0	
1400	–40	1403	0.0	
2500	–40	2503	0.0	
4400	–40	4403	0.0	
7600[b]	–40	7603	0.0	
14000[b]	–40	14003	0.0	

Table 2-77 Analyzer Settings

Test Frequency	Analyzer							Test Record Entry
(MHz)	Center Freq (GHz)	Span (kHz)	RBW (kHz)	VBW (kHz)	Ref Lvl (dBm)	Scale (dB)	Atten (dB)	
53	0.05	150	30	0.300	–10.0	10	0.0	1
50.004[a]	0.05[a]	1.0[a]	0.030[a]	0.030[a]	–10.0[a]	10[a]	0.0[a]	2
1403	1.40	150	30	0.300	–10.0	10	0.0	3
2503	2.50	150	30	0.300	–10.0	10	0.0	4
4403	4.40	150	30	0.300	–10.0	10	0.0	5
7603[b]	7.60	150	30	0.300	–10.0	10	0.0	6
14003[b]	14.0	150	30	0.300	–10.0	10	0.0	7

a. Option 1DR only.
b. E4405B, E4407B and E4408B only.

8. Repeat step 3 through step 7 for each of the settings listed in Table 2-76. Use the directional bridge in place of the coupler for frequencies less than or equal to 2503 MHz.
9. Disconnect the power sensor from the directional bridge and connect the directional bridge to the input of the analyzer using an adapter. Do not use a cable.

10. Set the synthesized sweeper 2 power level to Off.

11. Set the synthesized sweeper 1 power level to –24 dBm.

12. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Press **System, Alignments, Auto Align, Off**. Set the analyzer by pressing the following keys:

    Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
    FREQUENCY, Center Freq, 50 MHz (*or as indicated in* Table 2-77)
    SPAN, 150 kHz (*or as indicated in* Table 2-77)
    AMPLITUDE, Ref Level, –10 dBm, Attenuation 0 dB
    AMPLITUDE, Scale/Div, 10 dB
    BW/Avg, Resolution BW, 30 kHz (*or as indicated in* Table 2-77)
    BW/Avg, Video BW, 300 Hz (*or as indicated in* Table 2-77)

13. On the synthesized sweeper 2, set the appropriate power level to the setting recorded in Table 2-76. Then set RF to Off.

14. On the analyzer, press **Peak Search** (or **Search**).

15. Adjust the power level of the synthesized sweeper 1 to achieve a marker amplitude reading within 0.5 dB of the value indicated in Table 2-76. The marker amplitude is the uncompressed amplitude.

16. On the analyzer, press the following keys:

    Peak Search (or **Search**)
    Marker
    Delta

17. On the synthesized sweeper 2, set RF to On. The amplitude should be the same as recorded in Table 2-76.

18. On the analyzer, press **Peak Search** (or **Search**). This is the compressed amplitude. The ΔMkr1 amplitude is the measured gain compression.

19. Record the measured gain compression in the performance test record as the Entries indicated in Table 2-77.

20. Repeat step 10 through step 19 for each set of settings in Table 2-76 and Table 2-77 for frequencies less than or equal to 2503 MHz.

21. Replace the directional bridge with the directional coupler.

22. Repeat step 10 through step 19 for the remaining frequencies in Table 2-76.

34. Displayed Average Noise Level: Agilent E4401B and E4411B

This performance test measures the Displayed Average Noise Level (DANL) within the frequency range specified. The analyzer input is terminated in its characteristic impedance. If the analyzer is also equipped with a tracking generator (Option 1DN or 1DQ), the tracking generator is also terminated in its characteristic impedance and set for maximum leveled output power.

The test tunes the analyzer frequency across the band, uses the marker to locate the frequency with the highest response, and then reads the average noise in a narrow span.

To reduce measurement uncertainty due to input attenuator switching and resolution bandwidth switching, a reference level offset is added. The 50 MHz alignment signal is used as the amplitude reference for determining the amount of offset required. The offset is removed at the end of the test by pressing instrument preset.

For analyzers equipped with narrow resolution bandwidths (Option 1DR), DANL is also tested in the 10 Hz resolution bandwidth setting.

The related adjustment for this procedure is "Frequency Response."


Equipment Required

Termination, 50 Ω, Type-N (m) (*2 required for Options 1DN or 1DQ*)

Additional Equipment for 75 Ω Input

Termination, 75 Ω, Type-N (m) (*2 required for Option 1DQ*)
Adapter, Type-N (f), to BNC (m), 75 Ω

Figure 2-50 Displayed Average Noise Level Test Setup

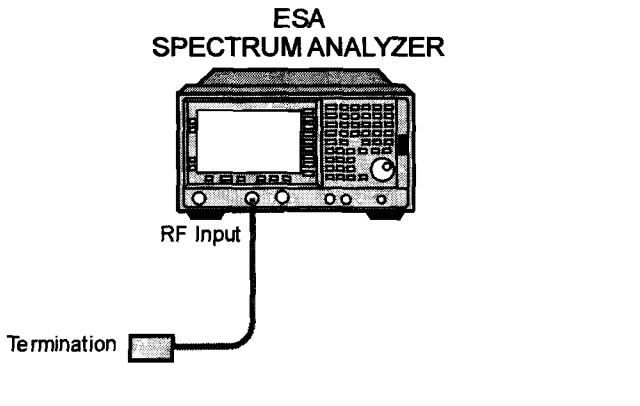

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω connectors, or damage to the connectors will occur.

Procedure

1. Set up the analyzers as shown in Figure 2-50.
2. On the analyzer, press **Preset**. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   Input/Output (or **Input**), **Amptd Ref Out** (On)
   FREQUENCY, 50 MHz
   SPAN, 2 kHz
   AMPLITUDE, –25 dBm (*50 Ω Input only*)
   AMPLITUDE, 28.75 dBmV (*75 Ω Input only*)
   AMPLITUDE, Attenuation, 10 dB
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
   BW/Avg, Resolution BW, 1 kHz
   BW/Avg, Video BW, 1 kHz
   Det/Demod, Detector, Sample, Return

3. On the analyzer, press **Single, Peak Search** (or **Search**) and record the Ref Amptd reading below.

   Ref Amptd _____ dB

4. On the analyzer, press the following keys:

   AMPLITUDE, Attenuation, 0 dB
   SPAN, 20 kHz
   BW/Avg, Resolution BW, 1 kHz
   BW/Avg, Video BW, 30 Hz

5. On the analyzer, press **Single, Peak Search** (or **Search**) and record the amplitude reading below as Meas Amptd(1 kHz RBW).

   Meas Amptd(1 kHz RBW)_____ dB

6. Calculate the necessary reference level offset by subtracting the Meas Amptd in step 5 from the Ref Amptd in step 3. If the calculated Ref Lvl Offst is greater than 0.05 dB or less than –0.05 dB, record the Ref Lvl Offst value below. Otherwise, enter 0.

   Ref Lvl Offset(1 kHz RBW) = Ref Amptd – Meas Amptd(1 kHz RBW)

   Ref Lvl Offst(1 kHz RBW)_____ dB

7. If the analyzer is not equipped with Option 1DR, proceed to step 11.

8. On the analyzer, press the following keys:

   AMPLITUDE, Attenuation, 0 dB
   SPAN, 500 Hz
   BW/Avg, Resolution BW, 10 Hz
   BW/Avg, Video BW, 1 Hz

9. On the analyzer, press **Single**, **Peak Search** (or **Search**) and record the amplitude reading below as Meas Amptd(10 Hz RBW).

   Meas Amptd(10 Hz RBW)_____ dB

10. Calculate the necessary reference level offset by subtracting the Meas Amptd in step 9 from the Ref Amptd in step 3. If the calculated Ref Lvl Offst is greater than 0.05 dB or less than –0.05 dB, record the Ref Lvl Offst value below. Otherwise, enter 0.

    Ref Lvl Offset(10 Hz RBW) = Ref Amptd – Meas Amptd(10 Hz RBW)

    Ref Lvl Offst(10 Hz RBW)_____ dB

11. On the analyzer, press **Input, Amptd Ref** (Off). Then press **AMPLITUDE, More, Ref Lvl Offst**, and enter the value recorded in step 6.

12. Connect the 50 Ω termination to the analyzer input as shown in Figure 2-50.

75 Ω Input only: Connect the 75 Ω termination to the analyzer Input 75 Ω using an adapter.

13. If the analyzer is equipped with Option 1DN, 50 Ω tracking generator, do the following:

    a. On the analyzer, press **Source, Amplitude, 0 dBm**.

    b. Connect a 50 Ω termination to the RF OUT 50 Ω.

14. If the analyzer is equipped with Option 1DQ, 75 Ω Tracking Generator, do the following:

    a. On the analyzer, press **Source, Amplitude, –6 dBm**.

    b. Connect a 75 Ω termination to the RF OUT 75 Ω.

Measurement Sequence

The DANL Measurement Sequence tables, for analyzers with 50 Ω inputs and for analyzers with 75 Ω inputs, list the procedures to be performed and the parameters to be used in each procedure. The table also lists the TR Entry number for recording the results in the performance verification test record.

1. If the analyzer is not equipped with Option 1DR, narrow bandwidths, or Option 1DS, preamplifier, perform only those procedures with an "X" ("X" = "Don't Care") in each of the Analyzer Options columns. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.
2. If the analyzer is equipped with Option 1DR, but not Option 1DS, perform those procedures with an "X" in each of the Analyzer Options columns, and those procedures with a "Y" in the 1DR option column. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.
3. If the analyzer is equipped with Option 1DS, but not Option 1DR, perform those procedures with an "X" in each of the Analyzer Options columns, and those procedures with a "Y" in the 1DS Option column. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.
4. If the analyzer is equipped with both Option 1DS and Option 1DR, perform all procedures. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.
5. After performing all applicable DANL measurement procedures, proceed to Remove Reference Level Offset.

Table 2-78 DANL Measurement Sequence, 50 Ω Inputs

Analyzer Options		Procedure	Procedure Parameters				TR Entry
1DR	1DS		Start Freq	Stop Freq	Test RBW	Preamp State	
X	X	Measure DANL at 400 kHz	N/A	N/A	1 kHz	Off	1)
X	X	Measure DANL	1 MHz	10 MHz	1 kHz	Off	2)
X	X	Measure DANL	10 MHz	500 MHz	1 kHz	Off	3)
X	X	Measure DANL	500 MHz	1 GHz	1 kHz	Off	4)
X	X	Measure DANL	1 GHz	1.5 GHz	1 kHz	Off	5)
X	Y	Measure DANL at 400 kHz	N/A	N/A	1 kHz	On	6)
X	Y	Measure DANL	1 MHz	10 MHz	1 kHz	On	7)
X	Y	Measure DANL	10 MHz	500 MHz	1 kHz	On	8)
X	Y	Measure DANL	500 MHz	1 GHz	1 kHz	On	9)
X	Y	Measure DANL	1 GHz	1.5 GHz	1 kHz	On	10)
Y	X	Measure DANL at 400 kHz	N/A	N/A	10 Hz	Off	11)
Y	X	Measure DANL	1 MHz	10 MHz	10 Hz	Off	12)
Y	X	Measure DANL	10 MHz	500 MHz	10 Hz	Off	13)
Y	X	Measure DANL	500 MHz	1 GHz	10 Hz	Off	14)
Y	X	Measure DANL	1 GHz	1.5 GHz	10 Hz	Off	15)
Y	Y	Measure DANL at 400 kHz	N/A	N/A	10 Hz	On	16)
Y	Y	Measure DANL	1 MHz	10 MHz	10 Hz	On	17)
Y	Y	Measure DANL	10 MHz	500 MHz	10 Hz	On	18)
Y	Y	Measure DANL	500 MHz	1 GHz	10 Hz	On	19)
Y	Y	Measure DANL	1 GHz	1.5 GHz	10 Hz	On	20)

Table 2-79 DANL Measurement Sequence, 75 Ω Inputs

Analyzer Options		Procedure	Procedure Parameters				TR Entry
1DR	1DS		Start Freq	Stop Freq	Test RBW	Preamp State	
X	X	Measure DANL	1 MHz	10 MHz	1 kHz	Off	**21)**
X	X	Measure DANL	10 MHz	500 MHz	1 kHz	Off	**22)**
X	X	Measure DANL	500 MHz	1 GHz	1 kHz	Off	**23)**
X	X	Measure DANL	1 GHz	1.5 GHz	1 kHz	Off	**24)**
X	X	Measure DANL	1 MHz	10 MHz	1 kHz	On	**25)**
X	Y	Measure DANL	10 MHz	500 MHz	1 kHz	On	**26)**
X	Y	Measure DANL	500 MHz	1 GHz	1 kHz	On	**27)**
X	Y	Measure DANL	1 GHz	1.5 GHz	1 kHz	On	**28)**
X	X	Measure DANL	1 MHz	10 MHz	1 kHz	Off	**29)**
Y	X	Measure DANL	10 MHz	500 MHz	10 Hz	Off	**30)**
Y	X	Measure DANL	500 MHz	1 GHz	10 Hz	Off	**31)**
Y	X	Measure DANL	1 GHz	1.5 GHz	10 Hz	Off	**32)**
X	X	Measure DANL	1 MHz	10 MHz	1 kHz	On	**33)**
Y	Y	Measure DANL	10 MHz	500 MHz	10 Hz	On	**34)**
Y	Y	Measure DANL	500 MHz	1 GHz	10 Hz	On	**35)**
Y	Y	Measure DANL	1 GHz	1.5 GHz	10 Hz	On	**36)**

Measuring Displayed Average Noise Level (DANL)

1. Set the analyzer as follows using the start and stop frequencies, test RBW and preamp state as specified in Table 2-78 or Table 2-79:

   Auto Couple
   FREQUENCY, Start Freq, (*enter specified start frequency*)
   FREQUENCY, Stop Freq, (*enter specified stop frequency*)
   AMPLITUDE, –70 dBm (*50 Ω Input only*)
   Attenuation, 0 dB
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**)
   dBmV, More, Ref Level, –21.24 dBmV (*75 Ω Input only*)
   AMPLITUDE, More, Ref Lvl Offset, (*enter Ref Lvl Offset (1 kHz) if test RBW = 1 kHz*)
   AMPLITUDE, More, Ref Lvl Offset, (*enter Ref Lvl Offset (10 Hz) if test RBW = 10 Hz*)
   BW/Avg, Resolution BW, 100 kHz

BW/Avg, Video BW, 10 kHz
AMPLITUDE, More, Int Preamp (Off) (*if preamp state = Off*)
AMPLITUDE, More, Int Preamp (On) (*if preamp state = On*)
Sweep, Sweep (Cont)
Sweep, Sweep Time (Auto)

3. On the analyzer, press **Single, View/Trace, Trace 1, Clear Write, BW/Avg, Average Type** (Video), **Averages, 3, Enter, Single.**

   Wait until VAvg 3 is displayed to the left of the graticule (the analyzer will take three sweeps, then stop).

2. On the analyzer, press **Peak Search** (or **Search**). Set the analyzer by pressing the following keys:

   BW/Avg, Average (Off)
   Marker →, Mκρ→ XΦ

3. If the test RBW is 1 kHz, press **Span, 20 kHz.**

   If the test RBW is 10 Hz, press **Span, 500 Hz.**

4. If the test RBW is 1 kHz, press **BW/Avg, Resolution BW, 1 kHz, Video BW, 30 Hz.**

   If the test RBW is 10 Hz, press **BW/Avg, Resolution BW, 10 Hz, Video BW, 1 Hz.**

5. On the analyzer, press **Single** and wait for the new sweep to finish.

6. On the analyzer, press **Display, Display Line** (On), and adjust the display line so that it is centered on the average trace noise, ignoring any residual responses (refer to the Residual Responses verification test for any suspect residuals).

Measuring Displayed Average Noise Level at 400 kHz

1. Press **FREQUENCY, Center Freq, 400 kHz.** Set the analyzer by pressing the following keys:

   SPAN, 20 kHz (*if test RBW = 1 kHz*)
   SPAN, 500 Hz (*if test RBW = 10 Hz*)
   AMPLITUDE, –70 dBm (*50 Ω Input only*)
   Attenuation, 0 dB
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBmV, More, Ref Level, –21.24 dBmV** (*75 Ω Input only*)
   AMPLITUDE, More, Ref Lvl Offset, (*enter Ref Lvl Offset (1 kHz) if test RBW = 1 kHz*)
   AMPLITUDE, More, Ref Lvl Offset, (*enter Ref Lvl Offset (10 Hz) if test RBW = 10 Hz*)
   AMPLITUDE, More, Int Preamp (Off) (*if preamp state = Off*)
   AMPLITUDE, More, Int Preamp (On) (*if preamp state = On*)
   BW/Avg, Resolution BW, 1 kHz (*if test RBW = 1 kHz*)

BW/Avg, Resolution BW, 10 Hz (*if test RBW = 10 Hz*)
BW/Avg, Video BW, 30 Hz (*if test RBW = 1 kHz*)
BW/Avg, Video BW, 30 Hz (*if test RBW = 10 Hz*)

2. On the analyzer, press **Single** and wait for a new sweep to complete.
3. On the analyzer, press **Display**, **Display Line** (On). Adjust the display line so that it is centered on the average trace noise, ignoring any residual responses (refer to the Residual Responses verification test for any suspect residuals).

Remove Reference Level Offset

1. Press **AMPLITUDE, More, Ref Lvl Offst, 0 dB**.
2. On the analyzer, press **Preset**.

35. Displayed Average Noise Level: Agilent E4402B and E4403B

This performance test measures the displayed average noise level (DANL) within the frequency range specified. The analyzer input is terminated in its characteristic impedance. If the analyzer is also equipped with a tracking generator (Option 1DN), the tracking generator is also terminated in its characteristic impedance and set for maximum leveled output power.

The test tunes the analyzer frequency across the band, uses the marker to locate the frequency with the highest response, and then reads the average noise in a narrow span.

To reduce measurement uncertainty due to input attenuator switching and resolution bandwidth switching, a reference level offset is added. The 50 MHz alignment signal is used as the amplitude reference for determining the amount of offset required. The offset is removed at the end of the test by pressing instrument preset.


For analyzers equipped with narrow resolution bandwidths (Option 1DR), DANL is also tested in the 10 Hz resolution bandwidth setting.

The related adjustment for this procedure is "Frequency Response."

Equipment Required

Termination, 50 Ω, Type-N (m) (*2 required for Option 1DN*)
Cable, BNC
Adapter, Type-N (m) to BNC (f)

Figure 2-51 Displayed Average Noise Level Test Setup

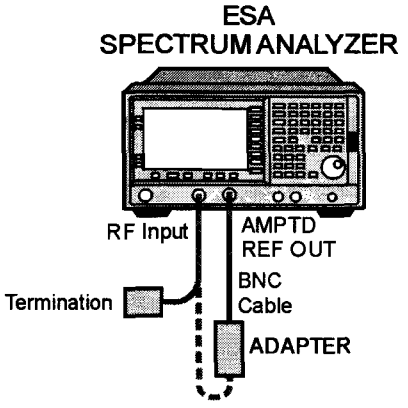

Procedure

1. Connect the AMPTD REF OUT to the 50 Ω Input using a BNC cable and adapter as shown in Figure 2-51.
2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   Input/Output (or **Input**), **Amptd Ref Out** (On)
   FREQUENCY, 50 MHz
   SPAN, 2 kHz
   AMPLITUDE, –20 dBm
   AMPLITUDE, Attenuation, 10 dB
   AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
   BW/Avg, Resolution BW, 1 kHz
   BW/Avg, Video BW, 1 kHz
   Det/Demod, Detector, Sample, Return
3. On the analyzer, press **Single, Peak Search** (or **Search**) and record the Ref Amptd reading below.

   Ref Amptd _____ dB
4. On the analyzer, press the following keys:

   AMPLITUDE. Attenuation. 0 dB
   SPAN, 20 kHz
   BW/Avg, Resolution BW, 1 kHz
   BW/Avg, Video BW, 30 Hz
5. On the analyzer, press **Single.**
6. On the analyzer, press **Peak Search** (or **Search**) and record the amplitude reading below as Meas Amptd(1 kHz RBW).

   Meas Amptd(1 kHz RBW)_____ dB
7. Calculate the necessary reference level offset by subtracting the Meas Amptd in step 6 from the Ref Amptd in step 3. If the calculated Ref Lvl Offst is greater than 0.05 dB or less than –0.05 dB, record the Ref Lvl Offst value below. Otherwise, enter 0.

   Ref Lvl Offset(1 kHz RBW) = Ref Amptd – Meas Amptd(1 kHz RBW)

   Ref Lvl Offst(1 kHz RBW)_____ dB
8. If the analyzer is not equipped with Option 1DR, proceed to step 12.
9. On the analyzer, press the following keys:

   AMPLITUDE, Attenuation, 0 dB
   SPAN, 500 Hz
   BW/Avg, Resolution BW, 10 Hz
   BW/Avg, Video BW, 1 Hz

10. On the analyzer, press **Single**, **Peak Search** (or **Search**) and record the amplitude reading below as Meas Amptd(10 Hz RBW).

    Meas Amptd(10 Hz RBW)_____ dB

11. Calculate the necessary reference level offset by subtracting the Meas Amptd in step 10 from the Ref Amptd in step 3. If the calculated Ref Lvl Offst is greater than 0.05 dB or less than –0.05 dB, record the Ref Lvl Offst value below. Otherwise, enter 0.

    Ref Lvl Offset(10 Hz RBW) = Ref Amptd – Meas Amptd(10 Hz RBW)

    Ref Lvl Offst(10 Hz RBW)_____ dB

12. On the analyzer, press **Input, Amptd Ref Out** (Off), then **AMPLITUDE, More, Ref Lvl Offst**, and enter the value recorded in step 7.

13. Connect the 50 Ω termination to the analyzer input as shown in Figure 2-51.

14. Disconnect the BNC cable and adapter from the AMPTD REF OUT and the 50 Ω Input.

15. If the analyzer is equipped with Option 1DN, 50 Ω tracking generator, do the following:

    a. On the analyzer, press **Source, Amplitude, 0 dBm**.

    b. Connect a 50 Ω termination to the RF OUT 50 Ω.

Measurement Sequence

The DANL Measurement Sequence tables list the procedures to be performed and the parameters to be used in each procedure. The table also lists the TR Entry number for recording the results in the performance verification test record.

1. If the analyzer is not equipped with Option 1DR, narrow bandwidths, or Option 1DS, preamplifier, perform only those procedures with an "X" ("X" = "Don't Care") in each of the Analyzer Options columns. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.

2. If the analyzer is equipped with Option 1DR, but not Option 1DS, perform those procedures with an "X" in each of the Analyzer Options columns, and those procedures with a "Y" in the 1DR option column. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.

3. If the analyzer is equipped with Option 1DS, but not Option 1DR, perform those procedures with an "X" in each of the Analyzer Options columns, and those procedures with a "Y" in the 1DS Option column. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.
4. If the analyzer is equipped with both Option 1DS and Option 1DR, perform all procedures. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.
5. After performing all applicable DANL measurement procedures, proceed to Remove Reference Level Offset.

Table 2-80 DANL Measurement Sequence

Analyzer Options		Procedure	Procedure Parameters				TR Entry[a]
1DR	1DS		Start Freq	Stop Freq	Test RBW	Preamp State	
X	X	Measure DANL	10 MHz	1 GHz	1 kHz	Off	**1)**
X	X	Measure DANL	1 GHz	2 GHz	1 kHz	Off	**2)**
X	X	Measure DANL	2 GHz	3 GHz	1 kHz	Off	**3)**
X	Y	Measure DANL	10 MHz	1 GHz	1 kHz	On	**4/13)**
X	Y	Measure DANL	1 GHz	2 GHz	1 kHz	On	**5/14)**
X	Y	Measure DANL	2 GHz	3 GHz	1 kHz	On	**6/15)**
Y	X	Measure DANL	10 MHz	1 GHz	10 Hz	Off	**7)**
Y	X	Measure DANL	1 GHz	2 GHz	10 Hz	Off	**8)**
Y	X	Measure DANL	2 GHz	3 GHz	10 Hz	Off	**9)**
Y	Y	Measure DANL	10 MHz	1 GHz	10 Hz	On	**10/16)**
Y	Y	Measure DANL	1 GHz	2 GHz	10 Hz	On	**11/17)**
Y	Y	Measure DANL	2 GHz	3 GHz	10 Hz	On	**12/18)**

a. There are two possible TR Entries for measurements made with Preamp On, depending upon the ambient temperature. The first entry is for measurements made with an ambient temperature outside of the 20 to 30° □C range, but within the 0 to 55° □C range. The second entry is for measurements made with an ambient temperature within the 20 to 30° □C range.

Measuring Displayed Average Noise Level (DANL)

1. Set the analyzer as follows using the start and stop frequencies, test RBW and preamp state as specified in Table 2-80:

   Auto Couple
   FREQUENCY, Start Freq, (*enter specified start frequency*)
   FREQUENCY, Stop Freq, (*enter specified stop frequency*)
   AMPLITUDE, –70 dBm
   Attenuation, 0 dB
   AMPLITUDE, More, Ref Lvl Offset, (*enter Ref Lvl Offset (1 kHz) if test RBW = 1 kHz*)
   AMPLITUDE, More, Ref Lvl Offset, (*enter Ref Lvl Offset (10 Hz) if test RBW = 10 Hz*)
   BW/Avg, Resolution BW, 1 MHz
   BW/Avg, Video BW, 10 kHz
   AMPLITUDE, More, Int Preamp (Off) (*if preamp state = Off*)
   AMPLITUDE, More, Int Preamp (On) (*if preamp state = On*)
   Sweep, Sweep (Cont)
   Sweep, Sweep Time (Auto)

2. On the analyzer, press **Single, View/Trace, Trace 1, Clear Write, BW/Avg, Average Type** (Video), **Averages, 3, Enter, Single**

3. Wait until VAvg 3 is displayed to the left of the graticule (the analyzer will take three sweeps, then stop).

4. On the analyzer, press the following keys:

   BW/Avg, Average (Off)
   Peak Search (or **Search**)
   BW/Avg, Average (On)
   Marker → , Mkr→ CF

5. If the test RBW is 1 kHz, press **Span, 20 kHz.**

6. If the test RBW is 10 Hz, press **Span, 500 Hz.**

7. If the test RBW is 1 kHz, press **BW/Avg, Resolution BW, 1 kHz, Video BW, 30 Hz.**

8. If the test RBW is 10 Hz, press **BW/Avg, Resolution BW, 10 Hz, Video BW, 1 Hz.**

9. On the analyzer, press **Single** and wait for the new sweep to finish. Then press **Display, Display Line** (On), and adjust the display line so that it is centered on the average trace noise, ignoring any residual responses (refer to the Residual Responses verification test for any suspect residuals).

Remove Reference Level Offset

1. Press **AMPLITUDE, More, Ref Lvl Offst, 0 dB.**

2. On the analyzer, press **Preset.**

36. Displayed Average Noise Level: Agilent E4404B and E4405B

This performance test measures the displayed average noise level (DANL) within the frequency range specified. The analyzer input is terminated in its characteristic impedance. If the analyzer is also equipped with a tracking generator (Option 1DN), the tracking generator is also terminated in its characteristic impedance and set for maximum leveled output power.

The test tunes the analyzer frequency across the band, uses the marker to locate the frequency with the highest response, and then reads the average noise in a narrow span.

To reduce measurement uncertainty due to input attenuator switching and resolution bandwidth switching, a reference level offset is added. The 50 MHz alignment signal is used as the amplitude reference for determining the amount of offset required. The offset is removed at the end of the test by pressing instrument preset.


For analyzers equipped with narrow resolution bandwidths (Option 1DR), DANL is also tested in the 10 Hz resolution bandwidth setting.

The related adjustment for this procedure is "Frequency Response."

Equipment Required

Termination, 50 Ω, Type-N (m) (*2 required for Option 1DN*)
Cable, BNC
Adapter, Type-N (m) to BNC (f)

Figure 2-52 Displayed Average Noise Level Test Setup

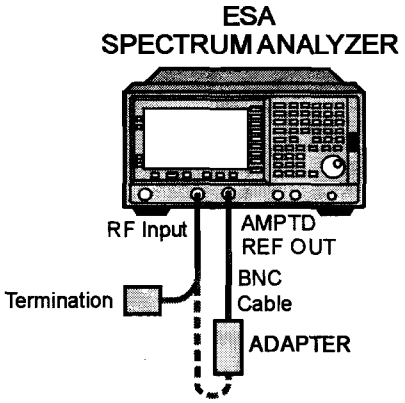

Procedure

1. Connect the AMPTD REF OUT to the 50 Ω Input using a BNC cable and adapter as shown in Figure 2-52.
2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   Input/Output (or **Input**), **Amptd Ref Out** (On)
   FREQUENCY, 50 MHz
   SPAN, 2 kHz
   AMPLITUDE, –20 dBm
   AMPLITUDE, Attenuation, 10 dB
   BW/Avg, Resolution BW, 1 kHz
   BW/Avg, Video BW, 1 kHz
   Det/Demod, Detector, Sample, Return
3. On the analyzer, press **Single**, **Peak Search** (or **Search**) and record the Ref Amptd reading below.

   Ref Amptd _____ dB
4. On the analyzer, press the following keys:

   AMPLITUDE, Attenuation, 0 dB
   SPAN, 20 kHz
   BW/Avg, Resolution BW, 1 kHz
   BW/Avg, Video BW, 30 Hz
5. On the analyzer, press **Single**, **Peak Search** (or **Search**) and record the amplitude reading below as Meas Amptd(1 kHz RBW).

   Meas Amptd(1 kHz RBW)_____ dB
6. Calculate the necessary reference level offset by subtracting the Meas Amptd in step 5 from the Ref Amptd in step 3. If the calculated Ref Lvl Offst is greater than 0.05 dB or less than –0.05 dB, record the Ref Lvl Offst value below. Otherwise, enter 0.

   Ref Lvl Offset(1 kHz RBW) = Ref Amptd – Meas Amptd(1 kHz RBW)

   Ref Lvl Offst(1 kHz RBW)_____ dB
7. If the analyzer is not equipped with Option 1DR, proceed to step 11.
8. On the analyzer, press the following keys:

   AMPLITUDE, Attenuation, 0 dB
   SPAN, 500 Hz
   BW/Avg, Resolution BW, 10 Hz
   BW/Avg, Video BW, 1 Hz
9. On the analyzer, press **Single**, **Peak Search** (or **Search**) and record the amplitude reading below as Meas Amptd(10 Hz RBW).

   Meas Amptd(10 Hz RBW)_____ dB

10. Calculate the necessary reference level offset by subtracting the Meas Amptd in step 9 from the Ref Amptd in step 3. If the calculated Ref Lvl Offst is greater than 0.05 dB or less than –0.05 dB, record the Ref Lvl Offst value below. Otherwise, enter 0.

    Ref Lvl Offset(10 Hz RBW) = Ref Amptd – Meas Amptd(10 Hz RBW)

    Ref Lvl Offst(10 Hz RBW)_____ dB

11. On the analyzer, press **Input, Amptd Ref Out** (Off), then **AMPLITUDE, More, Ref Lvl Offst**, and enter the value recorded in step 5.

12. Connect the 50 Ω termination to the analyzer input as shown in Figure 2-52.

13. Disconnect the BNC cable and adapter from the AMPTD REF OUT and the 50 Ω Input.

14. If the analyzer is equipped with Option 1DN, 50 Ω tracking generator, do the following:

    a. On the analyzer, press **Source, Amplitude, 0 dBm**.

    b. Connect a 50 Ω termination to the RF OUT 50 Ω.

Measurement Sequence

The DANL Measurement Sequence tables list the procedures to be performed and the parameters to be used in each procedure. The tables also list the TR Entry number for recording the results in the performance verification test record.

1. If the analyzer is not equipped with Option 1DR, narrow bandwidths, or Option 1DS, preamplifier, perform only those procedures with an "X" ("X" = "Don't Care") in each of the Analyzer Options columns. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.
2. If the analyzer is equipped with Option 1DR, but not Option 1DS, perform those procedures with an "X" in each of the Analyzer Options columns, and those procedures with a "Y" in the 1DR option column. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.

3. If the analyzer is equipped with Option 1DS, but not Option 1DR, perform those procedures with an "X" in each of the Analyzer Options columns, and those procedures with a "Y" in the 1DS Option column. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.
4. If the analyzer is equipped with both Option 1DS and Option 1DR, perform all procedures. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.
5. After performing all applicable DANL measurement procedures, proceed to Remove Reference Level Offset.

Table 2-81 DANL Measurement Sequence, E4404B

Analyzer Options		Procedure	Procedure Parameters				TR Entry[a]
1DR	1DS		Start Freq	Stop Freq	Test RBW	Preamp State	
X	X	Measure DANL	10 MHz	1 GHz	1 kHz	Off	**1)**
X	X	Measure DANL	1 GHz	2 GHz	1 kHz	Off	**2)**
X	X	Measure DANL	2 GHz	3 GHz	1 kHz	Off	**3)**
X	X	Measure DANL	3 GHz	6 GHz	1 kHz	Off	**4)**
X	X	Measure DANL	6 GHz	6.7 GHz	1 kHz	Off	**5)**
X	Y	Measure DANL	10 MHz	1 GHz	1 kHz	On	**6/20)**
X	Y	Measure DANL	1 GHz	2 GHz	1 kHz	On	**7/21)**
X	Y	Measure DANL	2 GHz	3 GHz	1 kHz	On	**8/22)**
Y	X	Measure DANL	10 MHz	1 GHz	10 Hz	Off	**9)**
Y	X	Measure DANL	1 GHz	2 GHz	10 Hz	Off	**10)**
Y	X	Measure DANL	2 GHz	3 GHz	10 Hz	Off	**11)**
Y	X	Measure DANL	3 GHz	6 GHz	10 Hz	Off	**12)**
Y	X	Measure DANL	6 GHz	6.7 GHz	10 Hz	Off	**13)**
Y	Y	Measure DANL	10 MHz	1 GHz	10 Hz	On	**14/23)**
Y	Y	Measure DANL	1 GHz	2 GHz	10 Hz	On	**15/24)**
Y	Y	Measure DANL	2 GHz	3 GHz	10 Hz	On	**16/25)**

a. There are two possible TR Entries for measurements made with Preamp On, depending upon the ambient temperature. The first entry is for measurements made with an ambient temperature outside of the 20 to 30°□C range, but within the 0 to 55°□C range. The second entry is for measurements made with an ambient temperature within the 20 to 30°□C range.

Table 2-82 DANL Measurement Sequence, E4405B

Analyzer Options		Procedure	Procedure Parameters				TR Entry[a]
1DR	1DS		Start Freq	Stop Freq	Test RBW	Preamp State	
X	X	Measure DANL	10 MHz	1 GHz	1 kHz	Off	**1)**
X	X	Measure DANL	1 GHz	2 GHz	1 kHz	Off	**2)**
X	X	Measure DANL	2 GHz	3 GHz	1 kHz	Off	**3)**
X	X	Measure DANL	3 GHz	6 GHz	1 kHz	Off	**4)**
X	X	Measure DANL	6 GHz	12 GHz	1 kHz	Off	**5)**
X	X	Measure DANL	12 GHz	13.2 GHz	1 kHz	Off	**6)**
X	Y	Measure DANL	10 MHz	1 GHz	1 kHz	On	**7/26)**
X	Y	Measure DANL	1 GHz	2 GHz	1 kHz	On	**8/27)**
X	Y	Measure DANL	2 GHz	3 GHz	1 kHz	On	**9/28)**
Y	X	Measure DANL	10 MHz	1 GHz	10 Hz	Off	**10)**
Y	X	Measure DANL	1 GHz	2 GHz	10 Hz	Off	**11)**
Y	X	Measure DANL	2 GHz	3 GHz	10 Hz	Off	**12)**
Y	X	Measure DANL	3 GHz	6 GHz	10 Hz	Off	**13)**
Y	X	Measure DANL	6 GHz	12 GHz	10 Hz	Off	**14)**
Y	X	Measure DANL	12 GHz	13.2 GHz	10 Hz	Off	**16)**
Y	Y	Measure DANL	10 MHz	1 GHz	10 Hz	On	**17/29)**
Y	Y	Measure DANL	1 GHz	2 GHz	10 Hz	On	**18/30)**
Y	Y	Measure DANL	2 GHz	3 GHz	10 Hz	On	**19/31)**

a. There are two possible TR Entries for measurements made with Preamp On, depending upon the ambient temperature. The first entry is for measurements made with an ambient temperature outside of the 20 to 30°□C range, but within the 0 to 55°□C range. The second entry is for measurements made with an ambient temperature within the 20 to 30°□C range.

Measuring Displayed Average Noise Level (DANL)

1. Set the analyzer as follows using the start and stop frequencies, test RBW and preamp state as specified in Table 2-81 for E4404B or Table 2-82 for E4405B:

   Auto Couple
   FREQUENCY, Start Freq, (*enter specified start frequency*)
   FREQUENCY, Stop Freq, (*enter specified stop frequency*)
   AMPLITUDE, –70 dBm
   Attenuation 0 dB
   AMPLITUDE, More, Ref Lvl Offset, (*enter Ref Lvl Offset (1 kHz) if test RBW = 1 kHz*)
   AMPLITUDE, More, Ref Lvl Offset, (*enter Ref Lvl Offset (10 Hz) if test RBW = 10 Hz*)
   BW/Avg, Resolution BW, 1 MHz
   BW/Avg, Video BW, 10 kHz
   AMPLITUDE, More, Int Preamp (Off) (*if preamp state = Off*)
   AMPLITUDE, More, Int Preamp (On) (*if preamp state = On*)
   Sweep, Sweep (Cont)
   Sweep, Sweep Time (Auto)

2. If the analyzer is equipped with Option 1DN and the current stop frequency is >3 GHz, press **Source, Amplitude** (Off).

3. On the analyzer, press **Single, View/Trace, Trace 1, Clear Write, BW/Avg, Average Type** (Video), **Averages, 3, Enter, Single.**

   Wait until VAvg 3 is displayed to the left of the graticule (the analyzer will take three sweeps, then stop).

4. On the analyzer, press the following keys:

   Peak Search (or **Search**)
   BW/Avg Average (Off)
   Marker →, Mkr→ CF

5. If the test RBW is 1 kHz, press **Span, 20 kHz.**

   If the test RBW is 10 Hz, press **Span, 500 Hz.**

6. If the test RBW is 1 kHz, press **BW/Avg, Resolution BW, 1 kHz, Video BW, 30 Hz.**

   If the test RBW is 10 Hz, press **BW/Avg, Resolution BW, 10 Hz, Video BW, 1 Hz.**

7. On the analyzer, press **Single** and wait for the new sweep to finish.

8. On the analyzer, press **Display, Display Line** (On), and adjust the display line so that it is centered on the average trace noise, ignoring any residual responses (refer to the Residual Responses verification test for any suspect residuals).

Remove Reference Level Offset

1. Press **AMPLITUDE, More, Ref Lvl Offst, 0 dB**.
2. On the analyzer, press **Preset**.

37. Displayed Average Noise Level: Agilent E4407B and E4408B

This performance test measures the displayed average noise level (DANL) within the frequency range specified. The analyzer input is terminated in its characteristic impedance. If the analyzer is also equipped with a tracking generator (Option 1DN), the tracking generator is also terminated in its characteristic impedance and set for maximum leveled output power.

The test tunes the analyzer frequency across the band, uses the marker to locate the frequency with the highest response, and then reads the average noise in a narrow span.

To reduce measurement uncertainty due to input attenuator switching and resolution bandwidth switching, a reference level offset is added. The 50 MHz alignment signal is used as the amplitude reference for determining the amount of offset required. The offset is removed at the end of the test by pressing instrument preset.

For analyzers equipped with narrow resolution bandwidths (Option 1DR), DANL is also tested in the 10 Hz resolution bandwidth setting.

The related adjustment for this procedure is "Frequency Response."


Equipment Required

Termination, 50 Ω, Type-N (m) (*2 required for Option 1DN*)
Cable, BNC
Adapter, Type-N (m) to BNC (f)

Additional Equipment for Option BAB

Adapter, APC 3.5 (f) to Type-N (f)

Figure 2-53 Displayed Average Noise Level Test Setup

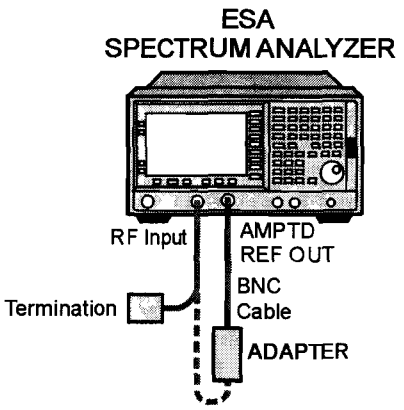

Procedure

1. Connect the AMPTD REF OUT to the 50 Ω Input using a BNC cable and adapter as shown in Figure 2-53.
2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   Input/Output (or **Input**), **Amptd Ref Out** (On)
   FREQUENCY, 50 MHz
   SPAN, 2 kHz
   AMPLITUDE, –20 dBm
   AMPLITUDE, Attenuation, 10 dB
   BW/Avg, Resolution BW, 1 kHz
   BW/Avg, Video BW, 1 kHz
   Det/Demod, Detector, Sample, Return
3. On the analyzer, press **Single**.
4. On the analyzer, press **Peak Search** (or **Search**) and record the Ref Amptd reading below.

   Ref Amptd _____ dB
5. On the analyzer, press the following keys:

   AMPLITUDE, Attenuation, 0 dB
   SPAN, 20 kHz
   BW/Avg, Resolution BW, 1 kHz
   BW/Avg, Video BW, 30 Hz
6. On the analyzer, press **Single**.

7. On the analyzer, press **Peak Search** (or **Search**) and record the amplitude reading below as Meas Amptd(1 kHz RBW).

   Meas Amptd(1 kHz RBW)_____ dB

8. Calculate the necessary reference level offset by subtracting the Meas Amptd in step 7 from the Ref Amptd in step 4. If the calculated Ref Lvl Offst is greater than 0.05 dB or less than –0.05 dB, record the Ref Lvl Offst value below. Otherwise, enter 0.

   Ref Lvl Offset(1 kHz RBW) = Ref Amptd – Meas Amptd(1 kHz RBW)

   Ref Lvl Offst(1 kHz RBW)_____ dB

9. If the analyzer is not equipped with Option 1DR, proceed to step 14.

10. On the analyzer, press the following keys:

    AMPLITUDE, Attenuation, 0 dB
    SPAN, 500 Hz
    BW/Avg, Resolution BW, 10 Hz
    BW/Avg, Video BW, 1 Hz

11. On the analyzer, press **Single**.

12. On the analyzer, press **Peak Search** (or **Search**) and record the amplitude reading below as Meas Amptd(10 Hz RBW).

    Meas Amptd(10 Hz RBW)_____ dB

13. Calculate the necessary reference level offset by subtracting the Meas Amptd in step 12 from the Ref Amptd in step 4. If the calculated Ref Lvl Offst is greater than 0.05 dB or less than –0.05 dB, record the Ref Lvl Offst value below. Otherwise, enter 0.

    Ref Lvl Offset(10 Hz RBW) = Ref Amptd – Meas Amptd(10 Hz RBW)

    Ref Lvl Offst(10 Hz RBW)_____ dB

14. On the analyzer, press **Input, Amptd Ref Out** (Off), then **AMPLITUDE, More, Ref Lvl Offst**, and enter the value recorded in step 7.

15. Connect the 50 Ω termination to the analyzer input as shown in Figure 2-53.

16. Disconnect the BNC cable and adapter from the AMPTD REF OUT and the 50 Ω Input.

17. If the analyzer is equipped with Option 1DN, 50 Ω tracking generator, do the following:

    a. On the analyzer, press **Source, Amplitude, 0 dBm**.

    b. Connect a 50 Ω termination to the RF OUT 50 Ω.

Measurement Sequence

The DANL Measurement Sequence tables list the procedures to be performed and the parameters to be used in each procedure. The table also lists the TR Entry number for recording the results in the performance verification test record.

1. If the analyzer is not equipped with Option 1DR, narrow bandwidths, or Option 1DS, preamplifier, perform only those procedures with an "X" ("X" = "Don't Care") in each of the Analyzer Options columns. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.
2. If the analyzer is equipped with Option 1DR, but not Option 1DS, perform those procedures with an "X" in each of the Analyzer Options columns, and those procedures with a "Y" in the 1DR option column. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.
3. If the analyzer is equipped with Option 1DS, but not Option 1DR, perform those procedures with an "X" in each of the Analyzer Options columns, and those procedures with a "Y" in the 1DS Option column. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.
4. If the analyzer is equipped with both Option 1DS and Option 1DR, perform all procedures. For each procedure performed, use the appropriate Procedure Parameters as described in the DANL Measurement Sequence table. Record the display line amplitude setting as the indicated TR Entry in the performance verification test record.
5. After performing all applicable DANL measurement procedures, proceed to Remove Reference Level Offset.

Table 2-83 DANL Measurement Sequence

Analyzer Options		Procedure	Procedure Parameters				TR Entry[a]
1DR	1DS		Start Freq	Stop Freq	Test RBW	Preamp State	
X	X	Measure DANL	10 MHz	1 GHz	1 kHz	Off	1)
X	X	Measure DANL	1 GHz	2 GHz	1 kHz	Off	2)
X	X	Measure DANL	2 GHz	3 GHz	1 kHz	Off	3)
X	X	Measure DANL	3 GHz	6 GHz	1 kHz	Off	4)
X	X	Measure DANL	6 GHz	12 GHz	1 kHz	Off	5)
X	X	Measure DANL	12 GHz	22 GHz	1 kHz	Off	6)
X	X	Measure DANL	22 GHz	26.5 GHz	1 kHz	Off	7)
X	Y	Measure DANL	10 MHz	1 GHz	1 kHz	On	8/21)
X	Y	Measure DANL	1 GHz	2 GHz	1 kHz	On	9/22)
X	Y	Measure DANL	2 GHz	3 GHz	1 kHz	On	10/23)
Y	X	Measure DANL	10 MHz	1 GHz	10 Hz	Off	11)
Y	X	Measure DANL	1 GHz	2 GHz	10 Hz	Off	12)
Y	X	Measure DANL	2 GHz	3 GHz	10 Hz	Off	13)
Y	X	Measure DANL	3 GHz	6 GHz	10 Hz	Off	14)
Y	X	Measure DANL	6 GHz	12 GHz	10 Hz	Off	15)
Y	X	Measure DANL	12 GHz	22 GHz	10 Hz	Off	16)
Y	X	Measure DANL	22 GHz	26.5 GHz	10 Hz	Off	17)
Y	Y	Measure DANL	10 MHz	1 GHz	10 Hz	On	18/24)
Y	Y	Measure DANL	1 GHz	2 GHz	10 Hz	On	19/25)
Y	Y	Measure DANL	2 GHz	3 GHz	10 Hz	On	20/26)

a. There are two possible TR Entries for measurements made with Preamp On, depending upon the ambient temperature. The first entry is for measurements made with an ambient temperature outside of the 20 to 30°□C range, but within the 0 to 55°□C range. The second entry is for measurements made with an ambient temperature within the 20 to 30°□C range.

Measuring Displayed Average Noise Level

1. Set the analyzer as follows using the start and stop frequencies, test RBW and preamp state as specified in Table 2-80:

   Auto Couple
   FREQUENCY, Start Freq, (*enter specified start frequency*)
   FREQUENCY, Stop Freq, (*enter specified stop frequency*)
   AMPLITUDE, –70 dBm
   Attenuation, 0 dB
   AMPLITUDE, More, Ref Lvl Offset, (*enter Ref Lvl Offset (1 kHz) if test RBW = 1 kHz*)
   AMPLITUDE, More, Ref Lvl Offset, (*enter Ref Lvl Offset (10 Hz) if test RBW = 10 Hz*)
   BW/Avg, Resolution BW, 1 MHz
   BW/Avg, Video BW, 10 kHz
   AMPLITUDE, More, Int Preamp (Off) (*if preamp state = Off*)
   AMPLITUDE, More, Int Preamp (On) (*if preamp state = On*)
   Sweep, Sweep (Cont)
   Sweep, Sweep Time (Auto)

2. If the analyzer is equipped with Option 1DN, press **Source, Amplitude** (Off).

3. On the analyzer, press **Single, View/Trace, Trace 1, Clear Write, BW/Avg, Average Type (Video), Averages, 3, Enter, Single.**

   Wait until VAvg 3 is displayed to the left of the graticule (the analyzer will take three sweeps, then stop).

4. On the analyzer, press the following keys:

   Peak Search (or **Search**)
   BW/Avg, Average (Off)
   Marker →, Mkr→ CF

5. If the test RBW is 1 kHz, press **Span, 20 kHz.**

   If the test RBW is 10 Hz, press **Span, 500 Hz.**

6. If the test RBW is 1 kHz, press **BW/Avg, Resolution BW, 1 kHz, Video BW, 30 Hz.**

   If the test RBW is 10 Hz, press **BW/Avg, Resolution BW, 10 Hz, Video BW, 1 Hz.**

7. On the analyzer, press **Single** and wait for the new sweep to finish.

8. On the analyzer, press **Display, Display Line** (On), and adjust the display line so that it is centered on the average trace noise, ignoring any residual responses (refer to the Residual Responses verification test for any suspect residuals).

Remove Reference Level Offset

9. Press **AMPLITUDE, More, Ref Lvl Offst, 0 dB.**

10. On the analyzer, press **Preset.**

38. Residual Responses

The analyzer input is terminated and the analyzer is swept from 150 kHz to 1 MHz. Then the analyzer is swept in incremental 10 MHz spans from 1 MHz to the upper frequency range. Any responses above the specification are noted.

There are no related adjustment procedures for this performance test.

Equipment Required

Termination, 50 Ω Type-N (m)


Additional Equipment for 75 Ω Input

Termination, 75 Ω, BNC (m)
Adapter, Type-N (f) to BNC (m), 75 Ω

Additional Equipment for Option BAB

Adapter, Type-N (f) to APC 3.5 (f)

Figure 2-54 Residual Response Test Setup

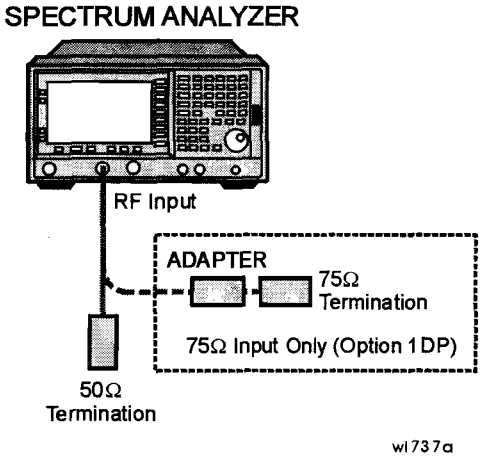

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω input, or damage to the input connector will occur.

Procedure

150 kHz to 1 MHz

1. Connect the 50 Ω termination to the analyzer input as shown in Figure 2-54.

   75 Ω Input: Use the adapter to connect the 75 Ω termination, and proceed with step 3.

2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   FREQUENCY, Start Freq, 150 kHz
   FREQUENCY, Stop Freq, 1 MHz
   AMPLITUDE, –60 dBm
   AMPLITUDE, Attenuation, 0 dB
   BW/Avg, 3 kHz
   BW/Avg, Video BW, 1 kHz
   Display, Display Line On, –90 dBm

3. Press **Single** and wait for a new sweep to finish. Look for any residual responses at or above the display line.

   If a residual is suspected, press **Single** again. A residual response will persist on successive sweeps, but a noise peak will not. Note the frequency and amplitude of any residual responses above the display line in Table 1.

4. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   FREQUENCY, 5.9 MHz
   FREQUENCY, CF Step, 9.9 MHz
   SPAN, 10 MHz
   AMPLITUDE, –60 dBm (*50 Ω Input only*)
   AMPLITUDE, –11.2 dBmV (*75 Ω Input only*)
   AMPLITUDE, Attenuation, 0 dB
   BW/Avg, 10 kHz
   BW/Avg, Video BW, 3 kHz
   Display, Display Line On, –90 dBm (*50 Ω Input only*)
   Display, Display Line On, –36 dBmV (*75 Ω Input only*)

5. Repeat step 6 and step 7 until the complete range of frequencies has been checked for the model and frequency ranges below.

Model	Frequency Range
E4401B and E4411B	1 MHz to 1.5 GHz
E4402B and E4403B	1 MHz to 3.0 GHz
E4404B, E4405B, E4407B, and E4408B	1 MHz to 6.7 GHz

6. Press **Single** and wait for a new sweep to finish. Look for any residual responses at or above the display line.

   If a residual is suspected, press **Single** again. A residual response will persist on successive sweeps, but a noise peak will not. Record the frequency and amplitude of any residual responses above the display line in Table 2-84.

7. Press **FREQUENCY** ↑.

   If there are any residuals at or near the frequency specification limits (1 MHz, 1.5 GHz, 3 GHz, or 6.7 GHz), it is recommended that a known frequency source be used as a frequency marker. This will ensure that testing is done at or below the specification limits.

Table 2-84 Residual Responses Worksheet

Frequency (MHz)	Amplitude (dBm or dBmV)

8. Record the highest residual from Table 2-84 as TR Entry 1 in the performance verification test record. If no residuals are found, then record "N/A" in the performance verification test record.

39. Fast Time Domain Amplitude Accuracy: Agilent E4401B, E4402B, E4404B, E4405B, and E4407B (Option AYX)


The analyzer amplitude reference signal is used to compare the amplitude level of a normal sweep time (≥5 ms) to a fast sweep time (≤5 ms) using the marker functions. The difference should be less than the marker readout resolution specification for the fast sweep times.

Equipment Required

Cable, BNC, 122 cm (48 in)
Adapter, Type-N (m) to BNC (f)

Procedure

Figure 2-55 Fast Time Domain Amplitude Accuracy Test Setup

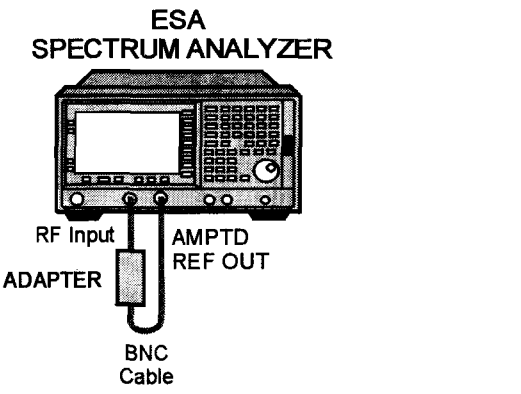

Fast Sweep Time Amplitude Accuracy

1. Connect the equipment as shown in Figure 2-55.

NOTE No test setup is required for E4401B.

2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. If the firmware revision is A.04.00 or later, press **Sweep, Points, 401, Enter**.

3. Set the analyzer as follows:

   FREQUENCY, 50 MHz
   SPAN, Zero Span
   Sweep 5 ms
   Input/Output (or **Input**), **Amptd Ref** (On) *(E4401B only)*
   Input/Output (or **Input**), **Amptd Ref Out** (On) *(E4402B, E4404B, E4405B, E4407B only)*
   AMPLITUDE, Scale Type (Lin)
   AMPLITUDE, Ref Level, 12.57 mV *(E4401B, 50 Ω only)*
   AMPLITUDE, Ref Level, 15.05 mV *(E4401B, 75 Ω only)*
   AMPLITUDE, Ref Level, 30.73 mV *(E4402B, E4404B, E4405B, E4407B only)*

4. On the analyzer, press:

   Marker, More 1 of 2, Function
   Marker Noise, Single
   Marker, Delta
   Sweep, 1 ms

5. If the ΔMkr1 amplitude readout (the second line) is <u>not</u> expressed as a percentage, subtract 1 from the ΔMkr1 amplitude (ignore the "X") and multiply the result by 100 to obtain the amplitude error in percent:

$$\text{Amplitude Error} = (\Delta\text{Mkr1} - 1.0) \times 100$$

6. If the ΔMkr1 amplitude readout is expressed as a percentage, subtract 100% from the ΔMkr1 amplitude reading to obtain the amplitude error in percent:

$$\text{Amplitude Error} = \Delta\text{Mkr1} - 100$$

7. Record the Amplitude Error as TR Entry 1 in the performance verification test record.

40. Tracking Generator Absolute Amplitude and Vernier Accuracy: Agilent E4401B and E4411B (Option 1DN or 1DQ)

A calibrated power sensor is connected to the tracking generator output to measure the power level at 50 MHz.

The power meter is set to relative mode so that future power level readings are in dB relative to the reference power level setting. The output power level setting is decreased in 1 dB steps and the power level is measured at each step. The difference between the ideal and actual power levels is calculated at each step.

Since a power sweep is accomplished by stepping through the vernier settings, the peak-to-peak variation of the vernier accuracy is equal to the power sweep accuracy.

The related adjustments for this performance test are "Tracking Generator ALC Calibration" and "Tracking Generator Frequency Slope."


Equipment Required

Power meter, compatible with power sensor
RF power sensor, 50 Ω

Additional Equipment for Option 1DQ

Power sensor, 75 Ω
Adapter, Type-N (f) to BNC (m), 75 Ω
Adapter, Type-N (f), 75 Ω to Type-N (m), 50 Ω

Figure 2-56 Absolute Amplitude, Vernier, and Power Sweep Accuracy Test Setup

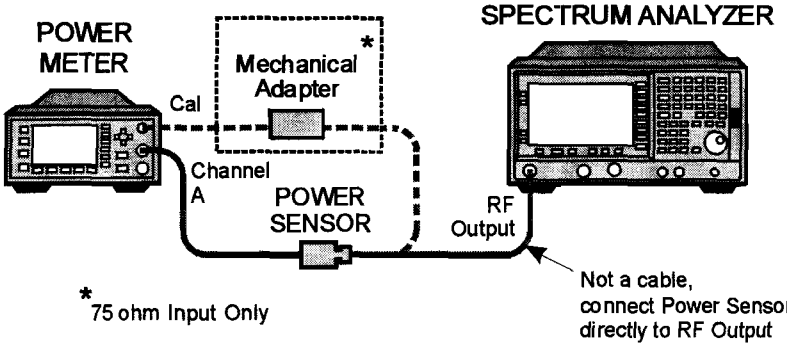

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω connectors, or damage to the connectors will occur.

Procedure

For E4411B analyzers, this test must be performed at 20 to 30° C.

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, 50 MHz
   SPAN, Zero Span
   AMPLITUDE, 0 dBm (*Option 1DN*)
   AMPLITUDE, 42.76 dBmV (*Option 1DQ*)
   Source, Amplitude (On), **0 dBm** (*Option 1DN*)
   Source, Amplitude (On), **42.76 dBmV** (*Option 1DQ*)
   Source, Attenuation, 0 dB
   Single

2. Zero and calibrate the power meter and power sensor in log mode (power reads out in dBm), as described in the power meter operation manual. Enter the 50 MHz Cal Factor of the power sensor into the power meter.

3. Connect the 50 Ω power sensor to the RF OUT as shown in Figure 2-56.

   Option 1DQ: Connect the 75 Ω power sensor to the RF OUT 75 Ω as shown in Figure 2-56.

4. Read the power level displayed on the power meter and record the result as TR Entry 1 of the performance verification test record as the Absolute Amplitude Accuracy.

   Absolute Amplitude Accuracy at 50 MHz = _____dB

   Option 1DQ: Add 6 dB to the power level displayed on the power meter and record the result as TR Entry 1 of the performance verification test record as the Absolute Amplitude Accuracy.

5. Set the power meter to dB relative mode as described in the power meter operation manual so that the readout is in power level relative to the power level at 50 MHz (press **Rel/Offset, Rel**).

6. Set the source amplitude to the settings indicated in Table 2-85.

   Option 1DQ: Use the source amplitude settings for Option 1DQ analyzers.

7. Press **Single** on the analyzer. At each setting, record the power level displayed on the power meter as Measured Power Level in Table 2-85.
8. Calculate the Vernier Accuracy by subtracting the Source Vernier Setting from the Measured Power Level for each Source Amplitude Setting in Table 2-85.

Vernier Accuracy = Measured Power Level (dB) – Source Vernier Setting (dB)

9. Locate the most positive and most negative Vernier Accuracy Values for Source Vernier Settings of –1 dBm to –10 dBm recorded in Table 2-85. Record the Positive Vernier Accuracy as TR entry 2 and the Negative Vernier Accuracy as TR entry 3 in the performance verification test record.

   Option 1DQ: For source amplitudes of 41.76 dBmV to 27.76 dBmV.

   Positive Vernier Accuracy _____ dB

   Negative Vernier Accuracy _____ dB

10. Locate the most positive and most negative Vernier Accuracy values for all Source Amplitude Settings in Table 2-85 and record these values below:

    Positive Power Sweep Accuracy _____ dB

    Negative Power Sweep Accuracy _____ dB

11. Calculate the Power Sweep Accuracy by subtracting the Negative Power Sweep Accuracy recorded in the previous step from the Positive Power Sweep Accuracy recorded in the previous step. Record the Power Sweep Accuracy as TR Entry 4 in the performance verification test record.

Power Sweep Accuracy = Positive Power Sweep Accuracy – Negative Power Sweep Accuracy

Power Sweep Accuracy _____ dB

Table 2-85 Vernier Accuracy Worksheet

Source Amplitude Setting		Source Vernier Setting	Measured Power Level	Vernier Accuracy
Option 1DN (dBm)	Option 1DQ (dBmV)	(dB)	(dB)	(dB)
0 (Ref)	42.76 (Ref)	0 (Ref)	NA	NA
–1	41.76	–1		
–2	40.76	–2		
–3	39.76	–3		
–4	38.76	–4		
–5	37.76	–5		
–6	36.76	–6		
–7	35.76	–7		
–8	34.76	–8		
–9	33.76	–9		
–10	32.76	–10		
–11	31.76	–11		
–12	30.76	–12		
–13	29.76	–13		
–14	28.76	–14		
–15	27.76	–15		

41. Tracking Generator Absolute Amplitude and Vernier Accuracy: Agilent E4402B, E4403B, E4404B, E4405B, E4407B and E4408B (Option 1DN)

A calibrated power sensor is connected to the tracking generator output to measure the power level at 50 MHz.

The power meter is set to relative mode so that future power level readings are in dB relative to the reference power level setting. The output power level setting is decreased in 1 dB steps and the power level is measured at each step. The difference between the ideal and actual power levels is calculated at each step.

Since a power sweep is accomplished by stepping through the vernier settings, the peak-to-peak variation of the vernier accuracy is equal to the power sweep accuracy.

The related adjustments for this performance test are "Tracking Generator ALC Calibration" and "Tracking Generator Frequency Slope."

Equipment Required

Power meter, compatible with power sensor
Power sensor, 50 Ω

Procedure


1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, 50 MHz
   SPAN, Zero Span
   AMPLITUDE, 0 dBm
   System, Alignments, Auto Align, Off
   Source Amptd, Amplitude (On), **–20 dBm**
   Source Amptd, Attenuation Auto Man, –20 dB
   Single Sweep

2. Zero and calibrate the power meter and power sensor in log mode (power reads out in dBm), as described in the power meter operation manual. Enter the 50 MHz Cal Factor of the power sensor into the power meter.

3. Connect the 50 Ω power sensor to the as shown in Figure 2-57.

Figure 2-57 **Absolute Amplitude, Vernier, and Power Sweep Accuracy Test Setup**

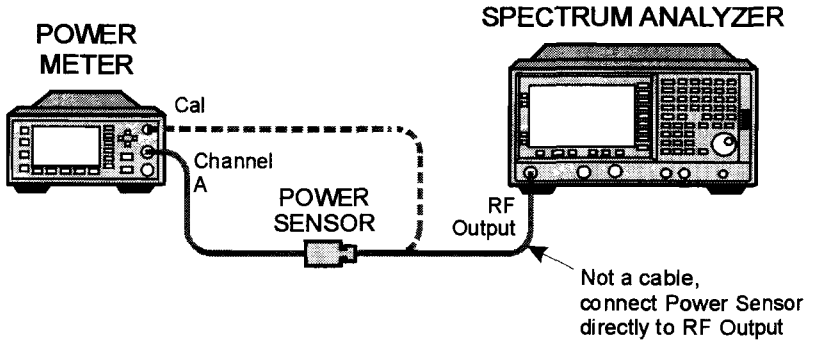

4. Read the power level displayed on the power meter, add 20 dB, and record the result as TR Entry 1 of the performance verification test record as the Absolute Amplitude Accuracy.

   Absolute Amplitude Accuracy at 50 MHz = _____dB

5. Set the power meter to dB relative mode as described in the power meter operation manual so that the readout is in power level relative to the power level at 50 MHz (press **Rel/Offset**, **Rel**).

6. Press **Single** on the analyzer. At each setting, record the power level displayed on the power meter in Table 2-86.

7. Set the source amplitude to the settings indicated in Table 2-86.

Table 2-86 **Vernier and Power Sweep Accuracy Worksheet**

Source Amplitude Setting (dBm)	Source Vernier Setting (dBm)	Measured Power Level (dB)	Vernier Accuracy (dB)
–18	–2		**1)**
–19	–3		**2)**
–20 (Ref)	–4	N/A	N/A
–21	–5		**3)**
–22	–6		**4)**
–23	–7		**5)**
–24	–8		**6)**
–25	–9		**7)**
–26	–10		**8)**

8. Calculate the Vernier Accuracy by adding 4 dB to the Source Vernier setting and subtracting the result from the Measured Power Level for each Source Amplitude Setting in Table 2-86.

Vernier Accuracy = Measured Power Level (dB) – (Source Vernier Setting (dB) + 4 dB)

9. Record the vernier accuracy values from Table 2-86 as test record entries 2 through 9 in the performance test record.
10. Press **System, Alignments, Auto Align, All.**

42. Tracking Generator Level Flatness: Agilent E4401B and E4411B (Option 1DN or 1DQ)

This test verifies that analyzers with the tracking generator option (1DN or 1DQ) meet their tracking generator level flatness specification. A calibrated power sensor is connected to the tracking generator output to measure the power level at 50 MHz. The power meter is set for dB relative mode so that future power level readings are in dB, relative to the power level at 50 MHz.

Next, the tracking generator is stepped to several frequencies throughout its range, and the output power difference relative to the power level at 50 MHz is measured for each frequency recorded.

For frequencies below 100 kHz, a digital voltmeter and precision 50 Ω termination are used to measure the power of the tracking generator output. The DVM is set to read out in dBm using the MATH function with R value set to 50 Ω. The following equation is used to calculate dBm:

$$dBm = 10 \log((E^2/R)/1mW)$$

The DVM readout is corrected by making the readings relative to the 100 kHz reading from the power sensor.

Option 1DN, 50 Ω tracking generators are tested from 9 kHz to 1500 MHz.

Option 1DQ, 75 Ω tracking generators are tested from 1 MHz to 1500 MHz.

The related adjustments for this procedure are "Tracking Generator ALC Calibration" and "Tracking Generator Frequency Slope."

Equipment Required

Power meter
Power sensor, 50 Ω, 100 kHz to 1.5 GHz
Digital multimeter
Termination, 50 Ω
Cable, BNC
Adapter, Type-N tee, (m) (f) (f)
Adapter, Type-N (m) to BNC (f)
Adapter, BNC (f) to dual banana plug


Additional Equipment for Option 1DQ

Power sensor, 75 Ω, 1 MHz to 1.5 GHz
Adapter, Type-N (f) to BNC (m), 75 Ω

CAUTION Use only 75 Ω cables, connectors, or adapters on the 75 Ω input of an Option 1DQ or damage to the input connector will occur.

Procedure

Figure 2-58 Tracking Generator Level Flatness Test Setup, ≥100 kHz

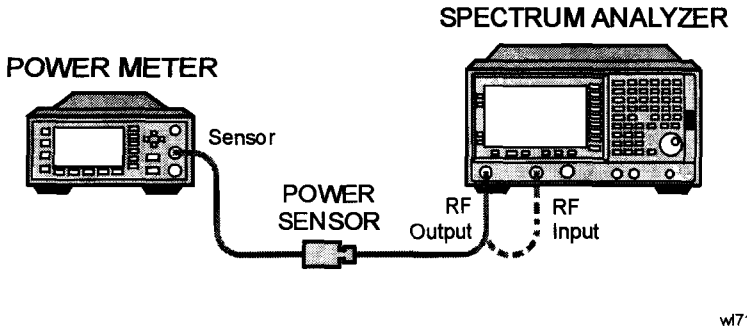

Tracking Generator Level Flatness, Center Frequency ≥100 kHz

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. If the firmware revision is A.04.00 or later, press **Sweep, Points, 401, Enter.**
2. Set the analyzer by pressing the following keys:

   FREQUENCY, 50 MHz
   FREQUENCY, CF Step, 100 MHz
   SPAN, Zero Span
   Source, Amplitude On, 0 dBm (*Option 1DN*)
   Source, Amplitude On, 42.76 dBmV (*Option 1DQ*)
   Single
3. Zero and calibrate the power meter with the power sensor in log mode (power reads out in dBm), as described in the power meter operation manual.

   Option 1DQ: Use a 75 Ω power sensor.
4. Connect the power sensor to the RF Out on the analyzer. See Figure 2-58.
5. Set the power meter to relative mode, as described in the power meter operation manual. Power levels now read out in power level relative to the power level at 50 MHz.

Perform the next four steps for each measurement value in Table 2-87.

1. Set the center frequency of the analyzer according to the values in Table 2-87. For 100 kHz, press **FREQUENCY**, **100 kHz**.
   The step up key (⇑) may be used to tune to center frequencies above 100 MHz.

   Option 1DQ: Start at 1 MHz by pressing **FREQUENCY, 1 MHz.**
2. Press **Single** on the analyzer.
3. Enter the appropriate power sensor Cal Factor into the power meter as indicated in Table 2-87.
4. Record the power level displayed on the power meter in the Level Flatness column in Table 2-87.

Table 2-87 Tracking Generator Level Flatness Worksheet, ≥100 kHz

Center Frequency	Level Flatness (dB)	Cal Factor (MHz)
100 kHz[a]		0.1
300 kHz[a]		0.3
500 kHz[a]		0.3
1 MHz		1
2 MHz		3
5 MHz		3
10 MHz		10
20 MHz		30
40 MHz		50
50 MHz	0 (Ref)	50
80 MHz		100
100 MHz		100
200 MHz		300
300 MHz		300
400 MHz		300
500 MHz		300
600 MHz		300
700 MHz		1000
800 MHz		1000

Table 2-87 **Tracking Generator Level Flatness Worksheet, ≥100 kHz**

Center Frequency	Level Flatness (dB)	Cal Factor (MHz)
900 MHz		1000
1000 MHz		1000
1100 MHz		1000
1200 MHz		1000
1300 MHz		1000
1400 MHz		1000
1500 MHz		2000

a. *These frequencies do not apply to analyzers with Option 1DQ Tracking Generators (75 Ω RF Output).*

5. Disconnect the power sensor from the RF Out on the analyzer.

Tracking Generator Level Flatness, Center Frequency ≤100 kHz

NOTE Perform step 2 to step 7 for 50 Ω tracking generators only (*Option 1DN*).


1. Set up the digital multimeter as follows.

Parameter	Setting
AC/DC	AC Volts
Impedance & Units:	
Set to 50 Ω impedance	SMATH 10[a]
Set to dBm	MATH 5[a]
Set to Synchronous	SETACV 3[a]
Sub-sampled mode	

a. *To set the HP/Agilent 3458A multi-meter functions from the front panel, press the blue shift key, then Recall State (T) key, then use the ⇑ (up) and ⇓ (down) arrows to select the appropriate function, then enter the value from the numeric keypad and press enter.*

NOTE Perform step 2 to step 7 for each measurement value in Table 2-89.

Figure 2-59 Tracking Generator Level Flatness Test Setup, ≤100 kHz

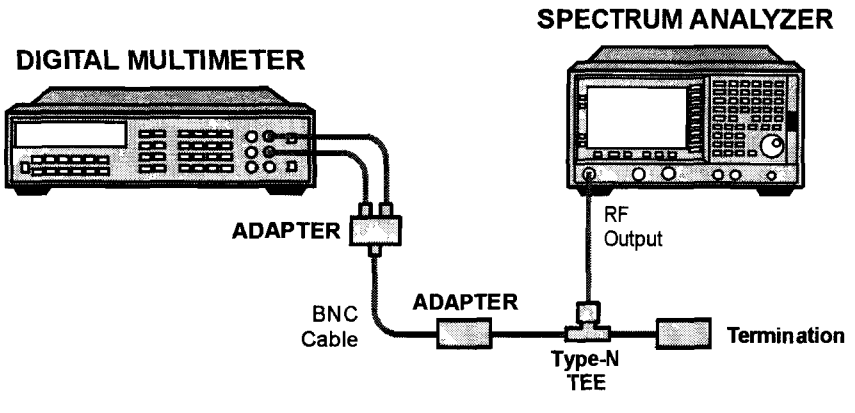

2. Refer to Figure 2-59 to set up the equipment.
3. To set the analyzer center frequency to 9 kHz, press **FREQUENCY**, **9 kHz** (or as indicated in Table 2-88).
4. Press **Single**.
5. Record the DVM readout in Table 2-88.
6. Subtract the 100 kHz Level Flatness readout in Table 2-87 from the 100 kHz DVM Readout in Table 2-88 and record as the DVM Offset at 100 kHz.

   DVM Offset at 100 kHz _____ dB

   For example, if the Level Flatness reading from Table 2-87 is 0.7 dB and the DVM Readout from Table 2-88 is –0.53 dBm, the DVM offset would be –1.23 dB.

   DVM Offset = DVM Readout – Level Flatness

7. Add the DVM Offset at 100 kHz from step 6, above, to each of the DVM Readouts in Table 2-88 and record as the Corrected Level Flatness in column 3.

   For example, if the DVM Readout from Table 2-88 is 0.22 dBm, and the DVM Offset is –1.23 dB, the Corrected Level Flatness would be –1.01 dB.

   Corrected Level Flatness = DVM + DVM Offset

Table 2-88 Tracking Generator Level Flatness Worksheet, ≤100 kHz

Center Frequency	DVM Readout (dBm)	Corrected Level Flatness (dBm)
9 kHz[a]		
20 kHz[a]		
40 kHz[a]		
60 kHz[a]		
80 kHz[a]		
100 kHz[a]		

a. *These frequencies do not apply to analyzers with Option 1DQ, 75 Ω tracking generators.*

8. For 50 Ω tracking generators only, locate the most positive Level Flatness reading in Table 2-87 and Table 2-88 for frequencies <1 MHz and enter this value as Test Record Entry 1 of the performance verification test record.
9. For 50 Ω tracking generators only, locate the most negative Level Flatness reading in Table 2-87 and Table 2-88 for frequencies <1 MHz and enter this value as Test Record Entry 2 of the performance verification test record.
10. Locate the most positive Level Flatness reading in Table 2-87 and Table 2-88 for frequencies ≥1 MHz and ≤10 MHz and enter this value as Test Record Entry 3 of the performance verification test record.
11. Locate the most negative Level Flatness reading in Table 2-87 and Table 2-88 for frequencies ≥1 MHz and ≤10 MHz and enter this value as Test Record Entry 4 of the performance verification test record.
12. Locate the most positive Level Flatness reading in Table 2-87 for frequencies ≥10 MHz and ≤1.5 GHz and enter this value as Test Record Entry 5 of the performance verification test record.
13. Locate the most negative Level Flatness reading in Table 2-87 for frequencies ≥10 MHz and ≤1.5 GHz and enter this value as Test Record Entry 6 of the performance verification test record.

43. Tracking Generator Level Flatness: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B (Option 1DN)

This test verifies that analyzers with the tracking generator option 1DN meet their tracking generator level flatness specification. In this test, a calibrated power sensor is connected to the tracking generator output to measure the power level at 50 MHz. The power meter is set for dB Relative mode so that future power level readings are in dB, relative to the power level at 50 MHz.

Next, the tracking generator is stepped to several frequencies throughout its range, and the output power difference relative to the power level at 50 MHz is measured for each frequency recorded.

For frequencies below 100 kHz, a digital voltmeter and precision 50 Ω termination are used to measure the power of the tracking generator output. The DVM is set to read out in dBm using the MATH function with R value set to 50 Ω. The following equation is used to calculate dBm:

$$dBm = 10 \log((E^2/R)/1mW)$$

The DVM readout is corrected by making the readings relative to the 100 kHz reading from the power sensor.

Option 1DN, 50 Ω tracking generators are tested from 9 kHz to 3000 MHz.


The related adjustment for this procedure is "Modulator Gain and Offset Adjustment."

Equipment Required

Power meter
Power sensor, 50 Ω
Digital multimeter
Termination, 50 Ω
Cable, BNC
Cable, Type-N (m) (m)
Adapter, Type-N tee, (m) (f) (f)
Adapter, Type-N (m) to BNC (f)
Adapter, BNC (f) to dual banana plug

Procedure

Figure 2-60 **Tracking Generator Level Flatness Test Setup ≥100 kHz**

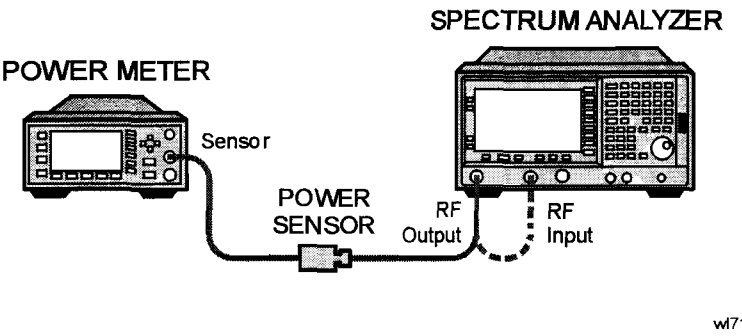

Tracking Generator Level Flatness, Center Frequency ≥100 kHz

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. If the firmware revision is A.04.00 or later, press **Sweep**, **Points**, **401**, **Enter**.
2. Connect the Type-N cable between the RF Input and the tracking generator RF OUT, as shown in Figure 2-60. Do not connect the power sensor to the analyzer yet.
3. Disconnect the Type-N cable.
4. Set the analyzer by pressing the following keys:

   FREQUENCY, **50 MHz**
   FREQUENCY, **CF Step**, **100 MHz**
   SPAN, **Zero Span**
   System, **Alignments**, **Auto Align**, **Off**
   Marker, **Source**
   Amplitude (On), **Source**
   Tracking Peak (*Wait for the* `Peaking` *message to disappear.*)
   Source, **Amplitude**
   –20 dBm, **Single**

5. Zero and calibrate the power meter with the power sensor in log mode (power reads out in dBm), as described in the power meter operation manual.
6. Connect the 50 Ω power sensor to the RF OUT 50 Ω on the analyzer. See Figure 2-60.
7. Set the power meter to relative mode, as described in the power meter operation manual. Power levels now read out in power level relative to the power level at 50 MHz.

Perform the next four steps for each measurement value in Table 2-89.

8. Set the center frequency of the analyzer according to the values in Table 2-89. For 100 kHz, press **FREQUENCY, 100 kHz**. The ⇑ (step up key) may be used to tune to center frequencies above 100 MHz.
9. Press **Single** on the analyzer.
10. Enter the appropriate power sensor Cal Factor into the power meter as indicated in Table 2-89.
11. Record the power level displayed on the power meter in the Level Flatness column in Table 2-89.

Table 2-89 Tracking Generator Level Flatness Worksheet, ≥100 kHz

Center Frequency	Level Flatness (dB)	Cal Factor (MHz)
100 kHz		0.1
300 kHz		0.3
500 kHz		0.3
1 MHz		1
2 MHz		3
5 MHz		3
10 MHz		10
20 MHz		30
40 MHz		50
50 MHz	0 (Ref)	50
80 MHz		100
100 MHz		100
200 MHz		300
300 MHz		300
400 MHz		300
500 MHz		300
600 MHz		300
700 MHz		1000
800 MHz		1000
900 MHz		1000
1000 MHz		1000
1100 MHz		1000

Table 2-89 Tracking Generator Level Flatness Worksheet, ≥100 kHz

Center Frequency	Level Flatness (dB)	Cal Factor (MHz)
1200 MHz		1000
1300 MHz		1000
1400 MHz		1000
1500 MHz		2000
1600 MHz		2000
1700 MHz		2000
1800 MHz		2000
1900 MHz		2000
2000 MHz		2000
2100 MHz		2000
2200 MHz		2000
2300 MHz		2000
2400 MHz		2000
2500 MHz		3000
2600 MHz		3000
2700 MHz		3000
2800 MHz		3000
2900 MHz		3000
3000 MHz		3000

12. Disconnect the power sensor from the RF Out 50 Ω on the analyzer. See Figure 2-60.


Tracking Generator Level Flatness, Center Frequency ≤100 kHz

1. Set up the digital multimeter as follows.

Parameter	Setting
AC/DC	AC Volts
Impedance & Units:	
Set to 50 Ω impedance	SMATH 10[a]
Set to dBm	MATH 5[a]
Set to Synchronous	SETACV 3[a]
Sub-sampled mode	

a. *To set the HP / Agilent 3458A multi-meter functions from the front panel, press the blue shift key, then Recall State (T) key, then use the ⇑ (up) and ⇓ (down) arrows to select the appropriate function, then enter the value from the numeric keypad and press enter.*

Figure 2-61 Tracking Generator Level Flatness Test Setup, ≤100 kHz

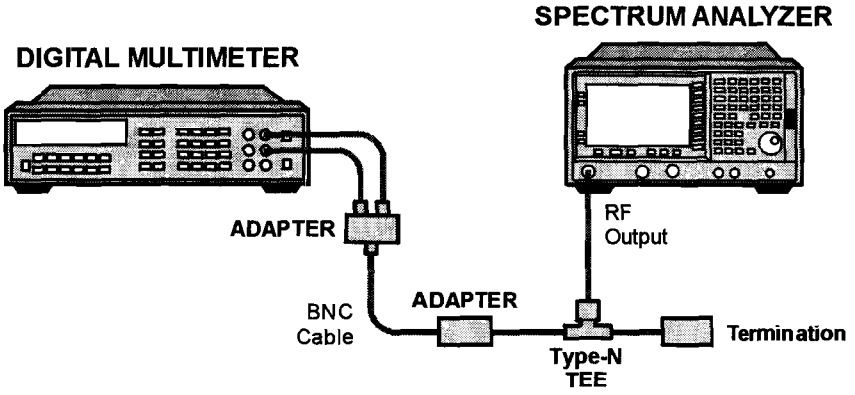

2. Refer to Figure 2-61 to set up the equipment.

   Repeat step 3 through step 7 for each Center Frequency value in Table 2-90.

3. Set the analyzer center frequency to 9 kHz, by pressing **FREQUENCY**, **9 kHz**.

4. Press **Single**.

5. Record the DVM readout in Table 2-90.

6. Subtract the 100 kHz Level Flatness readout in Table 2-89 from the 100 kHz DVM Readout in Table 2-90 and record as the DVM Offset at 100 kHz.

   DVM Offset at 100 kHz _____ dB

For example, if the Level Flatness reading from Table 2-89 is 0.7 dB and the DVM Readout from Table 2-90 is –0.53 dBm, the DVM offset would be –1.23 dB.

DVM Offset= DVM Readout – Level Flatness

7. Add the DVM Offset at 100 kHz from step 6, above, to each of the DVM Readouts in Table 2-90 and record as the Corrected Level Flatness in column 3.

   For example, if the DVM Readout from Table 2-90 is 0.22 dBm, and the DVM Offset is –1.23 dB, the Corrected Level Flatness would be –1.01 dB.

   Corrected Level Flatness= DVM Readout + DVM Offset

8. Press **System, Alignments, Auto Align, All.**

Table 2-90 Tracking Generator Level Flatness Worksheet, 100 kHz

Center Frequency	DVM Readout (dBm)	Corrected Level Flatness (dBm)
0 kHz		
20 kHz		
40 kHz		
60 kHz		
80 kHz		
100 kHz		

1. Locate the most positive Level Flatness reading in Table 2-89 and Table 2-90 for frequencies <1 MHz and enter this value as Test Record Entry 1 of the performance verification test record.
2. Locate the most negative Level Flatness reading in Table 2-89 and Table 2-90 for frequencies <1 MHz and enter this value as Test Record Entry 2 of the performance verification test record.
3. Locate the most positive Level Flatness reading in Table 2-89 and Table 2-90 for frequencies ≥1 MHz and ≤10 MHz and enter this value as Test Record Entry 3 of the performance verification test record.
4. Locate the most negative Level Flatness reading in Table 2-89 and Table 2-90 for frequencies ≥1 MHz and ≤10 MHz and enter this value as Test Record Entry 4 of the performance verification test record.
5. Locate the most positive Level Flatness reading in Table 2-89 for frequencies ≥10 MHz and ≤1.5 GHz and enter this value as Test Record Entry 5 of the performance verification test record.

6. Locate the most negative Level Flatness reading in Table 2-89 for frequencies ≥10 MHz and ≤1.5 GHz and enter this value as Test Record Entry 6 of the performance verification test record.
7. Locate the most positive Level Flatness reading in Table 2-89 for frequencies >1.5 GHz and enter this value as Test Record Entry 7 of the performance verification test record.
8. Locate the most negative Level Flatness reading in Table 2-89 for frequencies >1.5 GHz and enter this value as Test Record Entry 8 of the performance verification test record.

44. Tracking Generator Harmonic Spurious Outputs: Agilent E4401B and E4411B (Option 1DN or 1DQ)

The measurement for tracking generator harmonic spurious outputs determines the maximum level of tracking generator harmonics. The tracking generator output is connected to the input of a microwave analyzer, then tuned to several different frequencies as the amplitude of the second and third harmonics relative to the fundamental are measured at each frequency.

There are no related adjustment procedures for this performance test.


Equipment Required

Microwave analyzer
Cable, Type-N, 62 cm (24 in)
Cable, BNC to BNC, 23 cm (9 in)
Adapter, Type-N (m) to BNC (f)

Additional Equipment Required for Option 1DQ

50 Ω to 75 Ω Minimum loss pad
Adapter, Type-N (f) to BNC (m), 75 Ω

Figure 2-62 Harmonic Spurious Outputs Test Setup

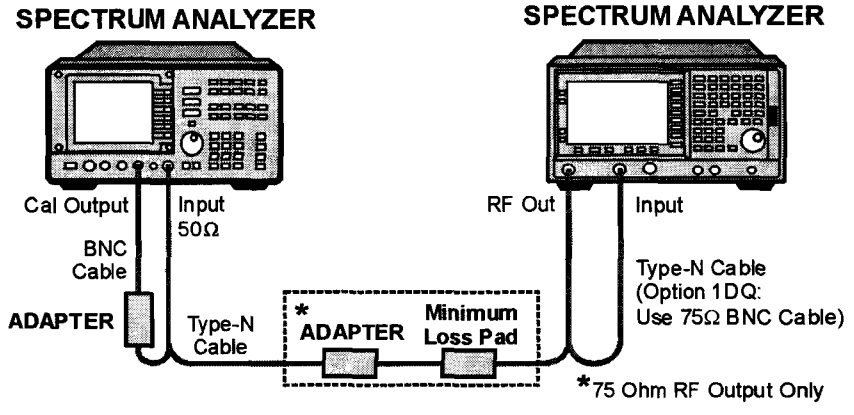

CAUTION Use only 75 Ω cables, connectors, or adapters on instruments with 75 Ω connectors or damage to the connectors will occur.

Procedure

NOTE The following steps are for an HP/Agilent 8563E microwave analyzer, the steps may be different if you are using another microwave analyzer.

1. Connect the 10 MHz reference output from the microwave analyzer to the 10 MHz reference input of the analyzer as shown in Figure 2-62.
2. *Complete this step only if more than 24 hours have elapsed since performing a front-panel calibration of the microwave analyzer.*

   The microwave analyzer should be allowed to warm up for at least 5 minutes before proceeding.

   Complete a front-panel calibration of the microwave analyzer by performing the following steps:

   a. Preset the microwave analyzer.

   b. Connect a BNC cable between CAL OUTPUT and 50 Ω Input.

   c. Press **CAL, REALIGN LO & IF**.

   d. Set **FREQUENCY, 300 MHz**.

   e. Set **SPAN, 20 MHz**.

   f. Set **AMPLITUDE, –10 dBm**.

   g. Press **PEAK SEARCH**.

   h. Press **CAL, REF LVL ADJ** and use the ⇑ ⇓ arrows to adjust the DAC value to a marker amplitude reading of –10 dBm. Press **STORE REF LVL**.

   i. Disconnect the BNC cable from between the CAL OUTPUT and 50 Ω Input.
3. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. If the firmware revision is A.04.00 or later, press **Sweep, Points, 401, Enter**.
4. Set the analyzer by pressing the following keys:

   FREQUENCY, 10 MHz
   SPAN, Zero Span
   BW/Avg, 10 kHz
   Source, Amplitude (On)
   Source, Amplitude (On), **0 dBm** (*Option 1DN*)
   Source, Amplitude (On),
   42.76 dBmV (Option 1DQ), **Single**

5. Set the microwave analyzer controls as follows:

   FREQUENCY, 10 MHz
   FREQUENCY, CF STEP, 10 MHz
   SPAN, 10 kHz
   AMPLITUDE, 5 dBm (*Option 1DN*)
   AMPLITUDE, 0 dBm (*Option 1DQ*)
   BW, 1 kHz

6. Refer to Figure 2-62 to connect the Type-N cable from the spectrum analyzer RF OUT to the input of the microwave analyzer.

NOTE The following steps are for an HP/Agilent 8563E microwave analyzer, the steps may be different if you are using another microwave analyzer.

Perform step 7 and step 8 for each measurement value in Table 2-91.

7. Set the analyzer center frequency to the next frequency listed in Table 2-91. Similarly, set the microwave analyzer frequency and step size to match the analyzer center frequency. Press **Single** on the analyzer.

8. On the microwave analyzer:

   a. Press **MKR, SIG TRK** (On). Wait for the signal to be displayed at center screen.

   b. Press **PEAK SEARCH, MKR, SIG TRK** (Off), **MARKER DELTA.**

   c. Press **FREQUENCY** and ⇑ (step-up key) to tune to the second harmonic.

   d. Press **PEAK SEARCH** and record the marker amplitude reading in Table 2-91 as the 2nd Harmonic Level for the appropriate Tracking Generator Output Frequency.

   e. Perform this step only if the Tracking Generator Output Frequency is ≤500 MHz. Press **FREQUENCY** and ⇑ (step-up key) to tune to the third harmonic. Press **PEAK SEARCH**.

      Record the marker amplitude reading in Table 2-91 as the 3rd Harmonic Level for the appropriate Tracking Generator Output Frequency.

   f. Press **MKR, MARKERS** (Off).

Table 2-91 Tracking Generator Harmonic Spurious Response Worksheet

1.5 GHz Tracking Generator Output Frequency	2nd Harmonic Level (dBc)	3rd Harmonic Level (dBc)
10 MHz		
100 MHz		
300 MHz		
750 MHz		N/A

9. From Table 2-91, enter the 2nd Harmonic Level at 10 MHz as Test Record Entry 1 and copy this value into the performance verification test record.

   Test Record Entry 1:
   TG 2nd Harmonic Spurious Output _____ dB

10. From Table 2-91, locate the most positive 2nd Harmonic Level for tracking generator frequencies of 100 MHz to 750 MHz and record this value as Test Record Entry 2 and copy this value into the performance verification test record.

    Test Record Entry 2:
    TG 2nd Harmonic Spurious Output _____ dB

11. From Table 2-91, enter the 3rd Harmonic Level at 10 MHz as Test Record Entry 3 and copy this value into the performance verification test record.

    Test Record Entry 3:
    TG 3rd Harmonic Spurious Output _____ dB

12. From Table 2-91, locate the most positive 3rd Harmonic Level for tracking generator frequencies of 100 MHz to 750 MHz and record this value as Test Record Entry 4 and copy this value into the performance verification test record.

    Test Record Entry 4:
    TG 3rd Harmonic Spurious Output _____ dB

45. Tracking Generator Harmonic Spurious Outputs: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B (Option 1DN)


The measurement for tracking generator harmonic spurious outputs determines the maximum level of tracking generator harmonics. The tracking generator output is connected to the input of a microwave analyzer, then tuned to several different frequencies as the amplitude of the second and third harmonics (relative to the fundamental) are measured at each frequency.

There are no related adjustment procedures for this performance test.

Equipment Required

Microwave analyzer
Cable, Type-N, 62 cm (24 in)
Cable, BNC to BNC, 23 cm (9 in)
Adapter, Type-N (m) to BNC (f)

Figure 2-63 Harmonic Spurious Outputs Test Setup

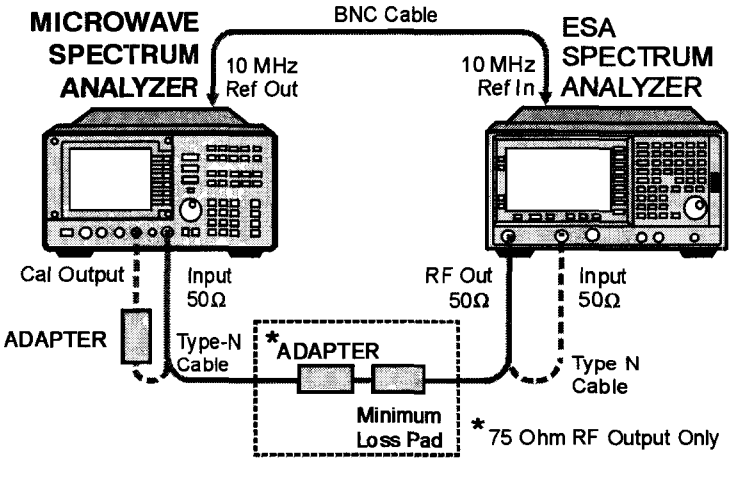

Procedure

NOTE The following steps are for an HP/Agilent 8563E microwave analyzer, the steps may be different if you are using another microwave analyzer.

1. *Complete this step only if more than 24 hours have elapsed since performing a front-panel calibration of the microwave analyzer.*

   The microwave analyzer should be allowed to warm up for at least 5 minutes before proceeding.

Complete a front-panel calibration of the microwave analyzer by performing the following steps:

a. Preset the microwave analyzer.

b. Connect a BNC cable between CAL OUTPUT and 50 Ω Input.

c. Press **CAL, REALIGN LO & IF**.

d. Set **FREQUENCY, 300 MHz**.

e. Set **SPAN, 20 MHz**.

f. Set **AMPLITUDE, –10 dBm**.

g. Press **PEAK SEARCH**.

h. Press **CAL, REF LVL ADJ** and use the ⇑ ⇓ arrows to adjust the DAC value to a marker amplitude reading of –10 dBm. Press **STORE REF LVL**.

i. Disconnect the BNC cable from between the CAL OUTPUT and 50 Ω Input.

2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. If the firmware revision is A.04.00 or later, press **Sweep, Points, 401, Enter**.

3. Use the Type-N cable to connect the RF INPUT to the tracking generator RF OUT as shown in Figure 2-63. Do not connect the Type-N cable to the microwave analyzer yet. Connect the 10 MHz Reference from the output of the microwave analyzer to the 10 MHz Reference Input of the analyzer being tested.

4. Set the analyzer by pressing the following keys:

   FREQUENCY, 10 MHz
   SPAN, Zero Span
   BW/Avg, 10 kHz
   System, Alignments, Auto Align, Off
   Marker
   Source, Amplitude (On)
   Source, Tracking Peak *(Wait for the* `Peaking` *message to appear.)*
   Source, Amplitude (On), **–2 dBm**
   Single

5. Set the microwave analyzer controls as follows:

   FREQUENCY, 9 kHz
   FREQUENCY, CF STEP, 9 kHz
   SPAN, 10 kHz
   AMPLITUDE, 5 dBm
   BW, 1 kHz

6. Disconnect the Type-N cable from between the analyzer RF INPUT and the tracking generator RF OUT. Refer to Figure 2-63 to connect the Type-N cable from the analyzer RF OUT to the input of the microwave analyzer.

NOTE The following steps are for an HP/Agilent 8563E microwave analyzer, the steps may be different if you are using another microwave analyzer.

Perform step 7 and step 8 for each measurement value in Table 2-92.

7. Set the analyzer center frequency to the next frequency listed in Table 2-92. Similarly, set the microwave analyzer frequency and step size to match the analyzer center frequency. Press **Single** on the analyzer.
8. On the microwave analyzer:
   a. Press **MKR**, **SIG TRK** (On). Wait for the signal to be displayed at center screen.
   b. Press **PEAK SEARCH**, **MKR**, **SIG TRK** (Off), **MARKER DELTA**.
   c. Press **FREQUENCY** and ⇑ (step up key) to tune to the second harmonic.
   d. Press **PEAK SEARCH** and record the marker amplitude reading in Table 2-92 as the 2nd Harmonic Level for the appropriate Tracking Generator Output Frequency.
   e. Perform this step only if the Tracking Generator Output Frequency is ≤900 MHz. Press **FREQUENCY** and ⇑ (step up key) to tune to the third harmonic. Press **PEAK SEARCH**.

      Record the marker amplitude reading in Table 2-92 as the 3rd Harmonic Level for the appropriate Tracking Generator Output Frequency.
   f. Press **MKR**, **MARKERS** (Off).

Table 2-92 Tracking Generator Harmonic Spurious Response Worksheet

1.5 GHz Tracking Generator Output Frequency	2nd Harmonic Level (dBc)	3rd Harmonic Level (dBc)
9 kHz		
25 kHz		
100 MHz		
300 MHz		
900 MHz		
1500 MHz		N/A

9. From Table 2-92, enter the 2nd Harmonic Level at 9 kHz as Test Record Entry 1 and copy this value into the performance verification test record.

   Test Record Entry 1:
   TG 2nd Harmonic Spurious Output _____ dB

10. From Table 2-92, locate the most positive 2nd Harmonic Level for tracking generator frequencies of 9 kHz to 750 MHz and record this value as Test Record Entry 2 and copy this value into the performance verification test record.

    Test Record Entry 2:
    TG 2nd Harmonic Spurious Output _____ dB

11. From Table 2-92, enter the 3rd Harmonic Level at 9 kHz as Test Record Entry 3 and copy this value into the performance verification test record.

    Test Record Entry 3:
    TG 3rd Harmonic Spurious Output _____ dB

12. From Table 2-92, locate the most positive 3rd Harmonic Level for tracking generator frequencies of 25 kHz to 1500 MHz and record this value as Test Record Entry 4 and copy this value into the performance verification test record.

    Test Record Entry 4:
    TG 3rd Harmonic Spurious Output _____ dB

13. Press **System, Alignments, Auto Align, All**.

46. Tracking Generator Non-Harmonic Spurious Outputs: Agilent E4401B and E4411B (Option 1DN or 1DQ)

This procedure determines the maximum level of the non-harmonic spurious outputs of the tracking generator. The tracking generator output is set to several different output frequencies. For each output frequency, several sweeps are taken on the microwave analyzer over different frequency spans and the highest displayed spurious response is measured in each span. Responses at the fundamental frequency of the tracking generator output or their harmonics are ignored. The amplitude of the highest spurious response is recorded.

There are no related adjustments for this performance test.


Equipment Required

Microwave analyzer
Cable, Type-N, 62 cm (24 in)
Cable, BNC, 23 cm (9 in)
Adapter, Type-N (m) to BNC (f)

Additional Equipment for 75 Ω Input

Pad, minimum loss
Adapter, Type-N (f) to BNC (m), 75 Ω

Figure 2-64 Non-Harmonic Spurious Outputs Test Setup

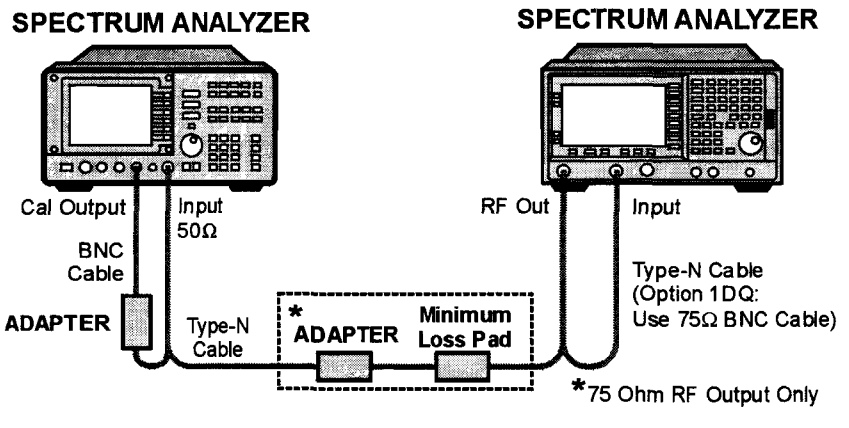

Procedure

NOTE The following steps are for an HP/Agilent 8563E microwave analyzer, the steps may be different if you are using another microwave analyzer.

1. *Complete this step only if more than two hours have elapsed since performing a front-panel calibration of the microwave analyzer.*

   The microwave analyzer should be allowed to warm up for at least 30 minutes before proceeding.

   Complete a front-panel calibration of the microwave analyzer by performing the following steps:

   a. Preset the microwave analyzer.

   b. Connect a BNC cable between CAL OUTPUT and 50 Ω Input.

   c. Press **CAL, REALIGN LO & IF**.

   d. Set **FREQUENCY, 300 MHz**.

   e. Set **SPAN, 20 MHz**.

   f. Set **AMPLITUDE, –10 dBm**.

   g. Press **PEAK SEARCH**.

   h. Press **CAL, REF LVL ADJ** and use the ⇑ ⇓ arrows to adjust the DAC value to a marker amplitude reading of –10 dBm. Press **STORE REF LVL**.

   i. Disconnect the BNC cable from between the CAL OUTPUT and 50 Ω Input.

2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, 50 MHz
   SPAN, Zero Span
   BW/Avg, 30 kHz
   Marker
   Source, Amplitude On, 0 dBm
   Source, Amplitude On, 42.76 dBmV *(75 Ω Option only)*

3. Set the microwave analyzer by pressing the following keys:

   SPAN, 100 kHz
   AMPLITUDE, 5 dBm
   AMPLITUDE, 0 dBm *(75 Ω Option only)*
   AMPLITUDE, ATTEN, 20 dB
   AMPLITUDE, LOG dB/DIV, 10 dB

4. Disconnect the Type-N cable from between the analyzer RF INPUT and the tracking generator RF OUT. Refer to Figure 2-64 to connect the Type-N cable from the analyzer RF OUT to the microwave analyzer 50 Ω Input.

Measuring Fundamental Amplitudes

Perform the following two steps for each fundamental frequency in Table 2-93.

1. Set the analyzer center frequency to the fundamental frequency listed in Table 2-93 and press **Single** to activate a single sweep. Set the microwave analyzer to the same frequency.
2. On the microwave analyzer, press **PEAK SEARCH**. Press **MKR →**, **MARKER → REF LVL**. Wait for another sweep to finish. Press **PEAK SEARCH**. Record the marker amplitude reading in Table 2-93 as the Fundamental Amplitude.

Table 2-93 Tracking Generator Fundamental Response Worksheet

Fundamental Frequency	Fundamental Amplitude (dBm)
10 MHz	
750 MHz	
1.5 GHz	

Measuring Non-Harmonic Responses

1. On the analyzer, set the center frequency to the initial value indicated in the first row of Table 2-93. Press **Single** on the analyzer to trigger a single sweep.
2. Set the microwave analyzer Start Freq, Stop Freq, and Res BW as indicated in the first row of Table 2-94.

   75 Ω outputs only: Measure only at start frequencies of 1 MHz and greater.
3. Press **SGL SWP** on the microwave analyzer to activate a single sweep and wait for the sweep to finish. Press **PEAK SEARCH** to locate the largest spurious response.
4. Verify that the marked signal is not the fundamental or a harmonic of the fundamental by performing the following steps:

NOTE The following steps are for an HP/Agilent 8563E microwave analyzer, the steps may be different if you are using another microwave analyzer.

a. Divide the marker frequency by the fundamental frequency (the analyzer center frequency setting). For example, if the marker frequency is 30.3 MHz and the fundamental frequency is 10 MHz, dividing 30.3 MHz by 10 MHz yields 3.03.

b. Round the number calculated in step a to the nearest whole number. In the example above, 3.03 should be rounded to 3. Values less than 1 should be rounded up to 1.

c. Multiply the fundamental frequency by the number calculated in step b. Following the example, multiplying 10 MHz by 3 yields 30 MHz.

d. Calculate the difference between the marker frequency and the frequency calculated in step c above. Continuing the example, the difference would be 300 kHz.

e. Due to span accuracy uncertainties in the microwave analyzer, the marker frequency might not equal the actual frequency. Given the marker frequency, check if the difference calculated in step d is within the appropriate tolerance:

   For marker frequencies <5 MHz, tolerance = ±200 kHz
   For marker frequencies <55 MHz, tolerance = ±750 kHz
   For marker frequencies >55 MHz, tolerance = ±10 MHz

f. If the difference in step d is within the indicated tolerance, the signal in question is the fundamental signal (if the number in step b = 1) or a harmonic of the fundamental (if the number in step b >1). This response should be ignored.

5. Verify that the marked signal is a true response and not a random noise peak by pressing **SINGLE** to trigger a new sweep and press **PEAK SEARCH**. A true response will remain at the same frequency and amplitude on successive sweeps but a noise peak will not.

   If the marked signal is not the fundamental or a harmonic of the fundamental and is a true response, proceed with step 7.

6. If the marked signal is either the fundamental or a harmonic of the fundamental or a noise peak, move the marker on the microwave analyzer to the next highest signal by pressing **NEXT PEAK**. Repeat step 4 above.

   Perform step 7 only if the marker signal is a true response and not a fundamental or harmonic of the fundamental. Otherwise, continue with step 8.

7. Calculate the difference between the amplitude of marked signal and the fundamental amplitude as listed in Table 2-93.

   For example, if the fundamental amplitude for a fundamental frequency of 10 MHz is 1.2 dBm and the marker amplitude is –40.8 dBm, the difference is –42 dBc.

Record this difference as the non-harmonic response amplitude for the appropriate analyzer center frequency and microwave analyzer start and stop frequency settings in Table 2-94.

Non-harmonic Amplitude = Marker Amplitude – Fundamental Amplitude

8. If a true non-harmonic spurious response is not found, record "NOISE" as the Amplitude of Non-Harmonic Response in Table 2-94 for the appropriate analyzer center frequency and microwave analyzer start and stop frequency settings.
9. Repeat step 1 through step 8 for the remaining analyzer center frequency and microwave analyzer settings in Table 2-94.

Table 2-94 1.5 GHz Tracking Generator Non-Harmonic Spurious Response Worksheet

Analyzer Center Frequency	Microwave Analyzer Start Frequency	Microwave Analyzer Stop Frequency	Microwave Analyzer Resolution Bandwidth	Amplitude of Non-Harmonic Response (dBc)
10 MHz	9 kHz[a]	100 kHz[a]	300 Hz[a]	
10 MHz	100 kHz[b]	5 MHz	10 kHz	
10 MHz	5 MHz	55 MHz	100 kHz	
10 MHz	55 MHz	1240 MHz	1 MHz	
10 MHz	1240 MHz	1500 MHz	1 MHz	
750 MHz	9 kHz[a]	100 kHz[a]	300 Hz[a]	
750 MHz	100 kHz[b]	5 MHz	10 kHz	
750 MHz	5 MHz	55 MHz	100 kHz	
750 MHz	55 MHz	1240 MHz	1 MHz	
750 MHz	1240 MHz	1500 MHz	1 MHz	
1.5 GHz	9 kHz[a]	100 kHz[a]	300 Hz[a]	
1.5 GHz	100 kHz[b]	5 MHz	10 kHz	
1.5 GHz	5 MHz	55 MHz	100 kHz	
1.5 GHz	55 MHz	1240 MHz	1 MHz	
1.5 GHz	1240 MHz	1500 MHz	1 MHz	

a. 75 Ω RF Outputs: Omit this frequency range.
b. 75 Ω RF Outputs: Set the start frequency to 1 MHz.

Determining the Highest Non-harmonic Spurious Response

1. In Table 2-94, locate the most positive non-harmonic response amplitude. Record this amplitude as the highest non-harmonic response amplitude in TR Entry 1 of the performance verification test record.

47. Tracking Generator Non-Harmonic Spurious Outputs: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B (Option 1DN)


This procedure determines the maximum level of the non-harmonic spurious outputs of the tracking generator. The tracking generator output is set to several different output frequencies. For each output frequency, several sweeps are taken on the microwave analyzer over different frequency spans and the highest displayed spurious response is measured in each span. Responses at the fundamental frequency of the tracking generator output or their harmonics are ignored. The amplitude of the highest spurious response is recorded.

There are no related adjustments for this performance test.

Equipment Required

Microwave analyzer
Cable, Type-N, 62 cm (24 in)
Cable, BNC, 23 cm (9 in)
Adapter, Type-N (m) to BNC (f)

Figure 2-65 Non-Harmonic Spurious Outputs Test Setup

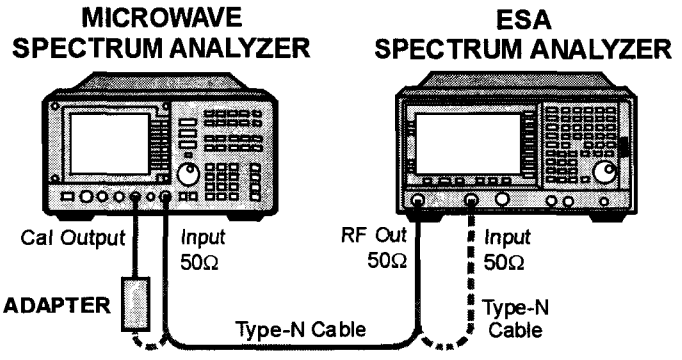

Procedure

NOTE The following steps are for an HP/Agilent 8563E microwave analyzer, the steps may be different if you are using another microwave analyzer.

47. Tracking Generator Non-Harmonic Spurious Outputs: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B (Option 1DN)

1. *Complete this step only if more than two hours have elapsed since performing a front-panel calibration of the microwave analyzer.*

   The microwave analyzer should be allowed to warm up for at least 30 minutes before proceeding.

   Complete a front-panel calibration of the microwave analyzer by performing the following steps:

   a. Preset the microwave analyzer.

   b. Connect a BNC cable between CAL OUTPUT and 50 Ω Input.

   c. Press **CAL, REALIGN LO & IF**.

   d. Set **FREQUENCY, 300 MHz**.

   e. Set **SPAN, 20 MHz**.

   f. Set **AMPLITUDE, –10 dBm**.

   g. Press **PEAK SEARCH**.

   h. Press **CAL, REF LVL ADJ** and use the ⇑ ⇓ arrows to adjust the DAC value to a marker amplitude reading of –10 dBm. Press **STORE REF LVL**.

   i. Disconnect the BNC cable from between the CAL OUTPUT and 50 Ω Input.

2. Use the Type-N cable to connect the RF Input to the RF OUT of the tracking generator as shown in Figure 2-65. Do not connect to the RF Input of the microwave analyzer yet.

3. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, 50 MHz
   SPAN, Zero Span
   BW/Avg, 30 kHz
   System, Alignments, Auto Align, Off
   Marker
   Source, Tracking Peak (*wait for the* `Peaking` *message to appear*)
   Source, Amplitude On, –2 dBm
   Single

4. Set the microwave analyzer by pressing the following keys:

   SPAN, 100 kHz
   AMPLITUDE, 5 dBm
   AMPLITUDE, Attenuation, 20 dB
   AMPLITUDE, LOG dB/DIV, 10 dB

5. Disconnect the Type-N cable from between the analyzer RF INPUT and the tracking generator RF OUT. Refer to Figure 2-65 to connect the Type-N cable from the analyzer RF OUT to the microwave analyzer 50 Ω Input.

Measuring Fundamental Amplitudes

Perform the following two steps for each measurement value in Table 2-95.

6. Set the analyzer center frequency to the Fundamental Frequency listed in Table 2-95 and press **Single** to activate a single sweep. Set the microwave analyzer to the same frequency.
7. On the microwave analyzer, press **PEAK SEARCH**. Press **MARKER →**, **MKR → REF LVL**. Wait for another sweep to finish. Press **PEAK SEARCH**. Record the marker amplitude reading in Table 2-95 as the fundamental amplitude.

Table 2-95 Tracking Generator Fundamental Response Worksheet

Fundamental Frequency	Fundamental Amplitude (dBm)
10 MHz	
1.5 GHz	
3.0 GHz	

Measuring Non-Harmonic Responses

8. On the analyzer, set the center frequency to the initial value indicated in the first row of Table 2-95. Press **Single** on the analyzer to trigger a single sweep.
9. Set the Start Freq, Stop Freq, and Res BW of the microwave analyzer as indicated in the first row of Table 2-96.
10. Press **SGL SWP** on the microwave analyzer to activate a single sweep and wait for the sweep to finish. Press **PEAK SEARCH** to locate the largest spurious response.
11. Verify that the marked signal is not the fundamental or a harmonic of the fundamental by performing the following steps:

NOTE The following steps are for an HP/Agilent 8563E microwave analyzer, the steps may be different if you are using another microwave analyzer.

a. Divide the marker frequency by the fundamental frequency (the analyzer center frequency setting). For example, if the marker frequency is 30.3 MHz and the fundamental frequency is 10 MHz, dividing 30.3 MHz by 10 MHz yields 3.03.

b. Round the number calculated in step a to the nearest whole number. In the example above, 3.03 should be rounded to 3. Values less than 1 should be rounded up to 1.

c. Multiply the fundamental frequency by the number calculated in step b. Following the example, multiplying 10 MHz by 3 yields 30 MHz.

d. Calculate the difference between the marker frequency and the frequency calculated in step c above. Continuing the example, the difference would be 300 kHz.

e. Due to span accuracy uncertainties in the microwave analyzer, the marker frequency might not equal the actual frequency. Given the marker frequency, check if the difference calculated in step d is within the appropriate tolerance:

For marker frequencies <5 MHz, tolerance = ±200 kHz
For marker frequencies <55 MHz, tolerance = ±750 kHz
For marker frequencies >55 MHz, tolerance = ±10 MHz

f. If the difference in step d is within the indicated tolerance, the signal in question is the fundamental signal (if the number in step b = 1) or a harmonic of the fundamental (if the number in step b >1). This response should be ignored.

12. Verify that the marked signal is a true response and not a random noise peak by pressing **SINGLE** to trigger a new sweep and press **PEAK SEARCH**. A true response will remain at the same frequency and amplitude on successive sweeps but a noise peak will not.

If the marked signal is not the fundamental or a harmonic of the fundamental and is a true response, proceed with step 14.

13. If the marked signal is either the fundamental or a harmonic of the fundamental or a noise peak, move the marker on the microwave analyzer to the next highest signal by pressing **NEXT PEAK**. Repeat step 11 above.

Perform step 14 only if the marker signal is a true response and not a fundamental or harmonic of the fundamental. Otherwise, continue with step 15.

14. Calculate the difference between the amplitude of marked signal and the fundamental amplitude as listed in Table 2-95.

For example, if the fundamental amplitude for a fundamental frequency of 10 MHz is 1.2 dBm and the marker amplitude is –40.8 dBm, the difference is –42 dBc.

Record this difference as the non-harmonic response amplitude for the appropriate analyzer center frequency and microwave analyzer start and stop frequency settings in Table 2-96.

Non-harmonic Amplitude = Marker Amplitude – Fundamental Amplitude

15. If a true non-harmonic spurious response is not found, record "NOISE" as the non-harmonic response Amplitude in Table 2-96 for the appropriate analyzer center frequency and microwave analyzer start and stop frequency settings.

16. Repeat step 8 through step 15 for the remaining analyzer center frequency and microwave analyzer settings in Table 2-96.

17. Press **System, Alignments, Auto Align, All**

Table 2-96 3.0 GHz Tracking Generator Non-Harmonic Spurious Response Worksheet

Analyzer Center Frequency	Microwave Analyzer Start Frequency	Microwave Analyzer Stop Frequency	Microwave Analyzer Resolution Bandwidth	Amplitude of Non-Harmonic Response (dBc)
10 MHz	9 kHz	100 kHz	300 Hz	
10 MHz	100 kHz	5 MHz	10 kHz	
10 MHz	5 MHz	55 MHz	100 kHz	
10 MHz	55 MHz	1240 MHz	1 MHz	
10 MHz	1240 MHz	2000 MHz	1 MHz	
10 MHz	2000 MHz	3000 MHz	1 MHz	
1.5 GHz	9 kHz	100 kHz	300 Hz	
1.5 GHz	100 kHz	5 MHz	10 kHz	
1.5 GHz	5 MHz	55 MHz	100 kHz	
1.5 GHz	55 MHz	1240 MHz	1 MHz	
1.5 GHz	1240 MHz	2000 MHz	1 MHz	
1.5 GHz	2000 MHz	3000 MHz	1 MHz	
3.0 GHz	9 kHz	100 kHz	300 Hz	
3.0 GHz	100 kHz	5 MHz	10 kHz	
3.0 GHz	5 MHz	55 MHz	100 kHz	
3.0 GHz	55 MHz	1240 MHz	1 MHz	
3.0 GHz	1240 MHz	2000 MHz	1 MHz	
3.0 GHz	2000 MHz	3000 MHz	1 MHz	

Determining the Highest Non-harmonic Spurious Response

1. In Table 2-96, locate the most positive non-harmonic response amplitude for microwave analyzer stop frequency settings ≤2000 MHz. Record this amplitude as the highest non-harmonic response amplitude in TR Entry 1 of the performance verification test record.
2. In Table 2-96, locate the most positive non-harmonic response amplitude for microwave analyzer start frequency settings ≥2000 MHz. Record this amplitude as the highest non-harmonic response amplitude in TR Entry 2 of the performance verification test record.

48. Tracking Generator LO Feedthrough Amplitude: Agilent E4402B, E4403B, E4404B, E4405B, E4407B, and E4408B (Option 1DN)


The tracking generator output is connected to the analyzer 50 Ω Input, and the tracking is adjusted at 50 MHz for a maximum signal level. The tracking generator output is then connected to the input of a microwave analyzer. The tracking generator is tuned to several different frequencies and the LO Feedthrough is measured at the frequency extremes of the LO.

The related adjustment for this procedure is "TG LO Leveling."

Equipment Required

Microwave analyzer
Cable, Type-N, 62 cm (24 in)
Cable, BNC, 23 cm (9 in)
Adapter, Type-N (m) to BNC (f)

Figure 2-66 LO Feedthrough Amplitude Test Setup

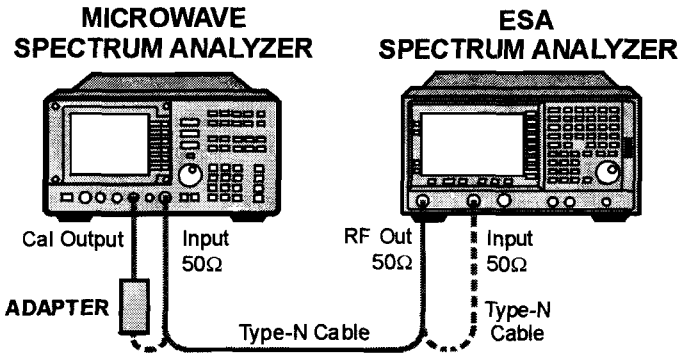

wi718a

Procedure

NOTE Note that the following steps are for an HP/Agilent 8563E microwave analyzer, the steps may be different if you are using another microwave analyzer.

1. Press **PRESET** on the microwave analyzer.

   The microwave analyzer should be allowed to warm up for at least five minutes before proceeding.

Complete step 2 only if more than 24 hours have elapsed since performing a front-panel calibration of the microwave analyzer.

2. Perform a front-panel calibration of the microwave analyzer by performing the following steps:
   a. Connect a BNC cable between CAL OUTPUT and 50 Ω Input.
   b. Press **CAL, REALIGN LO & IF**.
   c. Set **FREQUENCY, 300 MHz.**
   d. Set **SPAN, 20 MHz.**
   e. Set **AMPLITUDE, –10 dBm.**
   f. Press **PEAK SEARCH**.
   g. Press **CAL, REF LVL ADJ** and use the ⇑ ⇓ arrows to adjust the DAC value to a marker amplitude reading of –10 dBm. Press **STORE REF LVL.**
   h. Disconnect the BNC cable from between the CAL OUTPUT and 50 Ω Input.
3. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. If the firmware revision is A.04.00 or later, press **Sweep, Points, 401, Enter**.
4. Use the type-N cable to connect the RF Input to the tracking generator RF OUT on the analyzer as shown in Figure 2-66. *Do not connect to the microwave analyzer RF Input yet.*
5. Initialize the test equipment by pressing the following keys on the analyzer:

   FREQUENCY, 50 MHz
   SPAN, Zero Span
   BW / Avg, 30 kHz
   System, Alignments, Auto Align, Off
   Marker
   Source, Amplitude On, –5 dBm
   Source, Tracking Peak (*Wait for the* `PEAKING SIGNAL` *message to disappear.*)
   FREQUENCY, 9 kHz
   Source, Amplitude On, –2 dBm
   Single
6. On the microwave analyzer, press the following keys:

   FREQUENCY, 3.921409 GHz
   SPAN, 100 kHz
   AMPLITUDE, 0 dBm
   BW, 1 kHz

7. Disconnect the type-N cable from between the analyzer RF INPUT and the Tracking Generator RF OUT. Refer to Figure 2-66 to connect the type-N cable from the analyzer RF OUT to the microwave analyzer 50 Ω Input.

8. On the microwave analyzer, press:

   PEAK SEARCH
   MKR, SIG TRK (On)

   Wait for the signal to be displayed at center screen, then press **SIG TRK** (Off).

9. On the microwave analyzer, press **AUX CTRL**, **INTERNAL MIXER**, **PRESEL AUTO PK** then wait for the `PEAKING` message to disappear.

10. Record the microwave analyzer marker amplitude in Table 2-97 as the LO Feedthrough Amplitude for the Microwave analyzer CENTER FREQUENCY at 3.921409 GHz.

11. Repeat step 8 through step 10 for the remaining Analyzer CENTER FREQUENCY and Microwave Analyzer CENTER FREQUENCY settings listed in Table 2-97. Press **Single** on the analyzer to activate a single sweep each time the center frequency is changed.

12. Press **System, Alignments, Auto Align, All.**

13. In Table 2-97, for analyzer center frequencies of 9 kHz to 1.5 GHz, locate the highest LO Feedthrough Amplitude then record this amplitude as TR Entry 1 of the performance verification test record.

14. In Table 2-97, for the Analyzer Center Frequency of 3.0 GHz, record this LO Feedthrough Amplitude as TR Entry 2 of the performance verification test record.

Table 2-97 Tracking Generator LO Feedthrough Amplitude Worksheet

Analyzer CENTER FREQUENCY	Microwave Analyzer CENTER FREQUENCY	LO Feedthrough Amplitude (dBm)
9 kHz	3.921409 GHz	
70 MHz	3.9914 GHz	
150 MHz	4.0714 GHz	
1.5 GHz	5.4214 GHz	
3.0 GHz	6.9214 GHz	

49. Gate Delay Accuracy and Gate Length Accuracy: Agilent E4401B, E4402B, E4404B, E4405B, and E4407B (Option 1D6)

The method used for measuring the gate length times is determined by the length of the gate. Shorter gate-length times are measured with an oscilloscope, and longer gate-length times are measured with a counter.

For shorter gate-length times, the output signal of a pulse generator is used to trigger the gate circuitry. To measure the gate delay, Δt markers are used. The oscilloscope pulse width measurement feature is used to measure the short gate-length.

For longer gate-length times, a universal counter is used to measure the time period from the rising edge of the gate output to its falling edge. Because the gate-length time is equivalent to the clock accuracy of the analyzer, the gate-length time is compared to the specification for clock accuracy.

There are no related adjustments for this procedure.

Equipment Required


Universal counter
Function generator
Oscilloscope *(This procedure is written for the HP/Agilent 54820A.)*
Cable, BNC, 120 cm (48 in) *(four required)*
Adapter, BNC tee (m) (f) (f) *(two required)*

Procedure

1. Connect the equipment as shown in Figure 2-67. Connect the GATE OUT to Channel 2.
2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   Span, Zero Span
   Sweep, Sweep Time, 20ms
   Sweep, Gate (On),
   Gate Setup, Edge Setup
   Gate Delay, 1 μs
   Gate Length, 1 μs

Figure 2-67 Gate Delay and Gate Length Test Setup

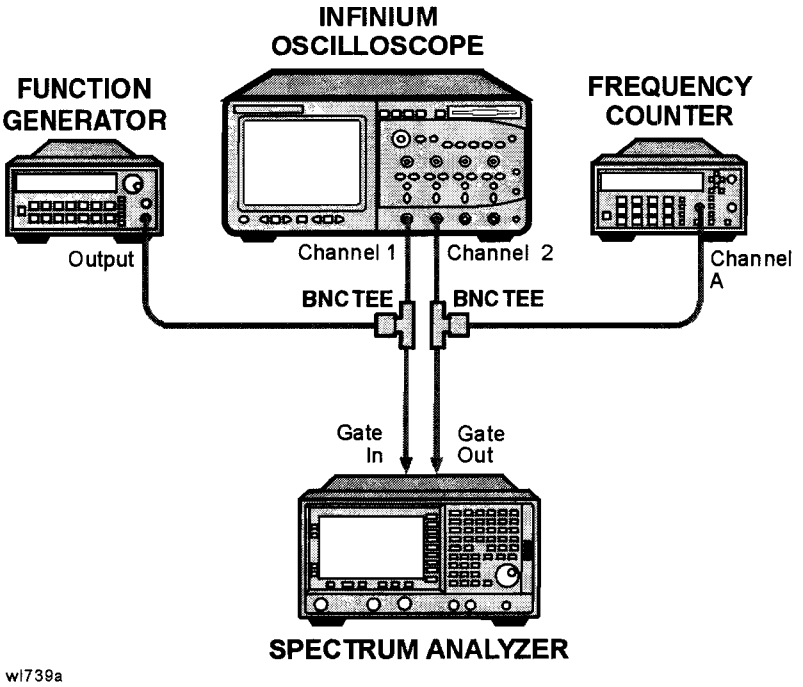

3. Set up the function generator as follows:

Waveform	Square
Frequency	100 Hz
Amplitude	2.5 V
Offset	1.25 V

4. Press **Default Setup** on the oscilloscope and set the controls as follows:

Timebase	500 ns/div
Trigger	Edge
Trigger Source	2
Trigger Level	2.0 V
Channel 1	
V/Div	1 V
Coupling	DC
Offset	2.0 V
Channel 2	
V/Div	1 V
Coupling	DC
Offset	3.0 V

5. On the oscilloscope, adjust the horizontal position to place the area between the rising edges of channel 1 and channel 2 at the center of the display. The horizontal position at the bottom of the grid should be between –500 ns and –650 ns.
6. Set the oscilloscope timebase to 200 ns/div. The rising edges of channel 1 and channel 2 should still be displayed. If not, adjust the horizontal position so the rising edges of channel 1 and channel 2 are displayed.
7. Use the mouse connected to the oscilloscope and click on the mouse icon in the upper right-hand corner of the display.
8. Set the oscilloscope statistics on.

   Click on **Measure** and verify that "Show Statistics" is checked.
9. Define the conditions for a delta time measurement on the oscilloscope.
   a. Click on **Measure, Customize, Measurement Definitions.**
   b. Set Threshold Definition to "10%, 50%, 90%".
   c. Set Top-Base Definition to "Standard".
   d. Set From Edge # to 1, and set To Edge # to 2.
   e. Set both Direction selections to "Rising".
   f. Set both Threshold selections to "Middle Level".
   g. Click **Close.**
10. Activate the delta time measurement.
    a. Click **Measure, Time, Delta Time.**
    b. Set Source 1 to "Channel 1".
    c. Set Source 2 to "Channel 2".
    d. Click **OK.**
11. Wait a few seconds for the minimum and maximum values displayed at the bottom of the oscilloscope grid to stabilize.
12. Refer to the measurement statistics at the bottom of the oscilloscope grid.

    Record the ΔTime (1)-(2) min value as Minimum Gate Delay in Table 2-98.

    Record the ΔTime (1)-(2) max value as the Maximum Gate Delay in Table 2-98.
13. Clear all current oscilloscope measurements. Click on **Measure, Clear,** and **All Measurements.**

14. Adjust the oscilloscope horizontal position to center the pulse on Channel 2 on the display.

15. Activate the pulse width measurement function for channel 2 of the oscilloscope.

    Click on **Measure, Time**, and click on **+width**.

    Set the Source to be channel 2 and click **OK**.

16. Record the +width (2) mean value in Table 2-98 as the 1 μs Gate Length.

17. On the analyzer, press

    Sweep, Sweep Time
    150 ms, Sweep
    Gate Setup, Edge Setup
    Gate Delay, 10ms
    Sweep, Gate Setup
    Edge Setup, Length, 65 ms

18. Set the universal counter controls as follows:

Function	Time Interval 1 - 2
Gate Time	0.1 s
Auto Trigger	On
Channel 1	
Coupling	DC
Impedance	1 MΩ
X10 Atten	Off
100 kHz Filter	Off
Common 1	On
Slope	Pos
Channel 2	
Coupling	DC
Impedance	1 MΩ
X10 Atten	Off
100 kHz Filter	Off
Common 1	On
Slope	Neg

19. Record the universal counter readout value as the 65ms Gate Length in Table 2-98.

Table 2-98 Gate Delay and Gate Length Accuracy Worksheet

Description	Value	TR Entry
Minimum Gate Delay		1)
Maximum Gate Delay		2)
1 μs Gate Length		3)
65 ms Gate Length		4)

50. Gate Mode Additional Amplitude Error: Agilent E4401B, E4402B, E4404B, E4405B, and E4407B (Option 1D6)

This procedure measures the additional amplitude error while gate mode is turned on. An amplitude reference is established while gate mode is off. Gate mode is then turned on with a function generator providing the gate trigger input. The amplitude with gate mode on is then measured using the marker delta function.

There are no related adjustments for this procedure.

Equipment Required

Synthesized signal generator
Function generator
Cable, Type-N (f), 50 Ω
Cable, BNC, 120 cm

Additional Equipment for Option 1DP

Adapter, Type-N (f) to BNC (m), 75 Ω
Minimum loss pad

Additional Equipment for Option BAB


Adapter, Type-N (f) to APC 3.5 (f)

Procedure

1. Connect the equipment as shown in Figure 2-68.
2. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, 300 MHz
   SPAN, Zero Span
   AMPLITUDE, MORE, Y Axis Units (or **Amptd Units**), **dBm**
   AMPLITUDE, Ref Level, –20 dBm (*50 Ω Inputs only*)
   AMPLITUDE, Ref Level, –10 dBm (*75 Ω Inputs only*)
   Sweep, 20 ms

Figure 2-68 Gate Delay and Gate Length Accuracy Test Setup

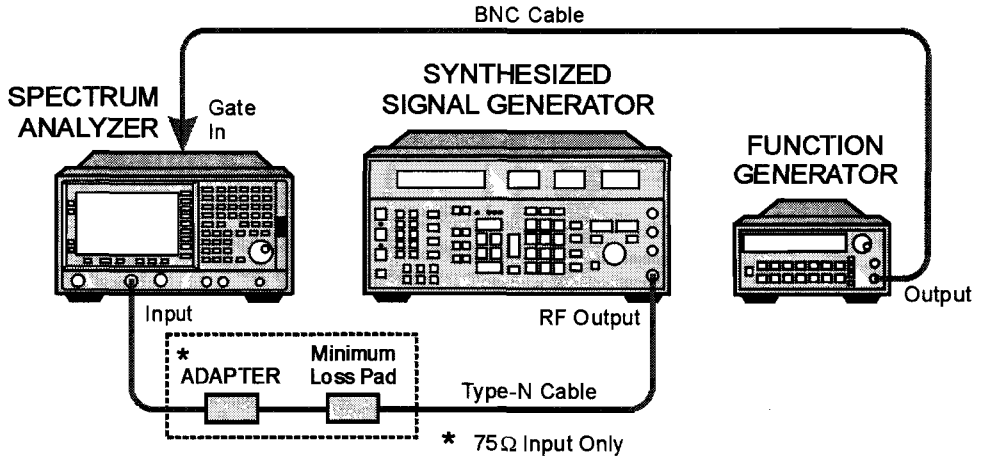

3. Set up the function generator as follows:

Waveform	Square
Duty Cycle	50%
Frequency	100 Hz
Amplitude	2.5 V pk-pk
Offset	1.25V

4. On the synthesized signal generator, press **Blue Key, Special, 0, 0.** Set the signal generator as follows:

FREQUENCY	300 MHz
AMPLITUDE	–20 dBm (*50 Ω Inputs only*)
AMPLITUDE	–10 dBm (*75 Ω Inputs only*)

5. On the analyzer, press **Single** and wait for the sweep to finish. Press **Peak Search** (or **Search**).
6. On the analyzer, press **Meas Tools, Delta.**
7. Set the analyzer as follows:

   Trig, External
   Sweep, Gate (On)
   Gate Setup, Edge Setup, Gate Delay, 1 μs
   Gate Length, 1 μs
   Sweep, Gate Setup, Trig Type (Level)

8. On the analyzer, press **Single** and wait for the sweep to finish. Press **Peak Search** (or **Search**).
9. Record the ΔMkr1 amplitude reading as TR Entry 1 in the performance test record.

51. First LO OUTPUT Amplitude Accuracy (Option AYZ only)

This test applies only to analyzers equipped with external mixing (Option AYZ).

This test verifies that analyzers with external mixing (Option AYZ) meet their specification for First LO (local oscillator) output level. The flatness of the First LO output determines the flatness of measurements made using external mixers. In this test, a calibrated power sensor is connected to the First LO output to measure the power level at frequencies between 2.9 GHz and 7.1 GHz.


The analyzer is put into external mixing mode using a harmonic number of –10. The tuned frequency of the spectrum will therefore be 321.4 MHz (the frequency of the Second IF) below the Tenth harmonic of the First LO. A 321.4 MHz frequency offset is used so that the center frequency will be exactly 10 times the First LO frequency. Setting the center frequency step size to 2 GHz allows the LO frequency to be stepped in 200 MHz increments.

The related adjustment for this performance test is "LO Power Adjustment."

Equipment Required

Power meter
Microwave power sensor
Adapter, type-N (m) to SMA (f)

Figure 2-69 First LO Output Amplitude Accuracy Test Setup

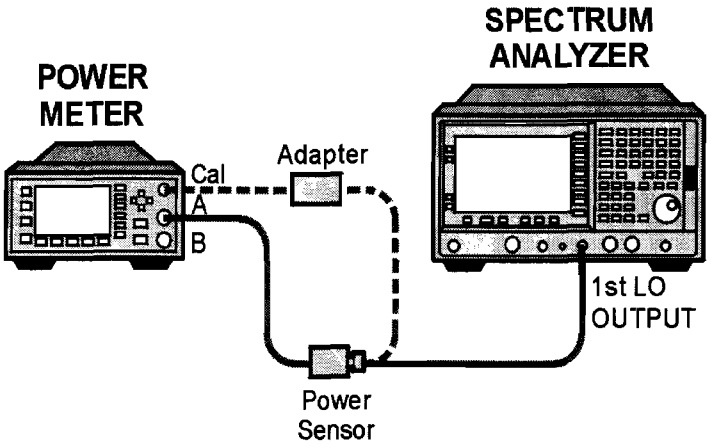

Procedure

1. Zero and calibrate the power sensor and power meter combination at 50 MHz. Set the power meter for dBm output.
2. Enter the 3 GHz calibration factor of the power sensor into the power meter.
3. Remove the termination from the First LO OUTPUT connector of the analyzer.
4. Connect the power sensor to the First LO OUTPUT connector of the analyzer as shown in Figure 2-69.
5. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   Input/Output, Input Mixer, Input Mixer (Ext)
   Mixer Config, Harmonic, –10
   SPAN, Zero Span
   FREQUENCY, 30 GHz
   CF Step, 2 GHz
   Freq Offset, 321.4 MHz
   System, Alignments, Auto Align, Off

6. Press **FREQUENCY** on the analyzer.
7. Read the power displayed on the power meter and record it as TR Entry 1 in the Performance Verification Test Record.
8. Press the ⇑ key on the analyzer to select the next center frequency and First LO frequency.
9. Enter the appropriate power sensor calibration factor into the power meter as shown in Table 2-99.
10. Read the power displayed on the power meter and record it in the Performance Verification Test Record as indicated in the TR Entry column of Table 2-99.
11. Repeat step 8 through step 10 for the remaining center frequency and First LO frequencies listed in Table 2-99.

Table 2-99 First LO Output Amplitude Accuracy Worksheet

First LO Frequency (GHz)	Center Frequency (GHz)	Calibration Factor Frequency (GHz)	TR Entry
2.9	29	3.0	**1)**
3.1	31	3.0	**2)**
3.3	33	3.0	**3)**
3.5	35	4.0	**4)**
3.7	37	4.0	**5)**
3.9	39	4.0	**6)**
4.1	41	4.0	**7)**
4.3	43	4.0	**8)**
4.5	45	5.0	**9)**
4.7	47	5.0	**10)**
4.9	49	5.0	**11)**
5.1	51	5.0	**12)**
5.3	53	5.0	**13)**
5.5	55	6.0	**14)**
5.7	57	6.0	**15)**
5.9	59	6.0	**16)**
6.1	61	6.0	**17)**
6.3	63	6.0	**18)**
6.5	65	7.0	**19)**
6.7	67	7.0	**20)**
6.9	69	7.0	**21)**
7.1	71	7.0	**22)**

Post-Test Instrument Restoration

12.Disconnect the power sensor from the First LO OUTPUT connector.

13.Replace the 50 Ω termination on the First LO OUTPUT connector.

14.Press **Preset** the analyzer.

15.Press **System, Alignments, Auto Align, All**.

52. IF INPUT Accuracy (Option AYZ only)

This test only applies to analyzers equipped with external mixing (Option AYZ).

This test measures the accuracy of the IF INPUT. A nominal –30 dBm, 321.4 MHz signal is applied to a power sensor and the power level is recorded. The actual frequency must be offset slightly to compensate for the IF centering error of the 1 kHz resolution bandwidth. This frequency offset is measured using the 321.4 MHz signal applied to the 50 Ω Input connector. The signal is measured with frequency corrections on and off. The difference between these two measurements is the IF centering error. The 321.4 MHz signal is then offset by the IF centering error.


This signal is then applied to the IF INPUT of the analyzer which is set to external mixing mode in A band (26.5 GHz to 40 GHz). Amplitude corrections are set to 0 dB. The amplitude is measured by the analyzer and then recorded. The difference between the two measurements is the IF INPUT accuracy.

The related adjustment procedure for this performance test is "IF INPUT Correction."

Equipment Required

Synthesized sweeper
Power meter
Low-power power sensor
30 dB reference attenuator
Cable, APC 3.5
Cable, BNC
Adapter, type-N (m) to APC 3.5 (f) (*not required for Option BAB*)
Adapter, APC 3.5 (f) to APC 3.5 (f) (*two required for Option BAB*)
Adapter, type-N (f) to APC 3.5 (f)

Figure 2-70 IF INPUT Accuracy Test Setup

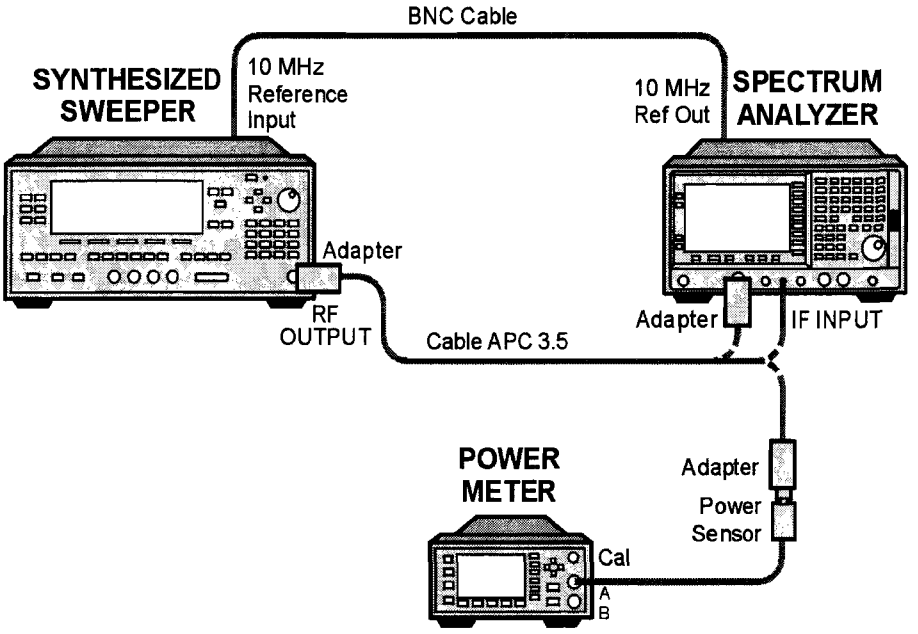

Procedure

Determining the IF Centering Error

1. Preset the synthesized sweeper and set the controls as follows:

   CW . . . . . 321.4 MHz
   POWER LEVEL . . . . . –30 dBm
   RF . . . . . On

2. Connect the synthesized sweeper output to the analyzer 50 Ω Input connector. The analyzer provides the frequency reference for the synthesized sweeper.

3. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   System, Alignments, Auto Align, Off
   FREQUENCY, 321.4 MHz
   SPAN, 5 kHz
   AMPLITUDE, –30 dBm
   BW/Avg, Resolution BW, 1 kHz

4. On the analyzer, press **Single** and wait for the sweep to finish.

5. On the analyzer, press the following keys:

   Peak Search (or **Search**)
   Marker, Delta
   System, Alignments, Freq Correct (Off).

6. On the analyzer, press **Single** and wait for the sweep to finish.

7. On the analyzer, press **Peak Search** (or **Search**).

8. Note the ΔMkr1 frequency.

9. Calculate the new synthesized sweeper CW frequency by adding the ΔMkr1 frequency to 321.4 MHz. Set the synthesized sweeper CW frequency to the new calculated frequency.

   New CW Frequency = 321.4 MHz + ΔMkr1 Frequency

   For example, if the ΔMkr1 frequency is 725 Hz, the new CW frequency would be 321.400725 MHz.

10. On the analyzer, press **System, Alignments, Freq Correct** (On).

Setting the Synthesized Sweeper Power Level

11. Zero and calibrate the low-power sensor and power meter in dBm mode using the 30 dB reference attenuator. Enter the 300 MHz calibration factor of the power sensor into the power meter.

12. Connect the equipment as shown in Figure 2-70, with the output of the synthesized sweeper connected to the power sensor using an adapter between the cable and the power sensor.

13. Adjust the synthesized sweeper power level for a power meter reading of –30 dBm ±0.1 dB.

14. Record the power meter reading as Input Power.

    Input Power _____dBm

Measuring the IF INPUT Accuracy

15. Connect the APC 3.5 cable from the RF OUTPUT of the synthesized sweeper to the IF INPUT of the analyzer.

16. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the analyzer by pressing the following keys:

    System, Alignments, Auto Align, Off
    AMPLITUDE, More 1 of 2, Corrections, Corrections (Off)
    AMPLITUDE, –30 dBm
    Input/Output, Input Mixer, Input Mixer (Ext)
    Ext Mix Band, 26.5–40 GHz
    FREQUENCY, 30 GHz
    SPAN, Zero Span
    BW/Avg, Resolution Bandwidth, 1 kHz

17. Press **Peak Search** on the analyzer. Record the Mkr1 amplitude reading as the Measured Power.

    Measured Power _____dBm

18. Subtract the Input Power (step 14) from the Measured Power (step 17) and record the difference as the IF INPUT Accuracy.

    IF INPUT Accuracy = Measured Power – Input Power

    For example, if the Measured Power is –29.34 dBm and the Input Power is –30.08 dBm, the IF INPUT Accuracy would be 0.74 dB.

19. Record the IF INPUT Accuracy as TR Entry 1 in the Performance Verification Test Record.

Post-Test Instrument Restoration

20. Disconnect the cable from the IF INPUT connector.

21. Preset the analyzer.

22. On the analyzer, press the following keys:

    System, Alignments
    Auto Align, All

53. Comms Frequency Response (Option BAC or BAH)

This test measures the analyzer's amplitude error as a function of frequency. The output of a source is fed through a power splitter to a power sensor and the analyzer. The source's power level is adjusted at 50 MHz to place the displayed signal at the analyzer's center graticule line. The power meter is then set to measure dB relative to the power level at 50 MHz. At each new analyzer source frequency and center frequency, the source power level is adjusted to place the signal at the center horizontal graticule line. The power meter displays the inverse of the frequency response relative to 50 MHz.

For improved amplitude accuracy in the PCS and Cellular bands, a power splitter is characterized using a second power sensor (the "reference" sensor) connected to one power splitter output port. The other power splitter output port connects to the "buried" sensor; it is not removed from the power splitter. Once the characterization is done, the reference sensor is removed and replaced by the analyzer.

The related adjustment for this performance test is "Frequency Response Error Correction."

Equipment Required


Synthesized sweeper
Function generator
Power meter
RF Power sensor (*2 required*)
Microwave power sensor
Microwave power splitter
Digital multimeter
Adapter, APC 3.5 (f) to APC 3.5 (f)
Adapter, Type-N (m) to Type-N (m)
Adapter, Type-N (m) to BNC (f)
Dual banana plug to BNC (f)
BNC Tee (BNC f,m,f)
Cable, BNC, 122-cm (48-in) (*2 required*)
Cable, Type-N, 183-cm (72-in)
Cable, APC 3.5
Termination, 50 Ω, BNC (m)

Procedure

Part 1: Source/splitter characterization

1. Connect the HP/Agilent 8482A to Channel A of the power meter. This will be the "reference" sensor. Connect the other HP/Agilent 8482A to Channel B of the power meter. This will be the "buried" sensor. Refer to Figure 2-71.

Figure 2-71 Source/splitter characterization setup

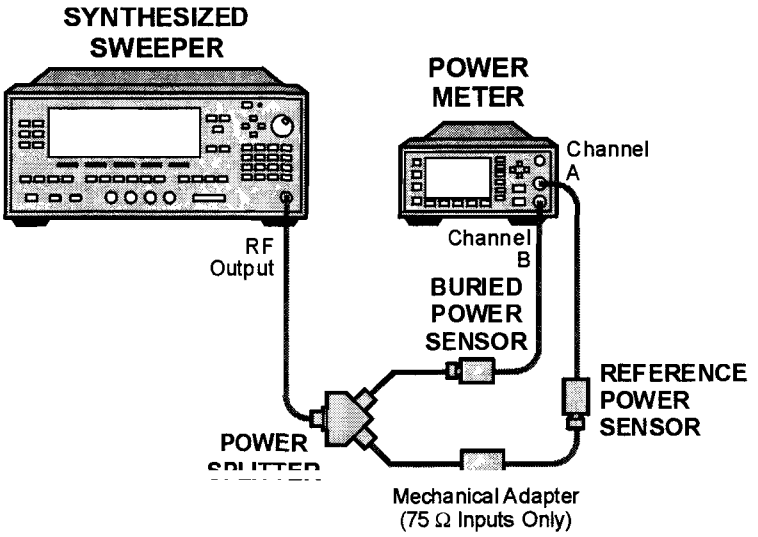

wl73c

2. Zero and calibrate both power sensors.
3. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor for 100 kHz.
4. On the power meter, set the Channel B calibration factor to 100%. Do not change this calibration factor during this test.
5. Connect the equipment as shown in Figure 2-71. Use the function generator as the source.
6. Set the source frequency to 50 MHz and amplitude to 0 dBm.
7. Adjust the source amplitude to obtain a Channel A power meter reading of –10 dBm ±0.01 dB.
8. Record the source amplitude setting, and both the Channel A and Channel B power meter readings in Table 2-100.
9. Tune the source to the next frequency in Table 2-100.

10. On the power meter, set the Channel A calibration factor to the calibration factor of the reference sensor for the current source frequency.
11. Adjust the source amplitude to obtain a Channel A power meter reading of –10 dBm ±0.1 dB.
12. Record the source amplitude setting, and both the Channel A and Channel B power meter readings in Table 2-100.
13. Repeat step 9 through step 12 for frequencies up to 2 GHz in Table 2-100.
14. For each entry in Table 2-100, calculate the splitter tracking error as follows:

    Splitter Tracking Error = Channel A Power – Channel B Power

    For example, if Channel A Power is –10.05 dBm and Channel B Power is –10.23 dBm, the Splitter Tracking Error is 0.18 dB.

Table 2-100 Source/splitter characterization

Frequency	Power Meter Reading		Splitter Tracking Error	Source Power Setting
	Channel A	Channel B		
50 MHz				0 dB (Ref)
800 MHz				
805 MHz				
810 MHz				
815 MHz				
820 MHz				
825 MHz				
830 MHz				
835 MHz				
840 MHz				
845 MHz				
850 MHz				
855 MHz				
860 MHz				
865 MHz				
875 MHz				

Table 2-100 Source/splitter characterization

Frequency	Power Meter Reading		Splitter Tracking Error	Source Power Setting
	Channel A	Channel B		
880 MHz				
885 MHz				
890 MHz				
895 MHz				
900 MHz				
905 MHz				
910 MHz				
915 MHz				
920 MHz				
925 MHz				
930 MHz				
935 MHz				
940 MHz				
945 MHz				
950 MHz				
955 MHz				
960 MHz				
965 MHz				
975 MHz				
980 MHz				
985 MHz				
990 MHz				
995 MHz				
1000 MHz				
1700 MHz				
1705 MHz				
1710 MHz				
1715 MHz				

Table 2-100 Source/splitter characterization


Frequency	Power Meter Reading		Splitter Tracking Error	Source Power Setting
	Channel A	Channel B		
1720 MHz				
1725 MHz				
1730 MHz				
1735 MHz				
1740 MHz				
1745 MHz				
1750 MHz				
1755 MHz				
1760 MHz				
1765 MHz				
1775 MHz				
1780 MHz				
1785 MHz				
1790 MHz				
1795 MHz				
1800 MHz				
1805 MHz				
1810 MHz				
1815 MHz				
1820 MHz				
1825 MHz				
1830 MHz				
1835 MHz				
1840 MHz				
1845 MHz				
1850 MHz				
1855 MHz				
1860 MHz				

Table 2-100 Source/splitter characterization

Frequency	Power Meter Reading		Splitter Tracking Error	Source Power Setting
	Channel A	Channel B		
1865 MHz				
1875 MHz				
1880 MHz				
1885 MHz				
1890 MHz				
1895 MHz				
1900 MHz				
1905 MHz				
1910 MHz				
1915 MHz				
1920 MHz				
1925 MHz				
1930 MHz				
1935 MHz				
1940 MHz				
1945 MHz				
1950 MHz				
1955 MHz				
1960 MHz				
1965 MHz				
1975 MHz				
1980 MHz				
1985 MHz				
1990 MHz				
1995 MHz				
2000 MHz				

Part 2: Measuring Frequency Response, 800 MHz to 1000 MHz, 1700 MHz to 2000 MHz (0 dB, 5 dB, 10 dB, 25 dB, and 40 dB Attenuation)

Figure 2-72 **Frequency response test setup, 800 MHz to 1000 MHz**

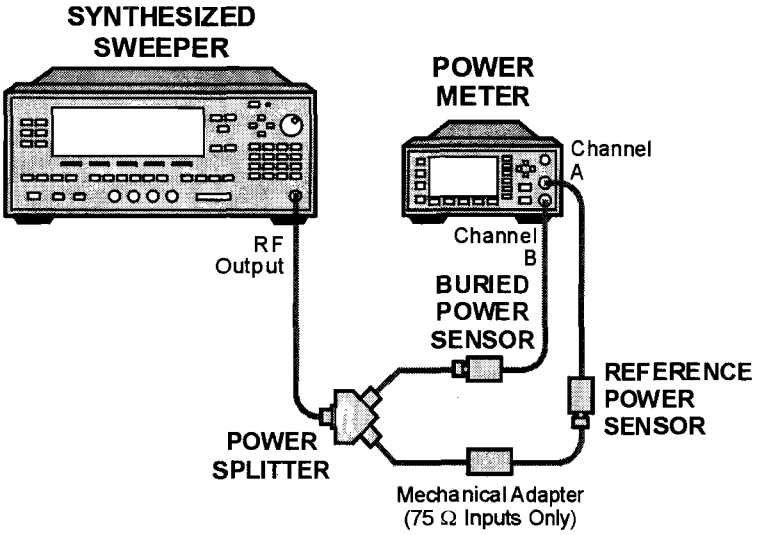

wl73c

1. Remove the reference sensor (Channel A sensor) from the power splitter. Connect the power splitter to the analyzer 50 Ω Input using an adapter. Do not use a cable. Refer to Figure 2-72.
2. Set the source POWER LEVEL to the value corresponding to the source power setting in Table 2-101 for the current source frequency.
3. Adjust the source POWER LEVEL to obtain the Channel B power meter reading recorded in Table 2-100 ±0.1 dB.
4. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. Set the controls as follows:

   Sweep, Points, 401, Enter *(Firmware revision A.04.00 and later)*
   FREQUENCY, Center Freq, 800 MHz
   CF Step, 5 MHz
   SPAN, 0 kHz
   Input/Output (or **Input**), **Coupling** (AC) *(E4402B with Option UKB, E4404B and E4405B)*
   AMPLITUDE, More, Int Preamp, (Off) *(Option 1DS only)*
   AMPLITUDE, Ref Level, –5 dBm
   Attenuation, 10 dB (Man)
   Scale/Div, 1 dB
   BW/Avg, Resolution BW, 10 kHz (Man)
   Video BW, 10 kHz (Man)

5. Record the current Channel B power reading in Table 2-101 as the current Channel B reading.
6. Trigger a sweep on the analyzer.
7. On the analyzer, press **Single**. Then, press **Peak Search** (or **Search**).
8. Record the Mkr1 amplitude reading in Table 2-101.
9. Set the source to the next frequency listed in Table 2-101 by pressing **FREQUENCY**, ↑.
10. Adjust the source POWER LEVEL to obtain the Channel B power meter reading of 10 dBm ±0.1 dB for the current frequency.
11. Record the current Channel B power reading in Table 2-101 as the current Channel B reading.
12. Trigger a sweep on the analyzer.
13. On the analyzer, press **Single**. Then, press **Peak Search** (or **Search**).
14. Record the Mkr1 amplitude reading in Table 2-101.
15. Repeat step 9 through step 14 for each frequency in Table 2-101.
16. Copy the splitter tracking errors from Table 2-100 into Table 2-101.
17. Calculate the Flatness Error for each frequency in Table 2-101 as follows:

Flatness Error = Mkr1 Amptd – Current Channel B – Splitter Tracking Error

For example, if Mkr1 Amptd is –10.32 dBm, Current Channel B is –10.2 and Splitter Tracking Error is 0.18 dB, Flatness Error would be –0.30 dB.

18. Record the Flatness Error for 50 MHz below as the 50 MHz Ref Amptd:

    50 MHz Ref Amptd: _____

19. Calculate the Flatness Relative to 50 MHz for each frequency in Table 2-101 as follows:

Flatness Relative to 50 MHz = Flatness Error – 50 MHz Ref Amptd

For example, if Flatness Error is –30.0 dB, 50 MHz Ref Amptd is 0.15 dB and setup change error is –0.19 dB, Flatness Relative to 50 MHz would be –0.45 dB.

20. Repeat the Frequency Response test with input attenuation and resolution bandwidth settings for each of the following tests:

    a. cdmaOne Channel Power Accuracy (Option BAC)

       RBW = 10 kHz
       Atten = 40 dB, 25 dB, and 10 dB

b. cdmaOne Receive Channel Power Accuracy (Option BAC) Preamp On

RBW = 10 kHz
Atten = 0 dB

c. cdmaOne Receive Channel Power Accuracy (Option BAC) Preamp Off

RBW = 10 kHz
Atten = 0 dB

d. GSM Transmit Power

RBW = 300 kHz
Atten = 40, 5 dB

Table 2-101 Frequency response worksheet, 800 MHz to 1 GHz and 1700 MHz to 2 GHz

Frequency	Current Channel B Reading	Mkr1 Amptd	Splitter Tracking Error	Flatness Error	Flatness Relative to 50 MHz
50 MHz					0 dB (Ref)
800 MHz					
805 MHz					
810 MHz					
815 MHz					
820 MHz					
825 MHz					
830 MHz					
835 MHz					
840 MHz					
845 MHz					
850 MHz					
855 MHz					
860 MHz					
865 MHz					
875 MHz					
880 MHz					
885 MHz					

Table 2-101 Frequency response worksheet, 800 MHz to 1 GHz and 1700 MHz to 2 GHz

Frequency	Current Channel B Reading	Mkr1 Amptd	Splitter Tracking Error	Flatness Error	Flatness Relative to 50 MHz
890 MHz					
895 MHz					
900 MHz					
905 MHz					
910 MHz					
915 MHz					
920 MHz					
925 MHz					
930 MHz					
935 MHz					
940 MHz					
945 MHz					
950 MHz					
955 MHz					
960 MHz					
965 MHz					
970 MHz					
975 MHz					
980 MHz					
985 MHz					
990 MHz					
995 MHz					
1000 MHz					
1700 MHz					
1705 MHz					
1710 MHz					
1715 MHz					
1720 MHz					

Table 2-101 Frequency response worksheet, 800 MHz to 1 GHz and 1700 MHz to 2 GHz

Frequency	Current Channel B Reading	Mkr1 Amptd	Splitter Tracking Error	Flatness Error	Flatness Relative to 50 MHz
1725 MHz					
1730 MHz					
1735 MHz					
1740 MHz					
1745 MHz					
1750 MHz					
1755 MHz					
1760 MHz					
1765 MHz					
1770 MHz					
1775 MHz					
1780 MHz					
1785 MHz					
1790 MHz					
1795 MHz					
1800 MHz					
1805 MHz					
1810 MHz					
1815 MHz					
1820 MHz					
1825 MHz					
1830 MHz					
1835 MHz					
1840 MHz					
1845 MHz					
1850 MHz					
1855 MHz					
1860 MHz					

Table 2-101 Frequency response worksheet, 800 MHz to 1 GHz and 1700 MHz to 2 GHz

Frequency	Current Channel B Reading	Mkr1 Amptd	Splitter Tracking Error	Flatness Error	Flatness Relative to 50 MHz
1865 MHz					
1870 MHz					
1875 MHz					
1880 MHz					
1885 MHz					
1890 MHz					
1895 MHz					
1900 MHz					
1905 MHz					
1910 MHz					
1915 MHz					
1920 MHz					
1925 MHz					
1930 MHz					
1935 MHz					
1940 MHz					
1945 MHz					
1950 MHz					
1955 MHz					
1960 MHz					
1965 MHz					
1970 MHz					
1975 MHz					
1980 MHz					
1985 MHz					
1990 MHz					
1995 MHz					
2000 MHz					

Part 3: Test Results

Perform the following steps to verify the frequency response of the analyzer:

1. Enter the most positive number from the Flatness Relative to 50 MHz column of Table 2-101 for the 800 MHz to 1000 MHz band:

   _____ dB

2. Enter the most positive number from the response relative to 50 MHz column of Table 2-101 for the 1700 MHz to the 2000 MHz band:

   _____ dB

3. Record the more positive of numbers from step 1 and step 2 as the maximum response for the 800 MHz to 1000 MHz and 1700 MHz to 2000 MHz bands.

4. Enter the most negative number from the Flatness Relative to 50 MHz column of Table 2-101 for the 800 MHz to 1000 MHz band:

   _____ dB

5. Enter the most negative number from the Flatness Relative to 50 MHz column of Table 2-101 for the 1700 MHz to 2000 MHz band:

   _____ dB

6. Record the more negative of numbers from step 4 and step 5 as the minimum response for band 0 in Table 2-102.

7. Subtract the minimum response for band 0 from the maximum response for band 0 and record the result (a positive number) as the Peak-to-Peak response to band 0 in Table 2-101.

8. The frequency response test is completed.

Table 2-102 cdmaOne Channel Power Accuracy Worksheet (Preamp Off)

Input Attenuation (dB)	Peak-to-Peak Response (dB) 800 to 1000 MHz (Cellular Band)	Peak-to-Peak Response (dB) 1700 to 2 GHz (PCS Band)	Resolution Bandwidth Setting (kHz)
40			10
25			10
10			10
10			10
10			10
10			10

Table 2-103 cdmaOne Receive Channel Power Accuracy Worksheet (Preamp On)

Input Attenuation (dB)	Peak-to-Peak Response (dB) 800 to 1000 MHz (Cellular Band)	Peak-to-Peak Response (dB) 1700 to 2 GHz (PCS Band)	Resolution Bandwidth Setting (kHz)
0			10
0			10
0			10
0			10
0			10
0			10

Table 2-104 cdmaOne Receive Channel Power Accuracy Worksheet (Preamp Off)

Input Attenuation (dB)	Peak-to-Peak Response (dB) 800 to 1000 MHz (Cellular Band)	Peak-to-Peak Response (dB) 1700 to 2 GHz (PCS Band)	Resolution Bandwidth Setting (kHz)
0			10
0			10
0			10
0			10
0			10
0			10

55. Modulation Accuracy – Rho (Options BAC and B7E)


This test verifies the ability of a UUT (unit under test) to measure Rho. ESA Series Spectrum Analyzers that use both Options BAC and B7E are used to measure and verify the performance of Rho. Rho is measured by generating an IS-95A cdmaOne forward carrier with a single pilot channel. Note that the Option B7D is a required Option for B7E.

NOTE This test is repeated at different frequencies and amplitude signal levels.

Equipment Required

Synthesized signal generator with cdmaOne capabilities
Cable, BNC, 120-cm (48-in.)
Cable, Type N, 152-cm (60-in)

Figure 2-73 Modulation Accuracy – Rho Test Setup

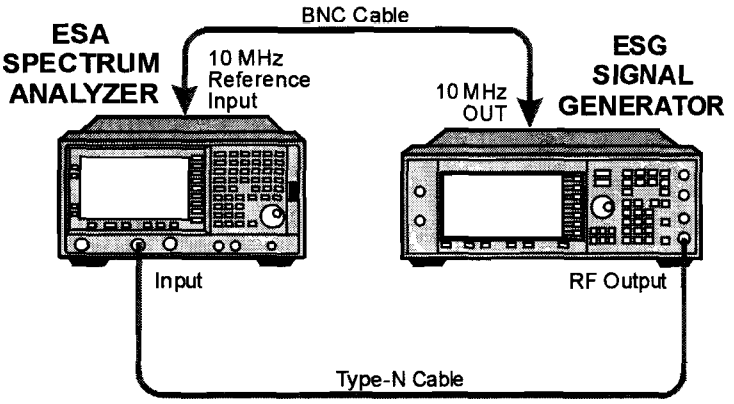

wl71c

Procedure

Set the signal generator to generate a single forward IS-95A carrier with a single pilot channel by performing the following steps:

NOTE The signal generator provides the 10 MHz reference for the analyzer.

1. Set up the equipment as shown in Figure 2-73.
2. Preset the signal generator by pressing the **PRESET** softkey.

3. Press **Preset** on the analyzer.
4. Perform the analyzer IQ Calibration by pressing the **Utility** hardkey followed by the **Instrument Adjustment** and **Hardware Adjustments** softkeys. Highlight the Dual Arb UND option and calibrate the selected items.
5. Load the Rho waveform by pressing the following keys:

   Mode, Arb Waveform Generator
   Dual Arb, Select Waveform *(Choose the CDMA_RHO waveform.)*
6. Set up the Dual Arbs sample rate by pressing the **Arb Setup** softkey.
7. Set the sample rate to 6.144 MHz and the reconstruction filter to 2.5 MHz.
8. Turn the RF on by pressing the **RF ON/OFF** hardkey.
9. Set the signal generator frequency by pressing the **FREQUENCY** hardkey followed by the numeric value of the first frequency listed in column 1 of Table 2-105.
10. Set the signal generator amplitude by pressing the **AMPLITUDE** hardkey followed by the numeric value of the first amplitude listed in column 2 of Table 2-106.
11. Set the analyzer to measure Modulation Accuracy (Rho) by performing the following steps:
    a. Preset the analyzer by pressing the **Preset** hardkey.
    b. Enter the cdmaOne personality by pressing the **Mode** hardkey followed by the **cdmaOne** softkey.
    c. Initiate the Rho measurement by pressing the **Measure** hardkey followed by the **Modulation Accuracy (Rho)** softkey.
    d. Set the frequency of the analyzer by pressing the **Frequency** hardkey followed by the numeric value of the first frequency listed in Table 2-105.
12. Enter the Rho value measured in the first row of Table 2-105. Repeat this test for each of the frequencies and amplitudes in Table 2-105.

Table 2-105 cdmaOne Rho Accuracy Worksheet

ESA/ESG Frequency (MHz)	ESG Amplitude (dBm)	Rho Measured	Actual Rho	Rho Accuracy	Uncertainty	Specification (± dB)	Pass/ Fail
870.03	–10		0.905957			0.0015	
870.03	–45		0.905957			0.0015	
1930.05	–10		0.905957			0.0015	
1930.05	–45		0.905957			0.0015	

Table 2-106 Example Test Report for E4407B, Option BAC and B7E

ESA/ESG Frequency (MHz)	ESG Amplitude (dBm)	Rho Measured	Actual Rho	Rho Accuracy	Uncertainty	Specification (± dB)	Pass/ Fail
870.03	–10					0.0015	
870.03	–45					0.0015	
1930.05	–10					0.0015	
1930.05	–45					0.0015	

56. CDMA Modulation Accuracy - EVM (Options BAC and B7E)


This test verifies the ability of a UUT (unit under test) to measure EVM (error vector magnitude). ESA Series Spectrum Analyzers that use both Options BAC and B7E are used to measure and verify the performance of EVM. Rho is measured by generating an IS-95A cdmaOne forward carrier with a single pilot channel. Note that the Option B7D is a required Option for B7E.

NOTE This test is repeated at different frequencies and amplitude signal levels.

Equipment Required

Sythesized signal generator with cdmaOne capabilities
Cable, BNC, 120-cm (48-in.)
Cable, Type N, 152-cm (60-in)

Figure 2-74 CDMA Modulation Accuracy - EVM Test Setup

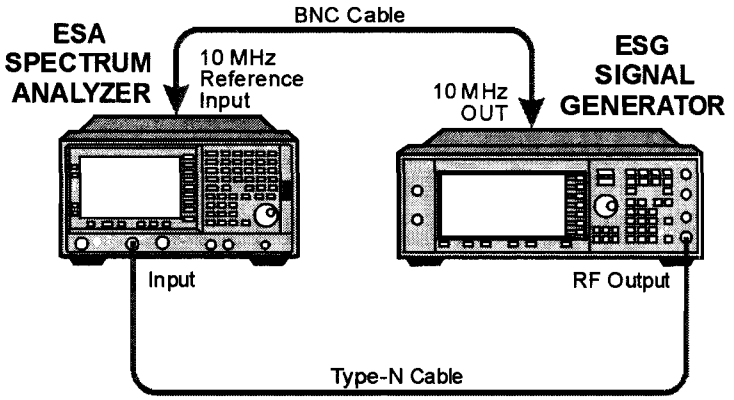

wl71c

Procedure

Set the Signal Generator to generate a single forward IS-95A carrier with a single pilot channel by performing the following steps:

NOTE The signal generator provides the 10 MHz reference for the analyzer.

1. Set up the equipment as shown in Figure 2-74.
2. Press **Preset** on the analyzer.

3. Perform the analyzer IQ Calibration by pressing the **Utility** hardkey followed by the **Instrument Adjustment** and **Hardware Adjustments** softkeys. Highlight the Dual Arb UND option and calibrate the selected items.
4. Load the Rho waveform by pressing the following keys:

   Mode, Arb Waveform Generator
   Dual Arb, Select Waveform *(Choose the CDMA_EVM waveform.)*
5. Set up the Dual Arbs sample rate by pressing the **Arb Setup** softkey.
6. Set the sample rate to 6.144 MHz and the reconstruction filter to 2.5 MHz.
7. Turn the RF on by pressing the **RF ON/OFF** hardkey.
8. Set the signal generator frequency by pressing the **FREQUENCY** hardkey followed by the numeric value of the first frequency listed in column 1 of Table 2-107.
9. Set the signal generator amplitude by pressing the **AMPLITUDE** hardkey followed by the numeric value of the first amplitude listed in column 2 of Table 2-108.
10. Set the analyzer to measure Modulation Accuracy (Rho) by performing the following steps:
    a. Preset the analyzer by pressing the **Preset** hardkey.
    b. Enter the cdmaOne personality by pressing the **Mode** hardkey followed by the **cdmaOne** softkey.
    c. Initiate the Rho measurement by pressing the **Measure** hardkey followed by the **Modulation Accuracy (Rho)** softkey.
    d. Set the analyzer frequency by pressing the **Frequency** hardkey followed by the numeric value of the first frequency listed in the Table 2-107.
11. Enter the EVM value measured in the first row of Table 2-107. Repeat this test for each of the frequencies and amplitudes in Table 2-107.

Table 2-107 cdmaOne EVM Accuracy Worksheet

ESA/ESG Frequency (MHz)	ESG Amplitude (dBm)	EVM Measured	Actual EVM	EVM Accuracy
870.03	–10		8.70	
870.03	–45		8.70	
1930.05	–10		8.70	
1930.05	–45		8.70	

Table 2-108 Example Test Report for E4407B, Option BAC and B7E

ESA/ESG Frequency (MHz)	ESG Amplitude (dBm)	EVM Measured	Actual EVM	EVM Accuracy
870.03	–10	8.52	8.70	0.18
870.03	–45	8.65	8.70	0.05
1930.05	–10	8.75	8.70	0.05
1930.05	–45	8.82	8.70	0.12

57. CDMA – Code Domain Power (Options BAC and B7E)


This test verifies the ability of a UUT (unit under test) to measure CDP (code domain power). ESA Series Spectrum Analyzers that use both Options BAC and B7E are used to measure and verify the performance of EVM. CDP is measured by generating an IS-95A cdmaOne forward carrier with a single pilot channel. Note that the Option B7D is a required Option for B7E.

NOTE This test is repeated at different frequencies and amplitude signal levels.

Equipment Required

Sythesized signal generator with cdmaOne capabilities
Cable, BNC, 120-cm (48-in.)
Cable, Type N (m), 62-cm (24-in)

Figure 2-75 CDMA – Code Domain Power Test setup

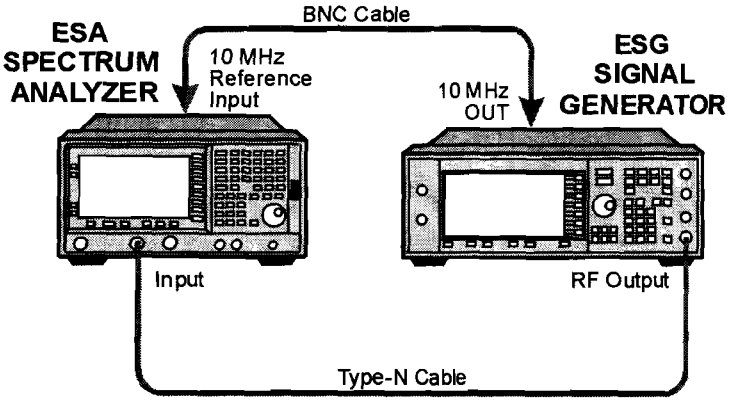

wl71c

Procedure

Set the signal generator to generate a single forward IS-95A carrier with a single pilot channel by performing the following steps:

NOTE The signal generator provides the 10 MHz reference for the analyzer.

1. Set up the equipment as shown in Figure 2-75.
2. Press **Preset** on the analyzer.

3. Perform the analyzer IQ Calibration by pressing the **Utility** hardkey followed by the **Instrument Adjustment** and **Hardware Adjustments** softkeys. Highlight the Dual Arb UND option and calibrate the selected items.
4. Load the Rho waveform by pressing the following keys:

   Mode, Arb Waveform Generator
   Dual Arb, Select Waveform *(Choose the CDMA_CDP waveform)*
5. Set up the Dual Arbs sample rate by pressing the **Arb Setup** softkey.
6. Set the sample rate to 6.144 MHz and the reconstruction filter to 2.5 MHz.
7. Turn the RF on by pressing the **RF ON/OFF** hardkey.
8. Set the signal generator frequency by pressing the **FREQUENCY** hardkey followed by the numeric value of the first frequency listed in column 1 of Table 2-109.
9. Set the signal generator amplitude by pressing the **AMPLITUDE** hardkey followed by the numeric value of the first amplitude listed in column 2 of Table 2-110.
10. Set the analyzer to measure Modulation Accuracy (Rho) by performing the following steps:
    a. Preset the analyzer by pressing the **Preset** hardkey.
    b. Enter the cdmaOne personality by pressing the **Mode** hardkey followed by the **cdmaOne** softkey.
    c. Initiate the Rho measurement by pressing the **Measure** hardkey followed by the **Modulation Accuracy (Rho)** softkey.
    d. Set the analyzer frequency by pressing the **FREQUENCY** hardkey followed by the numeric value of the first frequency listed in the Table 2-109.
11. Enter the CDP value measured in the first row of Table 2-109. Repeat this test for each of the frequencies and amplitudes in Table 2-109.

Table 2-109 cdmaOne Code Domain Power Accuracy Worksheet

ESA/ESG Frequency (MHz)	ESG Amplitude (dBm)	CDP Measured	Actual CDP	CDP Accuracy	Uncertainty	Specification (± dB)	Pass/ Fail
870.03	-10					0.2	
870.03	-45					0.2	
1930.05	-10					0.2	
1930.05	-45					0.2	

Table 2-110 Example Test Report for E4407B, Option BAC and B7E

ESA/ESG Frequency (MHz)	ESG Amplitude (dBm)	CDP Measured	Actual CDP	CDP Accuracy	Uncertainty	Specification (± dB)	Pass/ Fail
870.03	-10					0.2	
870.03	-45					0.2	
1930.05	-10					0.2	
1930.05	-45					0.2	

58. GSM – Phase and Frequency (Options BAH and B7E)

This test verifies the ability of a UUT (unit under test) to measure phase and frequency error in the GSM personality (Option BAH). ESA Series Spectrum Analyzers that use both Options BAH and B7E are used to measure and verify the performance of the phase and frequency error in the GSM personality.


Phase and frequency error in the GSM personality is measured by generating a GSM forward link carrier with a single active time slot. Note that Option B7D is a required Option for B7E.

NOTE This test is repeated at different frequencies and amplitude signal levels.

Equipment Required

Sythesized signal generator with GSM capabilities
Cable, BNC, 120-cm (48-in.)
Cable, Type N, 183-cm (73-in.)

Figure 2-76 GSM – Phase and Frequency test setup

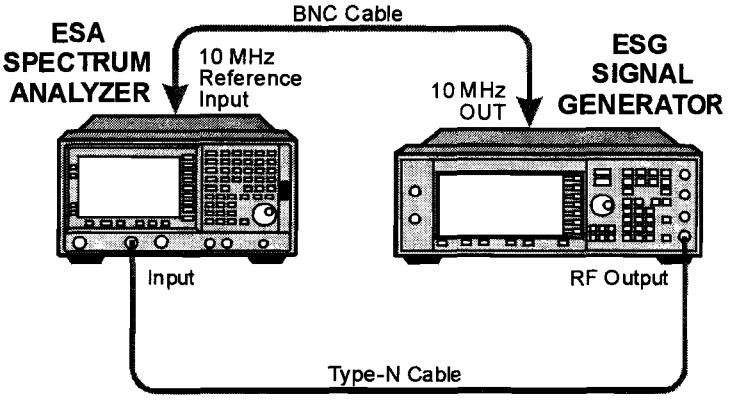

wl71c

Procedure

Set the signal generator to generate a single forward link GSM modulated carrier with a single time slot by performing the following steps:

NOTE The signal generator provides the 10 MHz reference for the analyzer.

1. Set up the equipment as shown in Figure 2-76.
2. Preset the signal generator by pressing the **PRESET** hardkey.
3. To enter the GSM setup, press the following signal generator keys:

   MODE, Real Time I/Q Baseband
   TDMA, GSM

4. Press the **Data Format Continuous/Framed** softkey and highlight **Framed** to select a single time slot.
5. Turn on the GSM setup screen by pressing the **GSM ON/OFF** softkey and highlighting **ON**.
6. Turn RF on by pressing the **RF ON/OFF** softkey.
7. Set the signal generator frequency to the first frequency listed in column 1 of Table 2-111.
8. Set the signal generator amplitude to the first amplitude listed in column 2 of Table 2-112.
9. Set the analyzer to measure GSM phase and frequency error by performing the following steps:
   a. Preset the analyzer by pressing the **Preset** hardkey.
   b. Enter the GSM personality by pressing the **Mode** hardkey followed by the **GSM** softkey.
   c. Initiate the phase and frequency measurement by pressing the **Measure** hardkey followed by the **Phase and Frequency** softkey.
   d. Use the first frequency listed in the Table 2-111 by pressing the **Frequency** hardkey and entering the numeric value.
10. Enter the phase and frequency value measured in the first row of Table 2-111. Repeat this test for each of the frequencies and amplitudes in Table 2-111.

Table 2-111 GSM – Phase and Frequency Measurement Table

ESA/ESG Frequency (MHz)	ESG Amplitude (dBm)	Phase Error (deg)	Spec (deg)	Pass/Fail	Freq Error (Hz)	Spec (Hz)	Pass/Fail
900	0		-2.1			10	
900	-30		-2.1			10	
1800	0		-2.1			10	
1800	-30		-2.1			10	

59. Comms Absolute Amplitude Accuracy (Options BAC or BAH)

This test measures the absolute amplitude of the ESA Series Spectrum Analyzer at numerous input levels, attenuator settings, and log levels. When Option 1DS is present, this test also measures the amplitude accuracy with the preamp set to On. When added to the absolute frequency response over a 20 to 30° C temperature range, the measured performance yields the Comms Absolute Accuracy. The absolute frequency response is tested separately. Refer to the Frequency Response performance test.

The frequency response is not specified in the Cellular or PCS bands, therefore, the Comms Frequency Response test must be completed first. The worksheet data will be used with the results of the Comms Amplitude Accuracy at 50 MHz to yield to the Comms absolute accuracy in the Cellular and PCS bands.

A sythesized signal generator and attenuators are used as the signal source to the analyzer. A power meter is used to measure the signal source (with the attenuators set to 0 dB). The value measured is recorded as the source amplitude. 15 dBm as well as 0 dBm are the source levels used.

The attenuators are used to adjust the signal levels applied to the analyzer from the initial signal amplitude. The amplitude measured by the analyzer is compared to the actual signal level. The amplitude error is then calculated.

The related adjustment for this performance test is the "IF Amplitude Adjustment."

NOTE This test is repeated at different frequencies and amplitude signal levels.


Equipment Required

Synthesized signal generator
10 dB step attenuator
1 dB step attenuator
Attenuator interconnection kit
Attenuator driver (if programmable step attenuators are used)
Power meter
Power sensor
Cable, Type-N, 62 cm (24 in.) (m) (2 *required*)
Cable, BNC
Adapter, Type-N (f) to Type-N (f)

Additional Equipment for Option BAB

Adapter, Type N (f) to APC 3.5 (f)

Figure 2-77 Measure Source Test Setup

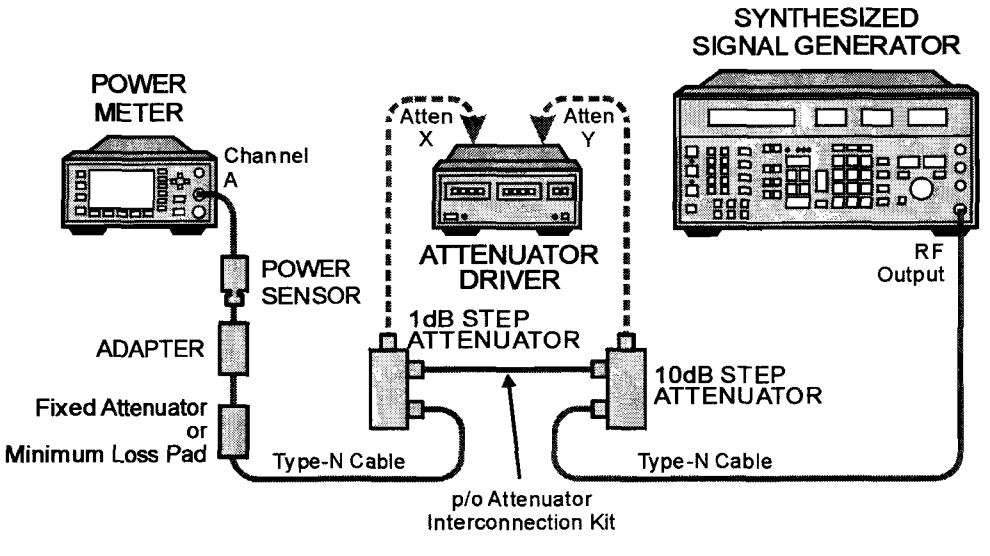

Procedure

Part 1: cdmaOne Channel Power

Table 2-112 and Table 2-113 list the reference level, nominal input level, and nominal attenuation for calibrated 1 dB and 10 dB step attenuators for the amplitude accuracy measurements.

Table 2-112 cdmaOne Receive Channel Power (Option BAC) - Preamp Off, Reference Level 0 dB

Nominal Input Level (dBm)	Reference Level (dBm)	Resolution Bandwidth (kHz)	Internal Attenuator (dB)	1 dB Step Attenuator (dB)	10 dB Step Attenuator (dB)	Source Nominal Level (dBm)
15	15	10	40	0	0	15
–5	–5	10	25	0	20	15
–25	–25	10	10	0	40	15
–45	–45	10	10	5	40	0
–55	–55	10	10	5	50	0
–70	–70	10	10	0	70	0

Table 2-113 cdmaOne Channel Power (Options BAC) - Preamp Off, Reference level –20 dB

Nominal Input Level (dBm)	Reference Level (dBm)	Resolution Bandwidth (kHz)	Internal Attenuator (dB)	1 dB Step Attenuator (dB)	10 dB Step Attenuator (dB)	Source Nominal Level (dBm)
15	30	10	40	0	0	15
–5	15	10	25	0	20	15
–25	–5	10	10	0	40	15
–45	–25	10	10	5	40	0
–55	–35	10	10	5	50	0
–70	–50	10	10	0	70	0

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. If the firmware revision is A.04.00 or later, press **Sweep, Points, 401, Enter**.
2. Perform a complete self-alignment and set Auto Align Off. Press **System, Alignments, Align Now, All**, and wait for the alignment routine to finish. Then, press **Return, Auto Align, Off**.
3. Zero and calibrate the power meter and power sensor connected to Channel A of the power meter.
4. Connect the equipment as shown in Figure 2-20.
5. Preset the synthesized signal generator. Manually press **Blue Key, Special, 0, 0**. Set the signal generator as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, 15 dBm

6. Set the 10 dB and 1 dB step attenuators to 0 dB.
7. From the metrology data for the step attenuators at 50 MHz, obtain the actual attenuation for the 0 dB setting of each attenuator (in some cases, this might be zero by definition). Add the two actual attenuations to obtain the 0 dB reference attenuation.

   $$\text{RefAtten}_{0dB} = 10\text{ dB Actual}_{0dB} + 1\text{ dB Actual}_{0dB}$$

   For example, if the actual attenuation for the 10 dB step attenuator is 0.03 dB, 10 dB Actual_{0dB} is 0.03 dB. If the actual attenuation for the 1 dB step attenuator is 0.02 dB, 1 dB Actual_{0dB} is 0.02 dB. In this case RefAtten_{0dB} is 0.05 dB.
8. Retrieve metrology data for the step attenuators at 50 MHz. Enter the actual attenuation values for each attenuator setting as indicated in Table 2-33 and Table 2-115.

Table 2-114 Amplitude Accuracy Worksheet, 0 dBm Reference Level

1 dB Step Attenuator		10 dB Step Attenuator		Total Attenuation		Nominal Amptd.	Meas. Amptd.	Amptd. Accuracy
Setting	Actual	Setting	Actual	Setting	Actual			
0 dB		0 dB		0 dB		15 dBm		
0 dB		20 dB		20 dB		–5 dBm		
0 dB		40 dB		40 dB		–25 dBm		
0 dB		40 dB		45 dB		–45 dBm		
0 dB		50 dB		55 dB		–55 dBm		
0 dB		70 dB		70 dB		–70 dBm		

Table 2-115 Amplitude Accuracy Worksheet, –20 dBm Reference Level

1 dB Step Attenuator		10 dB Step Attenuator		Total Attenuation		Nominal Amptd.	Meas. Amptd.	Amptd. Accuracy
Setting	Actual	Setting	Actual	Setting	Actual			
0 dB		0 dB		0 dB		15 dBm		
0 dB		20 dB		20 dB		–5 dBm		
0 dB		40 dB		40 dB		–25 dBm		
5 dB		40 dB		45 dB		–45 dBm		
5 dB		50 dB		55 dB		–55 dBm		
0 dB		70 dB		70 dB		–70 dBm		

9. Calculate the actual total attenuation by adding the actual attenuation for the 1 dB step attenuator to the actual attenuation for the 10 dB step attenuator for each total attenuation setting listed in Table 2-33 and Table 2-115.


NOTE The external attenuators and cables are now part of the "source."

10. Adjust the signal generator amplitude for a power meter reading of 15 dBm ±0.2 dB. Record the power meter reading here:

    $Amptd_{15dBm}$ = _____ dBm

11. Connect the equipment as indicated in Figure 2-78. The fixed attenuator must connect directly to the analyzer input.

Figure 2-78 Amplitude Accuracy Test Setup

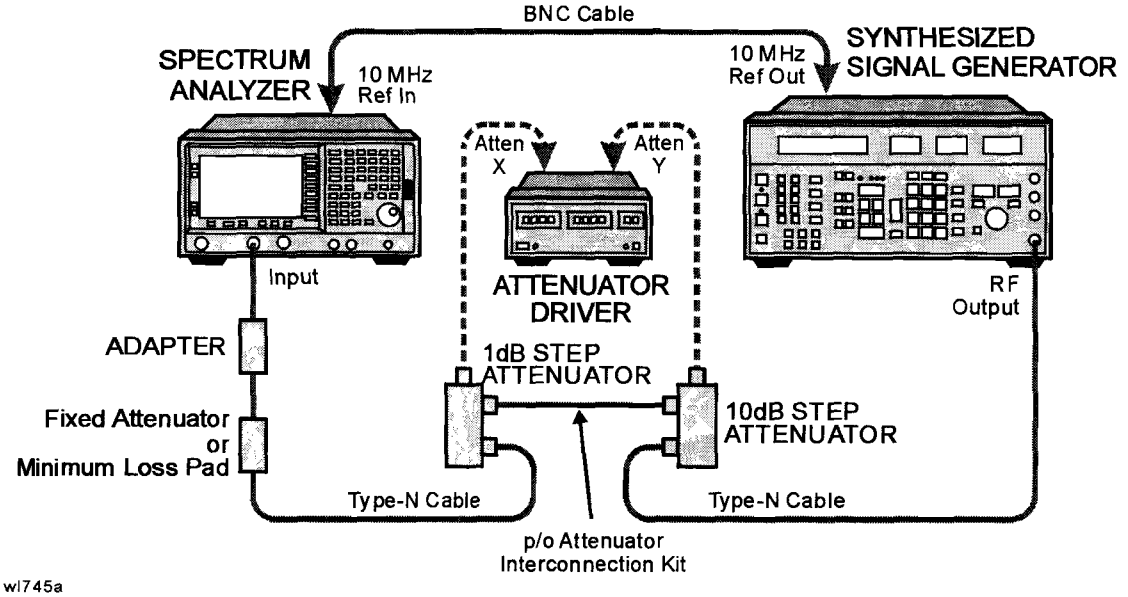

12. Set the analyzer as follows:

    FREQUENCY, Center Freq, 50 MHz
    SPAN, 0 kHz
    BW/Avg, Resolution BW, 10 kHz
    BW/Avg, Video BW, 10 kHz
    AMPLITUDE, More, Y Axis Units (or **Amptd Units**), **dBm**
    AMPLITUDE, Ref Level, 0 dBm
    Attenuation, 10 dB (Man)

13. Perform the following steps for each of the nominal amplitude values listed in Table 2-112 and Table 2-113:

    a. Set the 1 dB step attenuator as indicated in Table 2-112 and Table 2-113.
    b. Set the 10 dB step attenuator as indicated in Table 2-112 and Table 2-113.
    c. Press **Single** and wait for the sweep to finish.
    d. Press **Peak Search** (or **Search**). Even though the signal may be slightly above the reference level for the first nominal amplitude setting, the marker can still make a valid measurement.
    e. Record the Mkr 1 amplitude value as the measured amplitude in Table 2-33 and Table 2-115.
    f. If the nominal amplitude is 15 dBm, calculate the amplitude accuracy as follows:

    $$\text{Amplitude Accuracy} = \text{Measured Amplitude} - \text{Amptd}_{15\text{dBm}}$$

    g. If the amplitude is less than 0 dBm, calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - (\text{Amptd}_{15\text{dBm}} - \text{ActualTotalAtten} + \text{RefAtten}_{0\text{dB}})$$

h. Record the amplitude accuracy in the performance verification test record as indicated in Table 2-33.

14. Record the largest error between Table 2-33 and Table 2-115 in Table 2-116 and Table 2-117 for each of the nominal input levels.

15. Copy the Peak to Peak frequency response error from the Comms Frequency Response performance test for both the 800 MHz to 1 GHz Cellular band and the 1700 MHz to 2 GHz PCS bands measured in a 10 kHz resolution bandwidth.

16. Report the cdmaOne Channel Power Accuracy by summing together column 2 through 4.

Table 2-116 cdmaOne Channel Power Accuracy (Cellular Band)

Nominal Input Level (dBm)	50 MHz Amplitude Accuracy (dB)	Peak to Peak Response (800 MHz to 1 GHz) (dB)	Uncertainty (dB)	cdmaOne Channel Power Accuracy (dB) Col 1+2+3	Specification (± dB)	Pass/Fail
15			0.19		0.80	
-5			0.19		0.80	
-25			0.19		0.77	
-45			0.19		0.65	
-55			0.19		0.72	
-70			0.19		0.86	

Table 2-117 cdmaOne Channel Power Accuracy (PCS Band)

Nominal Input Level (dBm)	50 MHz Amplitude Accuracy (dB)	Peak to Peak Response (800 MHz to 1 GHz) (dB)	Uncertainty (dB)	cdmaOne Channel Power Accuracy (dB) Col 1+2+3	Specification (± dB)	Pass/Fail
15			0.19		0.70	
-5			0.19		0.70	
-25			0.19		0.67	
-45			0.19		0.66	
-55			0.19		0.73	
-70			0.19		0.87	

17. Proceed to Part 2.

Part 2: cdmaOne Receive Channel Power (Preamp On)

Table 2-118 and Table 2-119 list the reference level, nominal input level, and nominal attenuation for the calibrated 1 dB and 10 dB step attenuators for the amplitude accuracy measurements.

Table 2-118 cdmaOne Receive Channel Power (Option BAC or 1DS) - Preamp On, Reference Level 0 dB

Nominal Input Level (dBm)	Reference Level (dBm)	Resolution Bandwidth (kHz)	Internal Attenuator (dB)	1 dB Step Attenuator (dB)	10 dB Step Attenuator (dB)	Source Nominal Level (dBm)
0	0	10	10	0	0	0
-60	-60	10	0	0	60	0
-70	-70	10	0	0	70	0
-80	-80	10	0	0	80	0
-90	-90	10	0	0	90	0
-100	-100	10	0	0	100	0

Table 2-119 cdmaOne Receive Channel Power (Options BAC) - Preamp Off, Reference Level -20 dB

Nominal Input Level (dBm)	Reference Level (dBm)	Resolution Bandwidth (kHz)	Internal Attenuator (dB)	1 dB Step Attenuator (dB)	10 dB Step Attenuator (dB)	Source Nominal Level (dBm)
0	20	10	20	0	0	0
-60	-40	10	0	0	60	0
-70	-50	10	0	0	70	0
-80	-60	10	0	0	80	0
-90	-70	10	0	0	90	0
100	-80	10	0	0	100	0

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. If the firmware revision is A.04.00 or later, press **Sweep, Points, 401, Enter**.
2. Perform a complete self-alignment and set Auto Align Off. Press **System, Alignments, Align Now, All**, and wait for the alignment routine to finish. Then, press **Return, Auto Align, Off**.
3. Zero and calibrate the power meter and power sensor connected to Channel A of the power meter.

4. Connect the equipment as shown in Figure 2-20. The power sensor should connect directly to the 6 dB fixed attenuator using an adapter.
5. Preset the synthesized signal generator. Manually press **Blue Key, Special, 0, 0**. Set the signal generator as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, 0 dBm

6. Set the 10 dB attenuator to 40 dB and the 1 dB step attenuator to 0 dB.
7. From the metrology data for the step attenuators at 50 MHz, obtain the actual attenuation for the 0 dB setting of each attenuator (in some cases, this might be zero by definition). Add the two actual attenuations to obtain the 0 dB reference attenuation.

   $$\text{RefAtten}_{0dB} = 10\text{ dB Actual}_{0dB} + 1\text{ dB Actual}_{0dB}$$

   For example, if the actual attenuation for the 10 dB step attenuator is 0.03 dB, 10 dB Actual_{0dB} is 0.03 dB. If the actual attenuation for the 1 dB step attenuator is 0.02 dB, 1 dB Actual_{0dB} is 0.02 dB. In this case RefAtten_{0dB} is 0.05 dB.
8. Retrieve metrology data for the step attenuators at 50 MHz. Enter the actual attenuation values for each attenuator setting as indicated in Table 2-120 and Table 2-121. If using a programmable attenuator, the section two 40 dB step should be used for the 40 dB setting on the 10 dB step attenuator. Similarly, the section two 4 dB step should be used for the 4 dB setting on the 1 dB step attenuator.

Table 2-120 Amplitude Accuracy Worksheet, 0 dBm Reference Level

1 dB Step Attenuator		10 dB Step Attenuator		Total Attenuation		Nominal Amptd.	Meas. Amptd.	Amptd. Accuracy
Setting	Actual	Setting	Actual	Setting	Actual			(TR Entry)
0 dB		40 dB		40 dB		0 dBm		
0 dB		60 dB		60 dB		–60 dBm		
0 dB		70 dB		70 dB		–70 dBm		
0 dB		80 dB		80 dB		–80 dBm		
0 dB		90 dB		90 dB		–90 dBm		
5 dB		100 dB		105 dB		–100 dBm		

Table 2-121 Amplitude Accuracy Worksheet, –20 dBm Reference Level

1 dB Step Attenuator		10 dB Step Attenuator		Total Attenuation		Nominal Amptd.	Meas. Amptd.	Amptd. Accuracy
Setting	Actual	Setting	Actual	Setting	Actual			(TR Entry)
0 dB		40 dB		40 dB		0 dBm		
0 dB		60 dB		60 dB		–60 dBm		
0 dB		70 dB		70 dB		–70 dBm		
0 dB		80 dB		80 dB		–80 dBm		
0 dB		90 dB		90 dB		–90 dBm		
5 dB		100 dB		105 dB		–100 dBm		

9. Calculate the actual attenuation by adding the actual attenuation for the 1 dB step attenuator to the actual attenuation for the 10 dB step attenuator for each total attenuation setting listed in Table 2-120 and Table 2-121.

NOTE The external attenuators and cables are now part of the "source."

10. Adjust the signal generator amplitude for a power meter reading of –40 dBm ±0.2 dB. Record the power meter reading here:

    $Amptd_{0dBm}$ = _____ dBm

11. Connect the equipment as shown in Figure 2-78.

12. Set the analyzer as follows:

    FREQUENCY, Center Freq, 50 MHz
    SPAN, 0 kHz
    BW/Avg, Resolution BW, 10 kHz
    BW/Avg, Video BW, 10 kHz
    AMPLITUDE, More 1 of 2, Int Preamp (On)
    AMPLITUDE, Amptd Units, dBm
    Attenuation, 0 dB (Man)

13. Perform the following steps for each of the nominal amplitude values listed in Table 2-118 and Table 2-119:

    a. Set the 1 dB step attenuator as indicated in Table 2-118 and Table 2-119.
    b. Set the 10 dB step attenuator as indicated in Table 2-118 and Table 2-119.
    c. Press **Single** and wait for the sweep to finish.
    d. Press **Peak Search** (or **Search**). Even though the signal may be slightly above the reference level for the first nominal amplitude setting, the marker can still make a valid measurement.

e. Record the Mkr 1 amplitude value as the measured amplitude in Table 2-120 and Table 2-121.
f. Calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - (\text{Amptd}_{0\text{dBm}} - \text{ActualTotalAtten} + \text{RefAtten}_{0\text{dB}})$$

14. Record the largest error between Table 2-120 (0 dB Log level) and Table 2-121 (20 dB Log level) in for each of the nominal input levels.

15. Report the cdmaOne Receive Channel Power Accuracy by summing together column 2 through 4.

16. Report the worst value for each TR number in the cdmaOne Receive Channel Power (Preamp On) in the Test Record. This will be the worst value found in Table 2-122 and Table 2-123.

Table 2-122 cdmaOne Channel Receive Channel Power (Cellular Band) Preamp On

Nominal Input Level (dBm)	50 MHz Amplitude Accuracy (dB)	Peak to Peak Response (800 MHz to 1 GHz) (dB)	Uncertainty (dB)	TR Col 1+2+3	TR Number
0			0.24		15
-60			0.24		16
-70			0.24		16
-80			0.24		16
-90			0.24		16
-100			0.24		16

Table 2-123 cdmaOne Channel Receive Channel Power (PCS Band) Preamp On

Nominal Input Level (dBm)	50 MHz Amplitude Accuracy (dB)	Peak to Peak Response (1700 MHz to 2 GHz) (dB)	Uncertainty (dB)	TR Col 1+2+3	TR Number
0			0.24		17
–60			0.24		18
–70			0.24		18
–80			0.24		18
–90			0.24		18
–100			0.24		18

17.Proceed to Part 3.

Part 3: GSM Transmit Power

Table 2-124 and Table 2-125 list the reference level, nominal input level, and nominal attenuation for the calibrated 1 dB and 10 dB step attenuators for the amplitude accuracy measurements.

Table 2-124 GSM Transmit Power (Option BAH) - Preamp Off Reference Level –20 dB

Nominal Input Level (dBm)	Reference Level (dBm)	Resolution Bandwidth (kHz)	Internal Attenuator (dB)	1 dB Step Attenuator (dB)	10 dB Step Attenuator (dB)	Source Nominal Level (dBm)
15	15	300	40	0	0	15
–20	–20	300	5	0	20	0
–30	–30	300	5	0	40	0
–40	–40	300	5	0	50	0
–50	–50	300	5	0	60	0
–60	–60	300	5	0	60	0

Table 2-125 GSM Transmit Power (Option BAH) - Preamp Off, Reference Level 0 dB

Nominal Input Level (dBm)	Reference Level (dBm)	Resolution Bandwidth (kHz)	Internal Attenuator (dB)	1 dB Step Attenuator (dB)	10 dB Step Attenuator (dB)	Source Nominal Level (dBm)
15	30	300	40	0	0	15
–20	0	300	5	0	20	0
–30	–10	300	5	0	30	0
–40	–20	300	5	0	40	0
–50	–30	300	5	0	50	0
–60	–40	300	5	0	60	0

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. If the firmware revision is A.04.00 or later, press **Sweep, Points, 401, Enter.**
2. Perform a complete self-alignment and set Auto Align Off. Press **System, Alignments, Align Now, All**, and wait for the alignment routine to finish. Then, press **Return, Auto Align, Off.**
3. Zero and calibrate the power meter and power sensor connected to Channel A of the power meter.
4. Connect the equipment as shown in Figure 2-20. The power sensor should connect directly to the 6 dB fixed attenuator using an adapter.
5. Preset the synthesized signal generator. Manually press **Blue Key, Special, 0, 0.** Set the signal generator as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, 15 dBm

6. Set the 10 dB and 1 dB step attenuators to 0 dB.
7. From the metrology data for the step attenuators at 50 MHz, obtain the actual attenuation for the 0 dB setting of each attenuator (in some cases, this might be zero by definition). Add the two actual attenuations to obtain the 0 dB reference attenuation.

   $$\text{RefAtten}_{0dB} = 10\text{ dB Actual}_{0dB} + 1\text{ dB Actual}_{0dB}$$

   For example, if the actual attenuation for the 10 dB step attenuator is 0.03 dB, 10 dB Actual_{0dB} is 0.03 dB. If the actual attenuation for the 1 dB step attenuator is 0.02 dB, 1 dB Actual_{0dB} is 0.02 dB. In this case RefAtten_{0dB} is 0.05 dB.

8. Retrieve metrology data for the step attenuators at 50 MHz. Enter the actual attenuation values for each attenuator setting as indicated in Table 2-126 and Table 2-127.

Table 2-126 Amplitude Accuracy Worksheet, 0 dBm Reference Level

1 dB Step Attenuator		10 dB Step Attenuator		Total Attenuation		Nominal Amptd.	Meas. Amptd.	Amptd. Accuracy
Setting	Actual	Setting	Actual	Setting	Actual			(TR Entry)
0 dB		0 dB		0 dB		15 dBm		
0 dB		20 dB		20 dB		–20 dBm		
0 dB		30 dB		30 dB		–30 dBm		
0 dB		40 dB		40 dB		–40 dBm		
0 dB		50 dB		50 dB		–50 dBm		
0 dB		60 dB		60 dB		–60 dBm		

Table 2-127 Amplitude Accuracy Worksheet, –20 dBm Reference Level

1 dB Step Attenuator		10 dB Step Attenuator		Total Attenuation		Nominal Amptd.	Meas. Amptd.	Amptd. Accuracy
Setting	Actual	Setting	Actual	Setting	Actual			(TR Entry)
0 dB		0 dB		0 dB		15 dBm		
0 dB		20 dB		20 dB		–20 dBm		
0 dB		30 dB		30 dB		–30 dBm		
0 dB		40 dB		40 dB		–40 dBm		
0 dB		50 dB		50 dB		–50 dBm		
0 dB		60 dB		60 dB		–60 dBm		

9. Calculate the actual attenuation by adding the actual attenuation for the 1 dB step attenuator to the actual attenuation for the 10 dB step attenuator for each total attenuation setting listed in Table 2-126 and Table 2-127.

NOTE The external attenuators and cables are now part of the "source."

10. Adjust the signal generator amplitude for a power meter reading of 15 dBm ±0.2 dB. Record the power meter reading here:

$Amptd_{15dBm}$ = _____ dBm

11. Connect the equipment as shown in Figure 2-78.

12. Set the analyzer as follows:

FREQUENCY, Center Freq, 50 MHz
SPAN, 0 kHz
BW/Avg, Resolution BW, 300 kHz
BW/Avg, Video BW, 300 kHz
AMPLITUDE, More 1 of 2, Int Preamp (On)
AMPLITUDE, Amptd Units, dBm
Attenuation, 40 dB (Man)

13. Perform the following steps for each of the nominal amplitude values listed in Table 2-124 and Table 2-125:

a. Set the 1 dB step attenuator as indicated in Table 2-124 and Table 2-125.
b. Set the 10 dB step attenuator as indicated in Table 2-124 and Table 2-125.
c. Press **Single** and wait for the sweep to finish.
d. Press **Peak Search** (or **Search**). Even though the signal may be slightly above the reference level for the first nominal amplitude setting, the marker can still make a valid measurement.
e. Record the Mkr 1 amplitude value as the measured amplitude in Table 2-126 and Table 2-127.
f. If the nominal amplitude is 15 dBm, calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - \text{Amptd}_{15\text{dBm}}$$

g. If the nominal amplitude is less than 0 dBm, calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - (\text{Amptd}_{15\text{dBm}} - \text{ActualTotalAtten} + \text{RefAtten}_{15\text{dB}})$$

14. Record the largest error between Table 2-128 (0 dB Log level) and Table 2-129 (20 dB Log level) for each of the nominal input levels.

15. Report the cdmaOne Receive Channel Power Accuracy by summing together column 2 through 4.

16. Copy the peak to peak frequency response error from the Comms Frequency Response performance test for both the 800 MHz to 1 GHz Cellular band and the 1700 MHz to 2 GHz PCS bands measured in a 300 kHz resolution bandwidth.

17. Calculate the GSM Transmit Power Accuracy by summing together column 2 through 4.

18. Report the GSM Transmit Power Results in the Test Record.

19. Proceed to Part 4.

Table 2-128 GSM Transmit Power (Cellular Band) 800 MHz to 1 GHz, Preamp On

Nominal Input Level (dBm)	50 MHz Amplitude Accuracy (dB)	Peak to Peak Response (1700 MHz to 2 GHz) (dB)	Uncertainty (dB)	GSM Transmit Power Accuracy (dB) Col 1+2+3	Specification (± dB)	Pass/Fail
15			0.19		0.81	
–20			0.19		0.81	
–30			0.19		0.74	
–40			0.19		0.79	
–50			0.19		0.95	
–60			0.19		1.09	

Table 2-129 GSM Transmit Power (PCS Band) 1700 MHz to 2 GHz, Preamp Off

Nominal Input Level (dBm)	50 MHz Amplitude Accuracy (dB)	Peak to Peak Response (1700 MHz to 2 GHz) (dB)	Uncertainty (dB)	cdmaOne Channel Power Accuracy (dB) Col 1+2+3	Specification (± dB)	Pass/Fail
15			0.19		0.68	
–20			0.19		0.68	
–30			0.19		0.61	
–40			0.19		0.66	
–50			0.19		0.82	
–60			0.19		0.96	

Part 4: cdmaOne Receive Channel Power (Preamp Off)

Table 2-130 and Table 2-131 lists the reference level, nominal level, and nominal attenuation for the calibrated 1 dB and 10 dB step attenuators for the amplitude accuracy measurements.

Table 2-130 cdmaOne Receive Channel Power (Option BAC) - Preamp Off, Reference Level 0 dB

Nominal Input Level (dBm)	Reference Level (dBm)	Resolution Bandwidth (kHz)	Internal Attenuator (dB)	1 dB Step Attenuator (dB)	10 dB Step Attenuator (dB)	Source Nominal Level (dBm)
0	0	10	10	0	0	0
–40	–40	10	0	0	40	0
–60	–60	10	0	0	60	0
–70	–70	10	0	0	70	0
–80	–80	10	0	0	80	0
–85	–85	10	0	5	80	0

Table 2-131 cdmaOne Receive Channel Power (Options BAC) - Preamp Off, Reference Level -20 dB

Nominal Input Level (dBm)	Reference Level (dBm)	Resolution Bandwidth (kHz)	Internal Attenuator (dB)	1 dB Step Attenuator (dB)	10 dB Step Attenuator (dB)	Source Nominal Level (dBm)
0	20	10	10	0	0	0
–40	–20	10	0	0	40	0
–60	–40	10	0	0	60	0
–70	–50	10	0	0	70	0
–80	–60	10	0	0	80	0
–85	–65	10	0	5	80	0

1. Press **Preset** on the analyzer. Press the **Factory Preset** softkey, if it is displayed. If the firmware revision is A.04.00 or later, press **Sweep, Points, 401, Enter**.
2. Perform a complete self-alignment and set Auto Align Off. Press **System, Alignments, Align Now, All**, and wait for the alignment routine to finish. Then, press **Return, Auto Align, Off**.
3. Zero and calibrate the power meter and power sensor connected to Channel A of the power meter.

4. Connect the equipment as shown in Figure 2-20. The power sensor should connect directly to the 6 dB fixed attenuator using an adapter.
5. Preset the synthesized signal generator. Manually press **Blue Key, Special, 0, 0**. Set the signal generator as follows:

   FREQUENCY, 50 MHz
   AMPLITUDE, 0 dBm

6. Set the 10 dB and 1 dB step attenuators to 0 dB. Refer to Table 2-2 on page 2-7 for information on manually controlling a programmable step attenuator with an HP/Agilent 11713A attenuator/switch driver.
7. From the metrology data for the step attenuators at 50 MHz, obtain the actual attenuation for the 0 dB setting of each attenuator (in some cases, this might be zero by definition). Add the two actual attenuations to obtain the 0 dB reference attenuation.

   $$\text{RefAtten}_{0dB} = 10\text{ dB Actual}_{0dB} + 1\text{ dB Actual}_{0dB}$$

   For example, if the actual attenuation for the 10 dB step attenuator is 0.03 dB, 10 dB Actual_{0dB} is 0.03 dB. If the actual attenuation for the 1 dB step attenuator is 0.02 dB, 1 dB Actual_{0dB} is 0.02 dB. In this case RefAtten_{0dB} is 0.05 dB.
8. Retrieve metrology data for the step attenuators at 50 MHz. Enter the actual attenuation values for each attenuator setting as indicated in Table 2-132 and Table 2-133.

Table 2-132 Amplitude Accuracy Worksheet, 0 dBm Reference Level

1 dB Step Attenuator		10 dB Step Attenuator		Total Attenuation		Nominal Amptd.	Meas. Amptd.	Amptd. Accuracy
Setting	Actual	Setting	Actual	Setting	Actual			(TR Entry)
0 dB		40 dB		40 dB		–40 dBm		
0 dB		60 dB		60 dB		–60 dBm		
0 dB		70 dB		70 dB		–70 dBm		
0 dB		80 dB		80 dB		–80 dBm		
0 dB		90 dB		90 dB		–90 dBm		
5 dB		100 dB		105 dB		–105 dBm		

Table 2-133 Amplitude Accuracy Worksheet, –20 dBm Reference Level

1 dB Step Attenuator		10 dB Step Attenuator		Total Attenuation		Nominal Amptd.	Meas. Amptd.	Amptd. Accuracy
Setting	Actual	Setting	Actual	Setting	Actual			(TR Entry)
0 dB		40 dB		40 dB		–40 dBm		
0 dB		60 dB		60 dB		–60 dBm		
0 dB		70 dB		70 dB		–70 dBm		
0 dB		80 dB		80 dB		–80 dBm		
0 dB		90 dB		90 dB		–90 dBm		
5 dB		100 dB		105 dB		–105 dBm		

9. Calculate the actual attenuation by adding the actual attenuation for the 1 dB step attenuator to the actual attenuation for the 10 dB step attenuator for each total attenuation setting listed in Table 2-128 and Table 2-129.

NOTE The external attenuators and cables are now part of the "source."

10. Adjust the signal generator amplitude for a power meter reading of 0 dBm ±0.2 dB. Record the power meter reading here:

    $Amptd_{0dBm}$ = _____ dBm

11. Connect the equipment as shown in Figure 2-78. The 6 dB fixed attenuator must connect directly to the analyzer input.

12. Set the analyzer as follows:

    FREQUENCY, Center Freq, 50 MHz
    SPAN, 0 kHz
    BW/Avg, Resolution BW, 10 kHz
    BW/Avg, Video BW, 10 kHz
    AMPLITUDE, More 1 of 2, Int Preamp (Off)
    AMPLITUDE, Amptd Units, dBm
    Attenuation, 0 dB (Man)

13. Perform the following steps for each of the nominal amplitude values listed in Table 2-130 and Table 2-131:

    a. Set the 1 dB step attenuator as indicated in Table 2-130 and Table 2-131.
    b. Set the 10 dB step attenuator as indicated in Table 2-130 and Table 2-131.
    c. Press **Single** and wait for the sweep to finish.
    d. Press **Peak Search** (or **Search**). Even though the signal may be slightly above the reference level for the first nominal amplitude

setting, the marker can still make a valid measurement.

e. Record the Mkr 1 amplitude value as the measured amplitude in Table 2-132 and Table 2-133.

f. If the nominal amplitude is 15 dBm, calculate the amplitude accuracy as follows:

$$\text{Amplitude Accuracy} = \text{Measured Amplitude} - (\text{Amptd}_{0\text{dBm}} - \text{ActualTotalAtten} + \text{RefAtten}_{0\text{dB}})$$

14. Record the largest error between Table 2-132 (0 dB Log level) and Table 2-133 (20 dB Log level) for each of the nominal input levels.

15. Report the cdmaOne Receive Channel Power Accuracy by summing together column 2 through 4.

16. Report the cdmaOne Receive Channel Power (Preamp On) in the Test Record. This will be the worst value found in Table 2-134 and Table 2-135.

17. Copy the peak to peak frequency response error from the Comms Frequency Response performance test for both the 800 MHz to 1 GHz Cellular band and the 1700 MHz to 2 GHz PCS bands measured in a 300 kHz resolution bandwidth.

18. Calculate the cdmaOne Receive Channel Power Accuracy by summing together column 2 through 4.

19. Report the cdmaOne Transmit Power results in the Test Record. This will be the worst value found in Table 2-134 and Table 2-135.

20. Report the worst result for each TR number in the cdmaOne Receive Channel Power (Preamp Off) in the Test Record. This will be the worst value found in Table 2-134 and Table 2-135.

Table 2-134 cdmaOne Receive Channel Power (Cellular Band) - Preamp Off

Nominal Input Level (dBm)	50 MHz Amplitude Accuracy (dB)	Peak to Peak Response (900 MHz to 1 GHz) (dB)	Uncertainty (dB)	TR Col 1+2+3	TR Number
0			0.24		11
-40			0.24		12
-60			0.24		12
-70			0.24		12
-80			0.24		12
-85			0.24		12

Table 2-135 cdmaOne Receive Channel Power (PCS) - Preamp Off

Nominal Input Level (dBm)	50 MHz Amplitude Accuracy (dB)	Peak to Peak Response (1700 MHz to 2 GHz) (dB)	Uncertainty (dB)	TR Col 1+2+3	TR Number
0			0.24		13
-40			0.24		14
-60			0.24		14
-70			0.24		14
-80			0.24		14
-85			0.24		14

21.The Comms Absolute Accuracy test is now complete.

3 Performance Verification Test Records

Agilent E4401B Performance Verification Test Record

Only the tests for E4401B are included in this test record, therefore not all test numbers are included.

Table 3-1 E4401B Performance Verification Test Record

Agilent Technologies

Address: _____ Report No. _____

_____ Date _____

_____

Model E4401B

Serial No. _____ Ambient temperature _____ ° C

Options _____ Power mains line frequency _____ Hz (nominal)

Firmware Revision _____ Relative humidity _____%

Customer _____ Tested by _____

Test Equipment Used:

Description	**Model No.**	**Trace No.**	**Cal Due Date**
Synthesized Signal Generator	_____	_____	_____
Synthesized Sweeper	_____	_____	_____
Function Generator	_____	_____	_____
Power Meter, Dual-Channel	_____	_____	_____
RF Power Sensor #1	_____	_____	_____
RF Power Sensor #2 *(Non-Option 1DP only)*	_____	_____	_____
Low-Power Power Sensor	_____	_____	_____
75 Ω Power Sensor *(Option 1DP only)*	_____	_____	_____
Digital Multimeter	_____	_____	_____
Universal Counter	_____	_____	_____
Frequency Standard	_____	_____	_____
Power Splitter	_____	_____	_____

Table 3-1 E4401B Performance Verification Test Record

50 Ω Termination	_____	_____	_____
Minimum Loss Pad *(Option 1DP only)*	_____	_____	_____
1 dB Step Attenuator	_____	_____	_____
10 dB Step Attenuator	_____	_____	_____
6 dB Fixed Attenuator	_____	_____	_____
20 dB Fixed Attenuator *(Option 1DS only)*	_____	_____	_____
Oscilloscope *(Option 1D6 only)*	_____	_____	_____
Microwave Spectrum Analyzer *(Option 1DN or 1DQ only)*	_____	_____	_____
Notes/comments:	_____		

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
1. 10 MHz Reference Output Accuracy *(Non-Option 1D5 only)*				
Settability	–5.0 Hz	(1)_____	5.0 Hz	±293.3 μHz
2. 10 MHz Precision Frequency Reference Output Accuracy *(Option 1D5 only)*				
5 Minute Warm-Up Error	–0.1 ppm	(1)_____	0.1 ppm	±0.000072 ppm
15 Minute Warm-Up Error	–0.01 ppm	(2)_____	0.01 ppm	±0.000070 ppm

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies					
Model E4401B			**Report No.** _____		
Serial No. _____			**Date** _____		
Test Description		**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
3. Frequency Readout Accuracy and Marker Count Accuracy					
Frequency Readout Accuracy					
Center Freq	Span				
1490 MHz	20 MHz	1489.83 MHz	(1)_____	1490.17 MHz	±0 Hz
1490 MHz	10 MHz	1489.91 MHz	(2)_____	1490.09 MHz	±0 Hz
1490 MHz	1 MHz	1489.991 MHz	(3)_____	1490.009 MHz	±0 Hz
Marker Count Accuracy					
Center Freq	Span				
1490 MHz	10 MHz	1489.999999 MHz	(4)_____	1490.000001 MHz	±0 Hz
1490 MHz	1 MHz	1489.999999 MHz	(5)_____	1490.000001 MHz	±0 Hz
5. Frequency Span Readout Accuracy					
Span	Start Freq				
1500 MHz	0 Hz	1185 MHz	(1)_____	1215 MHz	±3.06 MHz
100 MHz	10 MHz	79 MHz	(2)_____	81 MHz	±204 kHz
100 kHz	10 MHz	79 kHz	(3)_____	81 kHz	±204 Hz
100 MHz	800 MHz	79 MHz	(4)_____	81 MHz	±204 kHz
100 kHz	800 MHz	79 kHz	(5)_____	81 kHz	±204 Hz
100 MHz	1400 MHz	79 MHz	(6)_____	81 MHz	±204 kHz
100 kHz	1499 MHz	79 kHz	(7)_____	81 kHz	±204 Hz

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies				
Model E4401B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
7. Noise Sidebands				
Offset from 1 GHz signal				
10 kHz		(1)_____	–93 dBc/Hz	±1.154 dB
20 kHz		(2)_____	–100 dBc/Hz	±1.154 dB
30 kHz		(3)_____	–104 dBc/Hz	±1.154 dB
100 kHz		(4)_____	–113 dBc/Hz	±1.154 dB
8. System Related Sidebands				
Offset from 500 MHz signal				
30 kHz to 230 kHz		(1)_____	–65 dBc	±1.154 dB
–30 kHz to –230 kHz		(2)_____	–65 dBc	±1.154 dB
9. Residual FM				
1 kHz Res BW, (*Non-Option 1D5)*		(1)_____	150 Hz	±9.24 Hz
1 kHz Res BW, (*Option 1D5)*		(1)_____	100 Hz	±9.24 Hz
10 Hz Res BW (*Options 1DR and 1D5 only*)		(2)_____	2 Hz	±0.274 Hz
10. Sweep Time Accuracy				
Sweep Time				
5 ms	–1.0%	(1)_____	±1.0%	±0.28%
20 ms	–1.0%	(2)_____	±1.0%	±0.28%
100 ms	–1.0%	(3)_____	±1.0%	±0.28%
1 s	–1.0%	(4)_____	±1.0%	±0.28%
10 s	–1.0%	(5)_____	±1.0%	±0.28%
1 ms (*Option AYX only)*	–1.0%	(6)_____	±1.0%	±0.28%

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies				
Model E4401B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
500 µs (*Option AYX only*)	–1.0%	(7)_____	±1.0%	±0.28%
100 µs (*Option AYX only*)	–1.0%	(8)_____	±1.0%	±0.28%
11. Display Scale Fidelity				
Cumulative Log Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–0.22 dB	(1)_____	0.22 dB	±0.064 dB
–8	–0.22 dB	(2)_____	0.22 dB	±0.064 dB
–12	–0.24 dB	(3)_____	0.24 dB	±0.064 dB
–16	–0.24 dB	(4)_____	0.24 dB	±0.064 dB
–20	–0.24 dB	(5)_____	0.24 dB	±0.063 dB
–24	–0.26 dB	(6)_____	0.26 dB	±0.064 dB
–28	–0.26 dB	(7)_____	0.26 dB	±0.064 dB
–32	–0.40 dB	(8)_____	0.40 dB	±0.064 dB
–36	–0.40 dB	(9)_____	0.40 dB	±0.064 dB
–40	–0.40 dB	(10)_____	0.40 dB	±0.063 dB
–44	–0.57 dB	(11)_____	0.57 dB	±0.064 dB
–48	–0.57 dB	(12)_____	0.57 dB	±0.064 dB
–52	–0.57dB	(13)_____	0.57 dB	±0.089 dB
–56	–0.57 dB	(14)_____	0.57 dB	±0.089 dB
–60	–0.57 dB	(15)_____	0.57 dB	±0.088 dB
–64	–0.66 dB	(16)_____	0.66 dB	±0.089 dB
–68	–0.66 dB	(17)_____	0.66 dB	±0.089 dB
–72	–0.66 dB	(18)_____	0.66 dB	±0.089 dB
–76	–0.66 dB	(19)_____	0.66 dB	±0.089 dB
–80	–0.66 dB	(20)_____	0.66 dB	±0.088 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–84	–1.15 dB	(21)_____	1.15 dB	±0.089 dB
Incremental Log Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–0.4 dB	(22)_____	0.4 dB	±0.064 dB
–8	–0.4 dB	(23)_____	0.4 dB	±0.064 dB
–12	–0.4 dB	(24)_____	0.4 dB	±0.064 dB
–16	–0.4 dB	(25)_____	0.4 dB	±0.064 dB
–20	–0.4 dB	(26)_____	0.4 dB	±0.063 dB
–24	–0.4 dB	(27)_____	0.4 dB	±0.064 dB
–28	–0.4 dB	(28)_____	0.4 dB	±0.064 dB
–32	–0.4 dB	(29)_____	0.4 dB	±0.064 dB
–36	–0.4 dB	(30)_____	0.4 dB	±0.064 dB
–40	–0.4 dB	(31)_____	0.4 dB	±0.063 dB
–44	–0.4 dB	(32)_____	0.4 dB	±0.064 dB
–48	–0.4 dB	(33)_____	0.4 dB	±0.064 dB
–52	–0.4 dB	(34)_____	0.4 dB	±0.089 dB
–56	–0.4 dB	(35)_____	0.4 dB	±0.089 dB
–60	–0.4 dB	(36)_____	0.4 dB	±0.088 dB
–64	–0.4 dB	(37)_____	0.4 dB	±0.089 dB
–68	–0.4 dB	(38)_____	0.4 dB	±0.089 dB
–72	–0.4 dB	(39)_____	0.4 dB	±0.089 dB
–76	–0.4 dB	(40)_____	0.4 dB	±0.089 dB
–80	–0.4 dB	(41)___	0.4 dB	±0.088 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Cumulative Log Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.34 dB	(43)_____	0.34 dB	±0.064 dB
–8	–0.38 dB	(44)_____	0.38 dB	±0.064 dB
–12	–0.42 dB	(45)_____	0.42 dB	±0.064 dB
–16	–0.46 dB	(46)_____	0.46 dB	±0.064 dB
–20	–0.50 dB	(47)_____	0.50 dB	±0.063 dB
–24	–0.54 dB	(48)_____	0.54 dB	±0.064 dB
–28	–0.58 dB	(49)_____	0.58 dB	±0.064 dB
–32	–0.62 dB	(50)_____	0.62 dB	±0.064 dB
–36	–0.66 dB	(51)_____	0.66 dB	±0.064 dB
–40	–0.70 dB	(52)_____	0.70 dB	±0.063 dB
–44	–0.74 dB	(53)_____	0.74 dB	±0.064 dB
–48	–0.78 dB	(54)_____	0.78 dB	±0.064 dB
–52	–0.82 dB	(55)_____	0.82 dB	±0.089 dB
–56	–0.86 dB	(56)_____	0.86 dB	±0.089 dB
–60	–0.90 dB	(57)_____	0.90 dB	±0.088 dB
–64	–0.94 dB	(58)_____	0.94 dB	±0.089 dB
–68	–0.98 dB	(59)_____	0.98 dB	±0.089 dB
–72	–1.02 dB	(60)_____	1.02 dB	±0.089 dB
–76	–1.06 dB	(61)_____	1.06 dB	±0.089 dB
–80	–1.10 dB	(62)_____	1.10 dB	±0.088 dB
–84	–1.14 dB	(63)_____	1.14 dB	±0.089 dB
–88	–1.18 dB	(64)_____	1.18 dB	±0.089 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–92	–1.22 dB	(65)_____	1.22 dB	±0.089 dB
–96	–1.26 dB	(66)_____	1.26 dB	±0.088 dB
–98	–1.28 dB	(67)_____	1.28 dB	±0.089 dB
Incremental Log Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.4 dB	(68)_____	0.4 dB	±0.064 dB
–8	–0.4 dB	(69)_____	0.4 dB	±0.064 dB
–12	–0.4 dB	(70)_____	0.4 dB	±0.064 dB
–16	–0.4 dB	(71)_____	0.4 dB	±0.064 dB
–20	–0.4 dB	(72)_____	0.4 dB	±0.063 dB
–24	–0.4 dB	(73)_____	0.4 dB	±0.064 dB
–28	–0.4 dB	(74)_____	0.4 dB	±0.064 dB
–32	–0.4 dB	(75)_____	0.4 dB	±0.064 dB
–36	–0.4 dB	(76)_____	0.4 dB	±0.064 dB
–40	–0.4 dB	(77)_____	0.4 dB	±0.063 dB
–44	–0.4 dB	(78)_____	0.4 dB	±0.064 dB
–48	–0.4 dB	(79)_____	0.4 dB	±0.064 dB
–52	–0.4 dB	(80)_____	0.4 dB	±0.089 dB
–56	–0.4 dB	(81)_____	0.4 dB	±0.089 dB
–60	–0.4 dB	(82)_____	0.4 dB	±0.088 dB
–64	–0.4 dB	(83)_____	0.4 dB	±0.089 dB
–68	–0.4 dB	(84)_____	0.4 dB	±0.089 dB
–72	–0.4 dB	(85)_____	0.4 dB	±0.089 dB
–76	–0.4 dB	(86)_____	0.4 dB	±0.089 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–80	–0.4 dB	(87)_____	0.4 dB	±0.088 dB
Linear Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–2.0%	(89)_____	2.0%	±0.064%
–8	–2.0%	(90)_____	2.0%	±0.064%
–12	–2.0%	(91)_____	2.0%	±0.064%
–16	–2.0%	(92)_____	2.0%	±0.064%
–20	–2.0%	(93)_____	2.0%	±0.063%
Linear Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–2.0%	(94)_____	2.0%	±0.064%
–8	–2.0%	(95)_____	2.0%	±0.064%
–12	–2.0%	(96)_____	2.0%	±0.064%
–16	–2.0%	(97)_____	2.0%	±0.064%
–20	–2.0%	(98)_____	2.0%	±0.063%
Zero Span, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.36 dB	(99)_____	0.36 dB	±0.064 dB
–8	–0.42 dB	(100)_____	0.42 dB	±0.064 dB
–12	–0.48 dB	(101)_____	0.48 dB	±0.064 dB
–16	–0.54 dB	(102)_____	0.54 dB	±0.064 dB
–20	–0.60 dB	(103)_____	0.60 dB	±0.063 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–24	–0.66 dB	(104)_____	0.66 dB	±0.064 dB
–28	–0.72 dB	(105)_____	0.72 dB	±0.064 dB
–32	–0.78 dB	(106)_____	0.78 dB	±0.064 dB
–36	–0.84 dB	(107)_____	0.84 dB	±0.064 dB
–40	–0.90 dB	(108)_____	0.90 dB	±0.063 dB
–44	–0.96 dB	(109)_____	0.96 dB	±0.064 dB
–48	–1.02 dB	(110)_____	1.02 dB	±0.064 dB
–52	–1.08 dB	(111)_____	1.08 dB	±0.089 dB
–56	–1.14 dB	(112)_____	1.14 dB	±0.089 dB
–60	–1.20 dB	(113)_____	1.20 dB	±0.088 dB
–64	–1.5 dB	(114)_____	1.5 dB	±0.089 dB
–68	–1.5 dB	(115)_____	1.5 dB	±0.089 dB
–70	–1.5 dB	(116)_____	1.5 dB	±0.089 dB
12. Input Attenuation Switching Uncertainty				
Input Attenuation Setting				
0 dB	–0.3 dB	(1)_____	0.3 dB	±0.108 dB
5 dB	–0.3 dB	(2)_____	0.3 dB	±0.107 dB
15 dB	–0.3 dB	(3)_____	0.3 dB	±0.107 dB
20 dB	–0.3 dB	(4)_____	0.3 dB	±0.089 dB
25 dB	–0.35 dB	(5)_____	0.35 dB	±0.089 dB
30 dB	–0.40 dB	(6)_____	0.40 dB	±0.089 dB
35 dB	–0.45 dB	(7)_____	0.45 dB	±0.089 dB
40 dB	–0.50 dB	(8)_____	0.50 dB	±0.089 dB
45 dB	–0.55 dB	(9)_____	0.55 dB	±0.089 dB
50 dB	–0.60 dB	(10)_____	0.60 dB	±0.089 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description		Minimum	Results Measured	Maximum	Measurement Uncertainty
55 dB		–0.65 dB	(11)_____	0.65 dB	±0.089 dB
60 dB		–0.70 dB	(12)_____	0.70 dB	±0.089 dB
13. Reference Level Accuracy					
Log, Res BW ≥1 kHz					
Reference Level					
50 Ω (dBm)	75 Ω (dBmV)				
–15	33.75	–0.3 dB	(1)_____	0.3 dB	±0.144 dB
–5	43.75	–0.3 dB	(2)_____	0.3 dB	±0.144 dB
–35	13.75	–0.3 dB	(3)_____	0.3 dB	±0.144 dB
–45	3.75	–0.3 dB	(4)_____	0.3 dB	±0.144 dB
–55	–6.25	–0.5 dB	(5)_____	0.5 dB	±0.156 dB
–65	–16.25	–0.5 dB	(6)_____	0.5 dB	±0.156 dB
–75	–26.25	–0.7 dB	(7)_____	0.7 dB	±0.156 dB
Linear, Res BW ≤300 Hz					
Reference Level					
50 Ω (dBm)	75 Ω (dBmV)				
–15	33.75	–0.3 dB	(8)_____	0.3 dB	±0.144 dB
–5	43.75	–0.3 dB	(9)_____	0.3 dB	±0.144 dB
–35	13.75	–0.3 dB	(10)_____	0.3 dB	±0.144 dB
–45	3.75	–0.3 dB	(11)_____	0.3 dB	±0.144 dB
–55	–6.25	–0.5 dB	(12)_____	0.5 dB	±0.156 dB
–65	–16.25	–0.5 dB	(13)_____	0.5 dB	±0.156 dB
–75	–26.25	–0.7 dB	(14)_____	0.7 dB	±0.156 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies					
Model E4401B			**Report No.** _____		
Serial No. _____			**Date** _____		
Test Description		**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
Log, Res BW ≤300 Hz *(Option 1DR only)*					
Reference Level					
50 Ω (dBm)	75 Ω (dBmV)				
–15	33.75	–0.3 dB	(15)_____	0.3 dB	±0.144 dB
–5	43.75	–0.3 dB	(16)_____	0.3 dB	±0.144 dB
–35	13.75	–0.3 dB	(17)_____	0.3 dB	±0.144 dB
–45	3.75	–0.3 dB	(18)_____	0.3 dB	±0.144 dB
–55	–6.25	–0.5 dB	(19)_____	0.5 dB	±0.156 dB
–65	–16.25	–0.5 dB	(20)_____	0.5 dB	±0.156 dB
–75	–26.25	–0.7 dB	(21)_____	0.7 dB	±0.156 dB
Linear, Res BW ≤300 Hz *(Option 1DR only)*					
Reference Level					
50 Ω (dBm)	75 Ω (dBmV)				
–15	33.75	–0.3 dB	(22)_____	0.3 dB	±0.144 dB
–5	43.75	–0.3 dB	(23)_____	0.3 dB	±0.144 dB
–35	13.75	–0.3 dB	(24)_____	0.3 dB	±0.144 dB
–45	3.75	–0.3 dB	(25)_____	0.3 dB	±0.144 dB
–55	–6.25	–0.5 dB	(26)_____	0.5 dB	±0.156 dB
–65	–16.25	–0.5 dB	(27)_____	0.5 dB	±0.156 dB
–75	–26.25	–0.7 dB	(28)_____	0.7 dB	±0.156 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
15. Resolution Bandwidth Switching Uncertainty				
Resolution Bandwidth				
3 kHz	–0.3 dB	(1)_____	0.3 dB	±0.064 dB
9 kHz	–0.3 dB	(2)_____	0.3 dB	±0.064 dB
10 kHz	–0.3 dB	(3)_____	0.3 dB	±0.064 dB
30 kHz	–0.3 dB	(4)_____	0.3 dB	±0.064 dB
100 kHz	–0.3 dB	(5)_____	0.3 dB	±0.064 dB
120 kHz	–0.3 dB	(6)_____	0.3 dB	±0.064 dB
300 kHz	–0.3 dB	(7)_____	0.3 dB	±0.064 dB
1 MHz	–0.3 dB	(8)_____	0.3 dB	±0.064 dB
3 MHz	–0.3 dB	(9)_____	0.3 dB	±0.064 dB
5 MHz	–0.6 dB	(10)_____	0.6 dB	±0.083 dB
300 Hz *(Option 1DR only)*	–0.3 dB	(11)_____	0.3 dB	±0.064 dB
200 Hz *(Option 1DR only)*	–0.3 dB	(12)_____	0.3 dB	±0.064 dB
100 Hz *(Option 1DR only)*	–0.3 dB	(13)_____	0.3 dB	±0.064 dB
30 Hz *(Option 1DR only)*	–0.3 dB	(14)_____	0.3 dB	±0.064 dB
10 Hz *(Option 1DR only)*	–0.3 dB	(15)_____	0.3 dB	±0.064 dB
16. Absolute Amplitude Accuracy (Reference Settings)				
Log, Preamp Off	–0.30 dB	(1)_____	0.30 dB	±0.148 dB
Lin, Preamp Off	–0.30 dB	(2)_____	0.30 dB	±0.148 dB
Log, Preamp On	–0.37 dB	(3)_____	0.37 dB	±0.148 dB
Lin, Preamp On	–0.37 dB	(4)_____	0.37 dB	±0.148 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies				
Model E4401B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
18. Overall Absolute Amplitude Accuracy				
0 dBm Reference Level				
0 dBm input	–0.54 dB	(1)_____	0.54 dB	±0.08 dB
–10 dBm input	–0.54 dB	(2)_____	0.54 dB	±0.081 dB
–20 dBm input	–0.54 dB	(3)_____	0.54 dB	±0.082 dB
–30 dBm input	–0.54 dB	(4)_____	0.54 dB	±0.083 dB
–40 dBm input	–0.54 dB	(5)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(6)_____	0.54 dB	±0.086 dB
–20 dBm Reference Level				
–20 dBm input	–0.54 dB	(7)_____	0.54 dB	±0.082 dB
–30 dBm input	–0.54 dB	(8)_____	0.54 dB	±0.083 dB
–40 dBm input	–0.54 dB	(9)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(10)_____	0.54 dB	±0.086 dB
–40 dBm Reference Level				
–40 dBm input	–0.54 dB	(11)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(12)_____	0.54 dB	±0.086 dB
–50 dBm Reference Level				
–50 dBm input	–0.54 dB	(13)_____	0.54 dB	±0.086 dB
20. Resolution Bandwidth Accuracy				
Resolution Bandwidth				
5 MHz	3.5 MHz	(1)_____	6.5 MHz	±38.2 kHz
3 MHz	2.55 MHz	(2)_____	3.45 MHz	±22.9 kHz
1 MHz	0.85 MHz	(3)_____	1.15 MHz	±7.64 kHz
300 kHz	255 kHz	(4)_____	345 kHz	±2.29 kHz

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies				
Model E4401B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
100 kHz	85 kHz	(5)_____	115 kHz	±764 Hz
30 kHz	25.5 kHz	(6)_____	34.5 kHz	±229 Hz
10 kHz	8.5 kHz	(7)_____	11.5 kHz	±76.4 Hz
3 kHz	2.55 kHz	(8)_____	3.45 kHz	±22.9 Hz
1 kHz	850 Hz	(9)_____	1.15 kHz	±7.64 Hz
120 kHz	102 kHz	(10)_____	138 kHz	±154 Hz
9 kHz	7.65 kHz	(11)_____	10.35kHz	±11.5 Hz
21. Frequency Response	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed and installed options.			
20 to 30° C:				
Non-Option 1DP (50 Ω) Band 0 (9 kHz to 1.5 GHz)				
Maximum Response		(1)_____	0.50 dB	±0.245 dB
Minimum Response	–0.50 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	1.0 dB	±0.245 dB
Option 1DP (75 Ω) Band 0 (1 MHz to 1.5 GHz)				
Maximum Response		(1)_____	0.50 dB	±0.245 dB
Minimum Response	–0.50 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	1.0 dB	±0.245 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
0 to 55° C:				
Non-Option 1DP (50 Ω) Band 0 (9 kHz to 1.5 GHz)				
Maximum Response		(1)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	2.0 dB	±0.245 dB
Option 1DP (75 Ω) Band 0 (1 MHz to 1.5 GHz)				
Maximum Response		(1)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	2.0 dB	±0.245 dB
24. Frequency Response (Preamp On) *(Option 1DS only)*	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed and installed options.			
20 to 30° C:				
Non-Option 1DP (50 Ω) Band 0 (100 kHz to 1.5 GHz)				
Maximum Response		(1)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	2.0 dB	±0.245 dB
Option 1DP (75 Ω) Band 0 (1 MHz to 1.5 GHz)				
Maximum Response		(1)_____	1.50 dB	±0.245 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Minimum Response	–1.50 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	3.0 dB	±0.245 dB
0 to 55° C:				
Non-Option 1DP (50 Ω) Band 0 (100 kHz to 1.5 GHz)				
Maximum Response		(1)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	3.0 dB	±0.245 dB
Option 1DP (75 Ω) Band 0 (1 MHz to 1.5 GHz)				
Maximum Response		(1)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	4.0 dB	±0.245 dB
27. Other Input Related Spurious Responses				
Input Frequency				
542.8 MHz		(1)_____	–65 dBc	±1.08 dB
510.7 MHz		(2)_____	–65 dBc	±1.08 dB
1310.7 MHz		(3)_____	–45 dBc	±1.08 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
29. Spurious Responses	Note: Enter data in the appropriate section below depending upon the input impedance and serial number of the analyzer.			
50 MHz TOI, 1 kHz RBW, 50 Ω (Serial Number less than US39440413)	10 dBm	(1)_____		±0.489 dB
50 MHz TOI, 1 kHz RBW, 50 Ω (Serial Number US39440413 or greater)	13.5 dBm	(1)_____		±0.489 dB
50 MHz TOI, 1 kHz RBW, 75 Ω	58.75 dBmV	(1)_____		±0.481 dB
50 MHz TOI, 30 Hz RBW, 50 Ω *(Option 1DR only)* (Serial Number less than US39440413)	10 dBm	(2)_____		±0.489 dB
50 MHz TOI, 30 Hz RBW, 50 Ω *(Option 1DR only)* (Serial Number US39440413 or greater)	13.5 dBm	(2)_____		±0.489 dB
50 MHz TOI, 30 Hz RBW, 75 Ω *(Option 1DR only)*	58.75 dBmV	(2)_____		±0.481 dB
40 MHz SHI, 50 Ω	35 dBm	(3)_____		±1.11 dB
40 MHz SHI, 75 Ω	83.75 dBmV	(3)_____		±1.11 dB
32. Gain Compression				
Test Frequency				
53 MHz		(1)_____	1.0 dB	±0.127 dB
50.004 MHz *(Option 1DR only)*		(2)_____	1.0 dB	±0.127 dB
1403 MHz		(3)_____	1.0 dB	±0.127 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies				
Model E4401B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
34. Displayed Average Noise Level	Note: Enter results in the appropriate section below based upon the input impedance of the analyzer.			
50 Ω, 1 kHz RBW, Preamp Off:				
400 kHz		(1)_____	–115 dBm	±1.82 dB
1 MHz to 10 MHz		(2)_____	–115 dBm	±1.82 dB
10 MHz to 500 MHz		(3)_____	–119 dBm	±1.82 dB
500 MHz to 1 GHz		(4)_____	–117 dBm	±1.82 dB
1 GHz to 1.5 GHz		(5)_____	–114 dBm	±1.82 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
50 Ω, 1 kHz RBW, Preamp On:				
400 kHz		(6)_____	–131 dBm	±1.82 dB
1 MHz to 10 MHz		(7)_____	–131 dBm	±1.82 dB
10 MHz to 500 MHz		(8)_____	–135 dBm	±1.82 dB
500 MHz to 1 GHz		(9)_____	–133 dBm	±1.82 dB
1 GHz to 1.5 GHz		(10)_____	–131 dBm	±1.82 dB
50 Ω, 10 Hz RBW, Preamp Off:				
400 kHz		(11)_____	–134 dBm	±1.82 dB
1 MHz to 10 MHz		(12)_____	–134 dBm	±1.82 dB
10 MHz to 500 MHz		(13)_____	–138 dBm	±1.82 dB
500 MHz to 1 GHz		(14)_____	–136 dBm	±1.82 dB
1 GHz to 1.5 GHz		(15)_____	–133 dBm	±1.82 dB
50 Ω, 10 Hz RBW, Preamp On:				
400 kHz		(16)_____	–150 dBm	±1.82 dB
1 MHz to 10 MHz		(17)_____	–150 dBm	±1.82 dB
10 MHz to 500 MHz		(18)_____	–154 dBm	±1.82 dB
500 MHz to 1 GHz		(19)_____	–152 dBm	±1.82 dB
1 GHz to 1.5 GHz		(20)_____	–150 dBm	±1.82 dB
75 Ω, 1 kHz RBW, Preamp Off:				
1 MHz to 10 MHz		(21)_____	–64 dBmV	±1.82 dB
10 MHz to 500 MHz		(22)_____	–66 dBmV	±1.82 dB
500 MHz to 1 GHz		(23)_____	–60 dBmV	±1.82 dB
1 GHz to 1.5 GHz		(24)_____	–56 dBmV	±1.82 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
75 Ω, 1 kHz RBW, Preamp On:				
1 MHz to 10 MHz		(25)_____	–80 dBmV	±1.82 dB
10 MHz to 500 MHz		(26)_____	–81 dBmV	±1.82 dB
500 MHz to 1 GHz		(27)_____	–81 dBmV	±1.82 dB
1 GHz to 1.5 GHz		(28)_____	–75 dBmV	±1.82 dB
75 Ω, 10 Hz RBW, Preamp Off:				
1 MHz to 10 MHz		(29)_____	–83 dBmV	±1.82 dB
10 MHz to 500 MHz		(30)_____	–85 dBmV	±1.82 dB
500 MHz to 1 GHz		(31)_____	–79 dBmV	±1.82 dB
1 GHz to 1.5 GHz		(32)_____	–75 dBmV	±1.82 dB
75 Ω, 10 Hz RBW, Preamp On:				
1 MHz to 10 MHz		(33)_____	–99 dBmV	±1.82 dB
10 MHz to 500 MHz		(34)_____	–100 dBmV	±1.82 dB
500 MHz to 1 GHz		(35)_____	–100 dBmV	±1.82 dB
1 GHz to 1.5 GHz		(36)_____	–94 dBmV	±1.82 dB
38. Residual Responses	Note: Enter results in the appropriate section below based upon the input impedance of the analyzer.			
50 Ω, 150 kHz to 1.5 GHz		(1)_____	–90 dBm	±0.90 dB
75 Ω, 1 MHz to 1.5 GHz		(1)_____	–36 dBmV	±0.90 dB
39. Fast Time Domain Amplitude Accuracy *(Option AYX only)*				
Amplitude Error	–0.3%	(1)_____	0.3%	±0.029%

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
40. Tracking Generator Absolute Amplitude and Vernier Accuracy	Note: Enter results in the appropriate section below based upon the input impedance of the analyzer.			
50 Ω *(Option 1DN)*				
Absolute Amplitude Accuracy	–0.5 dB	(1)_____	0.5 dB	±0.14 dB
Positive Vernier Accuracy		(2)_____	0.75 dB	±0.19 dB
Negative Vernier Accuracy	–0.75 dB	(3)_____		±0.19 dB
Power Sweep Accuracy		(4)_____	1.5 dB	±0.19 dB
75 Ω *(Option 1DQ)*				
Absolute Amplitude Accuracy	–1.5 dB	(1)_____	1.5 dB	±0.14 dB
Positive Vernier Accuracy		(2)_____	0.9 dB	±0.19 dB
Negative Vernier Accuracy	–0.9 dB	(3)_____		±0.19 dB
Power Sweep Accuracy		(4)_____	1.8 dB	±0.19 dB
42. Tracking Generator Level Flatness	Note: Enter results in the appropriate section below based upon the input impedance of the analyzer.			
50 Ω *(Option 1DN)*				
Positive Level Flatness, <1 MHz		(1)_____	2.0 dB	±0.588 dB
Negative Level Flatness, <1 MHz	–2.0 dB	(2)_____		±0.588 dB
Positive Level Flatness, 1 MHz to 10 MHz		(3)_____	2.0 dB	±0.281 dB
Negative Level Flatness, 1 MHz to 10 MHz	–2.0 dB	(4)_____		±0.281 dB
Positive Level Flatness, >10 MHz		(5)_____	1.5 dB	±0.202 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies

Model E4401B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Negative Level Flatness, >10 MHz	–1.5 dB	(6)_____		±0.202 dB
75 Ω *(Option 1DQ)*				
Positive Level Flatness, 1 MHz to 10 MHz		(3)_____	2.5 dB	±0.314 dB
Negative Level Flatness, 1 MHz to 10 MHz	–2.5 dB	(4)_____		±0.314 dB
Positive Level Flatness, >10 MHz		(5)_____	2.0 dB	±0.314 dB
Negative Level Flatness, >10 MHz	–2.0 dB	(6)_____		±0.314 dB
44. Tracking Generator Harmonic Spurious Outputs *(Option 1DN or Option 1DQ only)*				
2nd Harmonic, <20 MHz		(1)_____	–20 dBc	±2.6 dB
2nd Harmonic, ≥20 MHz		(2)_____	–25 dBc	±2.6 dB
3rd Harmonic, <20 MHz		(3)_____	–20 dBc	±2.6 dB
3rd Harmonic, ≥20 MHz		(4)_____	–25 dBc	±2.6 dB
46. Tracking Generator Non-Harmonic Spurious Outputs *(Option 1DN or Option 1DQ only)*				
Highest Non-Harmonic Spurious Output Amplitude		(1)_____	–35 dBc	±2.67 dB

Table 3-2 E4401B Performance Verification Test Record

Agilent Technologies				
Model E4401B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
49. Gate Delay Accuracy and Gate Length Accuracy *(Option 1D6 only)*				
Minimum Gate Delay	499.9 ns	(1)_____	1.5001 µs	±475 ps
Maximum Gate Delay	499.9 ns	(2)_____	1.5001 µs	±475 ps
1 µs Gate Length	499.9 ns	(3)_____	1.5001 µs	±450 ps
65 ms Gate Length	64.993 ms	(4)_____	65.007 ms	±561 ns
50. Gate Mode Amplitude Error *(Option 1D6 only)*				
Amplitude Error	0.2 dB	(1)_____	0.2 dB	±0.023 dB

Agilent E4402B Performance Verification Test Record

Only the tests for E4402B are included in this test record, therefore not all test numbers are included.

Table 3-3 E4402B Performance Verification Test Record

Agilent Technologies

Address: _____ Report No. _____

_____ Date _____

_____

Model E4402B

Serial No. _____ Ambient temperature _____ ° C

Options _____ Power mains line frequency _____ Hz (nominal)

Firmware Revision _____ Relative humidity _____%

Customer _____ Tested by _____

Test Equipment Used:

Description	Model No.	Trace No.	Cal Due Date
Synthesized Signal Generator	_____	_____	_____
Synthesized Sweeper	_____	_____	_____
Function Generator	_____	_____	_____
Power Meter, Dual-Channel	_____	_____	_____
RF Power Sensor #1	_____	_____	_____
RF Power Sensor #2	_____	_____	_____
Low-Power Power Sensor	_____	_____	_____
Digital Multimeter	_____	_____	_____
Universal Counter	_____	_____	_____
Frequency Standard	_____	_____	_____
Power Splitter	_____	_____	_____
50 Ω Termination	_____	_____	_____
1 dB Step Attenuator	_____	_____	_____
10 dB Step Attenuator	_____	_____	_____

Table 3-3 E4402B Performance Verification Test Record

6 dB Fixed Attenuator	_____	_____	_____
20 dB Fixed Attenuator *(Option 1DS only)*	_____	_____	_____
Oscilloscope *(Option 1D6 only)*	_____	_____	_____
Microwave Spectrum Analyzer *(Option 1DN only)*	_____	_____	_____
Notes/comments:	_____		

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description		Minimum	Results Measured	Maximum	Measurement Uncertainty
1. 10 MHz Reference Output Accuracy *(Non-Option 1D5 only)*					
Settability		–5.0 Hz	(1)_____	5.0 Hz	±293.3 μHz
2. 10 MHz Precision Frequency Reference Output Accuracy *(Option 1D5 only)*					
5 Minute Warm-Up Error		–0.1 ppm	(1)_____	0.1 ppm	±0.000072 ppm
15 Minute Warm-Up Error		–0.01 ppm	(2)_____	0.01 ppm	±0.000070 ppm
3. Frequency Readout Accuracy and Marker Count Accuracy					
Frequency Readout Accuracy					
Center Freq	Span				
1500 MHz	20 MHz	1499.83 MHz	(1)_____	1500.17 MHz	0 Hz
1500 MHz	10 MHz	1499.91 MHz	(2)_____	1500.09 MHz	0 Hz
1500 MHz	1 MHz	1499.988490 MHz	(3)_____	1500.011510 MHz	±0 Hz

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Marker Count Accuracy				
Center Freq Span				
1500 MHz 10 MHz	1499.991 MHz	(4)_____	1500.009 MHz	±0 Hz
1500 MHz 1 MHz	1499.999999 MHz	(5)_____	1500.000001 MHz	±0 Hz
6. Frequency Span Readout Accuracy				
Span Start Freq				
3000 MHz 0 Hz	2370 MHz	(1)_____	2430 MHz	±6.12 MHz
100 MHz 10 MHz	79 MHz	(2)_____	81 MHz	±204 kHz
100 kHz 10 MHz	79 kHz	(3)_____	81 kHz	±204 Hz
100 MHz 800 MHz	79 MHz	(4)_____	81 MHz	±204 kHz
100 kHz 800 MHz	79 kHz	(5)_____	81 kHz	±204 Hz
100 MHz 1400 MHz	79 MHz	(6)_____	81 MHz	±204 kHz
100 kHz 1499 MHz	79 kHz	(7)_____	81 kHz	±204 Hz
7. Noise Sidebands				
Offset from 1 GHz signal				
10 kHz		(1)_____	–90 dBc/Hz	±1.154 dB
20 kHz		(2)_____	–100 dBc/Hz	±1.154 dB
30 kHz		(3)_____	–106 dBc/Hz	±1.154 dB
100 kHz		(4)_____	–119 dBc/Hz	±1.154 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies				
Model E4402B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
8. System Related Sidebands				
Offset from 500 MHz signal				
30 kHz to 230 kHz		(1)_____	–65 dBc	±1.154 dB
–30 kHz to –230 kHz		(2)_____	–65 dBc	±1.154 dB
9. Residual FM				
1 kHz Res BW, (*Non-Option 1D5)*		(1)_____	150 Hz	±9.24 Hz
1 kHz Res BW, (*Option 1D5)*		(1)_____	100 Hz	±9.24 Hz
10 Hz Res BW (*Options 1DR and 1D5 only*)		(3)_____	2 Hz	±0.274 Hz
10. Sweep Time Accuracy				
Sweep Time				
5 ms	–1.0%	(1)_____	1.0%	±0.28%
20 ms	–1.0%	(2)_____	1.0%	±0.28%
100 ms	–1.0%	(3)_____	1.0%	±0.28%
1 s	–1.0%	(4)_____	1.0%	±0.28%
10 s	–1.0%	(5)_____	1.0%	±0.28%
1 ms (*Option AYX only)*	–1.0%	(6)_____	1.0%	±0.28%
500 µs (*Option AYX only)*	–1.0%	(7)_____	1.0%	±0.28%
100 µs (*Option AYX only)*	–1.0%	(8)_____	1.0%	±0.28%

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
11. Display Scale Fidelity				
Cumulative Log Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–0.22 dB	(1)_____	0.22 dB	±0.064 dB
–8	–0.22 dB	(2)_____	0.22 dB	±0.064 dB
–12	–0.24 dB	(3)_____	0.24 dB	±0.064 dB
–16	–0.24 dB	(4)_____	0.24 dB	±0.064 dB
–20	–0.24 dB	(5)_____	0.24 dB	±0.063 dB
–24	–0.26 dB	(6)_____	0.26 dB	±0.064 dB
–28	–0.26 dB	(7)_____	0.26 dB	±0.064 dB
–32	–0.40 dB	(8)_____	0.40 dB	±0.064 dB
–36	–0.40 dB	(9)_____	0.40 dB	±0.064 dB
–40	–0.40 dB	(10)_____	0.40 dB	±0.063 dB
–44	–0.57 dB	(11)_____	0.57 dB	±0.064 dB
–48	–0.57 dB	(12)_____	0.57 dB	±0.064 dB
–52	–0.57 dB	(13)_____	0.57 dB	±0.089 dB
–56	–0.57 dB	(14)_____	0.57 dB	±0.089 dB
–60	–0.57 dB	(15)_____	0.57 dB	±0.088 dB
–64	–0.66 dB	(16)_____	0.66 dB	±0.089 dB
–68	–0.66 dB	(17)_____	0.66 dB	±0.089 dB
–72	–0.66 dB	(18)_____	0.66 dB	±0.089 dB
–76	–0.66 dB	(19)_____	0.66 dB	±0.089 dB
–80	–0.66 dB	(20)_____	0.66 dB	±0.088 dB
–84	–1.15 dB	(21)_____	1.15 dB	±0.089 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Incremental Log Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–0.4 dB	(22)_____	0.4 dB	±0.064 dB
–8	–0.4 dB	(23)_____	0.4 dB	±0.064 dB
–12	–0.4 dB	(24)_____	0.4 dB	±0.064 dB
–16	–0.4 dB	(25)_____	0.4 dB	±0.064 dB
–20	–0.4 dB	(26)_____	0.4 dB	±0.063 dB
–24	–0.4 dB	(27)_____	0.4 dB	±0.064 dB
–28	–0.4 dB	(28)_____	0.4 dB	±0.064 dB
–32	–0.4 dB	(29)_____	0.4 dB	±0.064 dB
–36	–0.4 dB	(30)_____	0.4 dB	±0.064 dB
–40	–0.4 dB	(31)_____	0.4 dB	±0.063 dB
–44	–0.4 dB	(32)_____	0.4 dB	±0.064 dB
–48	–0.4 dB	(33)_____	0.4 dB	±0.064 dB
–52	–0.4 dB	(34)_____	0.4 dB	±0.089 dB
–56	–0.4 dB	(35)_____	0.4 dB	±0.089 dB
–60	–0.4 dB	(36)_____	0.4 dB	±0.088 dB
–64	–0.4 dB	(37)_____	0.4 dB	±0.089 dB
–68	–0.4 dB	(38)_____	0.4 dB	±0.089 dB
–72	–0.4 dB	(39)_____	0.4 dB	±0.089 dB
–76	–0.4 dB	(40)_____	0.4 dB	±0.089 dB
–80	–0.4 dB	(41)_____	0.4 dB	±0.088 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Cumulative Log Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.34 dB	(43)_____	0.34 dB	±0.064 dB
–8	–0.38 dB	(44)_____	0.38 dB	±0.064 dB
–12	–0.42 dB	(45)_____	0.42 dB	±0.064 dB
–16	–0.46 dB	(46)_____	0.46 dB	±0.064 dB
–20	–0.50 dB	(47)_____	0.50 dB	±0.063 dB
–24	–0.54 dB	(48)_____	0.54 dB	±0.064 dB
–28	–0.58 dB	(49)_____	0.58 dB	±0.064 dB
–32	–0.62 dB	(50)_____	0.62 dB	±0.064 dB
–36	–0.66 dB	(51)_____	0.66 dB	±0.064 dB
–40	–0.70 dB	(52)_____	0.70 dB	±0.063 dB
–44	–0.74 dB	(53)_____	0.74 dB	±0.064 dB
–48	–0.78 dB	(54)_____	0.78 dB	±0.064 dB
–52	–0.82 dB	(55)_____	0.82 dB	±0.089 dB
–56	–0.86 dB	(56)_____	0.86 dB	±0.089 dB
–60	–0.90 dB	(57)_____	0.90 dB	±0.088 dB
–64	–0.94 dB	(58)_____	0.94 dB	±0.089 dB
–68	–0.98 dB	(59)_____	0.98 dB	±0.089 dB
–72	–1.02 dB	(60)_____	1.02 dB	±0.089 dB
–76	–1.06 dB	(61)_____	1.06 dB	±0.089 dB
–80	–1.10 dB	(62)_____	1.10 dB	±0.088 dB
–84	–1.14 dB	(63)_____	1.14 dB	±0.089 dB
–88	–1.18 dB	(64)_____	1.18 dB	±0.089 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–92	–1.22 dB	(65)_____	1.22 dB	±0.089 dB
–96	–1.26 dB	(66)_____	1.26 dB	±0.088 dB
–98	–1.28 dB	(67)_____	1.28 dB	±0.089 dB
Incremental Log Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.4 dB	(68)_____	0.4 dB	±0.064 dB
–8	–0.4 dB	(69)_____	0.4 dB	±0.064 dB
–12	–0.4 dB	(70)_____	0.4 dB	±0.064 dB
–16	–0.4 dB	(71)_____	0.4 dB	±0.064 dB
–20	–0.4 dB	(72)_____	0.4 dB	±0.063 dB
–24	–0.4 dB	(73)_____	0.4 dB	±0.064 dB
–28	–0.4 dB	(74)_____	0.4 dB	±0.064 dB
–32	–0.4 dB	(75)_____	0.4 dB	±0.064 dB
–36	–0.4 dB	(76)_____	0.4 dB	±0.064 dB
–40	–0.4 dB	(77)_____	0.4 dB	±0.063 dB
–44	–0.4 dB	(78)_____	0.4 dB	±0.064 dB
–48	–0.4 dB	(79)_____	0.4 dB	±0.064 dB
–52	–0.4 dB	(80)_____	0.4 dB	±0.089 dB
–56	–0.4 dB	(81)_____	0.4 dB	±0.089 dB
–60	–0.4 dB	(82)_____	0.4 dB	±0.088 dB
–64	–0.4 dB	(83)_____	0.4 dB	±0.089 dB
–68	–0.4 dB	(84)_____	0.4 dB	±0.089 dB
–72	–0.4 dB	(85)_____	0.4 dB	±0.089 dB
–76	–0.4 dB	(86)_____	0.4 dB	±0.089 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–80	–0.4 dB	(87)___	0.4 dB	±0.088 dB
Linear Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–2.0%	(89)_____	2.0%	±0.064%
–8	–2.0%	(90)_____	2.0%	±0.064%
–12	–2.0%	(91)_____	2.0%	±0.064%
–16	–2.0%	(92)_____	2.0%	±0.064%
–20	–2.0%	(93)_____	2.0%	±0.063%
Linear Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–2.0%	(94)_____	2.0%	±0.064%
–8	–2.0%	(95)_____	2.0%	±0.064%
–12	–2.0%	(96)_____	2.0%	±0.064%
–16	–2.0%	(97)_____	2.0%	±0.064%
–20	–2.0%	(98)_____	2.0%	±0.063%
Zero Span, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.36 dB	(99)_____	0.36 dB	±0.064 dB
–8	–0.42 dB	(100)_____	0.42 dB	±0.064 dB
–12	–0.48 dB	(101)_____	0.48 dB	±0.064 dB
–16	–0.54 dB	(102)_____	0.54 dB	±0.064 dB
–20	–0.60 dB	(103)_____	0.60 dB	±0.063 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies				
Model E4402B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
–24	–0.66 dB	(104)_____	0.66 dB	±0.064 dB
–28	–0.72 dB	(105)_____	0.72 dB	±0.064 dB
–32	–0.78 dB	(106)_____	0.78 dB	±0.064 dB
–36	–0.84 dB	(107)_____	0.84 dB	±0.064 dB
–40	–0.90 dB	(108)_____	0.90 dB	±0.063 dB
–44	–0.96 dB	(109)_____	0.96 dB	±0.064 dB
–48	–1.02 dB	(110)_____	1.02 dB	±0.064 dB
–52	–1.08 dB	(111)_____	1.08 dB	±0.089 dB
–56	–1.14 dB	(112)_____	1.14 dB	±0.089 dB
–60	–1.20 dB	(113)_____	1.20 dB	±0.088 dB
–64	–1.5 dB	(114)_____	1.5 dB	±0.089 dB
–68	–1.5 dB	(115)_____	1.5 dB	±0.089 dB
–70	–1.5 dB	(116)_____	1.5 dB	±0.089 dB
12. Input Attenuation Switching Uncertainty				
Input Attenuation Setting				
0 dB	–0.3 dB	(1)_____	0.3 dB	±0.108 dB
5 dB	–0.3 dB	(2)_____	0.3 dB	±0.107 dB
15 dB	–0.3 dB	(3)_____	0.3 dB	±0.107 dB
20 dB	–0.3 dB	(4)_____	0.3 dB	±0.089 dB
25 dB	–0.35 dB	(5)_____	0.35 dB	±0.089 dB
30 dB	–0.40 dB	(6)_____	0.40 dB	±0.089 dB
35 dB	–0.45 dB	(7)_____	0.45 dB	±0.089 dB
40 dB	–0.50 dB	(8)_____	0.50 dB	±0.089 dB
45 dB	–0.55 dB	(9)_____	0.55 dB	±0.089 dB
50 dB	–0.60 dB	(10)_____	0.60 dB	±0.089 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
55 dB	–0.65 dB	(11)_____	0.65 dB	±0.089 dB
60 dB	–0.70 dB	(12)_____	0.70 dB	±0.089 dB
65 dB	–0.75 dB	(13)_____	0.75 dB	±0.089 dB
14. Reference Level Accuracy				
Log, Res BW ≥1 kHz				
Reference Level				
–10	–0.3 dB	(1)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(2)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(3)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(4)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(5)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(6)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(7)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(8)_____	0.7 dB	±0.156 dB
Linear, Res BW ≥1 kHz				
Reference Level				
–10	–0.3 dB	(9)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(10)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(11)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(12)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(13)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(14)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(15)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(16)_____	0.7 dB	±0.156 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies				
Model E4402B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
Log, Res BW ≤300 Hz *(Option 1DR only)*				
Reference Level				
–10	–0.3 dB	(17)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(18)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(19)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(20)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(21)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(22)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(23)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(24)_____	0.7 dB	±0.156 dB
Linear, Res BW ≤300 Hz *(Option 1DR only)*				
Reference Level				
–10	–0.3 dB	(25)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(26)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(27)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(28)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(29)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(30)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(31)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(32)_____	0.7 dB	±0.156 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
15. Resolution Bandwidth Switching Uncertainty				
Resolution Bandwidth				
3 kHz	–0.3 dB	(1)_____	0.3 dB	±0.064 dB
9 kHz	–0.3 dB	(2)_____	0.3 dB	±0.064 dB
10 kHz	–0.3 dB	(3)_____	0.3 dB	±0.064 dB
30 kHz	–0.3 dB	(4)_____	0.3 dB	±0.064 dB
100 kHz	–0.3 dB	(5)_____	0.3 dB	±0.064 dB
120 kHz	–0.3 dB	(6)_____	0.3 dB	±0.064 dB
300 kHz	–0.3 dB	(7)_____	0.3 dB	±0.064 dB
1 MHz	–0.3 dB	(8)_____	0.3 dB	±0.064 dB
3 MHz	–0.3 dB	(9)_____	0.3 dB	±0.064 dB
5 MHz	–0.6 dB	(10)_____	0.6 dB	±0.083 dB
300 Hz *(Option 1DR only)*	–0.3 dB	(11)_____	0.3 dB	±0.064 dB
200 Hz *(Option 1DR only)*	–0.3 dB	(12)_____	0.3 dB	±0.064 dB
100 Hz *(Option 1DR only)*	–0.3 dB	(13)_____	0.3 dB	±0.064 dB
30 Hz *(Option 1DR only)*	–0.3 dB	(14)_____	0.3 dB	±0.064 dB
10 Hz *(Option 1DR only)*	–0.3 dB	(15)_____	0.3 dB	±0.064 dB
17. Absolute Amplitude Accuracy (Reference Settings)				
Log, Preamp Off	–0.34 dB	(1)_____	0.34 dB	±0.148 dB
Lin, Preamp Off	–0.34 dB	(2)_____	0.34 dB	±0.148 dB
Log, Preamp On	–0.37 dB	(3)_____	0.37 dB	±0.148 dB
Lin, Preamp On	–0.37 dB	(4)_____	0.37 dB	±0.148 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
19. Overall Absolute Amplitude Accuracy				
0 dBm Reference Level				
0 dBm input	–0.54 dB	(1)_____	0.54 dB	±0.08 dB
–10 dBm input	–0.54 dB	(2)_____	0.54 dB	±0.081 dB
–20 dBm input	–0.54 dB	(3)_____	0.54 dB	±0.082 dB
–30 dBm input	–0.54 dB	(4)_____	0.54 dB	±0.083 dB
–40 dBm input	–0.54 dB	(5)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(6)_____	0.54 dB	±0.086 dB
–20 dBm Reference Level				
–20 dBm input	–0.54 dB	(7)_____	0.54 dB	±0.082 dB
–30 dBm input	–0.54 dB	(8)_____	0.54 dB	±0.083 dB
–40 dBm input	–0.54 dB	(9)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(10)_____	0.54 dB	±0.086 dB
–40 dBm Reference Level				
–40 dBm input	–0.54 dB	(11)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(12)_____	0.54 dB	±0.086 dB
–50 dBm Reference Level				
–50 dBm input	–0.54 dB	(13)_____	0.54 dB	±0.086 dB
20. Resolution Bandwidth Accuracy				
Resolution Bandwidth				
5 MHz	3.5 MHz	(1)_____	6.5 MHz	±38.2 kHz
3 MHz	2.55 MHz	(2)_____	3.45 MHz	±22.9 kHz
1 MHz	0.85 MHz	(3)_____	1.15 MHz	±7.64 kHz
300 kHz	255 kHz	(4)_____	345 kHz	±2.29 kHz

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
100 kHz	85 kHz	(5)_____	115 kHz	±764 Hz
30 kHz	25.5 kHz	(6)_____	34.5 kHz	±229 Hz
10 kHz	8.5 kHz	(7)_____	11.5 kHz	±76.4 Hz
3 kHz	2.55 kHz	(8)_____	3.45 kHz	±22.9 Hz
1 kHz	850 Hz	(9)_____	1.15 kHz	±7.64 Hz
120 kHz	102 kHz	(10)_____	138 kHz	±154 Hz
9 kHz	7.65 kHz	(11)_____	10.35kHz	±11.5 Hz
22. Frequency Response	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed and installed options.			
20 to 30° C:				
Non-Option UKB dc Coupled Band 0 (9 kHz to 3.0 GHz)				
Maximum Response		(1)_____	0.46 dB	±0.245 dB
Minimum Response	–0.46 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	0.92 dB	±0.245 dB
Option UKB dc Coupled Band 0 (100 Hz to 3.0 GHz)				
Maximum Response		(1)_____	0.50 dB	±0.245 dB
Minimum Response	–0.50 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	1.0 dB	±0.245 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
dc Coupled Band 0A (800 MHz to 1.0 GHz) (serial number US39441006 or greater)				
Maximum Response		(4)_____	0.46 dB	±0.245 dB
Minimum Response	–0.46 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	0.92 dB	±0.245 dB
dc Coupled Band 0B (1.7 GHz to 2.0 GHz) (serial number US39441006 or greater)				
Maximum Response		(7)_____	0.46 dB	±0.245 dB
Minimum Response	–0.46 dB	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	0.92 dB	±0.245 dB
Option UKB ac Coupled Band 0 (100 kHz to 3.0 GHz)				
Maximum Response		(10)_____	0.50 dB	±0.245 dB
Minimum Response	–0.50 dB	(11)_____		±0.245 dB
Peak-to-Peak Response		(12)_____	1.0 dB	±0.245 dB
Option UKB ac Coupled Band 0A (800 MHz to 1.0 GHz)				
Maximum Response		(13)_____	0.50 dB	±0.245 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Minimum Response	–0.50 dB	(14)_____		±0.245 dB
Peak-to-Peak Response		(15)_____	1.0 dB	±0.245 dB
Option UKB ac Coupled Band 0B (1.7 GHz to 2.0 GHz)				
Maximum Response		(16)_____	0.50 dB	±0.245 dB
Minimum Response	–0.50 dB	(17)_____		±0.245 dB
Peak-to-Peak Response		(18)_____	1.0 dB	±0.245 dB
0 to 55° C: Non-Option UKB dc Coupled Band 0 (9 kHz to 3.0 GHz)				
Maximum Response		(1)_____	0.76 dB	±0.245 dB
Minimum Response	–0.76 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	1.52 dB	±0.245 dB
Option UKB dc coupled Band 0 (100 Hz to 3.0 GHz)				
Maximum Response		(1)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	2.0 dB	±0.245 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
dc Coupled Band 0A (800 MHz to 1.0 GHz) (serial number US39441006 or greater)				
Maximum Response		(4)_____	0.76 dB	±0.245 dB
Minimum Response	–0.76 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	1.52 dB	±0.245 dB
dc Coupled Band 0B (1.7 GHz to 2.0 GHz) (serial number US39441006 or greater)				
Maximum Response		(7)_____	0.76 dB	±0.245 dB
Minimum Response	–0.76 dB	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	1.52 dB	±0.245 dB
Option UKB ac Coupled Band 0 (100 kHz to 3.0 GHz)				
Maximum Response		(10)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(11)_____		±0.245 dB
Peak-to-Peak Response		(12)_____	2.0 dB	±0.245 dB
Option UKB ac Coupled Band 0A (800 MHz to 1.0 GHz)				
Maximum Response		(13)_____	0.54 dB	±0.245 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Minimum Response	–1.0 dB	(14)_____		±0.245 dB
Peak-to-Peak Response		(15)_____	2.0 dB	±0.245 dB
Option UKB ac Coupled Band 0B (1.7 GHz to 2.0 GHz)				
Maximum Response		(16)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(17)_____		±0.245 dB
Peak-to-Peak Response		(18)_____	2.0 dB	±0.245 dB
26. Frequency Response (Preamp On) *(Option 1DS Only)*	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed and installed options.			
20 to 30° C:				
Band 0 (1 MHz to 3.0 GHz)				
Maximum Response		(1)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	3.0 dB	±0.245 dB
Band 0A (800 MHz to 1.0 GHz) (serial number US39441006 or greater)				
Maximum Response		(4)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	3.0 dB	±0.245 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Band 0B (1.7 GHz to 2.0 GHz) (serial number US39441006 or greater)				
Maximum Response		(7)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	3.0 dB	±0.245 dB
0 to 55° C:				
Band 0 (1 MHz to 3.0 GHz)				
Maximum Response		(1)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	4.0 dB	±0.245 dB
Band 0A (800 MHz to 1.0 GHz) (serial number US39441006 or greater)				
Maximum Response		(4)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	4.0 dB	±0.245 dB
Band 0B (1.7 GHz to 2.0 GHz) (serial number US39441006 or greater)				
Maximum Response		(7)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	4.0 dB	±0.245 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
28. Other Input Related Spurious Responses				
Input Frequency				
2042.8 MHz		(1)_____	–65 dBc	±1.14 dB
2642.8 MHz		(2)_____	–65 dBc	±1.14 dB
1820.8 MHz		(3)_____	–65 dBc	±1.14 dB
278.5 MHz		(4)_____	–65 dBc	±1.14 dB
30. Spurious Responses				
300 MHz TOI, 1 kHz RBW	11 dBm	(1)_____		±0.49 dB
300 MHz TOI, 30 Hz RBW *(Option 1DR only)*	11 dBm	(2)_____		±0.49 dB
300 MHz SHI	35 dBm	(3)_____		±0.90 dB
900 MHz SHI	45 dBm	(4)_____		±0.90 dB
33. Gain Compression				
Test Frequency				
53 MHz		(1)_____	1.0 dB	±0.127 dB
50.004 MHz *(Option 1DR only)*		(2)_____	1.0 dB	±0.127 dB
1403 MHz		(3)_____	1.0 dB	±0.127 dB
2503 MHz		(4)_____	1.0 dB	±0.144 dB
35. Displayed Average Noise Level	Note: Enter results with preamp on in the appropriate section based upon the ambient temperature when the test was performed.			
1 kHz RBW, Preamp Off:				
10 MHz to 1 GHz		(1)_____	–117 dBm	±1.82 dB
1 GHz to 2 GHz		(2)_____	–116 dBm	±1.82 dB
2 GHz to 3 GHz		(3)_____	–114 dBm	±1.82 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies				
Model E4402B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
1kHz RBW, Preamp On, 0 to 55° C:				
10 MHz to 1 GHz		(4)_____	–132 dBm	±1.82 dB
1 GHz to 2 GHz		(5)_____	–132 dBm	±1.82 dB
2 GHz to 3 GHz		(6)_____	–129 dBm	±1.82 dB
10 Hz RBW, Preamp Off:				
10 MHz to 1 GHz		(7)_____	–136 dBm	±1.82 dB
1 GHz to 2 GHz		(8)_____	–135 dBm	±1.82 dB
2 GHz to 3 GHz		(9)_____	–133 dBm	±1.82 dB
10 Hz RBW, Preamp On, 0 to 55° C:				
10 MHz to 1 GHz		(10)_____	–151 dBm	±1.82 dB
1 GHz to 2 GHz		(11)_____	–151 dBm	±1.82 dB
2 GHz to 3 GHz		(12)_____	–148 dBm	±1.82 dB
1kHz RBW, Preamp On, 20 to 30° C:				
10 MHz to 1 GHz		(13)_____	–133 dBm	±1.82 dB
1 GHz to 2 GHz		(14)_____	–134 dBm	±1.82 dB
2 GHz to 3 GHz		(15)_____	–132 dBm	±1.82 dB
10 Hz RBW, Preamp On, 20 to 30° C:				
10 MHz to 1 GHz		(16)_____	–152 dBm	±1.82 dB
1 GHz to 2 GHz		(17)_____	–152 dBm	±1.82 dB
2 GHz to 3 GHz		(18)_____	–151 dBm	±1.82 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies				
Model E4402B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
38. Residual Responses				
150 kHz to 3.0 GHz		(1)_____	–90 dBm	±0.93 dB
39. Fast Time Domain Amplitude Accuracy *(Option AYX only)*				
Amplitude Error	–0.3%	(1)_____	0.3%	±0.029%
41. Tracking Generator Absolute Amplitude and Vernier Accuracy				
Absolute Amplitude Accuracy	–0.75 dB	(1)_____	0.75 dB	±0.087 dB
Vernier Accuracy, –2 dB	–0.4 dB	(2)_____	0.4 dB	±0.11 dB
Vernier Accuracy, –3 dB	–0.5 dB	(3)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –5 dB	–0.5 dB	(4)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –6 dB	–0.5 dB	(5)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –7 dB	–0.5 dB	(6)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –8 dB	–0.5 dB	(7)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –9 dB	–0.5 dB	(8)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –10 dB	–0.5 dB	(9)_____	0.5 dB	±0.16 dB
43. Tracking Generator Level Flatness				
Positive Level Flatness, <1 MHz		(1)_____	3.0 dB	±0.255 dB
Negative Level Flatness, <1 MHz	–3.0 dB	(2)_____		±0.255 dB
Positive Level Flatness, 1 MHz to 10 MHz		(3)_____	3.0 dB	±0.145 dB
Negative Level Flatness, 1 MHz to 10 MHz	–3.0 dB	(4)_____		±0.145 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Positive Level Flatness, >10 MHz to 1.5 GHz		(5)_____	2.0 dB	±0.122 dB
Negative Level Flatness, >10 MHz to 1.5 GHz	–2.0 dB	(6)_____		±0.122 dB
Positive Level Flatness, >1.5 GHz		(7)_____	2.0 dB	±0.172 dB
Negative Level Flatness, >1.5 GHz	–2.0 dB	(8)_____		±0.172 dB
45. Tracking Generator Harmonic Spurious Outputs *(Option 1DN only)*				
2nd Harmonic, <20 kHz		(1)_____	–15 dBc	±2.6 dB
2nd Harmonic, ≥20 kHz		(2)_____	–25 dBc	±2.6 dB
3rd Harmonic, <20 kHz		(3)_____	–15 dBc	±2.6 dB
3rd Harmonic, ≥20 kHz		(4)_____	–25 dBc	±2.6 dB
47. Tracking Generator Non-Harmonic Spurious Outputs *(Option 1DN only)*				
Highest Non-Harmonic Spurious Output Amplitude, 9 kHz to 2 GHz		(1)_____	–27 dBc	±2.67 dB
Highest Non-Harmonic Spurious Output Amplitude, 2 GHz to 3 GHz		(2)_____	–23 dBc	±3.12 dB

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
48. Tracking Generator LO Feedthrough Amplitude *(Option 1DN only)*				
9 kHz to 2.9 GHz		(1)_____	–16 dBm	±1.94 dB
2.9 GHz to 3.0 GHz		(2)_____	–16 dBm	±2.49 dB
49. Gate Delay Accuracy and Gate Length Accuracy *(Option 1D6 only)*				
Minimum Gate Delay	499.9 ns	(1)_____	1.5001 µs	±475 ps
Maximum Gate Delay	499.9 ns	(2)_____	1.5001 µs	±475 ps
1 µs Gate Length	499.9 ns	(3)_____	1.5001 µs	±450 ps
65 ms Gate Length	64.993 ms	(4)_____	65.007 ms	±561 ns
50. Gate Mode Amplitude Error *(Option 1D6 only)*				
Amplitude Error	–0.2 dB	(1)_____	0.2 dB	±0.023 dB
55. cdmaOne Modulation Accuracy (Rho) *(Option BAC only)*	–0.0015 dB	(1)_____	0.0015 dB	0.00010 dB
56. cdmaOne Modulation Accuracy - EVM *(Option BAC only)*	–1.1%	(1)_____	+1.1%	0.12%
57. cdmaOne Code Domain Power *(Option BAC only)*	–0.20 dB	(1)_____	0.20 dB	
58. GSM Phase and Frequency Accuracy *(Option BAH and B7E)*				

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Peak	–2.1 Deg	(1)_____	2.1 Deg	0.24 Deg
RMS (Avg >10)	–1.1 Deg	(2)_____	2.1 Deg	0.24 Deg
59. Comms Absolute Accuracy *(Options BAC or BAH)*				
cdmaOne *(Option BAC only)*				
Channel Power Accuracy (Option BAC only)				
Cellular Bands				
30 dBm to –5 dBm				
20 to 30° C	–0.78 dB	(1)_____	0.78 dB	±0.19 dB
–5 dBm to –25 dBm				
20 to 30° C	–0.72 dB	(2)_____	0.72 dB	±0.19 dB
–25 dBm to –45 dBm				
20 to 30° C	–0.63 dB	(3)_____	0.63 dB	±0.19 dB
–45 dBm to –55 dBm				
20 to 30° C	–0.70 dB	(4)_____	0.70 dB	±0.19 dB
–55 dBm to –70 dBm				
20 to 30° C	–0.82 dB	(5)_____	0.82 dB	±0.19 dB
PCS Bands				
–30 dBm to –5 dBm				
20 to 30° C	–0.67 dB[a]	(6)_____	0.67 dB[b]	±0.19 dB
–5 dBm to –25 dBm				
20 to 30° C	–0.63 dB[a]	(7)_____	0.63 dB[b]	±0.19 dB
–25 dBm to –45 dBm				

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
20 to 30° C	–0.63 dB[a]	(8)_____	0.63 dB[b]	±0.19 dB
–45 dBm to –55 dBm				
20 to 30° C	–0.70 dB[a]	(9)_____	0.70 dB[b]	±0.19 dB
–55 dBm to –70 dBm				
20 to 30° C	–0.82 dB[a]	(10)_____	0.82 dB[b]	±0.19 dB
Receive Channel Power Accuracy				
Preamp Off				
Cellular Band				
30 to 0 dBm	-0.98 dB	(11)_____	0.98 dB	0.24 dB
0 to –85 dBm	-2.02 dB	(12)_____	2.02 dB	0.24 dB
PCS Bands				
30 to 0 dBm	-1.00 dB[a]	(13)_____	1.0 dB[b]	0.24 dB
0 to –85 dBm	-1.52 dB[a]	(14)_____	1.52 dB[b]	0.24 dB
Preamp On				
Cellular and PCS Band				
30 to –80 dBm	-2.45 dB	(15)_____	2.45 dB	0.24 dB
–80 to –100 dBm	-3.20 dB	(16)_____	3.20 dB	0.24 dB
P-GSM, E-GSM, and R-GSM Bands				
Transmit Power Accuracy				
Cellular Bands				
30 dBm to –20 dBm				
20 to 30° C	–0.89 dB	(17)_____	0.89 dB	±0.19 dB
–20 dBm to –30 dBm				

Table 3-4 E4402B Performance Verification Test Record

Agilent Technologies

Model E4402B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
20 to 30° C	–0.82 dB	(18)_____	0.82 dB	±0.19 dB
–30 dBm to –40 dBm				
20 to 30° C	–0.87 dB	(19)_____	0.87 dB	±0.19 dB
–40 dBm to –50 dBm				
20 to 30° C	–1.06 dB	(20)_____	1.06 dB	±0.19 dB
–50 dBm to –60 dBm				
20 to 30° C	–1.19 dB	(21)_____	1.19 dB	±0.19 dB
DCS 1800 and PCS 1900 Bands				
30 dBm to –20 dBm				
20 to 30° C	–0.76 dB[a]	(22)_____	0.76 dB[b]	±0.19 dB
–20 dBm to –30 dBm				
20 to 30° C	–0.66 dB[a]	(23)_____	0.66 dB[b]	±0.19 dB
–30 dBm to –40 dBm				
20 to 30° C	–0.71 dB[a]	(24)_____	0.71 dB[b]	±0.19 dB
–40 dBm to –50 dBm				
20 to 30° C	–0.90 dB[a]	(25)_____	0.90 dB[b]	±0.19 dB
–50 dBm to –60 dBm				
20 to 30° C	–1.03 dB[a]	(26)_____	1.03 dB[b]	±0.19 dB

a. Subtract 0.1 dB if analyzer is equipped with Option UKB.
b. Add 0.1 dB if analyzer is equipped with Option UKB.

Agilent E4403B Performance Verification Test Record

Only the tests for E4403B are included in this test record, therefore not all test numbers are included.

Table 3-5 E4403B Performance Verification Test Record

Agilent Technologies

Address: _____ Report No. _____

_____ Date _____

_____

Model E4403B

Serial No. _____ Ambient temperature _____° C

Options _____ Power mains line frequency _____ Hz (nominal)

Firmware Revision _____ Relative humidity _____%

Customer _____ Tested by _____

Test Equipment Used:

Description	Model No.	Trace No.	Cal Due Date
Synthesized Signal Generator	_____	_____	_____
Synthesized Sweeper	_____	_____	_____
Function Generator	_____	_____	_____
Power Meter, Dual-Channel	_____	_____	_____
RF Power Sensor #1	_____	_____	_____
RF Power Sensor #2	_____	_____	_____
Low-Power Power Sensor	_____	_____	_____
Digital Multimeter	_____	_____	_____
Universal Counter	_____	_____	_____
Frequency Standard	_____	_____	_____
Power Splitter	_____	_____	_____
50 Ω Termination	_____	_____	_____
1 dB Step Attenuator	_____	_____	_____
10 dB Step Attenuator	_____	_____	_____

Table 3-5 E4403B Performance Verification Test Record

6 dB Fixed Attenuator	_____	_____	_____
Microwave Spectrum Analyzer *(Option 1DN only)*	_____	_____	_____
Notes/comments:	_____		

Table 3-6 E4403B Performance Verification Test Record

Agilent Technologies

Model E4403B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
1. 10 MHz Reference Output Accuracy				
Settability	–5.0 Hz	(1)_____	5.0 Hz	±293.3 μHz
3. Frequency Readout Accuracy and Marker Count Accuracy				
Frequency Readout Accuracy				
Center Freq Span				
1500 MHz 20 MHz	1499.83 MHz	(1)_____	1500.17 MHz	±0 Hz
1500 MHz 10 MHz	1499.91 MHz	(2)_____	1500.09 MHz	±0 Hz
1500 MHz 1 MHz	1499.991 MHz	(3)_____	1500.009 MHz	±0 Hz
Marker Count Accuracy				
Center Freq Span				
1500 MHz 10 MHz	1499.999999 MHz	(4)_____	1500.000001 MHz	±0 Hz
1500 MHz 1 MHz	1499.999999 MHz	(5)_____	1500.000001 MHz	±0 Hz

Table 3-6 E4403B Performance Verification Test Record

Agilent Technologies

Model E4403B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
6. Frequency Span Readout Accuracy				
Span Start Freq				
3000 MHz 0 Hz	2370 MHz	(1)_____	2430 MHz	±6.12 MHz
100 MHz 10 MHz	79 MHz	(2)_____	81 MHz	±204 kHz
100 kHz 10 MHz	79 kHz	(3)_____	81 kHz	±204 Hz
100 MHz 800 MHz	79 MHz	(4)_____	81 MHz	±204 kHz
100 kHz 800 MHz	79 kHz	(5)_____	81 kHz	±204 Hz
100 MHz 1400 MHz	79 MHz	(6)_____	81 MHz	±204 kHz
100 kHz 1499 MHz	79 kHz	(7)_____	81 kHz	±204 Hz
7. Noise Sidebands				
Offset from 1 GHz signal				
10 kHz		(1)_____	–90 dBc/Hz	±1.154 dB
20 kHz		(2)_____	–100 dBc/Hz	±1.154 dB
30 kHz		(3)_____	–106 dBc/Hz	±1.154 dB
100 kHz		(4)_____	–119 dBc/Hz	±1.154 dB
8. System Related Sidebands				
Offset from 500 MHz signal				
30 kHz to 230 kHz		(1)_____	–65 dBc	±1.154 dB
–30 kHz to –230 kHz		(2)_____	–65 dBc	±1.154 dB
9. Residual FM				
1 kHz Res BW		(1)_____	150 Hz	±9.24 Hz

Table 3-6 E4403B Performance Verification Test Record

Agilent Technologies

Model E4403B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
10. Sweep Time Accuracy				
Sweep Time				
5 ms	–1.0%	(1)_____	1.0%	±0.28%
20 ms	–1.0%	(2)_____	1.0%	±0.28%
100 ms	–1.0%	(3)_____	1.0%	±0.28%
1 s	–1.0%	(4)_____	1.0%	±0.28%
10 s	–1.0%	(5)_____	1.0%	±0.28%
10 s	–1.0%	(5)_____	1.0%	±0.28%
11. Display Scale Fidelity				
Cumulative Log Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–0.34 dB	(1)_____	0.34 dB	±0.064 dB
–8	–0.38 dB	(2)_____	0.38 dB	±0.064 dB
–12	–0.42 dB	(3)_____	0.42 dB	±0.064 dB
–16	–0.46 dB	(4)_____	0.46 dB	±0.064 dB
–20	–0.50 dB	(5)_____	0.50 dB	±0.063 dB
–24	–0.54 dB	(6)_____	0.54 dB	±0.064 dB
–28	–0.58 dB	(7)_____	0.58 dB	±0.064 dB
–32	–0.62 dB	(8)_____	0.62 dB	±0.064 dB
–36	–0.66 dB	(9)_____	0.66 dB	±0.064 dB
–40	–0.70 dB	(10)_____	0.70 dB	±0.063 dB
–44	–0.74 dB	(11)_____	0.74 dB	±0.064 dB
–48	–0.78 dB	(12)_____	0.78 dB	±0.064 dB
–52	–0.82 dB	(13)_____	0.82 dB	±0.089 dB
–56	–0.86 dB	(14)_____	0.86 dB	±0.089 dB

Table 3-6 E4403B Performance Verification Test Record

Agilent Technologies

Model E4403B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–60	–0.90 dB	(15)_____	0.90 dB	±0.088 dB
–64	–0.94 dB	(16)_____	0.94 dB	±0.089 dB
–68	–0.98 dB	(17)_____	0.98 dB	±0.089 dB
–72	–1.02 dB	(18)_____	1.02 dB	±0.089 dB
–76	–1.06 dB	(19)_____	1.06 dB	±0.089 dB
–80	–1.10 dB	(20)_____	1.10 dB	±0.088 dB
–84	–1.14 dB	(21)_____	1.14 dB	±0.089 dB
Incremental Log Fidelity, Res BW ≥1 kHz				
–4	–0.4 dB	(22)_____	0.4 dB	±0.064 dB
–8	–0.4 dB	(23)_____	0.4 dB	±0.064 dB
–12	–0.4 dB	(24)_____	0.4 dB	±0.064 dB
–16	–0.4 dB	(25)_____	0.4 dB	±0.064 dB
–20	–0.4 dB	(26)_____	0.4 dB	±0.063 dB
–24	–0.4 dB	(27)_____	0.4 dB	±0.064 dB
–28	–0.4 dB	(28)_____	0.4 dB	±0.064 dB
–32	–0.4 dB	(29)_____	0.4 dB	±0.064 dB
–36	–0.4 dB	(30)_____	0.4 dB	±0.064 dB
–40	–0.4 dB	(31)_____	0.4 dB	±0.063 dB
–44	–0.4 dB	(32)_____	0.4 dB	±0.064 dB
–48	–0.4 dB	(33)_____	0.4 dB	±0.064 dB
–52	–0.4 dB	(34)_____	0.4 dB	±0.089 dB
–56	–0.4 dB	(35)_____	0.4 dB	±0.089 dB
–60	–0.4 dB	(36)_____	0.4 dB	±0.088 dB
–64	–0.4 dB	(37)_____	0.4 dB	±0.089 dB

Table 3-6 E4403B Performance Verification Test Record

Agilent Technologies				
Model E4403B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
–68	–0.4 dB	(38)_____	0.4 dB	±0.089 dB
–72	–0.4 dB	(39)_____	0.4 dB	±0.089 dB
–76	–0.4 dB	(40)_____	0.4 dB	±0.089 dB
–80	–0.4 dB	(41)_____	0.4 dB	±0.088 dB
Linear Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–2.0%	(89)_____	2.0%	±0.064%
–8	–2.0%	(90)_____	2.0%	±0.064%
–12	–2.0%	(91)_____	2.0%	±0.064%
–16	–2.0%	(92)_____	2.0%	±0.064%
–20	–2.0%	(93)_____	2.0%	±0.063%
12. Input Attenuation Switching Uncertainty				
Input Attenuation Setting				
0 dB	–0.3 dB	(1)_____	0.3 dB	±0.108 dB
5 dB	–0.3 dB	(2)_____	0.3 dB	±0.107 dB
15 dB	–0.3 dB	(3)_____	0.3 dB	±0.107 dB
20 dB	–0.3 dB	(4)_____	0.3 dB	±0.089 dB
25 dB	–0.35 dB	(5)_____	0.35 dB	±0.089 dB
30 dB	–0.40 dB	(6)_____	0.40 dB	±0.089 dB
35 dB	–0.45 dB	(7)_____	0.45 dB	±0.089 dB
40 dB	–0.50 dB	(8)_____	0.50 dB	±0.089 dB
45 dB	–0.55 dB	(9)_____	0.55 dB	±0.089 dB
50 dB	–0.60 dB	(10)_____	0.60 dB	±0.089 dB
55 dB	–0.65 dB	(11)_____	0.65 dB	±0.089 dB

Table 3-6 E4403B Performance Verification Test Record

Agilent Technologies

Model E4403B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
60 dB	–0.70 dB	(12)_____	0.70 dB	±0.089 dB
65 dB	–0.75 dB	(13)_____	0.75 dB	±0.089 dB
13. Reference Level Accuracy				
Log				
Reference Level				
–10	–0.3 dB	(1)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(2)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(3)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(4)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(5)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(6)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(7)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(8)_____	0.7 dB	±0.156 dB
Linear				
Reference Level				
–10	–0.3 dB	(9)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(10)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(11)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(12)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(13)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(14)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(15)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(16)_____	0.7 dB	±0.156 dB

Table 3-6 E4403B Performance Verification Test Record

Agilent Technologies

Model E4403B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
15. Resolution Bandwidth Switching Uncertainty				
Resolution Bandwidth				
3 kHz	–0.3 dB	(1)_____	0.3 dB	±0.064 dB
9 kHz	–0.3 dB	(2)_____	0.3 dB	±0.064 dB
10 kHz	–0.3 dB	(3)_____	0.3 dB	±0.064 dB
30 kHz	–0.3 dB	(4)_____	0.3 dB	±0.064 dB
100 kHz	–0.3 dB	(5)_____	0.3 dB	±0.064 dB
120 kHz	–0.3 dB	(6)_____	0.3 dB	±0.064 dB
300 kHz	–0.3 dB	(7)_____	0.3 dB	±0.064 dB
1 MHz	–0.3 dB	(8)_____	0.3 dB	±0.064 dB
3 MHz	–0.3 dB	(9)_____	0.3 dB	±0.064 dB
5 MHz	–0.6 dB	(10)_____	0.6 dB	±0.083 dB
17. Absolute Amplitude Accuracy (Reference Settings)				
Log, Preamp Off	–0.4 dB	(1)_____	0.4 dB	±0.148 dB
Lin, Preamp Off	–0.4 dB	(2)_____	0.4 dB	±±0.148 dB
19. Overall Absolute Amplitude Accuracy				
0 dBm Reference Level				
0 dBm input	–0.6 dB	(1)_____	0.6 dB	±0.08 dB
–10 dBm input	–0.6 dB	(2)_____	0.6 dB	±0.081 dB
–20 dBm input	–0.6 dB	(3)_____	0.6 dB	±0.082 dB
–30 dBm input	–0.6 dB	(4)_____	0.6 dB	±0.083 dB
–40 dBm input	–0.6 dB	(5)_____	0.6 dB	±0.084 dB
–50 dBm input	–0.6 dB	(6)_____	0.6 dB	±0.086 dB

Table 3-6 E4403B Performance Verification Test Record

Agilent Technologies

Model E4403B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–20 dBm Reference Level				
–20 dBm input	–0.6 dB	(7)_____	0.6 dB	±0.082 dB
–30 dBm input	–0.6 dB	(8)_____	0.6 dB	±0.083 dB
–40 dBm input	–0.6 dB	(9)_____	0.6 dB	±0.084 dB
–50 dBm input	–0.6 dB	(10)_____	0.6 dB	±0.086 dB
–40 dBm Reference Level				
–40 dBm input	–0.6 dB	(11)_____	0.6 dB	±0.084 dB
–50 dBm input	–0.6 dB	(12)_____	0.6 dB	±0.086 dB
–50 dBm Reference Level				
–50 dBm input	–0.6 dB	(13)_____	0.6 dB	±0.086 dB
20. Resolution Bandwidth Accuracy				
Resolution Bandwidth				
5 MHz	3.5 MHz	(1)_____	6.5 MHz	±38.2 kHz
3 MHz	2.55 MHz	(2)_____	3.45 MHz	±22.9 kHz
1 MHz	0.85 MHz	(3)_____	1.15 MHz	±7.64 kHz
300 kHz	255 kHz	(4)_____	345 kHz	±2.29 kHz
100 kHz	85 kHz	(5)_____	115 kHz	±764 Hz
30 kHz	25.5 kHz	(6)_____	34.5 kHz	±229 Hz
10 kHz	8.5 kHz	(7)_____	11.5 kHz	±76.4 Hz
3 kHz	2.55 kHz	(8)_____	3.45 kHz	±22.9 Hz
1 kHz	850 Hz	(9)_____	1.15 kHz	±7.64 Hz
120 kHz	102 kHz	(10)_____	138 kHz	±154 Hz
9 kHz	7.65 kHz	(11)_____	10.35kHz	±11.5 Hz

Table 3-6 E4403B Performance Verification Test Record

Agilent Technologies				
Model E4403B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
22. Frequency Response	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed.			
20 to 30° C:				
Maximum Response		(1)_____	0.5 dB	±0.245 dB
Minimum Response	–0.5 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	1.0 dB	±0.245 dB
0 to 55° C:				
Maximum Response		(1)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	2.0 dB	±0.245 dB
28. Other Input Related Spurious Responses				
Input Frequency				
2042.8 MHz		(1)_____	–65 dBc	±1.14 dB
2642.8 MHz		(2)_____	–65 dBc	±1.14 dB
1820.8 MHz		(3)_____	–65 dBc	±1.14 dB
278.5 MHz		(4)_____	–65 dBc	±1.14 dB
31. Spurious Responses				
300 MHz TOI	7.5 dBm	(1)_____		±0.49 dB
300 MHz SHI	30 dBm	(3)_____		±0.90 dB
900 MHz SHI	40 dBm	(4)_____		±0.90 dB
33. Gain Compression				
Test Frequency				
53 MHz		(1)_____	1.0 dB	±0.127 dB
1403 MHz		(3)_____	1.0 dB	±0.127 dB
2503 MHz		(4)_____	1.0 dB	±0.144 dB

Table 3-6 E4403B Performance Verification Test Record

Agilent Technologies

Model E4403B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
35. Displayed Average Noise Level				
10 MHz to 1 GHz		(1)_____	–117 dBm	±1.82 dB
1 GHz to 2 GHz		(2)_____	–116 dBm	±1.82 dB
2 GHz to 3 GHz		(3)_____	–114 dBm	±1.82 dB
38. Residual Responses				
150 kHz to 3.0 GHz		(1)_____	–90 dBm	±0.93 dB
39. Fast Time Domain Amplitude Accuracy *(Option AYX only)*				
Amplitude Error	–0.3%	(1)_____	0.3%	±0.029%
41. Tracking Generator Absolute Amplitude and Vernier Accuracy				
Absolute Amplitude Accuracy	–0.75 dB	(1)_____	0.75 dB	±0.087 dB
Vernier Accuracy, –2 dB	–0.4 dB	(2)_____	0.4 dB	±0.11 dB
Vernier Accuracy, –3 dB	–0.5 dB	(3)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –5 dB	–0.5 dB	(4)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –6 dB	–0.5 dB	(5)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –7 dB	–0.5 dB	(6)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –8 dB	–0.5 dB	(7)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –9 dB	–0.5 dB	(8)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –10 dB	–0.5 dB	(9)_____	0.5 dB	±0.16 dB

Table 3-6 E4403B Performance Verification Test Record

Agilent Technologies				
Model E4403B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
43. Tracking Generator Level Flatness				
Positive Level Flatness, <1 MHz		(1)_____	3.0 dB	±0.255 dB
Negative Level Flatness, <1 MHz	–3.0 dB	(2)_____		±0.255 dB
Positive Level Flatness, 1 MHz to 10 MHz		(3)_____	3.0 dB	±0.145 dB
Negative Level Flatness, 1 MHz to 10 MHz	–3.0 dB	(4)_____		±0.145 dB
Positive Level Flatness, >10 MHz to 1.5 GHz		(5)_____	2.0 dB	±0.122 dB
Negative Level Flatness, >10 MHz to 1.5 GHz	–2.0 dB	(6)_____		±0.122 dB
Positive Level Flatness, >1.5 GHz		(7)_____	2.0 dB	±0.172 dB
Negative Level Flatness, >1.5 GHz	–2.0 dB	(8)_____		±0.172 dB
47. Tracking Generator Harmonic Spurious Outputs *(Option 1DN only)*				
2nd Harmonic, <20 kHz		(1)_____	–15 dBc	±2.6 dB
2nd Harmonic, ≥20 kHz		(2)_____	–25 dBc	±2.6 dB
3rd Harmonic, <20 kHz		(3)_____	–15 dBc	±2.6 dB
3rd Harmonic, ≥20 kHz		(4)_____	–25 dBc	±2.6 dB

Table 3-6 E4403B Performance Verification Test Record

Agilent Technologies

Model E4403B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
49. Tracking Generator Non-Harmonic Spurious Outputs *(Option 1DN only)*				
Highest Non-Harmonic Spurious Output Amplitude, 9 kHz to 2 GHz		(1)_____	–27 dBc	±2.67 dB
Highest Non-Harmonic Spurious Output Amplitude, 2 GHz to 3 GHz		(2)_____	–23 dBc	±3.12 dB
50. Tracking Generator LO Feedthrough Amplitude *(Option 1DN only)*				
9 kHz to 2.9 GHz		(1)_____	–16 dBm	±1.94 dB
2.9 GHz to 3.0 GHz		(2)_____	–16 dBm	±2.49 dB

Agilent E4404B Performance Verification Test Record

Only the tests for E4404B are included in this test record, therefore not all test numbers are included.

Table 3-7 E4404B Performance Verification Test Record

Agilent Technologies

Address: _____ Report No. _____

_____ Date _____

_____

Model E4404B

Serial No. _____ Ambient temperature _____° C

Options _____ Power mains line frequency _____ Hz (nominal)

Firmware Revision _____ Relative humidity _____%

Customer _____ Tested by _____

Test Equipment Used:

Description	Model No.	Trace No.	Cal Due Date
Synthesized Signal Generator			
Synthesized Sweeper #1			
Synthesized Sweeper #2			
Function Generator			
Power Meter, Dual-Channel			
RF Power Sensor #1			
RF Power Sensor #2			
Microwave Power Sensor			
Low-Power Power Sensor			
Digital Multimeter			
Universal Counter			
Frequency Standard			
Power Splitter			
50 Ω Termination			

Table 3-7 E4404B Performance Verification Test Record

1 dB Step Attenuator	_____	_____	_____
10 dB Step Attenuator	_____	_____	_____
6 dB Fixed Attenuator	_____	_____	_____
20 dB Fixed Attenuator *(Option 1DS only)*	_____	_____	_____
Oscilloscope *(Option 1D6 only)*	_____	_____	_____
Microwave Spectrum Analyzer *(Option 1DN only)*	_____	_____	_____
Notes/comments:	_____		

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description		**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
1.	**10 MHz Reference Accuracy** (*Non-Option 1D5 only*)				
	Settability	–5.0 Hz	(1)_____	5.0 Hz	±293.3 μHz
2.	**10 MHz Precision Frequency Reference Output Accuracy** (*Option 1D5 only*)				
	5 Minute Warm-Up Error	–0.1 ppm	(1)_____	0.1 ppm	±0.000072 ppm
	15 Minute Warm-Up Error	–0.01 ppm	(2)_____	0.01 ppm	±0.000070 ppm
4.	**Frequency Readout Accuracy and Marker Count Accuracy**				
	Frequency Readout Accuracy				
	Center Freq Span				
	1500 MHz 20 MHz	1499.83 MHz	(1)_____	1500.17 MHz	±0 Hz
	1500 MHz 10 MHz	1499.91 MHz	(2)_____	1500.09 MHz	±0 Hz

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description		Minimum	Results Measured	Maximum	Measurement Uncertainty
1500 MHz	1 MHz	1499.991 MHz	(3)_____	1500.009 MHz	±0 Hz
4000 MHz	20 MHz	3999.83 MHz	(4)_____	4000.17 MHz	±0 Hz
4000 MHz	10 MHz	3999.91 MHz	(5)_____	4000.09 MHz	±0 Hz
4000 MHz	1 MHz	3999.991 MHz	(6)_____	4000.009 MHz	±0 Hz
Marker Count Accuracy					
Center Freq	Span				
1500 MHz	10 MHz	1499.999999 MHz	(16)_____	1500.000001 MHz	±0 Hz
1500 MHz	1 MHz	1499.999999 MHz	(17)_____	1500.000001 MHz	±0 Hz
4000 MHz	10 MHz	3999.999999 MHz	(18)_____	4000.000001 MHz	±0 Hz
4000 MHz	1 MHz	3999.999999 MHz	(19)_____	4000.000001 MHz	±0 Hz
6. Frequency Span Readout Accuracy					
Span	Start Freq				
3000 MHz	0 Hz	2370 MHz	(1)_____	2430 MHz	±6.12 MHz
100 MHz	10 MHz	79 MHz	(2)_____	81 MHz	±204 kHz
100 kHz	10 MHz	79 kHz	(3)_____	81 kHz	±204 Hz
100 MHz	800 MHz	79 MHz	(4)_____	81 MHz	±204 kHz
100 kHz	800 MHz	79 kHz	(5)_____	81 kHz	±204 Hz
100 MHz	1400 MHz	79 MHz	(6)_____	81 MHz	±204 kHz
100 kHz	1499 MHz	79 kHz	(7)_____	81 kHz	±204 Hz

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
7. Noise Sidebands				
Offset from 1 GHz signal				
10 kHz		(1)_____	–90 dBc/Hz	±1.154 dB
20 kHz		(2)_____	–100 dBc/Hz	±1.154 dB
30 kHz		(3)_____	–106 dBc/Hz	±1.154 dB
100 kHz		(4)_____	–119 dBc/Hz	±1.154 dB
8. System Related Sidebands				
Offset from 500 MHz signal				
30 kHz to 230 kHz		(1)_____	–65 dBc	±1.154 dB
–30 kHz to –230 kHz		(2)_____	–65 dBc	±1.154 dB
9. Residual FM				
1 kHz Res BW, *(Non-Option 1D5)*		(1)_____	150 Hz	±9.24 Hz
1 kHz Res BW, *(Option 1D5)*		(1)_____	100 Hz	±9.24 Hz
10 Hz Res BW *(Options 1DR and 1D5 only)*		(2)_____	2 Hz	±0.274 Hz
10. Sweep Time Accuracy				
Sweep Time				
5 ms	–1.0%	(1)_____	1.0%	±0.28%
20 ms	–1.0%	(2)_____	1.0%	±0.28%
100 ms	–1.0%	(3)_____	1.0%	±0.28%
1 s	–1.0%	(4)_____	1.0%	±0.28%
10 s	–1.0%	(5)_____	1.0%	±0.28%
1 ms *(Option AYX only)*	–1.0%	(6)_____	1.0%	±0.28%

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
500 us (*Option AYX only*)	–1.0%	(7)_____	1.0%	±0.28%
100 us (*Option AYX only*)	–1.0%	(8)_____	1.0%	±0.28%
11. Display Scale Fidelity				
Cumulative Log Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–0.22 dB	(1)_____	0.22 dB	±0.064 dB
–8	–0.22 dB	(2)_____	0.22 dB	±0.064 dB
–12	–0.24 dB	(3)_____	0.24 dB	±0.064 dB
–16	–0.24 dB	(4)_____	0.24 dB	±0.064 dB
–20	–0.24 dB	(5)_____	0.24 dB	±0.063 dB
–24	–0.26 dB	(6)_____	0.26 dB	±0.064 dB
–28	–0.26 dB	(7)_____	0.26 dB	±0.064 dB
–32	–0.40 dB	(8)_____	0.40 dB	±0.064 dB
–36	–0.40 dB	(9)_____	0.40 dB	±0.064 dB
–40	–0.40 dB	(10)_____	0.40 dB	±0.063 dB
–44	–0.57 dB	(11)_____	0.57 dB	±0.064 dB
–48	–0.57 dB	(12)_____	0.57 dB	±0.064 dB
–52	–0.57 dB	(13)_____	0.57 dB	±0.089 dB
–56	–0.57 dB	(14)_____	0.57 dB	±0.089 dB
–60	–0.57 dB	(15)_____	0.57 dB	±0.088 dB
–64	–0.66 dB	(16)_____	0.66 dB	±0.089 dB
–68	–0.66 dB	(17)_____	0.66 dB	±0.089 dB
–72	–0.66 dB	(18)_____	0.66 dB	±0.089 dB
–76	–0.66 dB	(19)_____	0.66 dB	±0.089 dB
–80	–0.66 dB	(20)_____	0.66 dB	±0.088 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–84	–1.15 dB	(21)_____	1.15 dB	±0.089 dB
Incremental Log Fidelity, Res BW ≥1 kHz dB from Ref Level				
–4	–0.4 dB	(22)_____	0.4 dB	±0.064 dB
–8	–0.4 dB	(23)_____	0.4 dB	±0.064 dB
–12	–0.4 dB	(24)_____	0.4 dB	±0.064 dB
–16	–0.4 dB	(25)_____	0.4 dB	±0.064 dB
–20	–0.4 dB	(26)_____	0.4 dB	±0.063 dB
–24	–0.4 dB	(27)_____	0.4 dB	±0.064 dB
–28	–0.4 dB	(28)_____	0.4 dB	±0.064 dB
–32	–0.4 dB	(29)_____	0.4 dB	±0.064 dB
–36	–0.4 dB	(30)_____	0.4 dB	±0.064 dB
–40	–0.4 dB	(31)_____	0.4 dB	±0.063 dB
–44	–0.4 dB	(32)_____	0.4 dB	±0.064 dB
–48	–0.4 dB	(33)_____	0.4 dB	±0.064 dB
–52	–0.4 dB	(34)_____	0.4 dB	±0.089 dB
–56	–0.4 dB	(35)_____	0.4 dB	±0.089 dB
–60	–0.4 dB	(36)_____	0.4 dB	±0.088 dB
–64	–0.4 dB	(37)_____	0.4 dB	±0.089 dB
–68	–0.4 dB	(38)_____	0.4 dB	±0.089 dB
–72	–0.4 dB	(39)_____	0.4 dB	±0.089 dB
–76	–0.4 dB	(40)_____	0.4 dB	±0.089 dB
–80	–0.4 dB	(41)_____	0.4 dB	±0.088 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Cumulative Log Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.34 dB	(43)_____	0.34 dB	±0.064 dB
–8	–0.38 dB	(44)_____	0.38 dB	±0.064 dB
–12	–0.42 dB	(45)_____	0.42 dB	±0.064 dB
–16	–0.46 dB	(46)_____	0.46 dB	±0.064 dB
–20	–0.50 dB	(47)_____	0.50 dB	±0.063 dB
–24	–0.54 dB	(48)_____	0.54 dB	±0.064 dB
–28	–0.58 dB	(49)_____	0.58 dB	±0.064 dB
–32	–0.62 dB	(50)_____	0.62 dB	±0.064 dB
–36	–0.66 dB	(51)_____	0.66 dB	±0.064 dB
–40	–0.70 dB	(52)_____	0.70 dB	±0.063 dB
–44	–0.74 dB	(53)_____	0.74 dB	±0.064 dB
–48	–0.78 dB	(54)_____	0.78 dB	±0.064 dB
–52	–0.82 dB	(55)_____	0.82 dB	±0.089 dB
–56	–0.86 dB	(56)_____	0.86 dB	±0.089 dB
–60	–0.90 dB	(57)_____	0.90 dB	±0.088 dB
–64	–0.94 dB	(58)_____	0.94 dB	±0.089 dB
–68	–0.98 dB	(59)_____	0.98 dB	±0.089 dB
–72	–1.02 dB	(60)_____	1.02 dB	±0.089 dB
–76	–1.06 dB	(61)_____	1.06 dB	±0.089 dB
–80	–1.10 dB	(62)_____	1.10 dB	±0.088 dB
–84	–1.14 dB	(63)_____	1.14 dB	±0.089 dB
–88	–1.18 dB	(64)_____	1.18 dB	±0.089 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–92	–1.22 dB	(65)_____	1.22 dB	±0.089 dB
–96	–1.26 dB	(66)_____	1.26 dB	±0.088 dB
–98	–1.28 dB	(67)_____	1.28 dB	±0.089 dB
Incremental Log Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.4 dB	(68)_____	0.4 dB	±0.064 dB
–8	–0.4 dB	(69)_____	0.4 dB	±0.064 dB
–12	–0.4 dB	(70)_____	0.4 dB	±0.064 dB
–16	–0.4 dB	(71)_____	0.4 dB	±0.064 dB
–20	–0.4 dB	(72)_____	0.4 dB	±0.063 dB
–24	–0.4 dB	(73)_____	0.4 dB	±0.064 dB
–28	–0.4 dB	(74)_____	0.4 dB	±0.064 dB
–32	–0.4 dB	(75)_____	0.4 dB	±0.064 dB
–36	–0.4 dB	(76)_____	0.4 dB	±0.064 dB
–40	–0.4 dB	(77)_____	0.4 dB	±0.063 dB
–44	–0.4 dB	(78)_____	0.4 dB	±0.064 dB
–48	–0.4 dB	(79)_____	0.4 dB	±0.064 dB
–52	–0.4 dB	(80)_____	0.4 dB	±0.089 dB
–56	–0.4 dB	(81)_____	0.4 dB	±0.089 dB
–60	–0.4 dB	(82)_____	0.4 dB	±0.088 dB
–64	–0.4 dB	(83)_____	0.4 dB	±0.089 dB
–68	–0.4 dB	(84)_____	0.4 dB	±0.089 dB
–72	–0.4 dB	(85)_____	0.4 dB	±0.089 dB
–76	–0.4 dB	(86)_____	0.4 dB	±0.089 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–80	–0.4 dB	(87)_____	0.4 dB	±0.088 dB
Linear Fidelity, Res BW ≥1 kHz dB from Ref Level				
–4	–2.0%	(89)_____	2.0%	±0.064%
–8	–2.0%	(90)_____	2.0%	±0.064%
–12	–2.0%	(91)_____	2.0%	±0.064%
–16	–2.0%	(92)_____	2.0%	±0.064%
–20	–2.0%	(93)_____	2.0%	±0.063%
Linear Fidelity, Res BW ≤300 Hz *(Option 1DR only)* dB from Ref Level				
–4	–2.0%	(94)_____	2.0%	±0.064%
–8	–2.0%	(95)_____	2.0%	±0.064%
–12	–2.0%	(96)_____	2.0%	±0.064%
–16	–2.0%	(97)_____	2.0%	±0.064%
–20	–2.0%	(98)_____	2.0%	±0.063%
Zero Span, Res BW ≤300 Hz *(Option 1DR only)* dB from Ref Level				
–4	–0.36 dB	(99)_____	0.36 dB	±0.064 dB
–8	–0.42 dB	(100)_____	0.42 dB	±0.064 dB
–12	–0.48 dB	(101)_____	0.48 dB	±0.064 dB
–16	–0.54 dB	(102)_____	0.54 dB	±0.064 dB
–20	–0.60 dB	(103)_____	0.60 dB	±0.063 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–24	–0.66 dB	(104)_____	0.66 dB	±0.064 dB
–28	–0.72 dB	(105)_____	0.72 dB	±0.064 dB
–32	–0.78 dB	(106)_____	0.78 dB	±0.064 dB
–36	–0.84 dB	(107)_____	0.84 dB	±0.064 dB
–40	–0.90 dB	(108)_____	0.90 dB	±0.063 dB
–44	–0.96 dB	(109)_____	0.96 dB	±0.064 dB
–48	–1.02 dB	(110)_____	1.02 dB	±0.064 dB
–52	–1.08 dB	(111)_____	1.08 dB	±0.089 dB
–56	–1.14 dB	(112)_____	1.14 dB	±0.089 dB
–60	–1.20 dB	(113)_____	1.20 dB	±0.088 dB
–64	–1.5 dB	(114)_____	1.5 dB	±0.089 dB
–68	–1.5 dB	(115)_____	1.5 dB	±0.089 dB
–70	–1.5 dB	(116)_____	1.5 dB	±0.089 dB
12. Input Attenuation Switching Uncertainty				
Input Attenuation Setting				
0 dB	–0.3 dB	(1)_____	0.3 dB	±0.108 dB
5 dB	–0.3 dB	(2)_____	0.3 dB	±0.107 dB
15 dB	–0.3 dB	(3)_____	0.3 dB	±0.107 dB
20 dB	–0.3 dB	(4)_____	0.3 dB	±0.089 dB
25 dB	–0.35 dB	(5)_____	0.35 dB	±0.089 dB
30 dB	–0.40 dB	(6)_____	0.40 dB	±0.089 dB
35 dB	–0.45 dB	(7)_____	0.45 dB	±0.089 dB
40 dB	–0.50 dB	(8)_____	0.50 dB	±0.089 dB
45 dB	–0.55 dB	(9)_____	0.55 dB	±0.089 dB
50 dB	–0.60 dB	(10)_____	0.60 dB	±0.089 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
55 dB	–0.65 dB	(11)_____	0.65 dB	±0.089 dB
60 dB	–0.70 dB	(12)_____	0.70 dB	±0.089 dB
65 dB	–0.75 dB	(13)_____	0.75 dB	±0.089 dB
14. Reference Level Accuracy				
Log, Res BW ≥1 kHz				
Reference Level				
–10	–0.3 dB	(1)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(2)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(3)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(4)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(5)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(6)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(7)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(8)_____	0.7 dB	±0.156 dB
Linear, Res BW ≥1 kHz				
Reference Level				
–10	–0.3 dB	(9)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(10)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(11)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(12)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(13)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(14)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(15)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(16)_____	0.7 dB	±0.156 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Log, Res BW ≤300 Hz *(Option 1DR only)*				
Reference Level				
–10	–0.3 dB	(17)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(18)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(19)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(20)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(21)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(22)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(23)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(24)_____	0.7 dB	±0.156 dB
Linear, Res BW ≤300 Hz *(Option 1DR only)*				
Reference Level				
–10	–0.3 dB	(25)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(26)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(27)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(28)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(29)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(30)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(31)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(32)_____	0.7 dB	±0.156 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies				
Model E4404B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
15. Resolution Bandwidth Switching Uncertainty				
Resolution Bandwidth				
3 kHz	–0.3 dB	(1)_____	0.3 dB	±0.064 dB
9 kHz	–0.3 dB	(2)_____	0.3 dB	±0.064 dB
10 kHz	–0.3 dB	(3)_____	0.3 dB	±0.064 dB
30 kHz	–0.3 dB	(4)_____	0.3 dB	±0.064 dB
100 kHz	–0.3 dB	(5)_____	0.3 dB	±0.064 dB
120 kHz	–0.3 dB	(6)_____	0.3 dB	±0.064 dB
300 kHz	–0.3 dB	(7)_____	0.3 dB	±0.064 dB
1 MHz	–0.3 dB	(8)_____	0.3 dB	±0.064 dB
3 MHz	–0.3 dB	(9)_____	0.3 dB	±0.064 dB
5 MHz	–0.6 dB	(10)_____	0.6 dB	±0.083 dB
300 Hz *(Option 1DR only)*	–0.3 dB	(11)_____	0.3 dB	±0.064 dB
200 Hz *(Option 1DR only)*	–0.3 dB	(12)_____	0.3 dB	±0.064 dB
100 Hz *(Option 1DR only)*	–0.3 dB	(13)_____	0.3 dB	±0.064 dB
30 Hz *(Option 1DR only)*	–0.3 dB	(14)_____	0.3 dB	±0.064 dB
10 Hz *(Option 1DR only)*	–0.3 dB	(15)_____	0.3 dB	±0.064 dB
17. Absolute Amplitude Accuracy (Reference Settings)				
Log, Preamp Off	–0.34 dB	(1)_____	0.34 dB	±0.148 dB
Lin, Preamp Off	–0.34 dB	(2)_____	0.34 dB	±0.148 dB
Log, Preamp On	–0.37 dB	(3)_____	0.37 dB	±0.148 dB
Lin, Preamp On	–0.37 dB	(4)_____	0.37 dB	±0.148 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
19. Overall Absolute Amplitude Accuracy				
0 dBm Reference Level				
0 dBm input	–0.54 dB	(1)_____	0.54 dB	±0.08 dB
–10 dBm input	–0.54 dB	(2)_____	0.54 dB	±0.081 dB
–20 dBm input	–0.54 dB	(3)_____	0.54 dB	±0.082 dB
–30 dBm input	–0.54 dB	(4)_____	0.54 dB	±0.083 dB
–40 dBm input	–0.54 dB	(5)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(6)_____	0.54 dB	±0.086 dB
–20 dBm Reference Level				
–20 dBm input	–0.54 dB	(7)_____	0.54 dB	±0.082 dB
–30 dBm input	–0.54 dB	(8)_____	0.54 dB	±0.083 dB
–40 dBm input	–0.54 dB	(9)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(10)_____	0.54 dB	±0.086 dB
–40 dBm Reference Level				
–40 dBm input	–0.54 dB	(11)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(12)_____	0.54 dB	±0.086 dB
–50 dBm Reference Level				
–50 dBm input	–0.54 dB	(13)_____	0.54 dB	±0.086 dB
20. Resolution Bandwidth Accuracy				
Resolution Bandwidth				
5 MHz	3.5 MHz	(1)_____	6.5 MHz	±38.2 kHz
3 MHz	2.55 MHz	(2)_____	3.45 MHz	±22.9 kHz
1 MHz	0.85 MHz	(3)_____	1.15 MHz	±7.64 kHz
300 kHz	255 kHz	(4)_____	345 kHz	±2.29 kHz

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
100 kHz	85 kHz	(5)_____	115 kHz	±764 Hz
30 kHz	25.5 kHz	(6)_____	34.5 kHz	±229 Hz
10 kHz	8.5 kHz	(7)_____	11.5 kHz	±76.4 Hz
3 kHz	2.55 kHz	(8)_____	3.45 kHz	±22.9 Hz
1 kHz	850 Hz	(9)_____	1.15 kHz	±7.64 Hz
120 kHz	102 kHz	(10)_____	138 kHz	±154 Hz
9 kHz	7.65 kHz	(11)_____	10.35kHz	±11.5 Hz
23. Frequency Response	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed and installed options.			
20 to 30° C:				
Non-Option UKB dc Coupled Band 0 (9 kHz to 3.0 GHz				
Maximum Response		(1)_____	0.46 dB	±0.245 dB
Minimum Response	–0.46 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	0.92 dB	±0.245 dB
Option UKB dc Coupled Band 0 (100 Hz to 3.0 GHz)				
Maximum Response		(1)_____	0.50 dB	±0.245 dB
Minimum Response	–0.50 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	1.0 dB	±0.245 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
dc Coupled Band 1 (3.0 GHz to 6.7 GHz)				
Maximum Response		(4)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	2.6 dB	±0.245 dB
ac Coupled Band 0 (100 kHz to 3.0 GHz)				
Maximum Response		(10)_____	0.5 dB	±0.245 dB
Minimum Response	–0.5 dB	(11)_____		±0.245 dB
Peak-to-Peak Response		(12)_____	1.0 dB	±0.245 dB
ac Coupled Band 0A (800 MHz to 1.0 GHz) (serial number US39440498 or greater)				
Maximum Response		(13)_____	0.5 dB	±0.245 dB
Minimum Response	–0.5 dB	(14)_____		±0.245 dB
Peak-to-Peak Response		(15)_____	1.0 dB	±0.245 dB
ac Coupled Band 0B (1.7 GHz to 2.0 GHz) (serial number US39440498 or greater)				
Maximum Response		(16)_____	0.5 dB	±0.245 dB
Minimum Response	–0.5 dB	(17)_____		±0.245 dB
Peak-to-Peak Response		(18)_____	1.0 dB	±0.245 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies				
Model E4404B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
ac Coupled Band 1 (3.0 GHz to 6.7 GHz)				
Maximum Response		(19)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(20)_____		±0.245 dB
Peak-to-Peak Response		(21)_____	2.6 dB	±0.245 dB
0 to 55° C:				
Non-Option UKB dc Coupled Band 0 (9 kHz to 3.0 GHz)				
Maximum Response		(1)_____	0.76 dB	±0.245 dB
Minimum Response	–0.76 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	1.52 dB	±0.245 dB
Option UKB dc Coupled Band 0 (100 Hz to 3.0 GHz)				
Maximum Response		(1)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	2.0 dB	±0.245 dB
dc Coupled Band 1 (3.0 GHz to 6.7 GHz)				
Maximum Response		(4)_____	2.5 dB	±0.245 dB
Minimum Response	–2.5 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	3.0 dB	±0.245 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
ac Coupled Band 0 (100 kHz to 3.0 GHz)				
Maximum Response		(10)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(11)_____		±0.245 dB
Peak-to-Peak Response		(12)_____	2.0 dB	±0.245 dB
ac Coupled Band 0A (800 MHz to 1.0 GHz) (serial number US39440498 or greater)				
Maximum Response		(13)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(14)_____		±0.245 dB
Peak-to-Peak Response		(15)_____	2.0 dB	±0.245 dB
ac Coupled Band 0B (1.7 GHz to 2.0 GHz) (serial number US39440498 or greater)				
Maximum Response		(16)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(17)_____		±0.245 dB
Peak-to-Peak Response		(18)_____	2.0 dB	±0.245 dB
ac Coupled Band 1 (3.0 GHz to 6.7 GHz)				
Maximum Response		(19)_____	2.5 dB	±0.245 dB
Minimum Response	–2.5 dB	(20)_____		±0.245 dB
Peak-to-Peak Response		(21)_____	3.0 dB	±0.245 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
26. Frequency Response (Preamp On) *(Option 1DS Only)*	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed and installed options.			
20 to 30° C:				
Band 0 (1 MHz to 3.0 GHz)				
Maximum Response		(1)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	3.0 dB	±0.245 dB
Band 0A (800 MHz to 1.0 GHz) (serial number US39440498 or greater)				
Maximum Response		(4)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	3.0 dB	±0.245 dB
Band 0B (1.7 GHz to 2.0 GHz) (serial number US39440498 or greater)				
Maximum Response		(7)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	3.0 dB	±0.245 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
0 to 55° C:				
Band 0 (1 MHz to 3.0 GHz)				
Maximum Response		(1)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	4.0 dB	±0.245 dB
Band 0A (800 MHz to 1.0 GHz) (serial number US39440498 or greater)				
Maximum Response		(4)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	4.0 dB	±0.245 dB
Band 0B (1.7 GHz to 2.0 GHz) (serial number US39440498 or greater)				
Maximum Response		(7)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	4.0 dB	±0.245 dB
28. Other Input Related Spurious Responses				
Center Freq Input Freq				
2.0 GHz 2042.8 MHz		(1)_____	–65 dBc	±1.14 dB
2.0 GHz 2642.8 MHz		(2)_____	–65 dBc	±1.14 dB
2.0 GHz 1820.8 MHz		(3)_____	–65 dBc	±1.14 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
2.0 GHz 278.5 MHz		(4)_____	–65 dBc	±1.14 dB
2.0 GHz 5600.0 MHz		(5)_____	–80 dBc	±1.14 dB
2.0 GHz 6242.8 MHz		(6)_____	–80 dBc	±1.14 dB
4.0 GHz 4042.8 MHz		(7)_____	–65 dBc	±1.14 dB
4.0 GHz 4642.8 MHz		(8)_____	–65 dBc	±1.14 dB
4.0 GHz 3742.9 MHz		(9)_____	–65 dBc	±1.14 dB
4.0 GHz 2242.8 MHz		(10)_____	–80 dBc	±1.14 dB
31. Spurious Responses				
300 MHz TOI, 1 kHz RBW	12.5 dBm	(1)_____		±0.49 dB
300 MHz TOI, 30 Hz RBW *(Option 1DR only)*	12.5 dBm	(2)_____		±0.49 dB
5 GHz TOI	11 dBm	(3)_____		±0.589 dB
300 MHz SHI	35 dBm	(5)_____		±0.90 dB
900 MHz SHI	45 dBm	(6)_____		±0.90 dB
1.55 GHz SHI	75 dBm	(7)_____		±0.90 dB
3.1 GHz SHI	90 dBm	(8)_____		±0.90 dB
33. Gain Compression				
Test Frequency				
53 MHz		(1)_____	1.0 dB	±0.127 dB
50.004 MHz *(Option 1DR only)*		(2)_____	1.0 dB	±0.127 dB
1403 MHz		(3)_____	1.0 dB	±0.127 dB
2503 MHz		(4)_____	1.0 dB	±0.144 dB
4403 MHz		(5)_____	1.0 dB	±0.201 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
36. Displayed Average Noise Level	Note: Enter results with preamp on in the appropriate section based upon the ambient temperature when the test was performed.			
1 kHz RBW, Preamp Off:				
10 MHz to 1 GHz		(1)_____	–116 dBm	±1.82 dB
1 GHz to 2 GHz		(2)_____	–116 dBm	±1.82 dB
2 GHz to 3 GHz		(3)_____	–112 dBm	±1.82 dB
3 GHz to 6 GHz		(4)_____	–112 dBm	±1.82 dB
6 GHz to 6.7 GHz		(5)_____	–111 dBm	±1.82 dB
1kHz RBW, Preamp On, 0 to 55° C:				
10 MHz to 1 GHz		(6)_____	–131 dBm	±1.82 dB
1 GHz to 2 GHz		(7)_____	–131 dBm	±1.82 dB
2 GHz to 3 GHz		(8)_____	–127 dBm	±1.82 dB
10 Hz RBW, Preamp Off:				
10 MHz to 1 GHz		(9)_____	–135 dBm	±1.82 dB
1 GHz to 2 GHz		(10)_____	–135 dBm	±1.82 dB
2 GHz to 3 GHz		(11)_____	–131 dBm	±1.82 dB
3 GHz to 6 GHz		(12)_____	–131 dBm	±1.82 dB
6 GHz to 6.7 GHz		(13)_____	–130 dBm	±1.82 dB
10 Hz RBW, Preamp On, 0 to 55° C:				
10 MHz to 1 GHz		(14)_____	–150 dBm	±1.82 dB
1 GHz to 2 GHz		(15)_____	–150 dBm	±1.82 dB
2 GHz to 3 GHz		(16)_____	–146 dBm	±1.82 dB
1 kHz RBW, Preamp On, 20 to 30° C:				
10 MHz to 1 GHz		(17)_____	–132 dBm	±1.82 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies				
Model E4404B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
1 GHz to 2 GHz		(18)_____	–132 dBm	±1.82 dB
2 GHz to 3 GHz		(19)_____	–130 dBm	±1.82 dB
10 Hz RBW, Preamp On, 20 to 30° C:				
10 MHz to 1 GHz		(20)_____	–151 dBm	±1.82 dB
1 GHz to 2 GHz		(21)_____	–151 dBm	±1.82 dB
2 GHz to 3 GHz		(22)_____	–149 dBm	±1.82 dB
38. Residual Responses				
150 kHz to 6.7 GHz		(1)_____	–90 dBm	±0.93 dB
39. Fast Time Domain Amplitude Accuracy *(Option AYX only)*				
Amplitude Error	–0.3%	(1)_____	0.3%	±0.029%
41. Tracking Generator Absolute Amplitude and Vernier Accuracy				
Absolute Amplitude Accuracy	–0.75 dB	(1)_____	0.75 dB	±0.087 dB
Vernier Accuracy, –2 dB	–0.4 dB	(2)_____	0.4 dB	±0.11 dB
Vernier Accuracy, –3 dB	–0.5 dB	(3)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –5 dB	–0.5 dB	(4)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –6 dB	–0.5 dB	(5)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –7 dB	–0.5 dB	(6)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –8 dB	–0.5 dB	(7)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –9 dB	–0.5 dB	(8)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –10 dB	–0.5 dB	(9)_____	0.5 dB	±0.16 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
43. Tracking Generator Level Flatness				
Positive Level Flatness, <1 MHz		(1)_____	3.0 dB	±0.255 dB
Negative Level Flatness, <1 MHz	–3.0 dB	(2)_____		±0.255 dB
Positive Level Flatness, 1 MHz to 10 MHz		(3)_____	3.0 dB	±0.145 dB
Negative Level Flatness, 1 MHz to 10 MHz	–3.0 dB	(4)_____		±0.145 dB
Positive Level Flatness, >10 MHz to 1.5 GHz		(5)_____	2.0 dB	±0.122 dB
Negative Level Flatness, >10 MHz to 1.5 GHz	–2.0 dB	(6)_____		±0.122 dB
Positive Level Flatness, >1.5 GHz		(7)_____	2.0 dB	±0.172 dB
Negative Level Flatness, >1.5 GHz	–2.0 dB	(8)_____		±0.172 dB
45. Tracking Generator Harmonic Spurious Outputs *(Option 1DN only)*				
2^{nd} Harmonic, <20 kHz		(1)_____	–15 dBc	±2.6 dB
2^{nd} Harmonic, ≥ 20 kHz		(2)_____	–25 dBc	±2.6 dB
3^{rd} Harmonic, <20 kHz		(3)_____	–15 dBc	±2.6 dB
3^{rd} Harmonic, ≥ 20 kHz		(4)_____	–25 dBc	±2.6 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies				
Model E4404B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
47. Tracking Generator Non-Harmonic Spurious Outputs *(Option 1DN only)*				
Highest Non-Harmonic Spurious Output Amplitude, 9 kHz to 2 GHz		(1)_____	–27 dBc	±2.67 dB
Highest Non-Harmonic Spurious Output Amplitude, 2 GHz to 3 GHz		(2)_____	–23 dBc	±3.12 dB
48. Tracking Generator LO Feedthrough Amplitude *(Option 1DN only)*				
9 kHz to 2.9 GHz		(1)_____	–16 dBm	±1.94 dB
2.9 GHz to 3.0 GHz		(2)_____	–16 dBm	±2.49 dB
49. Gate Delay Accuracy and Gate Length Accuracy *(Option 1D6 only)*				
Minimum Gate Delay	499.9 ns	(1)_____	1.5001 µs	±475 ps
Maximum Gate Delay	499.9 ns	(2)_____	1.5001 µs	±475 ps
1 us Gate Length	499.9 ns	(3)_____	1.5001 µs	±450 ps
65 ms Gate Length	64.993 ms	(4)_____	65.007 ms	±561 ns
50. Gate Mode Amplitude Error *(Option 1D6 only)*				
Amplitude Error	–0.2 dB	(1)_____	0.2 dB	±0.023 dB
55. cdmaOne Modulation Accuracy (Rho) *(Option BAC only)*				
	–0.0015 dB	(1)_____	0.0015 dB	0.00010 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
56. cdmaOne Modulation Accuracy - EVM *(Option BAC only)*	–1.1%	(1)_____	+1.1%	0.12%
57. cdmaOne Code Domain Power *(Option BAC only)*	–0.20 dB	(1)_____	0.20 dB	
58. GSM Phase and Frequency Accuracy *(Option BAH and B7E)*				
Peak	–2.1 Deg	(1)_____	2.1 Deg	0.24 Deg
RMS (Avg >10)	–1.1 Deg	(2)_____	2.1 Deg	0.24 Deg
59. Comms Absolute Accuracy *(Options BAC or BAH)*				
cdmaOne *(Option BAC only)*				
Channel Power Accuracy (Option BAC only)				
Cellular Bands				
30 dBm to –5 dBm				
20 to 30° C	–0.80 dB	(1)_____	0.80 dB	±0.19 dB
–5 dBm to –25 dBm				
20 to 30° C	–0.77 dB	(2)_____	0.77 dB	±0.19 dB
–25 dBm to –45 dBm				
20 to 30° C	–0.65 dB	(3)_____	0.65 dB	±0.19 dB
–45 dBm to –55 dBm				
20 to 30° C	–0.72 dB	(4)_____	0.72 dB	±0.19 dB
–55 dBm to –70 dBm				

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies				
Model E4404B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
20 to 30° C	–0.86 dB	(5)_____	0.86 dB	±0.19 dB
PCS Bands				
30 dBm to –5 dBm				
20 to 30° C	–0.70 dB	(6)_____	0.70 dB	±0.19 dB
–5 dBm to –25 dBm				
20 to 30° C	–0.67 dB	(7)_____	0.67 dB	±0.19 dB
–25 dBm to –45 dBm				
20 to 30° C	–0.66 dB	(8)_____	0.66 dB	±0.19 dB
–45 dBm to –55 dBm				
20 to 30° C	–0.73 dB	(9)_____	0.73 dB	±0.19 dB
–55 dBm to –70 dBm				
20 to 30° C	–0.87 dB	(10)_____	0.87 dB	±0.19 dB
Receive Channel Power Accuracy				
Preamp Off				
Cellular Band				
30 to 0 dBm	–1.07 dB	(11)_____	1.07 dB	±0.24 dB
0 to –85 dBm	±1.64 dB	(12)_____	1.64 dB	±0.24 dB
PCS Bands				
30 to 0 dBm	–0.86 dB	(13)_____	0.86 dB	0.24 dB
0 to –85 dBm	–1.76	(14)_____	1.76 dB	0.24 dB
Preamp On				
Cellular Band				
30 to –80 dBm	–2.96	(15)_____	2.96 dB	0.24 dB
–80 to –100 dBm	–4.07	(16)_____	4.07 dB	0.24 dB
PCS Band				

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies

Model E4404B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
30 to –80 dBm	–2.14	(17)_____	2.14 dB	0.24 dB
–80 to –100 dBm	–3.37	(18)_____	3.37 dB	0.24 dB
P-GSM, E-GSM, and R-GSM Bands				
Transmit Power Accuracy				
Cellular Bands				
30 dBm to –20 dBm				
20 to 30° C	–0.81 dB	(19)_____	0.81 dB	±0.19 dB
–20 dBm to –30 dBm				
20 to 30° C	–0.74 dB	(20)_____	0.74 dB	±0.19 dB
–30 dBm to –40 dBm				
20 to 30° C	–0.79 dB	(21)_____	0.79 dB	±0.19 dB
–40 dBm to –50 dBm				
20 to 30° C	–0.95 dB	(22)_____	0.95 dB	±0.19 dB
–50 dBm to –60 dBm				
20 to 30° C	–1.09 dB	(23)_____	1.09 dB	±0.19 dB
DCS 1800 and PCS 1900 Bands				
30 dBm to –20 dBm				
20 to 30° C	–0.68 dB	(24)_____	0.68 dB	±0.19 dB
–20 dBm to –30 dBm				
20 to 30° C	–0.61 dB	(25)_____	0.61 dB	±0.19 dB
–30 dBm to –40 dBm				
20 to 30° C	–0.66 dB	(26)_____	0.66 dB	±0.19 dB
–40 dBm to –50 dBm				
20 to 30° C	–0.82 dB	(27)_____	0.82 dB	±0.19 dB

Table 3-8 E4404B Performance Verification Test Record

Agilent Technologies				
Model E4404B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
–50 dBm to –60 dBm 20 to 30° C	–0.96 dB	(28)_____	0.96 dB	±0.19 dB

Agilent E4405B Performance Verification Test Record

Only the tests for E4405B are included in this test record, therefore not all test numbers are included.

Table 3-9 E4405B Performance Verification Test Record

Agilent Technologies

Address: _____ Report No. _____

_____ Date _____

_____

Model E4405B

Serial No. _____ Ambient temperature _____ ° C

Options _____ Power mains line frequency _____ Hz (nominal)

Firmware Revision _____ Relative humidity _____%

Customer _____ Tested by _____

Test Equipment Used:

Description	Model No.	Trace No.	Cal Due Date
Synthesized Signal Generator			
Synthesized Sweeper #1			
Synthesized Sweeper #2			
Function Generator			
Power Meter, Dual-Channel			
RF Power Sensor #1			
RF Power Sensor #2			
Microwave Power Sensor			
Low-Power Power Sensor			
Digital Multimeter			
Universal Counter			
Frequency Standard			
Power Splitter			
50 Ω Termination			

Table 3-9 E4405B Performance Verification Test Record

1 dB Step Attenuator	_____	_____	_____
10 dB Step Attenuator	_____	_____	_____
6 dB Fixed Attenuator	_____	_____	_____
20 dB Fixed Attenuator *(Option 1DS only)*	_____	_____	_____
Oscilloscope *(Option 1D6 only)*	_____	_____	_____
Microwave Spectrum Analyzer *(Option 1DN only)*	_____	_____	_____
Notes/comments:	_____		
	_____		

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description		**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
1.	**10 MHz Reference Output Accuracy** (*Non-Option 1D5 only*)				
	Settability	–5.0 Hz	(1)_____	5.0 Hz	±293.3 μHz
2.	**10 MHz Precision Frequency Reference Accuracy** (*Option 1D5 only*)				
	5 Minute Warm-Up Error	–0.1 ppm	(1)_____	0.1 ppm	±0.000072 ppm
	15 Minute Warm-Up Error	–0.01 ppm	(2)_____	0.01 ppm	±0.000070 ppm
4.	**Frequency Readout Accuracy and Marker Count Accuracy**	Note: TR Entries 10 through 15 do not apply to the E4405B.			
	Frequency Readout Accuracy				
	Center Freq Span				
	1500 MHz 20 MHz	1499.83 MHz	(1)_____	1500.17 MHz	0 Hz
	1500 MHz 10 MHz	1499.91 MHz	(2)_____	1500.09 MHz	0 Hz

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description		Minimum	Results Measured	Maximum	Measurement Uncertainty
1500 MHz	1 MHz	1499.991 MHz	(3)_____	1500.009 MHz	0 Hz
4000 MHz	20 MHz	3999.83 MHz	(4)_____	4000.17 MHz	0 Hz
4000 MHz	10 MHz	3999.91 MHz	(5)_____	4000.09 MHz	0 Hz
4000 MHz	1 MHz	3999.991 MHz	(6)_____	4000.009 MHz	0 Hz
9000 MHz	20 MHz	8999.83 MHz	(7)_____	9000.17 MHz	0 Hz
9000 MHz	10 MHz	8999.91 MHz	(8)_____	9000.09 MHz	0 Hz
9000 MHz	1 MHz	8999.991 MHz	(9)_____	9000.009 MHz	0 Hz
Marker Count Accuracy		Note: Enter results in the appropriate section below based upon the firmware revision of the analyzer.			
Firmware Revision Prior to A.03.00					
Center Freq	Span				
1500 MHz	10 MHz	1499.999998 MHz	(16)_____	1500.000002 MHz	±0 Hz
1500 MHz	1 MHz	1499.999998 MHz	(17)_____	1500.000002 MHz	±0 Hz
4000 MHz	10 MHz	3999.999998 MHz	(18)_____	4000.000002 MHz	±0 Hz
4000 MHz	1 MHz	3999.999998 MHz	(19)_____	4000.000002 MHz	±0 Hz
9000 MHz	10 MHz	8999.999997 MHz	(20)_____	9000.000003 MHz	±0 Hz
9000 MHz	1 MHz	8999.999997 MHz	(21)_____	9000.000003 MHz	±0 Hz
Marker Count Accuracy					
Firmware Revision A.03.00 or later					

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Center Freq Span				
1500 MHz 10 MHz	1499.999999 MHz	(16)_____	1500.000001 MHz	±0 Hz
1500 MHz 1 MHz	1499.999999 MHz	(17)_____	1500.000001 MHz	±0 Hz
4000 MHz 10 MHz	3999.999999 MHz	(18)_____	4000.000001 MHz	±0 Hz
4000 MHz 1 MHz	3999.999999 MHz	(19)_____	4000.000001 MHz	±0 Hz
9000 MHz 10 MHz	8999.999999 MHz	(20)_____	9000.000001 MHz	±0 Hz
9000 MHz 1 MHz	8999.999999 MHz	(21)_____	9000.000001 MHz	±0 Hz
6. Frequency Span Readout Accuracy				
Span Start Freq				
3000 MHz 0 Hz	2370 MHz	(1)_____	2430 MHz	±6.12 MHz
100 MHz 10 MHz	79 MHz	(2)_____	81 MHz	±204 kHz
100 kHz 10 MHz	79 kHz	(3)_____	81 kHz	±204 Hz
100 MHz 800 MHz	79 MHz	(4)_____	81 MHz	±204 kHz
100 kHz 800 MHz	79 kHz	(5)_____	81 kHz	±204 Hz
100 MHz 1400 MHz	79 MHz	(6)_____	81 MHz	±204 kHz
100 kHz 1499 MHz	79 kHz	(7)_____	81 kHz	±204 Hz
7. Noise Sidebands				
Offset from 1 GHz signal				
10 kHz		(1)_____	–90 dBc/Hz[a]	±1.154 dB
20 kHz		(2)_____	–100 dBc/Hz[a]	±1.154 dB
30 kHz		(3)_____	–106 dBc/Hz[a]	±1.154 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
100 kHz		(4)_____	–119 dBc/Hz[a]	±1.154 dB
	[a] Add +20 Log (N) for frequencies > 6.7 GHz.			
8. System Related Sidebands				
Offset from 500 MHz signal				
30 kHz to 230 kHz		(1)_____	–65 dBc	±1.154 dB
–30 kHz to –230 kHz		(2)_____	–65 dBc	±1.154 dB
9. Residual FM				
1 kHz Res BW (*Non-Option 1D5)*		(1)_____	150 Hz	±9.24 Hz
1 kHz Res BW (*Option 1D5)*		(1)_____	100 Hz	±9.24 Hz
10 Hz Res BW (*Options 1DR and 1D5 only*)		(2)_____	2 Hz	±0.274 Hz
10. Sweep Time Accuracy				
Sweep Time				
5 ms	–1.0%	(1)_____	1.0%	±0.28%
20 ms	–1.0%	(2)_____	1.0%	±0.28%
100 ms	–1.0%	(3)_____	1.0%	±0.28%
1 s	–1.0%	(4)_____	1.0%	±0.28%
10 s	–1.0%	(5)_____	1.0%	±0.28%
1 ms (*Option AYX only)*	–1.0%	(6)_____	1.0%	±0.28%
500 µs (*Option AYX only)*	–1.0%	(7)_____	1.0%	±0.28%
100 µs (*Option AYX only)*	–1.0%	(8)_____	1.0%	±0.28%

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
11. Display Scale Fidelity				
Cumulative Log Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–0.22 dB	(1)_____	0.22 dB	±0.064 dB
–8	–0.22 dB	(2)_____	0.22 dB	±0.064 dB
–12	–0.24 dB	(3)_____	0.24 dB	±0.064 dB
–16	–0.24 dB	(4)_____	0.24 dB	±0.064 dB
–20	–0.24 dB	(5)_____	0.24 dB	±0.063 dB
–24	–0.26 dB	(6)_____	0.26 dB	±0.064 dB
–28	–0.26 dB	(7)_____	0.26 dB	±0.064 dB
–32	–0.40 dB	(8)_____	0.40 dB	±0.064 dB
–36	–0.40 dB	(9)_____	0.40 dB	±0.064 dB
–40	–0.40 dB	(10)_____	0.40 dB	±0.063 dB
–44	–0.57 dB	(11)_____	0.57 dB	±0.064 dB
–48	–0.57 dB	(12)_____	0.57 dB	±0.064 dB
–52	–0.57 dB	(13)_____	0.57 dB	±0.089 dB
–56	–0.57 dB	(14)_____	0.57 dB	±0.089 dB
–60	–0.57 dB	(15)_____	0.57 dB	±0.088 dB
–64	–0.66 dB	(16)_____	0.66 dB	±0.089 dB
–68	–0.66 dB	(17)_____	0.66 dB	±0.089 dB
–72	–0.66 dB	(18)_____	0.66 dB	±0.089 dB
–76	–0.66 dB	(19)_____	0.66 dB	±0.089 dB
–80	–0.66 dB	(20)_____	0.66 dB	±0.088 dB
–84	–1.15 dB	(21)_____	1.15 dB	±0.089 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Incremental Log Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–0.4 dB	(22)_____	0.4 dB	±0.064 dB
–8	–0.4 dB	(23)_____	0.4 dB	±0.064 dB
–12	–0.4 dB	(24)_____	0.4 dB	±0.064 dB
–16	–0.4 dB	(25)_____	0.4 dB	±0.064 dB
–20	–0.4 dB	(26)_____	0.4 dB	±0.063 dB
–24	–0.4 dB	(27)_____	0.4 dB	±0.064 dB
–28	–0.4 dB	(28)_____	0.4 dB	±0.064 dB
–32	–0.4 dB	(29)_____	0.4 dB	±0.064 dB
–36	–0.4 dB	(30)_____	0.4 dB	±0.064 dB
–40	–0.4 dB	(31)_____	0.4 dB	±0.063 dB
–44	–0.4 dB	(32)_____	0.4 dB	±0.064 dB
–48	–0.4 dB	(33)_____	0.4 dB	±0.064 dB
–52	–0.4 dB	(34)_____	0.4 dB	±0.089 dB
–56	–0.4 dB	(35)_____	0.4 dB	±0.089 dB
–60	–0.4 dB	(36)_____	0.4 dB	±0.088 dB
–64	–0.4 dB	(37)_____	0.4 dB	±0.089 dB
–68	–0.4 dB	(38)_____	0.4 dB	±0.089 dB
–72	–0.4 dB	(39)_____	0.4 dB	±0.089 dB
–76	–0.4 dB	(40)_____	0.4 dB	±0.089 dB
–80	–0.4 dB	(41)_____	0.4 dB	±0.088 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies				
Model E4405B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
Cumulative Log Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.34 dB	(43)_____	0.34 dB	±0.064 dB
–8	–0.38 dB	(44)_____	0.38 dB	±0.064 dB
–12	–0.42 dB	(45)_____	0.42 dB	±0.064 dB
–16	–0.46 dB	(46)_____	0.46 dB	±0.064 dB
–20	–0.50 dB	(47)_____	0.50 dB	±0.063 dB
–24	–0.54 dB	(48)_____	0.54 dB	±0.064 dB
–28	–0.58 dB	(49)_____	0.58 dB	±0.064 dB
–32	–0.62 dB	(50)_____	0.62 dB	±0.064 dB
–36	–0.66 dB	(51)_____	0.66 dB	±0.064 dB
–40	–0.70 dB	(52)_____	0.70 dB	±0.063 dB
–44	–0.74 dB	(53)_____	0.74 dB	±0.064 dB
–48	–0.78 dB	(54)_____	0.78 dB	±0.064 dB
–52	–0.82 dB	(55)_____	0.82 dB	±0.089 dB
–56	–0.86 dB	(56)_____	0.86 dB	±0.089 dB
–60	–0.90 dB	(57)_____	0.90 dB	±0.088 dB
–64	–0.94 dB	(58)_____	0.94 dB	±0.089 dB
–68	–0.98 dB	(59)_____	0.98 dB	±0.089 dB
–72	–1.02 dB	(60)_____	1.02 dB	±0.089 dB
–76	–1.06 dB	(61)_____	1.06 dB	±0.089 dB
–80	–1.10 dB	(62)_____	1.10 dB	±0.088 dB
–84	–1.14 dB	(63)_____	1.14 dB	±0.089 dB
–88	–1.18 dB	(64)_____	1.18 dB	±0.089 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–92	–1.22 dB	(65)_____	1.22 dB	±0.089 dB
–96	–1.26 dB	(66)_____	1.26 dB	±0.088 dB
–98	–1.28 dB	(67)_____	1.28 dB	±0.089 dB
Incremental Log Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.4 dB	(68)_____	0.4 dB	±0.064 dB
–8	–0.4 dB	(69)_____	0.4 dB	±0.064 dB
–12	–0.4 dB	(70)_____	0.4 dB	±0.064 dB
–16	–0.4 dB	(71)_____	0.4 dB	±0.064 dB
–20	–0.4 dB	(72)_____	0.4 dB	±0.063 dB
–24	–0.4 dB	(73)_____	0.4 dB	±0.064 dB
–28	–0.4 dB	(74)_____	0.4 dB	±0.064 dB
–32	–0.4 dB	(75)_____	0.4 dB	±0.064 dB
–36	–0.4 dB	(76)_____	0.4 dB	±0.064 dB
–40	–0.4 dB	(77)_____	0.4 dB	±0.063 dB
–44	–0.4 dB	(78)_____	0.4 dB	±0.064 dB
–48	–0.4 dB	(79)_____	0.4 dB	±0.064 dB
–52	–0.4 dB	(80)_____	0.4 dB	±0.089 dB
–56	–0.4 dB	(81)_____	0.4 dB	±0.089 dB
–60	–0.4 dB	(82)_____	0.4 dB	±0.088 dB
–64	–0.4 dB	(83)_____	0.4 dB	±0.089 dB
–68	–0.4 dB	(84)_____	0.4 dB	±0.089 dB
–72	–0.4 dB	(85)_____	0.4 dB	±0.089 dB
–76	–0.4 dB	(86)_____	0.4 dB	±0.089 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–80	–0.4 dB	(87)_____	0.4 dB	±0.088 dB
Linear Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–2.0%	(89)_____	2.0%	±0.064%
–8	–2.0%	(90)_____	2.0%	±0.064%
–12	–2.0%	(91)_____	2.0%	±0.064%
–16	–2.0%	(92)_____	2.0%	±0.064%
–20	–2.0%	(93)_____	2.0%	±0.063%
Linear Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–2.0%	(94)_____	2.0%	±0.064%
–8	–2.0%	(95)_____	2.0%	±0.064%
–12	–2.0%	(96)_____	2.0%	±0.064%
–16	–2.0%	(97)_____	2.0%	±0.064%
–20	–2.0%	(98)_____	2.0%	±0.063%
Zero Span, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.36 dB	(99)_____	0.36 dB	±0.064 dB
–8	–0.42 dB	(100)_____	0.42 dB	±0.064 dB
–12	–0.48 dB	(101)_____	0.48 dB	±0.064 dB
–16	–0.54 dB	(102)_____	0.54 dB	±0.064 dB
–20	–0.60 dB	(103)_____	0.60 dB	±0.063 dB
–24	–0.66 dB	(104)_____	0.66 dB	±0.064 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–28	–0.72 dB	(105)_____	0.72 dB	±0.064 dB
–32	–0.78 dB	(106)_____	0.78 dB	±0.064 dB
–36	–0.84 dB	(107)_____	0.84 dB	±0.064 dB
–40	–0.90 dB	(108)_____	0.90 dB	±0.063 dB
–44	–0.96 dB	(109)_____	0.96 dB	±0.064 dB
–48	–1.02 dB	(110)_____	1.02 dB	±0.064 dB
–52	–1.08 dB	(111)_____	1.08 dB	±0.089 dB
–56	–1.14 dB	(112)_____	1.14 dB	±0.089 dB
–60	–1.20 dB	(113)_____	1.20 dB	±0.088 dB
–64	–1.5 dB	(114)_____	1.5 dB	±0.089 dB
–68	–1.5 dB	(115)_____	1.5 dB	±0.089 dB
–70	–1.5 dB	(116)_____	1.5 dB	±0.089 dB
12. Input Attenuation Switching Uncertainty				
Input Attenuation Setting				
0 dB	–0.3 dB	(1)_____	0.3 dB	±0.108 dB
5 dB	–0.3 dB	(2)_____	0.3 dB	±0.107 dB
15 dB	–0.3 dB	(3)_____	0.3 dB	±0.107 dB
20 dB	–0.3 dB	(4)_____	0.3 dB	±0.089 dB
25 dB	–0.35 dB	(5)_____	0.35 dB	±0.089 dB
30 dB	–0.40 dB	(6)_____	0.40 dB	±0.089 dB
35 dB	–0.45 dB	(7)_____	0.45 dB	±0.089 dB
40 dB	–0.50 dB	(8)_____	0.50 dB	±0.089 dB
45 dB	–0.55 dB	(9)_____	0.55 dB	±0.089 dB
50 dB	–0.60 dB	(10)_____	0.60 dB	±0.089 dB
55 dB	–0.65 dB	(11)_____	0.65 dB	±0.089 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies				
Model E4405B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
60 dB	–0.70 dB	(12)_____	0.70 dB	±0.089 dB
65 dB	–0.75 dB	(13)_____	0.75 dB	±0.089 dB
14. Reference Level Accuracy				
Log, Res BW ≥1 kHz				
Reference Level				
–10	–0.3 dB	(1)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(2)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(3)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(4)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(5)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(6)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(7)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(8)_____	0.7 dB	±0.156 dB
Linear, Res BW ≥1 kHz				
Reference Level				
–10	–0.3 dB	(9)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(10)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(11)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(12)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(13)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(14)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(15)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(16)_____	0.7 dB	±0.156 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Log, Res BW ≤300 Hz *(Option 1DR only)*				
Reference Level				
–10	–0.3 dB	(17)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(18)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(19)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(20)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(21)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(22)_____	0.5 dB	±0.156 dB
[illegible]	[illegible]	[illegible]	[illegible]	[illegible]
–80	–0.7 dB	(24)_____	0.7 dB	±0.156 dB
Linear, Res BW ≤300 Hz *(Option 1DR only)*				
Reference Level				
–10	–0.3 dB	(25)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(26)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(27)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(28)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(29)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(30)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(31)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(32)_____	0.7 dB	±0.156 dB
15. Resolution Bandwidth Switching Uncertainty				
Resolution Bandwidth				
3 kHz	–0.3 dB	(1)_____	0.3 dB	±0.064 dB
9 kHz	–0.3 dB	(2)_____	0.3 dB	±0.064 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
10 kHz	–0.3 dB	(3)_____	0.3 dB	±0.064 dB
30 kHz	–0.3 dB	(4)_____	0.3 dB	±0.064 dB
100 kHz	–0.3 dB	(5)_____	0.3 dB	±0.064 dB
120 kHz	–0.3 dB	(6)_____	0.3 dB	±0.064 dB
300 kHz	–0.3 dB	(7)_____	0.3 dB	±0.064 dB
1 MHz	–0.3 dB	(8)_____	0.3 dB	±0.064 dB
3 MHz	–0.3 dB	(9)_____	0.3 dB	±0.064 dB
5 MHz	–0.6 dB	(10)_____	0.6 dB	±0.083 dB
300 Hz *(Option 1DR only)*	–0.3 dB	(11)_____	0.3 dB	±0.064 dB
200 Hz *(Option 1DR only)*	–0.3 dB	(12)_____	0.3 dB	±0.064 dB
100 Hz *(Option 1DR only)*	–0.3 dB	(13)_____	0.3 dB	±0.064 dB
30 Hz *(Option 1DR only)*	–0.3 dB	(14)_____	0.3 dB	±0.064 dB
10 Hz *(Option 1DR only)*	–0.3 dB	(15)_____	0.3 dB	±0.064 dB
17. Absolute Amplitude Accuracy (Reference Settings)				
Log, Preamp Off	–0.34 dB	(1)_____	0.34 dB	±0.148 dB
Lin, Preamp Off	–0.34 dB	(2)_____	0.34 dB	±0.148 dB
Log, Preamp On	–0.37 dB	(3)_____	0.37 dB	±0.148 dB
Lin, Preamp On	–0.37 dB	(4)_____	0.37 dB	±0.148 dB
19. Overall Absolute Amplitude Accuracy				
0 dBm Reference Level				
0 dBm input	–0.54 dB	(1)_____	0.54 dB	±0.08 dB
–10 dBm input	–0.54 dB	(2)_____	0.54 dB	±0.081 dB
–20 dBm input	–0.54 dB	(3)_____	0.54 dB	±0.082 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–30 dBm input	–0.54 dB	(4)_____	0.54 dB	±0.083 dB
–40 dBm input	–0.54 dB	(5)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(6)_____	0.54 dB	±0.086 dB
–20 dBm Reference Level				
–20 dBm input	–0.54 dB	(7)_____	0.54 dB	±0.082 dB
–30 dBm input	–0.54 dB	(8)_____	0.54 dB	±0.083 dB
–40 dBm input	–0.54 dB	(9)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(10)_____	0.54 dB	±0.086 dB
–40 dBm Reference Level				
–40 dBm input	–0.54 dB	(11)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(12)_____	0.54 dB	±0.086 dB
–50 dBm Reference Level				
–50 dBm input	–0.54 dB	(13)_____	0.54 dB	±0.086 dB
20. Resolution Bandwidth Accuracy				
Resolution Bandwidth				
5 MHz	3.5 MHz	(1)_____	6.5 MHz	±38.2 kHz
3 MHz	2.55 MHz	(2)_____	3.45 MHz	±22.9 kHz
1 MHz	0.85 MHz	(3)_____	1.15 MHz	±7.64 kHz
300 kHz	255 kHz	(4)_____	345 kHz	±2.29 kHz
100 kHz	85 kHz	(5)_____	115 kHz	±764 Hz
30 kHz	25.5 kHz	(6)_____	34.5 kHz	±229 Hz
10 kHz	8.5 kHz	(7)_____	11.5 kHz	±76.4 Hz
3 kHz	2.55 kHz	(8)_____	3.45 kHz	±22.9 Hz
1 kHz	850 Hz	(9)_____	1.15 kHz	±7.64 Hz
120 kHz	102 kHz	(10)_____	138 kHz	±154 Hz

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
9 kHz	7.65 kHz	(11)_____	10.35 kHz	±11.5 Hz
23. Frequency Response	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed and installed options.			
20 to 30° C:				
Non-Option UKB dc Coupled Band 0 (9 kHz to 3.0 GHz				
Maximum Response		(1)_____	0.46 dB	±0.245 dB
Minimum Response	–0.46 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	0.92 dB	±0.245 dB
Option UKB dc Coupled Band 0 (100 Hz to 3.0 GHz)				
Maximum Response		(1)_____	0.50 dB	±0.245 dB
Minimum Response	–0.50 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	1.0 dB	±0.245 dB
dc Coupled Band 1 (3.0 GHz to 6.7 GHz)				
Maximum Response		(4)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	2.6 dB	±0.245 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
dc Coupled Band 2 (6.7 GHz to 13.2 GHz)				
Maximum Response		(7)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	3.6 dB	±0.245 dB
ac Coupled Band 0 (100 kHz to 3.0 GHz)				
Maximum Response		(10)_____	0.5 dB	±0.245 dB
Minimum Response	–0.5 dB	(11)_____		±0.245 dB
Peak-to-Peak Response		(12)_____	1.0 dB	±0.245 dB
ac Coupled Band 0A (800 MHz to 1.0 GHz) (serial number US39440327 or greater)				
Maximum Response		(13)_____	0.5 dB	±0.245 dB
Minimum Response	–0.5 dB	(14)_____		±0.245 dB
Peak-to-Peak Response		(15)_____	1.0 dB	±0.245 dB
ac Coupled Band 0B (1.7 GHz to 2.0 GHz) (serial number US39440327 or greater)				
Maximum Response		(16)_____	0.5 dB	±0.245 dB
Minimum Response	–0.5 dB	(17)_____		±0.245 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Peak-to-Peak Response		(18)_____	1.0 dB	±0.245 dB
ac Coupled Band 1 (3.0 GHz to 6.7 GHz)				
Maximum Response		(19)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(20)_____		±0.245 dB
Peak-to-Peak Response		(21)_____	2.6 dB	±0.245 dB
ac Coupled Band 2 (6.7 GHz to 13.2 GHz)				
Maximum Response		(22)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(23)_____		±0.245 dB
Peak-to-Peak Response		(24)_____	3.6 dB	±0.245 dB
0 to 55° C: Non-Option UKB dc Coupled Band 0 (9 kHz to 3.0 GHz)				
Maximum Response		(1)_____	0.76 dB	±0.245 dB
Minimum Response	–0.76 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	1.52 dB	±0.245 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Option UKB dc Coupled Band 0 (100 Hz to 3.0 GHz)				
Maximum Response		(1)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	2.0 dB	±0.245 dB
dc Coupled Band 1 (3.0 GHz to 6.7 GHz)				
Maximum Response		(4)_____	2.5 dB	±0.245 dB
Minimum Response	–2.5 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	3.0 dB	±0.245 dB
dc Coupled Band 2 (6.7 GHz to 13.2 GHz)				
Maximum Response		(7)_____	3.0 dB	±0.245 dB
Minimum Response	–3.0 dB	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	4.0 dB	±0.245 dB
ac Coupled Band 0 (100 kHz to 3.0 GHz)				
Maximum Response		(10)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(11)_____		±0.245 dB
Peak-to-Peak Response		(12)_____	2.0 dB	±0.245 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
ac Coupled Band 0A (800 MHz to 1.0 GHz) (serial number US39440327 or greater)				
Maximum Response		(13)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(14)_____		±0.245 dB
Peak-to-Peak Response		(15)_____	2.0 dB	±0.245 dB
ac Coupled Band 0B (1.7 GHz to 2.0 GHz) (serial number US39440327 or greater)				
Maximum Response		(16)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(17)_____		±0.245 dB
Peak-to-Peak Response		(18)_____	2.0 dB	±0.245 dB
ac Coupled Band 1 (3.0 GHz to 6.7 GHz)				
Maximum Response		(19)_____	2.5 dB	±0.245 dB
Minimum Response	–2.5 dB	(20)_____		±0.245 dB
Peak-to-Peak Response		(21)_____	3.0 dB	±0.245 dB
ac Coupled Band 2 (6.7 GHz to 13.2 GHz)				
Maximum Response		(22)_____	3.0 dB	±0.245 dB
Minimum Response	–3.0 dB	(23)_____		±0.245 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Peak-to-Peak Response		(24)_____	4.0 dB	±0.245 dB
26. Frequency Response (Preamp On) *(Option 1DS Only)*	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed and installed options.			
20 to 30° C:				
Band 0 (1 MHz to 3.0 GHz)				
Maximum Response		(1)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	3.0 dB	±0.245 dB
Band 0A (800 MHz to 1.0 GHz) (serial number US39440327 or greater)				
Maximum Response		(4)_____	0.87 dB	±0.245 dB
Minimum Response	–0.87 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	1.74 dB	±0.245 dB
Band 0B (1.7 GHz to 2.0 GHz) (serial number US39440327 or greater)				
Maximum Response		(7)_____	0.70 dB	±0.245 dB
Minimum Response	–0.70 dB	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	1.40 dB	±0.245 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
0 to 55° C:				
Band 0 (1 MHz to 3.0 GHz)				
Maximum Response		(1)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	4.0 dB	±0.245 dB
Band 0A (800 MHz to 1.0 GHz) (serial number US39440327 or greater)				
Maximum Response		(4)_____	1.18 dB	±0.245 dB
Minimum Response	–1.18 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	2.36 dB	±0.245 dB
Band 0B (1.7 GHz to 2.0 GHz) (serial number US39440327 or greater)				
Maximum Response		(7)_____	0.98 dB	±0.245 dB
Minimum Response	–0.98 dB	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	1.96 dB	±0.245 dB
28. Other Input Related Spurious Responses				
Center Freq Input Freq				
2.0 GHz 2042.8 MHz		(1)_____	–65 dBc	±1.14 dB
2.0 GHz 2642.8 MHz		(2)_____	–65 dBc	±1.14 dB
2.0 GHz 1820.8 MHz		(3)_____	–65 dBc	±1.14 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
2.0 GHz 278.5 MHz		(4)_____	–65 dBc	±1.14 dB
2.0 GHz 5600.0 MHz		(5)_____	–80 dBc	±1.14 dB
2.0 GHz 6242.8 MHz		(6)_____	–80 dBc	±1.14 dB
4.0 GHz 4042.8 MHz		(7)_____	–65 dBc	±1.14 dB
4.0 GHz 4642.8 MHz		(8)_____	–65 dBc	±1.14 dB
4.0 GHz 3742.9 MHz		(9)_____	–65 dBc	±1.14 dB
4.0 GHz 2242.8 MHz		(10)_____	–80 dBc	±1.14 dB
9.0 GHz 9042.8 MHz		(11)_____	–65 dBc	±1.14 dB
9.0 GHz 9642.8 MHz		(12)_____	–65 dBc	±1.14 dB
9.0 GHz 9342.8 MHz		(13)_____	–65 dBc	±1.14 dB
9.0 GHz 4982.1 MHz		(14)_____	–80 dBc	±1.14 dB
31. Spurious Responses				
300 MHz TOI, 1 kHz RBW	12.5 dBm	(1)_____		±0.49 dB
300 MHz TOI, 30 Hz RBW (*Option 1DR only*)	12.5 dBm	(2)_____		±0.49 dB
5 GHz TOI	11 dBm	(3)_____		±0.589 dB
8 GHz TOI	7.5 dBm	(4)_____		±0.589 dB
300 MHz SHI	35 dBm	(5)_____		±0.90 dB
900 MHz SHI	45 dBm	(6)_____		±0.90 dB
1.55 GHz SHI	75 dBm	(7)_____		±0.90 dB
3.1 GHz SHI	90 dBm	(8)_____		±0.90 dB
33. Gain Compression				
Test Frequency				
53 MHz		(1)_____	1.0 dB	±0.127 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
50.004 MHz *(Option 1DR only)*		(2)_____	1.0 dB	±0.127 dB
1403 MHz		(3)_____	1.0 dB	±0.127 dB
2503 MHz		(4)_____	1.0 dB	±0.144 dB
4403 MHz		(5)_____	1.0 dB	±0.201 dB
7603 MHz		(6)_____	1.0 dB	±0.201 dB
36. Displayed Average Noise Level	Note: Enter results with preamp on in the appropriate section based upon the ambient temperature when the test was performed.			
1 kHz RBW, Preamp Off:				
10 MHz to 1 GHz		(1)_____	–116 dBm	±1.82 dB
1 GHz to 2 GHz		(2)_____	–116 dBm	±1.82 dB
2 GHz to 3 GHz		(3)_____	–112 dBm	±1.82 dB
3 GHz to 6 GHz		(4)_____	–112 dBm	±1.82 dB
6 GHz to 12 GHz		(5)_____	–111 dBm	±1.82 dB
12 GHz to 13.2 GHz		(6)_____	–107 dBm	±1.82 dB
1 kHz RBW, Preamp On, 0 to 55° C:				
10 MHz to 1 GHz		(7)_____	–131 dBm	±1.82 dB
1 GHz to 2 GHz		(8)_____	–131 dBm	±1.82 dB
2 GHz to 3 GHz		(9)_____	–127 dBm	±1.82 dB
10 Hz RBW, Preamp Off:				
10 MHz to 1 GHz		(10)_____	–135 dBm	±1.82 dB
1 GHz to 2 GHz		(11)_____	–135 dBm	±1.82 dB
2 GHz to 3 GHz		(12)_____	–131 dBm	±1.82 dB
3 GHz to 6 GHz		(13)_____	–131 dBm	±1.82 dB
6 GHz to 12 GHz		(14)_____	–130 dBm	±1.82 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
12 GHz to 13.2 GHz		(15)_____	–120 dBm	±1.82 dB
10 Hz RBW, Preamp On, 0 to 55° C:				
10 MHz to 1 GHz		(16)_____	–150 dBm	±1.82 dB
1 GHz to 2 GHz		(17)_____	–150 dBm	±1.82 dB
2 GHz to 3 GHz		(18)_____	–146 dBm	±1.82 dB
1 kHz RBW, Preamp On, 20 to 30° C:				
10 MHz to 1 GHz		(19)_____	–132 dBm	±1.82 dB
1 GHz to 2 GHz		(20)_____	–132 dBm	±1.82 dB
2 GHz to 3 GHz		(21)_____	–130 dBm	±1.82 dB
10 Hz RBW, Preamp On, 20 to 30° C:				
10 MHz to 1 GHz		(22)_____	–151 dBm	±1.82 dB
1 GHz to 2 GHz		(23)_____	–151 dBm	±1.82 dB
2 GHz to 3 GHz		(24)_____	–149 dBm	±1.82 dB
38. Residual Responses				
150 kHz to 6.7 GHz		(1)_____	–90 dBm	±0.93 dB
39. Fast Time Domain Amplitude Accuracy *(Option AYX only)*				
Amplitude Error	–0.3%	(1)_____	0.3%	±0.029%
41. Tracking Generator Absolute Amplitude and Vernier Accuracy				
Absolute Amplitude Accuracy	–0.75 dB	(1)_____	0.75 dB	±0.087 dB
Vernier Accuracy, –2 dB	–0.4 dB	(2)_____	0.4 dB	±0.11 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Vernier Accuracy, –3 dB	–0.5 dB	(3)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –5 dB	–0.5 dB	(4)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –6 dB	–0.5 dB	(5)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –7 dB	–0.5 dB	(6)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –8 dB	–0.5 dB	(7)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –9 dB	–0.5 dB	(8)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –10 dB	–0.5 dB	(9)_____	0.5 dB	±0.16 dB
43. Tracking Generator Level Flatness				
Positive Level Flatness, <1 MHz		(1)_____	3.0 dB	±0.255 dB
Negative Level Flatness, <1 MHz	–3.0 dB	(2)_____		±0.255 dB
Positive Level Flatness, 1 MHz to 10 MHz		(3)_____	3.0 dB	±0.145 dB
Negative Level Flatness, 1 MHz to 10 MHz	–3.0 dB	(4)_____		±0.145 dB
Positive Level Flatness, >10 MHz to 1.5 GHz		(5)_____	2.0 dB	±0.122 dB
Negative Level Flatness, >10 MHz to 1.5 GHz	–2.0 dB	(6)_____		±0.122 dB
Positive Level Flatness, >1.5 GHz		(7)_____	2.0 dB	±0.172 dB
Negative Level Flatness, >1.5 GHz	–2.0 dB	(8)_____		±0.172 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
45. Tracking Generator Harmonic Spurious Outputs *(Option 1DN only)*				
2^{nd} Harmonic, <20 kHz		(1)_____	–15 dBc	±2.6 dB
2^{nd} Harmonic, ≥ 20 kHz		(2)_____	–25 dBc	±2.6 dB
3^{rd} Harmonic, <20 kHz		(3)_____	–15 dBc	±2.6 dB
3^{rd} Harmonic, ≥ 20 kHz		(4)_____	–25 dBc	±2.6 dB
47. Tracking Generator Non-Harmonic Spurious Outputs *(Option 1DN only)*				
Highest Non-Harmonic Spurious Output Amplitude, 9 kHz to 2 GHz		(1)_____	–27 dBc	±2.67 dB
Highest Non-Harmonic Spurious Output Amplitude, 2 GHz to 3 GHz		(2)_____	–23 dBc	±3.12 dB
48. Tracking Generator LO Feedthrough Amplitude *(Option 1DN only)*				
9 kHz to 2.9 GHz		(1)_____	–16 dBm	±1.94 dB
2.9 GHz to 3.0 GHz		(2)_____	–16 dBm	±2.49 dB
49. Gate Delay Accuracy and Gate Length Accuracy *(Option 1D6 only)*				
Minimum Gate Delay	499.9 ns	(1)_____	1.5001µs	±475 ps
Maximum Gate Delay	499.9 ns	(2)_____	1.5001µs	±475 ps
1 µs Gate Length	499.9 ns	(3)_____	1.5001µs	±450 ps

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
65 ms Gate Length	64.993 ms	(4)_____	65.007 ms	±561 ns
50. Gate Mode Amplitude Error *(Option 1D6 only)*				
55. cdmaOne Modulation Accuracy (Rho) *(Option BAC only)*	–0.0015 dB	(1)_____	0.0015 dB	0.00010 dB
56. cdmaOne Modulation Accuracy - EVM *(Option BAC only)*	–0.80%	(1)_____	0.80%	0.12%
57. cdmaOne Code Domain Power *(Option BAC only)*	–0.20 dB	(1)_____	0.20 dB	
58. GSM Phase and Frequency Accuracy *(Option BAH and B7E)*				
Peak	–2.1 Deg	(1)_____	2.1 Deg	0.24 Deg
RMS (Avg >10)	–1.1 Deg	(2)_____	2.1 Deg	0.24 Deg
59. Comms Absolute Accuracy *(Options BAC or BAH)*				
cdmaOne *(Option BAC only)*				
Channel Power Accuracy (Option BAC only)				
Cellular Bands				
30 dBm to –5 dBm				
20 to 30° C	–0.80 dB	(1)_____	0.80 dB	±0.19 dB
–5 dBm to –25 dBm				

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
20 to 30° C	–0.77 dB	(2)_____	0.77 dB	±0.19 dB
–25 dBm to –45 dBm				
20 to 30° C	–0.65 dB	(3)_____	0.65 dB	±0.19 dB
–45 dBm to –55 dBm				
20 to 30° C	–0.72 dB	(4)_____	0.72 dB	±0.19 dB
–55 dBm to –70 dBm				
20 to 30° C	–0.86 dB	(5)_____	0.86 dB	±0.19 dB
PCS Bands				
30 dBm to –5 dBm				
20 to 30° C	–0.70 dB	(6)_____	0.70 dB	±0.19 dB
–5 dBm to –25 dBm				
20 to 30° C	–0.67 dB	(7)_____	0.67 dB	±0.19 dB
–25 dBm to –45 dBm				
20 to 30° C	–0.66 dB	(8)_____	0.66 dB	±0.19 dB
–45 dBm to –55 dBm				
20 to 30° C	–0.73 dB	(9)_____	0.73 dB	±0.19 dB
–55 dBm to –70 dBm				
20 to 30° C	–0.87 dB	(10)_____	0.87 dB	±0.19 dB
Receive Channel Power Accuracy				
Preamp Off				
Cellular Band				
30 to 0 dBm	–1.07 dB	(11)_____	1.07 dB	±0.24 dB
0 to -85 dBm	±1.64 dB	(12)_____	1.64 dB	±0.24 dB
PCS Bands				
30 to 0 dBm	-0.86 dB	(13)_____	0.86 dB	0.24 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
0 to -85 dBm	-1.76 dB	(14)_____	1.76 dB	0.24 dB
Preamp On				
Cellular Band				
30 to -80 dBm	-2.96 dB	(15)_____	2.96 dB	0.24 dB
-80 to -100 dBm	-4.07 dB	(16)_____	4.07 dB	0.24 dB
PCS Band				
30 to -80 dBm	-2.14 dB	(17)_____	2.14 dB	0.24 dB
-80 to -100 dBm	-3.37 dB	(18)_____	3.37 dB	0.24 dB
P-GSM, E-GSM, and R-GSM Bands				
Transmit Power Accuracy				
Cellular Bands				
30 dBm to -20 dBm				
20 to 30° C	-0.81 dB	(19)_____	0.81 dB	±0.19 dB
-20 dBm to -30 dBm				
20 to 30° C	-0.74 dB	(20)_____	0.74 dB	±0.19 dB
-30 dBm to -40 dBm				
20 to 30° C	-0.79 dB	(21)_____	0.79 dB	±0.19 dB
-40 dBm to -50 dBm				
20 to 30° C	-0.95 dB	(22)_____	0.95 dB	±0.19 dB
-50 dBm to -60 dBm				
20 to 30° C	-1.09 dB	(23)_____	1.09 dB	±0.19 dB
DCS 1800 and PCS 1900 Bands				
30 dBm to -20 dBm				
20 to 30° C	-0.68 dB	(24)_____	0.68 dB	±0.19 dB

Table 3-10 E4405B Performance Verification Test Record

Agilent Technologies

Model E4405B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–20 dBm to –30 dBm				
20 to 30° C	–0.61 dB	(25)_____	0.61 dB	±0.19 dB
–30 dBm to –40 dBm				
20 to 30° C	–0.66 dB	(26)_____	0.66 dB	±0.19 dB
–40 dBm to –50 dBm				
20 to 30° C	–0.82 dB	(27)_____	0.82 dB	±0.19 dB
–50 dBm to –60 dBm				
20 to 30° C	–0.96 dB	(28)_____	0.96 dB	±0.19 dB

Agilent E4407B Performance Verification Test Record

Only the tests for E4407B are included in this test record, therefore not all test numbers are included.

Table 3-11 E4407B Performance Verification Test Record

Agilent Technologies

Address: _____ Report No. _____

_____ Date _____

_____

Model E4407B

Serial No. _____ Ambient temperature _____° C

Options _____ Power mains line frequency _____ Hz (nominal)

Firmware Revision _____ Relative humidity _____%

Customer _____ Tested by _____

Test Equipment Used:

Description	Model No.	Trace No.	Cal Due Date
Synthesized Signal Generator	_____	_____	_____
Synthesized Sweeper #1	_____	_____	_____
Synthesized Sweeper #2	_____	_____	_____
Function Generator	_____	_____	_____
Power Meter, Dual-Channel	_____	_____	_____
RF Power Sensor #1	_____	_____	_____
RF Power Sensor #2	_____	_____	_____
Microwave Power Sensor	_____	_____	_____
Low-Power Power Sensor	_____	_____	_____
Digital Multimeter	_____	_____	_____
Universal Counter	_____	_____	_____
Frequency Standard	_____	_____	_____
Power Splitter	_____	_____	_____
50 Ω Termination	_____	_____	_____

Table 3-11 E4407B Performance Verification Test Record

1 dB Step Attenuator	_____	_____	_____
10 dB Step Attenuator	_____	_____	_____
6 dB Fixed Attenuator	_____	_____	_____
20 dB Fixed Attenuator *(Option 1DS only)*	_____	_____	_____
Oscilloscope *(Option 1D6 only)*	_____	_____	_____
Microwave Spectrum Analyzer *(Option 1DN only)*	_____	_____	_____
Notes/comments:	_____		

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
1. 10 MHz Reference Output Accuracy (*Non-Option 1D5 only*)				
Settability	–5.0 Hz	(1)_____	5.0 Hz	±293.3 μHz
2. 10 MHz Precision Frequency Reference Output Accuracy (*Option 1D5 only*)				
5 Minute Warm-Up Error	–0.1 ppm	(1)_____	0.1 ppm	±0.000072 ppm
15 Minute Warm-Up Error	–0.01 ppm	(2)_____	0.01 ppm	±0.000070 ppm
4. Frequency Readout and Marker Frequency Accuracy				
Frequency Readout Accuracy				
Center Freq Span				
1500 MHz 20 MHz	1499.83 MHz	(1)_____	1500.17 MHz	±0 Hz

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description		Minimum	Results Measured	Maximum	Measurement Uncertainty
1500 MHz	10 MHz	1499.91 MHz	(2)_____	1500.09 MHz	±0 Hz
1500 MHz	1 MHz	1499.991 MHz	(3)_____	1500.009 MHz	±0 Hz
4000 MHz	20 MHz	3999.83 MHz	(4)_____	4000.17 MHz	±0 Hz
4000 MHz	10 MHz	3999.91 MHz	(5)_____	4000.09 MHz	±0 Hz
4000 MHz	1 MHz	3999.991 MHz	(6)_____	4000.009 MHz	±0 Hz
9000 MHz	20 MHz	8999.83 MHz	(7)_____	9000.17 MHz	±0 Hz
9000 MHz	10 MHz	8999.91 MHz	(8)_____	9000.09 MHz	±0 Hz
9000 MHz	1 MHz	8999.991 MHz	(9)_____	9000.009 MHz	±0 Hz
16000 MHz	20 MHz	15999.83 MHz	(10)_____	16000.17 MHz	±0 Hz
16000 MHz	10 MHz	15999.91 MHz	(11)_____	16000.09 MHz	±0 Hz
16000 MHz	1 MHz	15999.991 MHz	(12)_____	16000.009 MHz	±0 Hz
21000 MHz	20 MHz	20999.83 MHz	(13)_____	21000.17 MHz	±0 Hz
21000 MHz	10 MHz	20999.91 MHz	(14)_____	21000.09 MHz	±0 Hz
21000 MHz	1 MHz	20999.991 MHz	(15)_____	21000.009 MHz	±0 Hz

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description		Minimum	Results Measured	Maximum	Measurement Uncertainty
Marker Count Accuracy		Note: Enter results in the appropriate section below based upon the firmware revision of the analyzer.			
Firmware Revision Prior to A.03.00					
Center Freq	Span				
1500 MHz	10 MHz	1499.999998 MHz	(16)_____	1500.000002 MHz	±0 Hz
1500 MHz	1 MHz	1499.999998 MHz	(17)_____	1500.000002 MHz	±0 Hz
4000 MHz	10 MHz	3999.999998 MHz	(18)_____	4000.000002 MHz	±0 Hz
4000 MHz	1 MHz	3999.999998 MHz	(19)_____	4000.000002 MHz	±0 Hz
9000 MHz	10 MHz	8999.999997 MHz	(20)_____	9000.000003 MHz	±0 Hz
9000 MHz	1 MHz	8999.999997 MHz	(21)_____	9000.000003 MHz	±0 Hz
16000 MHz	10 MHz	15999.999995 MHz	(22)_____	16000.000005 MHz	±0 Hz
16000 MHz	1 MHz	20999.999995 MHz	(23)_____	21000.000005 MHz	±0 Hz
21000 MHz	10 MHz	20999.999995 MHz	(24)_____	21000.000005 MHz	±0 Hz
21000 MHz	1 MHz	20999.999995 MHz	(25)_____	21000.000005 MHz	±0 Hz
Firmware Revision A.03.00 or later					
Center Freq	Span				
1500 MHz	10 MHz	1499.999999 MHz	(16)_____	1500.000001 MHz	±0 Hz

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description		Minimum	Results Measured	Maximum	Measurement Uncertainty
1500 MHz	1 MHz	1499.999999 MHz	(17)_____	1500.000001 MHz	±0 Hz
4000 MHz	10 MHz	3999.999999 MHz	(18)_____	4000.000001 MHz	±0 Hz
4000 MHz	1 MHz	3999.999999 MHz	(19)_____	4000.000001 MHz	±0 Hz
9000 MHz	10 MHz	8999.999999 MHz	(20)_____	9000.000001 MHz	±0 Hz
9000 MHz	1 MHz	8999.999999 MHz	(21)_____	9000.000001 MHz	±0 Hz
16000 MHz	10 MHz	15999.999999 MHz	(22)_____	16000.000001 MHz	±0 Hz
16000 MHz	1 MHz	20999.999999 MHz	(23)_____	21000.000001 MHz	±0 Hz
21000 MHz	10 MHz	20999.999999 MHz	(24)_____	21000.000001 MHz	±0 Hz
21000 MHz	1 MHz	20999.999999 MHz	(25)_____	21000.000001 MHz	±0 Hz
6. Frequency Span Accuracy					
Span	Start Freq				
3000 MHz	0 Hz	2370 MHz	(1)_____	2430 MHz	±6.12 MHz
100 MHz	10 MHz	79 MHz	(2)_____	81 MHz	±204 kHz
100 kHz	10 MHz	79 kHz	(3)_____	81 kHz	±204 Hz
100 MHz	800 MHz	79 MHz	(4)_____	81 MHz	±204 kHz
100 kHz	800 MHz	79 kHz	(5)_____	81 kHz	±204 Hz
100 MHz	1400 MHz	79 MHz	(6)_____	81 MHz	±204 kHz
100 kHz	1499 MHz	79 kHz	(7)_____	81 kHz	±204 Hz

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
7. Noise Sidebands				
Offset from 1 GHz signal				
10 kHz		(1)_____	–90 dBc/Hz[a]	±1.154 dB
20 kHz		(2)_____	–100 dBc/Hz[a]	±1.154 dB
30 kHz		(3)_____	–106 dBc/Hz[a]	±1.154 dB
100 kHz		(4)_____	–119 dBc/Hz[a]	±1.154 dB
	[a] Add +20 Log (N) for frequencies > 6.7 GHz.			
8. System-Related Sidebands				
Offset from 500 MHz signal				
30 kHz to 230 kHz		(1)_____	–65 dBc	±1.154 dB
–30 kHz to –230 kHz		(2)_____	–65 dBc	±1.154 dB
9. Residual FM				
1 kHz Res BW, *(Non-Option 1D5)*		(1)_____	150 Hz	±9.24 Hz
1 kHz Res BW, *(Option 1D5)*		(1)_____	100 Hz	±9.24 Hz
10 Hz Res BW *(Options 1DR and 1D5 only)*		(2)_____	2 Hz	±0.274 Hz
10. Sweep Time Accuracy				
Sweep Time				
5 ms	–1.0%	(1)_____	±1.0%	±0.28%
20 ms	–1.0%	(2)_____	±1.0%	±0.28%
100 ms	–1.0%	(3)_____	±1.0%	±0.28%
1 s	–1.0%	(4)_____	±1.0%	±0.28%

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies				
Model E4407B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
10 s	–1.0%	(5)_____	±1.0%	±0.28%
1 ms *(Option AYX only)*	–1.0%	(6)_____	±1.0%	±0.28%
500 µs *(Option AYX only)*	–1.0%	(7)_____	±1.0%	±0.28%
100 µs *(Option AYX only)*	–1.0%	(8)_____	±1.0%	±0.28%
11. Display Scale Fidelity				
Cumulative Log Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–0.22 dB	(1)_____	0.22 dB	±0.064 dB
–8	–0.22 dB	(2)_____	0.22 dB	±0.064 dB
–12	–0.24 dB	(3)_____	0.24 dB	±0.064 dB
–16	–0.24 dB	(4)_____	0.24 dB	±0.064 dB
–20	–0.24 dB	(5)_____	0.24 dB	±0.063 dB
–24	–0.26 dB	(6)_____	0.26 dB	±0.064 dB
–28	–0.26 dB	(7)_____	0.26 dB	±0.064 dB
–32	–0.40 dB	(8)_____	0.40 dB	±0.064 dB
–36	–0.40 dB	(9)_____	0.40 dB	±0.064 dB
–40	–0.40 dB	(10)_____	0.40 dB	±0.063 dB
–44	–0.57 dB	(11)_____	0.57 dB	±0.064 dB
–48	–0.57 dB	(12)_____	0.57 dB	±0.064 dB
–52	–0.57 dB	(13)_____	0.57 dB	±0.089 dB
–56	–0.57 dB	(14)_____	0.57 dB	±0.089 dB
–60	–0.57 dB	(15)_____	0.57 dB	±0.088 dB
–64	–0.66 dB	(16)_____	0.66 dB	±0.089 dB
–68	–0.66 dB	(17)_____	0.66 dB	±0.089 dB
–72	–0.66 dB	(18)_____	0.66 dB	±0.089 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–76	–0.66 dB	(19)_____	0.66 dB	±0.089 dB
–80	–0.66 dB	(20)_____	0.66 dB	±0.088 dB
–84	–1.15 dB	(21)_____	1.15 dB	±0.089 dB
Incremental Log Fidelity, Res BW ≥1 kHz dB from Ref Level				
–4	–0.4 dB	(22)_____	0.4 dB	±0.064 dB
–8	–0.4 dB	(23)_____	0.4 dB	±0.064 dB
–12	–0.4 dB	(24)_____	0.4 dB	±0.064 dB
–16	–0.4 dB	(25)_____	0.4 dB	±0.064 dB
–20	–0.4 dB	(26)_____	0.4 dB	±0.063 dB
–24	–0.4 dB	(27)_____	0.4 dB	±0.064 dB
–28	–0.4 dB	(28)_____	0.4 dB	±0.064 dB
–32	–0.4 dB	(29)_____	0.4 dB	±0.064 dB
–36	–0.4 dB	(30)_____	0.4 dB	±0.064 dB
–40	–0.4 dB	(31)_____	0.4 dB	±0.063 dB
–44	–0.4 dB	(32)_____	0.4 dB	±0.064 dB
–48	–0.4 dB	(33)_____	0.4 dB	±0.064 dB
–52	–0.4 dB	(34)_____	0.4 dB	±0.089 dB
–56	–0.4 dB	(35)_____	0.4 dB	±0.089 dB
–60	–0.4 dB	(36)_____	0.4 dB	±0.088 dB
–64	–0.4 dB	(37)_____	0.4 dB	±0.089 dB
–68	–0.4 dB	(38)_____	0.4 dB	±0.089 dB
–72	–0.4 dB	(39)_____	0.4 dB	±0.089 dB
–76	–0.4 dB	(40)_____	0.4 dB	±0.089 dB
–80	–0.4 dB	(41)_____	0.4 dB	±0.088 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Cumulative Log Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.34 dB	(43)_____	0.34 dB	±0.064 dB
–8	–0.38 dB	(44)_____	0.38 dB	±0.064 dB
–12	–0.42 dB	(45)_____	0.42 dB	±0.064 dB
–16	–0.46 dB	(46)_____	0.46 dB	±0.064 dB
–20	–0.50 dB	(47)_____	0.50 dB	±0.063 dB
–24	–0.54 dB	(48)_____	0.54 dB	±0.064 dB
–28	–0.58 dB	(49)_____	0.58 dB	±0.064 dB
–32	–0.62 dB	(50)_____	0.62 dB	±0.064 dB
–36	–0.66 dB	(51)_____	0.66 dB	±0.064 dB
–40	–0.70 dB	(52)_____	0.70 dB	±0.063 dB
–44	–0.74 dB	(53)_____	0.74 dB	±0.064 dB
–48	–0.78 dB	(54)_____	0.78 dB	±0.064 dB
–52	–0.82 dB	(55)_____	0.82 dB	±0.089 dB
–56	–0.86 dB	(56)_____	0.86 dB	±0.089 dB
–60	–0.90 dB	(57)_____	0.90 dB	±0.088 dB
–64	–0.94 dB	(58)_____	0.94 dB	±0.089 dB
–68	–0.98 dB	(59)_____	0.98 dB	±0.089 dB
–72	–1.02 dB	(60)_____	1.02 dB	±0.089 dB
–76	–1.06 dB	(61)_____	1.06 dB	±0.089 dB
–80	–1.10 dB	(62)_____	1.10 dB	±0.088 dB
–84	–1.14 dB	(63)_____	1.14 dB	±0.089 dB
–88	–1.18 dB	(64)_____	1.18 dB	±0.089 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–92	–1.22 dB	(65)_____	1.22 dB	±0.089 dB
–96	–1.26 dB	(66)_____	1.26 dB	±0.088 dB
–98	–1.28 dB	(67)_____	1.28 dB	±0.089 dB
Incremental Log Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.4 dB	(68)_____	0.4 dB	±0.064 dB
–8	–0.4 dB	(69)_____	0.4 dB	±0.064 dB
–12	–0.4 dB	(70)_____	0.4 dB	±0.064 dB
–16	–0.4 dB	(71)_____	0.4 dB	±0.064 dB
–20	–0.4 dB	(72)_____	0.4 dB	±0.063 dB
–24	–0.4 dB	(73)_____	0.4 dB	±0.064 dB
–28	–0.4 dB	(74)_____	0.4 dB	±0.064 dB
–32	–0.4 dB	(75)_____	0.4 dB	±0.064 dB
–36	–0.4 dB	(76)_____	0.4 dB	±0.064 dB
–40	–0.4 dB	(77)_____	0.4 dB	±0.063 dB
–44	–0.4 dB	(78)_____	0.4 dB	±0.064 dB
–48	–0.4 dB	(79)_____	0.4 dB	±0.064 dB
–52	–0.4 dB	(80)_____	0.4 dB	±0.089 dB
–56	–0.4 dB	(81)_____	0.4 dB	±0.089 dB
–60	–0.4 dB	(82)_____	0.4 dB	±0.088 dB
–64	–0.4 dB	(83)_____	0.4 dB	±0.089 dB
–68	–0.4 dB	(84)_____	0.4 dB	±0.089 dB
–72	–0.4 dB	(85)_____	0.4 dB	±0.089 dB
–76	–0.4 dB	(86)_____	0.4 dB	±0.089 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–80	–0.4 dB	(87)___	0.4 dB	±0.088 dB
Linear Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–2.0%	(89)_____	2.0%	±0.064%
–8	–2.0%	(90)_____	2.0%	±0.064%
–12	–2.0%	(91)_____	2.0%	±0.064%
–16	–2.0%	(92)_____	2.0%	±0.064%
–20	–2.0%	(93)_____	2.0%	±0.063%
Linear Fidelity, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–2.0%	(94)_____	2.0%	±0.064%
–8	–2.0%	(95)_____	2.0%	±0.064%
–12	–2.0%	(96)_____	2.0%	±0.064%
–16	–2.0%	(97)_____	2.0%	±0.064%
–20	–2.0%	(98)_____	2.0%	±0.063%
Zero Span, Res BW ≤300 Hz *(Option 1DR only)*				
dB from Ref Level				
–4	–0.36 dB	(99)_____	0.36 dB	±0.064 dB
–8	–0.42 dB	(100)_____	0.42 dB	±0.064 dB
–12	–0.48 dB	(101)_____	0.48 dB	±0.064 dB
–16	–0.54 dB	(102)_____	0.54 dB	±0.064 dB
–20	–0.60 dB	(103)_____	0.60 dB	±0.063 dB
–24	–0.66 dB	(104)_____	0.66 dB	±0.064 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–28	–0.72 dB	(105)_____	0.72 dB	±0.064 dB
–32	–0.78 dB	(106)_____	0.78 dB	±0.064 dB
–36	–0.84 dB	(107)_____	0.84 dB	±0.064 dB
–40	–0.90 dB	(108)_____	0.90 dB	±0.063 dB
–44	–0.96 dB	(109)_____	0.96 dB	±0.064 dB
–48	–1.02 dB	(110)_____	1.02 dB	±0.064 dB
–52	–1.08 dB	(111)_____	1.08 dB	±0.089 dB
–56	–1.14 dB	(112)_____	1.14 dB	±0.089 dB
–64	–1.5 dB	(114)_____	1.5 dB	±0.089 dB
–68	–1.5 dB	(115)_____	1.5 dB	±0.089 dB
–70	–1.5 dB	(116)_____	1.5 dB	±0.089 dB
12. Input Attenuation Switching Uncertainty				
Input Attenuation Setting				
0 dB	–0.3 dB	(1)_____	0.3 dB	±0.108 dB
5 dB	–0.3 dB	(2)_____	0.3 dB	±0.107 dB
15 dB	–0.3 dB	(3)_____	0.3 dB	±0.107 dB
20 dB	–0.3 dB	(4)_____	0.3 dB	±0.089 dB
25 dB	–0.35 dB	(5)_____	0.35 dB	±0.089 dB
30 dB	–0.40 dB	(6)_____	0.40 dB	±0.089 dB
35 dB	–0.45 dB	(7)_____	0.45 dB	±0.089 dB
40 dB	–0.50 dB	(8)_____	0.50 dB	±0.089 dB
45 dB	–0.55 dB	(9)_____	0.55 dB	±0.089 dB
50 dB	–0.60 dB	(10)_____	0.60 dB	±0.089 dB
55 dB	–0.65 dB	(11)_____	0.65 dB	±0.089 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies				
Model E4407B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
60 dB	–0.70 dB	(12)_____	0.70 dB	±0.089 dB
65 dB	–0.75 dB	(13)_____	0.75 dB	±0.089 dB
14. Reference Level Accuracy				
Log, Res BW ≥1 kHz				
Reference Level				
–10	–0.3 dB	(1)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(2)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(3)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(4)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(5)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(6)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(7)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(8)_____	0.7 dB	±0.156 dB
Linear, Res BW ≥1 kHz				
Reference Level				
–10	–0.3 dB	(9)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(10)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(11)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(12)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(13)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(14)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(15)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(16)_____	0.7 dB	±0.156 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Log, Res BW ≤300 Hz *(Option 1DR only)*				
Reference Level				
–10	–0.3 dB	(17)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(18)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(19)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(20)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(21)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(22)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(23)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(24)_____	0.7 dB	±0.156 dB
Linear, Res BW ≤300 Hz *(Option 1DR only)*				
Reference Level				
–10	–0.3 dB	(25)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(26)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(27)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(28)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(29)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(30)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(31)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(32)_____	0.7 dB	±0.156 dB
15. Resolution Bandwidth Switching Uncertainty				
Resolution Bandwidth				
3 kHz	–0.3 dB	(1)_____	0.3 dB	±0.064 dB
9 kHz	–0.3 dB	(2)_____	0.3 dB	±0.064 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
10 kHz	–0.3 dB	(3)_____	0.3 dB	±0.064 dB
30 kHz	–0.3 dB	(4)_____	0.3 dB	±0.064 dB
100 kHz	–0.3 dB	(5)_____	0.3 dB	±0.064 dB
120 kHz	–0.3 dB	(6)_____	0.3 dB	±0.064 dB
300 kHz	–0.3 dB	(7)_____	0.3 dB	±0.064 dB
1 MHz	–0.3 dB	(8)_____	0.3 dB	±0.064 dB
3 MHz	–0.3 dB	(9)_____	0.3 dB	±0.064 dB
5 MHz	–0.6 dB	(10)_____	0.6 dB	±0.083 dB
300 Hz *(Option 1DR only)*	–0.3 dB	(11)_____	0.3 dB	±0.064 dB
200 Hz *(Option 1DR only)*	–0.3 dB	(12)_____	0.3 dB	±0.064 dB
100 Hz *(Option 1DR only)*	–0.3 dB	(13)_____	0.3 dB	±0.064 dB
30 Hz *(Option 1DR only)*	–0.3 dB	(14)_____	0.3 dB	±0.064 dB
10 Hz *(Option 1DR only)*	–0.3 dB	(15)_____	0.3 dB	±0.064 dB
17. Absolute Amplitude Accuracy (Reference Settings)				
Log, Preamp Off	–0.34 dB	(1)_____	0.34 dB	±0.148 dB
Lin, Preamp Off	–0.34 dB	(2)_____	0.34 dB	±0.148 dB
Log, Preamp On	–0.37 dB	(3)_____	0.37 dB	±0.148 dB
Lin, Preamp On	–0.37 dB	(4)_____	0.37 dB	±0.148 dB
19. Overall Absolute Amplitude Accuracy				
0 dBm Reference Level				
0 dBm input	–0.54 dB	(1)_____	0.54 dB	±0.08 dB
–10 dBm input	–0.54 dB	(2)_____	0.54 dB	±0.081 dB
–20 dBm input	–0.54 dB	(3)_____	0.54 dB	±0.082 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–30 dBm input	–0.54 dB	(4)_____	0.54 dB	±0.083 dB
–40 dBm input	–0.54 dB	(5)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(6)_____	0.54 dB	±0.086 dB
–20 dBm Reference Level				
–20 dBm input	–0.54 dB	(7)_____	0.54 dB	±0.082 dB
–30 dBm input	–0.54 dB	(8)_____	0.54 dB	±0.083 dB
–40 dBm input	–0.54 dB	(9)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(10)_____	0.54 dB	±0.086 dB
–40 dBm Reference Level				
–40 dBm input	–0.54 dB	(11)_____	0.54 dB	±0.084 dB
–50 dBm input	–0.54 dB	(12)_____	0.54 dB	±0.086 dB
–50 dBm Reference Level				
–50 dBm input	–0.54 dB	(13)_____	0.54 dB	±0.086 dB
20. Resolution Bandwidth Accuracy				
Resolution Bandwidth				
5 MHz	3.5 MHz	(1)_____	6.5 MHz	±38.2 kHz
3 MHz	2.55 MHz	(2)_____	3.45 MHz	±22.9 kHz
1 MHz	0.85 MHz	(3)_____	1.15 MHz	±7.64 kHz
300 kHz	255 kHz	(4)_____	345 kHz	±2.29 kHz
100 kHz	85 kHz	(5)_____	115 kHz	±764 Hz
30 kHz	25.5 kHz	(6)_____	34.5 kHz	±229 Hz
10 kHz	8.5 kHz	(7)_____	11.5 kHz	±76.4 Hz
3 kHz	2.55 kHz	(8)_____	3.45 kHz	±22.9 Hz
1 kHz	850 Hz	(9)_____	1.15 kHz	±7.64 Hz
120 kHz	102 kHz	(10)_____	138 kHz	±154 Hz

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
9 kHz	7.65 kHz	(11)_____	10.35kHz	±11.5 Hz
23. Frequency Response	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed and installed options.			
20 to 30° C:				
Band 0 (9 kHz to 3.0 GHz				
Maximum Response		(1)_____	0.46 dB	±0.245 dB
Minimum Response	–0.46 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	0.92 dB	±0.245 dB
Band 0A (800 MHz to 1.0 GHz) (serial number US39440871 or greater)				
Maximum Response		(4)_____	0.46 dB	±0.245 dB
Minimum Response	–0.46 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	0.92 dB	±0.245 dB
Band 0B (1.7 GHz to 2.0 GHz) (serial number US39440871 or greater)				
Maximum Response		(7)_____	0.46 dB	±0.245 dB
Minimum Response	–0.46 dB	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	0.92 dB	±0.245 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Band 1 (3.0 GHz to 6.7 GHz)				
Maximum Response		(10)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(11)_____		±0.245 dB
Peak-to-Peak Response		(12)_____	2.6 dB	±0.245 dB
Band 2 (6.7 GHz to 13.2 GHz)				
Maximum Response		(13)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(14)_____		±0.245 dB
Peak-to-Peak Response		(15)_____	3.6 dB	±0.245 dB
Band 3 (13.2 GHz to 26.5 GHz)				
Maximum Response		(16)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(17)_____		±0.245 dB
Peak-to-Peak Response		(18)_____	3.6 dB	±0.245 dB
0 to 55° C:				
Band 0 (9 kHz to 3.0 GHz				
Maximum Response		(1)_____	0.76 dB	±0.245 dB
Minimum Response	–0.76 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	1.52 dB	±0.245 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Band 0A (800 MHz to 1.0 GHz) (serial number US39440871 or greater)				
Maximum Response		(4)_____	0.76 dB	±0.245 dB
Minimum Response	–0.76 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	1.52 dB	±0.245 dB
Band 0B (1.7 GHz to 2.0 GHz) (serial number US39440871 or greater)				
Maximum Response		(7)_____	0.76 dB	±0.245 dB
Minimum Response	–0.76 dB	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	1.52 dB	±0.245 dB
Band 1 (3.0 GHz to 6.7 GHz)				
Maximum Response		(10)_____	2.5 dB	±0.245 dB
Minimum Response	–2.5 dB	(11)_____		±0.245 dB
Peak-to-Peak Response		(12)_____	3.0 dB	±0.245 dB
Band 2 (6.7 GHz to 13.2 GHz)				
Maximum Response		(13)_____	3.0 dB	±0.245 dB
Minimum Response	–3.0 dB	(14)_____		±0.245 dB
Peak-to-Peak Response		(15)_____	4.0 dB	±0.245 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Band 3 (13.2 GHz to 26.5 GHz)				
Maximum Response		(16)_____	3.0 dB	±0.245 dB
Minimum Response	–3.0 dB	(17)_____		±0.245 dB
Peak-to-Peak Response		(18)_____	4.0 dB	±0.245 dB
26. Frequency Response (Preamp On) *(Option 1DS Only)*	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed and installed options.			
20 to 30° C:				
Band 0 (1 MHz to 3.0 GHz)				
Maximum Response		(1)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	3.0 dB	±0.245 dB
Band 0A (800 MHz to 1.0 GHz) (serial number US39440871 or greater)				
Maximum Response		(4)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	3.0 dB	±0.245 dB
Band 0B (1.7 GHz to 2.0 GHz) (serial number US39440871 or greater)				
Maximum Response		(7)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	3.0 dB	±0.245 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
0 to 55° C:				
Band 0 (1 MHz to 3.0 GHz)				
Maximum Response		(1)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	4.0 dB	±0.245 dB
Band 0A (800 MHz to 1.0 GHz) (serial number US39440871 or greater)				
Maximum Response		(4)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(5)_____		±0.245 dB
Peak-to-Peak Response		(6)_____	4.0 dB	±0.245 dB
Band 0B (1.7 GHz to 2.0 GHz) (serial number US39440871 or greater)				
Maximum Response		(7)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(8)_____		±0.245 dB
Peak-to-Peak Response		(9)_____	4.0 dB	±0.245 dB
28. Other Input-Related Spurious Responses				
Center Freq Input Freq				
2.0 GHz 2042.8 MHz		(1)_____	–65 dBc	±1.14 dB
2.0 GHz 2642.8 MHz		(2)_____	–65 dBc	±1.14 dB
2.0 GHz 1820.8 MHz		(3)_____	–65 dBc	±1.14 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
2.0 GHz 278.5 MHz		(4)_____	–65 dBc	±1.14 dB
2.0 GHz 5600.0 MHz		(5)_____	–80 dBc	±1.14 dB
2.0 GHz 6242.8 MHz		(6)_____	–80 dBc	±1.14 dB
4.0 GHz 4042.8 MHz		(7)_____	–65 dBc	±1.14 dB
4.0 GHz 4642.8 MHz		(8)_____	–65 dBc	±1.14 dB
4.0 GHz 3742.9 MHz		(9)_____	–65 dBc	±1.14 dB
4.0 GHz 2242.8 MHz		(10)_____	–80 dBc	±1.14 dB
9.0 GHz 9042.8 MHz		(11)_____	–65 dBc	±1.14 dB
9.0 GHz 9642.8 MHz		(12)_____	–65 dBc	±1.14 dB
9.0 GHz 9342.8 MHz		(13)_____	–65 dBc	±1.14 dB
9.0 GHz 4982.1 MHz		(14)_____	–80 dBc	±1.14 dB
15.0 GHz 15042.8 MHz		(15)_____	–65 dBc	±1.14 dB
15.0 GHz 15642.8 MHz		(16)_____	–65 dBc	±1.14 dB
15.0 GHz 18830.35 MHz		(17)_____	–65 dBc	±1.14 dB
15.0 GHz 4151.75 MHz		(18)_____	–80 dBc	±1.14 dB
21.0 GHz 21042.8 MHz		(19)_____	–65 dBc	±1.14 dB
21.0 GHz 21642.8 MHz		(20)_____	–65 dBc	±1.14 dB
21.0 GHz 21342.8 MHz		(21)_____	–65 dBc	±1.14 dB
21.0 GHz 5008.95 MHz		(22)_____	–80 dBc	±1.14 dB
31. Spurious Responses				
300 MHz TOI, 1 kHz RBW	12.5 dBm	(1)_____		±0.49 dB
300 MHz TOI, 30 Hz RBW (*Option 1DR only*)	12.5 dBm	(2)_____		±0.49 dB
5 GHz TOI	11 dBm	(3)_____		±0.589 dB
8 GHz TOI	7.5 dBm	(4)_____		±0.589 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
300 MHz SHI	35 dBm	(5)_____		±0.90 dB
900 MHz SHI	45 dBm	(6)_____		±0.90 dB
1.55 GHz SHI	75 dBm	(7)_____		±0.90 dB
3.1 GHz SHI	90 dBm	(8)_____		±0.90 dB
33. Gain Compression				
Test Frequency				
53 MHz		(1)_____	1.0 dB	±0.127 dB
50.004 MHz *(Option 1DR only)*		(2)_____	1.0 dB	±0.127 dB
1403 MHz		(3)_____	1.0 dB	±0.127 dB
2503 MHz		(4)_____	1.0 dB	±0.144 dB
4403 MHz		(5)_____	1.0 dB	±0.201 dB
7603 MHz		(6)_____	1.0 dB	±0.201 dB
14003 MHz		(7)_____	1.0 dB	±0.201 dB
37. Displayed Average Noise Level	Note: Enter results with preamp on in the appropriate section based upon the ambient temperature when the test was performed.			
1 kHz RBW, Preamp Off:				
10 MHz to 1 GHz		(1)_____	–116 dBm	±1.82 dB
1 GHz to 2 GHz		(2)_____	–116 dBm	±1.82 dB
2 GHz to 3 GHz		(3)_____	–112 dBm	±1.82 dB
3 GHz to 6 GHz		(4)_____	–112 dBm	±1.82 dB
6 GHz to 12 GHz		(5)_____	–111 dBm	±1.82 dB
12 GHz to 22 GHz		(6)_____	–107 dBm	±1.82 dB
22 GHz to 26.5 GHz		(7)_____	–106 dBm	±1.82 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
1kHz RBW, Preamp On, 0 to 55° C:				
10 MHz to 1 GHz		(8)_____	–131 dBm	±1.82 dB
1 GHz to 2 GHz		(9)_____	–131 dBm	±1.82 dB
2 GHz to 3 GHz		(10)_____	–127 dBm	±1.82 dB
10 Hz RBW, Preamp Off:				
10 MHz to 1 GHz		(11)_____	–135 dBm	±1.82 dB
1 GHz to 2 GHz		(12)_____	–135 dBm	±1.82 dB
2 GHz to 3 GHz		(13)_____	–131 dBm	±1.82 dB
3 GHz to 6 GHz		(14)_____	–131 dBm	±1.82 dB
6 GHz to 12 GHz		(15)_____	–130 dBm	±1.82 dB
12 GHz to 22 GHz		(16)_____	–126 dBm	±1.82 dB
22 GHz to 26.5 GHz		(17)_____	–125 dBm	±1.82 dB
10 Hz RBW, Preamp On, 0 to 55° C:				
10 MHz to 1 GHz		(18)_____	–150 dBm	±1.82 dB
1 GHz to 2 GHz		(19)_____	–150 dBm	±1.82 dB
2 GHz to 3 GHz		(20)_____	–146 dBm	±1.82 dB
1kHz RBW, Preamp On, 20 to 30° C:				
10 MHz to 1 GHz		(21)_____	–132 dBm	±1.82 dB
1 GHz to 2 GHz		(22)_____	–132 dBm	±1.82 dB
2 GHz to 3 GHz		(23)_____	–130 dBm	±1.82 dB
10 Hz RBW, Preamp On, 20 to 30° C:				
10 MHz to 1 GHz		(24)_____	–151 dBm	±1.82 dB
1 GHz to 2 GHz		(25)_____	–151 dBm	±1.82 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
2 GHz to 3 GHz		(26)_____	–149 dBm	±1.82 dB
38. Residual Responses				
150 kHz to 6.7 GHz		(1)_____	–90 dBm	±0.93 dB
39. Fast Time Domain Amplitude Accuracy *(Option AYX only)*				
Amplitude Error	–0.3%	(1)_____	0.3%	±0.029%
41. Tracking Generator Absolute Amplitude and Vernier Accuracy				
Absolute Amplitude Accuracy	–0.75 dB	(1)_____	0.75 dB	±0.087 dB
Vernier Accuracy, –2 dB	–0.4 dB	(2)_____	0.4 dB	±0.11 dB
Vernier Accuracy, –3 dB	–0.5 dB	(3)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –5 dB	–0.5 dB	(4)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –6 dB	–0.5 dB	(5)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –7 dB	–0.5 dB	(6)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –8 dB	–0.5 dB	(7)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –9 dB	–0.5 dB	(8)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –10 dB	–0.5 dB	(9)_____	0.5 dB	±0.16 dB
43. Tracking Generator Output Level Flatness				
Positive Level Flatness, <1 MHz		(1)_____	3.0 dB	±0.255 dB
Negative Level Flatness, <1 MHz	–3.0 dB	(2)_____		±0.255 dB
Positive Level Flatness, 1 MHz to 10 MHz		(3)_____	3.0 dB	±0.145 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Negative Level Flatness, 1 MHz to 10 MHz	–3.0 dB	(4)_____		±0.145 dB
Positive Level Flatness, >10 MHz to 1.5 GHz		(5)_____	2.0 dB	±0.122 dB
Negative Level Flatness, >10 MHz to 1.5 GHz	–2.0 dB	(6)_____		±0.122 dB
Positive Level Flatness, >1.5 GHz		(7)_____	2.0 dB	±0.172 dB
Negative Level Flatness, >1.5 GHz	–2.0 dB	(8)_____		±0.172 dB
45. Tracking Generator Harmonic Spurious Outputs *(Option 1DN only)*				
2nd Harmonic, <20 kHz		(1)_____	–15 dBc	±2.6 dB
2nd Harmonic, ≥20 kHz		(2)_____	–25 dBc	±2.6 dB
3rd Harmonic, <20 kHz		(3)_____	–15 dBc	±2.6 dB
3rd Harmonic, ≥20 kHz		(4)_____	–25 dBc	±2.6 dB
47. Tracking Generator Non-Harmonic Spurious Outputs *(Option 1DN only)*				
Highest Non-Harmonic Spurious Output Amplitude, 9 kHz to 2 GHz		(1)_____	–27 dBc	±2.67 dB
Highest Non-Harmonic Spurious Output Amplitude, 2 GHz to 3 GHz		(2)_____	–23 dBc	±3.12 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
48. Tracking Generator LO Feedthrough Amplitude *(Option 1DN only)*				
9 kHz to 2.9 GHz		(1)_____	–16 dBm	±1.94 dB
2.9 GHz to 3.0 GHz		(2)_____	–16 dBm	±2.49 dB
49. Gate Delay and Gate Length Accuracy *(Option 1D6 only)*				
Minimum Gate Delay	499.9 ns	(1)_____	1.5001µs	±475 ps
Maximum Gate Delay	499.9 ns	(2)_____	1.5001µs	±475 ps
1 µs Gate Length	499.9 ns	(3)_____	1.5001µs	±450 ps
65 ms Gate Length	64.993ms	(4)_____	65.007ms	±561 ns
50. Gate Mode Amplitude Error *(Option 1D6 only)*				
Amplitude Error	–0.2 dB	(1)_____	0.2 dB	±0.023 dB
51. First LO Output Amplitude Accuracy *(Option AYZ only)* 20 to 30° C	Note: Enter data in the appropriate section based upon the ambient temperature at which the test was performed.			
First LO Frequency				
2.9 GHz	15.5 dBm	(1)_____	17.0 dBm	±0.357 dB
3.1 GHz	15.5 dBm	(2)_____	17.0 dBm	±0.357 dB
3.3 GHz	15.5 dBm	(3)_____	17.0 dBm	±0.357 dB
3.5 GHz	15.5 dBm	(4)_____	17.0 dBm	±0.357 dB
3.7 GHz	15.5 dBm	(5)_____	17.0 dBm	±0.357 dB
3.9 GHz	15.5 dBm	(6)_____	17.0 dBm	±0.357 dB
4.1 GHz	15.5 dBm	(7)_____	17.0 dBm	±0.357 dB
4.3 GHz	15.5 dBm	(8)_____	17.0 dBm	±0.357 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
4.5 GHz	15.5 dBm	(9)_____	17.0 dBm	±0.357 dB
4.7 GHz	15.5 dBm	(10)_____	17.0 dBm	±0.357 dB
4.9 GHz	15.5 dBm	(11)_____	17.0 dBm	±0.357 dB
5.1 GHz	15.5 dBm	(12)_____	17.0 dBm	±0.357 dB
5.3 GHz	15.5 dBm	(13)_____	17.0 dBm	±0.357 dB
5.5 GHz	15.5 dBm	(14)_____	17.0 dBm	±0.357 dB
5.7 GHz	15.5 dBm	(15)_____	17.0 dBm	±0.357 dB
5.9 GHz	15.5 dBm	(16)_____	17.0 dBm	±0.357 dB
6.1 GHz	15.5 dBm	(17)_____	17.0 dBm	±0.357 dB
6.3 GHz	13.0 dBm	(18)_____	17.5 dBm	±0.357 dB
6.5 GHz	13.0 dBm	(19)_____	17.5 dBm	±0.357 dB
6.7 GHz	13.0 dBm	(20)_____	17.5 dBm	±0.357 dB
6.9 GHz	13.0 dBm	(21)_____	17.5 dBm	±0.357 dB
7.1 GHz	13.0 dBm	(22)_____	17.5 dBm	±0.357 dB
0 to 55° C First LO Frequency				
2.9 GHz	15.0 dBm	(1)_____	17.5 dBm	±0.357 dB
3.1 GHz	15.0 dBm	(2)_____	17.5 dBm	±0.357 dB
3.3 GHz	15.0 dBm	(3)_____	17.5 dBm	±0.357 dB
3.5 GHz	15.0 dBm	(4)_____	17.5 dBm	±0.357 dB
3.7 GHz	15.0 dBm	(5)_____	17.5 dBm	±0.357 dB
3.9 GHz	15.0 dBm	(6)_____	17.5 dBm	±0.357 dB
4.1 GHz	15.0 dBm	(7)_____	17.5 dBm	±0.357 dB
4.3 GHz	15.0 dBm	(8)_____	17.5 dBm	±0.357 dB
4.5 GHz	15.0 dBm	(9)_____	17.5 dBm	±0.357 dB
4.7 GHz	15.0 dBm	(10)_____	17.5 dBm	±0.357 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
4.9 GHz	15.0 dBm	(11)_____	17.5 dBm	±0.357 dB
5.1 GHz	15.0 dBm	(12)_____	17.5 dBm	±0.357 dB
5.3 GHz	15.0 dBm	(13)_____	17.5 dBm	±0.357 dB
5.5 GHz	15.0 dBm	(14)_____	17.5 dBm	±0.357 dB
5.7 GHz	15.0 dBm	(15)_____	17.5 dBm	±0.357 dB
5.9 GHz	15.0 dBm	(16)_____	17.5 dBm	±0.357 dB
6.1 GHz	15.0 dBm	(17)_____	17.5 dBm	±0.357 dB
6.3 GHz	13.0 dBm	(18)_____	17.5 dBm	±0.357 dB
6.5 GHz	13.0 dBm	(19)_____	17.5 dBm	±0.357 dB
6.7 GHz	13.0 dBm	(20)_____	17.5 dBm	±0.357 dB
6.9 GHz	13.0 dBm	(21)_____	17.5 dBm	±0.357 dB
7.1 GHz	13.0 dBm	(22)_____	17.5 dBm	±0.357 dB
52. IF Input Accuracy, *(Option AYZ only)*	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed.			
20 to 30° C:				
IF Input Accuracy	–1.0 dB	(1)_____	1.0 dBm	±0.23 dB
0 to 50° C:				
IF Input Accuracy	–1.5 dB	(1)_____	1.5 dBm	±0.23 dB
55. cdmaOne Modulation Accuracy (Rho) *(Option BAC only)*	–0.0015 dB	(1)_____	0.0015 dB	0.00010
56. cdmaOne Modulation Accuracy - EVM *(Option BAC only)*	–1.1%	(1)_____	+1.1%	0.12%

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
57. cdmaOne Code Domain Power *(Option BAC only)*	–0.20 dB	(1)_____	0.20 dB	
58. GSM Phase and Frequency Accuracy *(Option BAH and B7E)*				
Peak	–2.1 Deg	(1)_____	2.1 Deg	0.24 Deg.
RMS (Avg >10)	–1.1 Deg	(2)_____	2.1 Deg	0.24 Deg.
59. Comms Absolute Accuracy *(Options BAC or BAH)*				
cdmaOne *(Option BAC only)*				
Channel Power Accuracy (Option BAC only)				
Cellular Bands				
30 dBm to –5 dBm				
20 to 30° C	–0.80 dB	(1)_____	0.80 dB	±0.19 dB
–5 dBm to –25 dBm				
20 to 30° C	–0.77 dB	(2)_____	0.77 dB	±0.19 dB
–25 dBm to –45 dBm				
20 to 30° C	–0.65 dB	(3)_____	0.65 dB	±0.19 dB
–45 dBm to –55 dBm				
20 to 30° C	–0.72 dB	(4)_____	0.72 dB	±0.19 dB
–55 dBm to –70 dBm				
20 to 30° C	–0.86 dB	(5)_____	0.86 dB	±0.19 dB
PCS Bands				
30 dBm to –5 dBm				

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
20 to 30° C	–0.70 dB	(6)_____	0.70 dB	±0.19 dB
–5 dBm to –25 dBm				
20 to 30° C	–0.67 dB	(7)_____	0.67 dB	±0.19 dB
–25 dBm to –45 dBm				
20 to 30° C	–0.66 dB	(8)_____	0.66 dB	±0.19 dB
–45 dBm to –55 dBm				
20 to 30° C	–0.73 dB	(9)_____	0.73 dB	±0.19 dB
–55 dBm to –70 dBm				
20 to 30° C	–0.87 dB	(10)_____	0.87 dB	±0.19 dB
Receive Channel Power Accuracy				
Preamp Off				
Cellular Band				
30 to 0 dBm	–1.07 dB	(11)_____	1.07 dB	±0.24 dB
0 to –85 dBm	±1.64 dB	(12)_____	1.64 dB	±0.24 dB
PCS Bands				
30 to 0 dBm	–0.86 dB	(13)_____	0.86 dB	0.24 dB
0 to –85 dBm	–1.76 dB	(14)_____	1.76 dB	0.24 dB
Preamp On				
Cellular Band				
30 to –80 dBm	–2.96 dB	(15)_____	2.96 dB	0.24 dB
–80 to –100 dBm	–4.07 dB	(16)_____	4.07 dB	0.24 dB
PCS Band				
30 to –80 dBm	–2.14 dB	(17)_____	2.14 dB	0.24 dB
–80 to –100 dBm	–3.37 dB	(18)_____	3.37 dB	0.24 dB

Table 3-12 E4407B Performance Verification Test Record

Agilent Technologies

Model E4407B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
P-GSM, E-GSM, and R-GSM Bands				
Transmit Power Accuracy				
Cellular Bands				
30 dBm to -20 dBm				
20 to 30° C	–0.81 dB	(19)_____	0.81 dB	±0.19 dB
–20 dBm to -30 dBm				
20 to 30° C	–0.74 dB	(20)_____	0.74 dB	±0.19 dB
–30 dBm to –40 dBm				
20 to 30° C	–0.79 dB	(21)_____	0.79 dB	±0.19 dB
–40 dBm to –50 dBm				
20 to 30° C	–0.95 dB	(22)_____	0.95 dB	±0.19 dB
–50 dBm to –60 dBm				
20 to 30° C	–1.09 dB	(23)_____	1.09 dB	±0.19 dB
DCS 1800 and PCS 1900 Bands				
30 dBm to –20 dBm				
20 to 30° C	–0.68 dB	(24)_____	0.68 dB	±0.19 dB
–20 dBm to –30 dBm				
20 to 30° C	–0.61 dB	(25)_____	0.61 dB	±0.19 dB
–30 dBm to –40 dBm				
20 to 30° C	–0.66 dB	(26)_____	0.66 dB	±0.19 dB
–40 dBm to –50 dBm				
20 to 30° C	–0.82 dB	(27)_____	0.82 dB	±0.19 dB
–50 dBm to –60 dBm				
20 to 30° C	–0.96 dB	(28)_____	0.96 dB	±0.19 dB

Agilent E4408B Performance Verification Test Record

Only the tests for E4408B are included in this test record, therefore not all test numbers a re included.

Table 3-13 E4408B Performance Verification Test Record

Agilent Technologies

Address: _____ Report No. _____

_____ Date _____

_____

Model E4408B

Serial No. _____ Ambient temperature _____° C

Options _____ Power mains line frequency _____ Hz (nominal)

Firmware Revision _____ Relative humidity _____%

Customer _____ Tested by _____

Test Equipment Used:

Description	Model No.	Trace No.	Cal Due Date
Synthesized Signal Generator	_____	_____	_____
Synthesized Sweeper #1	_____	_____	_____
Synthesized Sweeper #2	_____	_____	_____
Function Generator	_____	_____	_____
Power Meter, Dual-Channel	_____	_____	_____
RF Power Sensor #1	_____	_____	_____
RF Power Sensor #2	_____	_____	_____
Microwave Power Sensor	_____	_____	_____
Low-Power Power Sensor	_____	_____	_____
Digital Multimeter	_____	_____	_____
Universal Counter	_____	_____	_____
Frequency Standard	_____	_____	_____
Power Splitter	_____	_____	_____
50 Ω Termination	_____	_____	_____

Table 3-13 E4408B Performance Verification Test Record

1 dB Step Attenuator	_____	_____	_____
10 dB Step Attenuator	_____	_____	_____
6 dB Fixed Attenuator	_____	_____	_____
Microwave Spectrum Analyzer *(Option 1DN only)*	_____	_____	_____
Notes/comments:	_____		

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No.** _____

Serial No. _____ **Date** _____

Test Description		Minimum	Results Measured	Maximum	Measurement Uncertainty
1. 10 MHz Reference Output Accuracy					
Settability		–5.0 Hz	(1)_____	5.0 Hz	±293.3 μHz
4. Frequency Readout Accuracy and Marker Count Accuracy					
Frequency Readout Accuracy					
Center Freq	Span				
1500 MHz	20 MHz	1499.83 MHz	(1)_____	1500.17 MHz	±0 Hz
1500 MHz	10 MHz	1499.91 MHz	(2)_____	1500.09 MHz	±0 Hz
1500 MHz	1 MHz	1499.991 MHz	(3)_____	1500.009 MHz	±0 Hz
4000 MHz	20 MHz	3999.83 MHz	(4)_____	4000.17 MHz	±0 Hz
4000 MHz	10 MHz	3999.91 MHz	(5)_____	4000.09 MHz	±0 Hz
4000 MHz	1 MHz	3999.991 MHz	(6)_____	4000.009 MHz	±0 Hz
9000 MHz	20 MHz	8999.83 MHz	(7)_____	9000.17 MHz	±0 Hz
9000 MHz	10 MHz	8999.91 MHz	(8)_____	9000.09 MHz	±0 Hz
9000 MHz	1 MHz	8999.991 MHz	(9)_____	9000.009 MHz	±0 Hz

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No.** _____

Serial No. _____ **Date** _____

Test Description		Minimum	Results Measured	Maximum	Measurement Uncertainty
16000 MHz	20 MHz	15999.83 MHz	(10)_____	16000.17 MHz	±0 Hz
16000 MHz	10 MHz	15999.91 MHz	(11)_____	16000.09 MHz	±0 Hz
16000 MHz	1 MHz	15999.991 MHz	(12)_____	16000.009 MHz	±0 Hz
21000 MHz	20 MHz	20999.83 MHz	(13)_____	21000.17 MHz	±0 Hz
21000 MHz	10 MHz	20999.91 MHz	(14)_____	21000.09 MHz	±0 Hz
21000 MHz	1 MHz	20999.991 MHz	(15)_____	21000.009 MHz	±0 Hz
Marker Count Accuracy		Note: Enter results in the appropriate section below based upon the firmware revision of the analyzer.			
Firmware Revision Prior to A.03.00					
Center Freq	Span				
1500 MHz	10 MHz	1499.999998 MHz	(16)_____	1500.000002 MHz	±0 Hz
1500 MHz	1 MHz	1499.999998 MHz	(17)_____	1500.000002 MHz	±0 Hz
4000 MHz	10 MHz	3999.999998 MHz	(18)_____	4000.000002 MHz	±0 Hz
4000 MHz	1 MHz	3999.999998 MHz	(19)_____	4000.000002 MHz	±0 Hz
9000 MHz	10 MHz	8999.999997 MHz	(20)_____	9000.000003 MHz	±0 Hz
9000 MHz	1 MHz	8999.999997 MHz	(21)_____	9000.000003 MHz	±0 Hz
16000 MHz	10 MHz	15999.999995 MHz	(22)_____	16000.000005 MHz	±0 Hz

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
16000 MHz 1 MHz	20999.999995 MHz	(23)_____	21000.000005 MHz	±0 Hz
21000 MHz 10 MHz	20999.999995 MHz	(24)_____	21000.000005 MHz	±0 Hz
21000 MHz 1 MHz	20999.999995 MHz	(25)_____	21000.000005 MHz	±0 Hz
Firmware Revision A.03.00 or later				
Center Freq Span				
1500 MHz 10 MHz	1499.999999 MHz	(16)_____	1500.000001 MHz	±0 Hz
1500 MHz 1 MHz	1499.999999 MHz	(17)_____	1500.000001 MHz	±0 Hz
4000 MHz 10 MHz	3999.999999 MHz	(18)_____	4000.000001 MHz	±0 Hz
4000 MHz 1 MHz	3999.999999 MHz	(19)_____	4000.000001 MHz	±0 Hz
9000 MHz 10 MHz	8999.999999 MHz	(20)_____	9000.000001 MHz	±0 Hz
9000 MHz 1 MHz	8999.999999 MHz	(21)_____	9000.000001 MHz	±0 Hz
16000 MHz 10 MHz	15999.999999 MHz	(22)_____	16000.000001 MHz	±0 Hz
16000 MHz 1 MHz	20999.999999 MHz	(23)_____	21000.000001 MHz	±0 Hz
21000 MHz 10 MHz	20999.999999 MHz	(24)_____	21000.000001 MHz	±0 Hz
21000 MHz 1 MHz	20999.999999 MHz	(25)_____	21000.000001 MHz	±0 Hz

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
6. Frequency Span Readout Accuracy				
Span Start Freq				
3000 MHz 0 Hz	2370 MHz	(1)_____	2430 MHz	±6.12 MHz
100 MHz 10 MHz	79 MHz	(2)_____	81 MHz	±204 kHz
100 kHz 10 MHz	79 kHz	(3)_____	81 kHz	±204 Hz
100 MHz 800 MHz	79 MHz	(4)_____	81 MHz	±204 kHz
100 kHz 800 MHz	79 kHz	(5)_____	81 kHz	±204 Hz
100 MHz 1400 MHz	79 MHz	(6)_____	81 MHz	±204 kHz
100 kHz 1499 MHz	79 kHz	(7)_____	81 kHz	±204 Hz
7. Noise Sidebands				
Offset from 1 GHz signal				
10 kHz		(1)_____	–90 dBc/Hz[a]	±1.154 dB
20 kHz		(2)_____	–100 dBc/Hz[a]	±1.154 dB
30 kHz		(3)_____	–106 dBc/Hz[a]	±1.154 dB
100 kHz		(4)_____	–119 dBc/Hz[a]	±1.154 dB
	[a] Add +20 Log (N) for frequencies > 6.7 GHz.			
8. System Related Sidebands				
Offset from 500 MHz signal				
30 kHz to 230 kHz		(1)_____	–65 dBc	±1.154 dB
–30 kHz to –230 kHz		(2)_____	–65 dBc	±1.154 dB

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
9. Residual FM				
1 kHz Res BW		(1)_____	150 Hz	±9.24 Hz
10. Sweep Time Accuracy				
Sweep Time				
5 ms	–1.0%	(1)_____	±1.0%	±0.28%
20 ms	–1.0%	(2)_____	±1.0%	±0.28%
100 ms	–1.0%	(3)_____	±1.0%	±0.28%
1 s	–1.0%	(4)_____	±1.0%	±0.28%
10 s	–1.0%	(5)_____	±1.0%	±0.28%
11. Display Scale Fidelity				
Cumulative Log Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–0.34 dB	(1)_____	0.34 dB	±0.064 dB
–8	–0.38 dB	(2)_____	0.38 dB	±0.064 dB
–12	–0.42 dB	(3)_____	0.42 dB	±0.064 dB
–16	–0.46 dB	(4)_____	0.46 dB	±0.064 dB
–20	–0.50 dB	(5)_____	0.50 dB	±0.063 dB
–24	–0.54 dB	(6)_____	0.54 dB	±0.064 dB
–28	–0.58 dB	(7)_____	0.58 dB	±0.064 dB
–32	–0.62 dB	(8)_____	0.62 dB	±0.064 dB
–36	–0.66 dB	(9)_____	0.66 dB	±0.064 dB
–40	–0.70 dB	(10)_____	0.70 dB	±0.063 dB
–44	–0.74 dB	(11)_____	0.74 dB	±0.064 dB
–48	–0.78 dB	(12)_____	0.78 dB	±0.064 dB
–52	–0.82 dB	(13)_____	0.82 dB	±0.089 dB

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No. _____**

Serial No. _____ **Date _____**

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–56	–0.86 dB	(14)_____	0.86 dB	±0.089 dB
–60	–0.90 dB	(15)_____	0.90 dB	±0.088 dB
–64	–0.94 dB	(16)_____	0.94 dB	±0.089 dB
–68	–0.98 dB	(17)_____	0.98 dB	±0.089 dB
–72	–1.02 dB	(18)_____	1.02 dB	±0.089 dB
–76	–1.06 dB	(19)_____	1.06 dB	±0.089 dB
–80	–1.10 dB	(20)_____	1.10 dB	±0.088 dB
–84	–1.14 dB	(21)_____	1.14 dB	±0.089 dB
Incremental Log Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–0.4 dB	(22)_____	0.4 dB	±0.064 dB
–8	–0.4 dB	(23)_____	0.4 dB	±0.064 dB
–12	–0.4 dB	(24)_____	0.4 dB	±0.064 dB
–16	–0.4 dB	(25)_____	0.4 dB	±0.064 dB
–20	–0.4 dB	(26)_____	0.4 dB	±0.063 dB
–24	–0.4 dB	(27)_____	0.4 dB	±0.064 dB
–28	–0.4 dB	(28)_____	0.4 dB	±0.064 dB
–32	–0.4 dB	(29)_____	0.4 dB	±0.064 dB
–36	–0.4 dB	(30)_____	0.4 dB	±0.064 dB
–40	–0.4 dB	(31)_____	0.4 dB	±0.063 dB
–44	–0.4 dB	(32)_____	0.4 dB	±0.064 dB
–48	–0.4 dB	(33)_____	0.4 dB	±0.064 dB
–52	–0.4 dB	(34)_____	0.4 dB	±0.089 dB
–56	–0.4 dB	(35)_____	0.4 dB	±0.089 dB
–60	–0.4 dB	(36)_____	0.4 dB	±0.088 dB

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–64	–0.4 dB	(37)_____	0.4 dB	±0.089 dB
–68	–0.4 dB	(38)_____	0.4 dB	±0.089 dB
–72	–0.4 dB	(39)_____	0.4 dB	±0.089 dB
–76	–0.4 dB	(40)_____	0.4 dB	±0.089 dB
–80	–0.4 dB	(41)_____	0.4 dB	±0.088 dB
Linear Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–2.0%	(89)_____	2.0%	±0.064%
–8	–2.0%	(90)_____	2.0%	±0.064%
–12	–2.0%	(91)_____	2.0%	±0.064%
–16	–2.0%	(92)_____	2.0%	±0.064%
–20	–2.0%	(93)_____	2.0%	±0.063%
12. Input Attenuation Switching Uncertainty				
Input Attenuation Setting				
0 dB	–0.3 dB	(1)_____	0.3 dB	±0.108 dB
5 dB	–0.3 dB	(2)_____	0.3 dB	±0.107 dB
15 dB	–0.3 dB	(3)_____	0.3 dB	±0.107 dB
20 dB	–0.3 dB	(4)_____	0.3 dB	±0.089 dB
25 dB	–0.35 dB	(5)_____	0.35 dB	±0.089 dB
30 dB	–0.40 dB	(6)_____	0.40 dB	±0.089 dB
35 dB	–0.45 dB	(7)_____	0.45 dB	±0.089 dB
40 dB	–0.50 dB	(8)_____	0.50 dB	±0.089 dB
45 dB	–0.55 dB	(9)_____	0.55 dB	±0.089 dB
50 dB	–0.60 dB	(10)_____	0.60 dB	±0.089 dB

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No. _____**

Serial No. _____ **Date _____**

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
55 dB	–0.65 dB	(11)_____	0.65 dB	±0.089 dB
60 dB	–0.70 dB	(12)_____	0.70 dB	±0.089 dB
65 dB	–0.75 dB	(13)_____	0.75 dB	±0.089 dB
4. Reference Level Accuracy				
Log				
Reference Level				
–10	–0.3 dB	(1)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(2)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(3)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(4)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(5)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(6)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(7)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(8)_____	0.7 dB	±0.156 dB
Linear				
Reference Level				
–10	–0.3 dB	(9)_____	0.3 dB	±0.144 dB
0	–0.3 dB	(10)_____	0.3 dB	±0.144 dB
–30	–0.3 dB	(11)_____	0.3 dB	±0.144 dB
–40	–0.3 dB	(12)_____	0.3 dB	±0.144 dB
–50	–0.5 dB	(13)_____	0.5 dB	±0.156 dB
–60	–0.5 dB	(14)_____	0.5 dB	±0.156 dB
–70	–0.5 dB	(15)_____	0.5 dB	±0.156 dB
–80	–0.7 dB	(16)_____	0.7 dB	±0.156 dB

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
15. Resolution Bandwidth Switching Uncertainty				
Resolution Bandwidth				
3 kHz	–0.3 dB	(1)_____	0.3 dB	±0.064 dB
9 kHz	–0.3 dB	(2)_____	0.3 dB	±0.064 dB
10 kHz	–0.3 dB	(3)_____	0.3 dB	±0.064 dB
30 kHz	–0.3 dB	(4)_____	0.3 dB	±0.064 dB
100 kHz	–0.3 dB	(5)_____	0.3 dB	±0.064 dB
120 kHz	–0.3 dB	(6)_____	0.3 dB	±0.064 dB
300 kHz	–0.3 dB	(7)_____	0.3 dB	±0.064 dB
1 MHz	–0.3 dB	(8)_____	0.3 dB	±0.064 dB
3 MHz	–0.3 dB	(9)_____	0.3 dB	±0.064 dB
5 MHz	–0.6 dB	(10)_____	0.6 dB	±0.083 dB
17. Absolute Amplitude Accuracy (Reference Settings)				
Log, Preamp Off	–0.4 dB	(1)_____	0.4 dB	±0.148 dB
Lin, Preamp Off	–0.4 dB	(2)_____	0.4 dB	±0.148 dB
19. Overall Absolute Amplitude Accuracy				
0 dBm Reference Level				
0 dBm input	–0.6 dB	(1)_____	0.6 dB	±0.08 dB
–10 dBm input	–0.6 dB	(2)_____	0.6 dB	±0.081 dB
–20 dBm input	–0.6 dB	(3)_____	0.6 dB	±0.082 dB
–30 dBm input	–0.6 dB	(4)_____	0.6 dB	±0.083 dB
–40 dBm input	–0.6 dB	(5)_____	0.6 dB	±0.084 dB
–50 dBm input	–0.6 dB	(6)_____	0.6 dB	±0.086 dB

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No. _____**

Serial No. _____ **Date _____**

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–20 dBm Reference Level				
–20 dBm input	–0.6 dB	(7)_____	0.6 dB	±0.082 dB
–30 dBm input	–0.6 dB	(8)_____	0.6 dB	±0.083 dB
–40 dBm input	–0.6 dB	(9)_____	0.6 dB	±0.084 dB
–50 dBm input	–0.6 dB	(10)_____	0.6 dB	±0.086 dB
–40 dBm Reference Level				
–40 dBm input	–0.6 dB	(11)_____	0.6 dB	±0.084 dB
–50 dBm input	–0.6 dB	(12)_____	0.6 dB	±0.086 dB
–50 dBm Reference Level				
–50 dBm input	–0.6 dB	(13)_____	0.6 dB	±0.086 dB
10. **Resolution Bandwidth Accuracy**				
Resolution Bandwidth				
5 MHz	3.5 MHz	(1)_____	6.5 MHz	±38.2 kHz
3 MHz	2.55 MHz	(2)_____	3.45 MHz	±22.9 kHz
1 MHz	0.85 MHz	(3)_____	1.15 MHz	±7.64 kHz
300 kHz	255 kHz	(4)_____	345 kHz	±2.29 kHz
100 kHz	85 kHz	(5)_____	115 kHz	±764 Hz
30 kHz	25.5 kHz	(6)_____	34.5 kHz	±229 Hz
10 kHz	8.5 kHz	(7)_____	11.5 kHz	±76.4 Hz
3 kHz	2.55 kHz	(8)_____	3.45 kHz	±22.9 Hz
1 kHz	850 Hz	(9)_____	1.15 kHz	±7.64 Hz
120 kHz	102 kHz	(10)_____	138 kHz	±154 Hz
9 kHz	7.65 kHz	(11)_____	10.35kHz	±11.5 Hz

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
24. Frequency Response	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed and installed options.			
20 to 30° C:				
Band 0 (9 kHz to 3.0 GHz				
Maximum Response		(1)_____	0.50 dB	±0.245 dB
Minimum Response	–0.50 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	1.0 dB	±0.245 dB
Band 1 (3.0 GHz to 6.7 GHz)				
Maximum Response		(10)_____	1.5 dB	±0.245 dB
Minimum Response	–1.5 dB	(11)_____		±0.245 dB
Peak-to-Peak Response		(12)_____	2.6 dB	±0.245 dB
Band 2 (6.7 GHz to 13.2 GHz)				
Maximum Response		(13)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(14)_____		±0.245 dB
Peak-to-Peak Response		(15)_____	3.6 dB	±0.245 dB
Band 3 (13.2 GHz to 26.5 GHz)				
Maximum Response		(16)_____	2.0 dB	±0.245 dB
Minimum Response	–2.0 dB	(17)_____		±0.245 dB
Peak-to-Peak Response		(18)_____	3.6 dB	±0.245 dB

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No. _____**

Serial No. _____ **Date _____**

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
0 to 55° C:				
Band 0 (9 kHz to 3.0 GHz				
Maximum Response		(1)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	2.0 dB	±0.245 dB
Band 1 (3.0 GHz to 6.7 GHz)				
Maximum Response		(10)_____	2.5 dB	±0.245 dB
Minimum Response	–2.5 dB	(11)_____		±0.245 dB
Peak-to-Peak Response		(12)_____	3.0 dB	±0.245 dB
Band 2 (6.7 GHz to 13.2 GHz)				
Maximum Response		(13)_____	3.0 dB	±0.245 dB
Minimum Response	–3.0 dB	(14)_____		±0.245 dB
Peak-to-Peak Response		(15)_____	4.0 dB	±0.245 dB
Band 3 (13.2 GHz to 26.5 GHz)				
Maximum Response		(16)_____	3.0 dB	±0.245 dB
Minimum Response	–3.0 dB	(17)_____		±0.245 dB
Peak-to-Peak Response		(18)_____	4.0 dB	±0.245 dB

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
28. Other Input Related Spurious Responses				
Center Freq Input Freq				
2.0 GHz 2042.8 MHz		(1)_____	–65 dBc	±1.14 dB
2.0 GHz 2642.8 MHz		(2)_____	–65 dBc	±1.14 dB
2.0 GHz 1820.8 MHz		(3)_____	–65 dBc	±1.14 dB
2.0 GHz 278.5 MHz		(4)_____	–65 dBc	±1.14 dB
2.0 GHz 5600.0 MHz		(5)_____	–80 dBc	±1.14 dB
2.0 GHz 6242.8 MHz		(6)	–80 dBc	±1.14 dB
[illegible]		(7)_____	[illegible]	[illegible]
4.0 GHz 4642.8 MHz		(8)_____	–65 dBc	±1.14 dB
4.0 GHz 3742.9 MHz		(9)_____	–65 dBc	±1.14 dB
4.0 GHz 2242.8 MHz		(10)_____	–80 dBc	±1.14 dB
9.0 GHz 9042.8 MHz		(11)_____	–65 dBc	±1.14 dB
9.0 GHz 9642.8 MHz		(12)_____	–65 dBc	±1.14 dB
9.0 GHz 9342.8 MHz		(13)_____	–65 dBc	±1.14 dB
9.0 GHz 4982.1 MHz		(14)_____	–80 dBc	±1.14 dB
15.0 GHz 15042.8 MHz		(15)_____	–65 dBc	±1.14 dB
15.0 GHz 15642.8 MHz		(16)_____	–65 dBc	±1.14 dB
15.0 GHz 18830.35 MHz		(17)_____	–65 dBc	±1.14 dB
15.0 GHz 4151.75 MHz		(18)_____	–80 dBc	±1.14 dB
21.0 GHz 21042.8 MHz		(19)_____	–65 dBc	±1.14 dB
21.0 GHz 21642.8 MHz		(20)_____	–65 dBc	±1.14 dB
21.0 GHz 21342.8 MHz		(21)_____	–65 dBc	±1.14 dB
21.0 GHz 5008.95 MHz		(22)_____	–80 dBc	±1.14 dB

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
31. Spurious Responses	Note: TR Entry 2 does not apply to the E4408B.			
300 MHz TOI	7.5 dBm	(1)_____		±0.49 dB
5 GHz TOI	7.5 dBm	(3)_____		±0.589 dB
8 GHz TOI	5 dBm	(4)_____		±0.589 dB
300 MHz SHI	30 dBm	(5)_____		±0.90 dB
900 MHz SHI	40 dBm	(6)_____		±0.90 dB
1.55 GHz SHI	70 dBm	(7)_____		±0.90 dB
3.1 GHz SHI	85 dBm	(8)_____		±0.90 dB
33. Gain Compression	Note: TR Entry 2 does not apply to the E4408B.			
Test Frequency				
53 MHz		(1)_____	1.0 dB	±0.127 dB
1403 MHz		(3)_____	1.0 dB	±0.127 dB
2503 MHz		(4)_____	1.0 dB	±0.144 dB
4403 MHz		(5)_____	1.0 dB	±0.201 dB
7603 MHz		(6)_____	1.0 dB	±0.201 dB
14003 MHz		(7)_____	1.0 dB	±0.201 dB
37. Displayed Average Noise Level				
10 MHz to 1 GHz		(1)_____	–116 dBm	±1.82 dB
1 GHz to 2 GHz		(2)_____	–115 dBm	±1.82 dB
2 GHz to 3 GHz		(3)_____	–112 dBm	±1.82 dB
3 GHz to 6 GHz		(4)_____	–112 dBm	±1.82 dB
6 GHz to 12 GHz		(5)_____	–110 dBm	±1.82 dB
12 GHz to 22 GHz		(6)_____	–107 dBm	±1.82 dB
22 GHz to 26.5 GHz		(7)_____	–101 dBm	±1.82 dB

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
38. Residual Responses				
150 kHz to 6.7 GHz		(1)_____	–90 dBm	±0.93 dB
41. Tracking Generator Absolute Amplitude and Vernier Accuracy				
Absolute Amplitude Accuracy	–0.75 dB	(1)_____	0.75 dB	±0.087 dB
Vernier Accuracy, –2 dB	–0.4 dB	(2)_____	0.4 dB	±0.11 dB
Vernier Accuracy, –3 dB	–0.5 dB	(3)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –5 dB	–0.5 dB	(4)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –6 dB	–0.5 dB	(5)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –7 dB	–0.5 dB	(6)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –8 dB	–0.5 dB	(7)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –9 dB	–0.5 dB	(8)_____	0.5 dB	±0.16 dB
Vernier Accuracy, –10 dB	–0.5 dB	(9)_____	0.5 dB	±0.16 dB
43. Tracking Generator Level Flatness				
Positive Level Flatness, <1 MHz		(1)_____	3.0 dB	±0.255 dB
Negative Level Flatness, <1 MHz	–3.0 dB	(2)_____		±0.255 dB
Positive Level Flatness, 1 MHz to 10 MHz		(3)_____	3.0 dB	±0.145 dB
Negative Level Flatness, 1 MHz to 10 MHz	–3.0 dB	(4)_____		±0.145 dB
Positive Level Flatness, >10 MHz to 1.5 GHz		(5)_____	2.0 dB	±0.122 dB
Negative Level Flatness, >10 MHz to 1.5 GHz	–2.0 dB	(6)_____		±0.122 dB

Table 3-14 E4408B Performance Verification Test Record

Agilent Technologies

Model E4408B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Positive Level Flatness, >1.5 GHz		(7)_____	2.0 dB	±0.172 dB
Negative Level Flatness, >1.5 GHz	–2.0 dB	(8)_____		±0.172 dB
45. Tracking Generator Harmonic Spurious Outputs *(Option 1DN only)*				
2nd Harmonic, <20 kHz		(1)_____	–15 dBc	±2.6 dB
2nd Harmonic, ≥20 kHz		(2)_____	–25 dBc	±2.6 dB
3rd Harmonic, <20 kHz		(3)_____	–15 dBc	±2.6 dB
3rd Harmonic, ≥20 kHz		(4)_____	–25 dBc	±2.6 dB
47. Tracking Generator Non-Harmonic Spurious Outputs *(Option 1DN only)*				
Highest Non-Harmonic Spurious Output Amplitude, 9 kHz to 2 GHz		(1)_____	–27 dBc	±2.67 dB
Highest Non-Harmonic Spurious Output Amplitude, 2 GHz to 3 GHz		(2)_____	–23 dBc	±3.12 dB
48. Tracking Generator LO Feedthrough Amplitude *(Option 1DN only)*				
9 kHz to 2.9 GHz		(1)_____	–16 dBm	±1.94 dB
2.9 GHz to 3.0 GHz		(2)_____	–16 dBm	±2.49 dB

Agilent E4411B Performance Verification Test Record

Only the tests for E4411B are included in this test record, therefore not all test numbers are included.

Table 3-15 E4411B Performance Verification Test Record

Agilent Technologies

Address: _____ Report No. _____

_____ Date _____

_____

Model E4411B

Serial No. _____ Ambient temperature _____ ° C

Options _____ Power mains line frequency _____ Hz (nominal)

Firmware Revision _____ Relative humidity _____%

Customer _____ Tested by _____

Test Equipment Used:

Description	Model No.	Trace No.	Cal Due Date
Synthesized Signal Generator	_____	_____	_____
Synthesized Sweeper	_____	_____	_____
Function Generator	_____	_____	_____
Power Meter, Dual-Channel	_____	_____	_____
RF Power Sensor #1	_____	_____	_____
RF Power Sensor #2 *(Non-Option 1DP only)*	_____	_____	_____
Low-Power Power Sensor	_____	_____	_____
75Ω Power Sensor *(Option 1DP only)*	_____	_____	_____
Digital Multimeter	_____	_____	_____
Universal Counter	_____	_____	_____
Frequency Standard	_____	_____	_____
Power Splitter	_____	_____	_____

Table 3-15 E4411B Performance Verification Test Record

50Ω Termination	_____	_____	_____
Minimum Loss Pad *(Option 1DP only)*	_____	_____	_____
1 dB Step Attenuator	_____	_____	_____
10 dB Step Attenuator	_____	_____	_____
6 dB Fixed Attenuator	_____	_____	_____
20 dB Fixed Attenuator *(Option 1DS only)*			
Oscilloscope *(Option 1D6 only)*			
Notes/comments:	_____		
	_____		

Table 3-16 E4411B Performance Verification Test Record

Agilent Technologies

Model E4411B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
1. 10 MHz Reference Output Accuracy				
Settability	–5.0 Hz	(1)_____	5.0 Hz	±293.3 μHz
3. Frequency Readout Accuracy and Marker Count Accuracy				
Frequency Readout Accuracy				
Center Freq Span				
1490 MHz 20 MHz	1489.83 MHz	(1)_____	1490.17 MHz	±0 Hz
1490 MHz 10 MHz	1489.91 MHz	(2)_____	1490.09 MHz	±0 Hz
1490 MHz 1 MHz	1489.991 MHz	(3)_____	1490.009 MHz	±0 Hz
Marker Count Accuracy				
Center Freq Span				

Table 3-16 E4411B Performance Verification Test Record

Agilent Technologies

Model E4411B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
1490 MHz 10 MHz	1489.999998 MHz	(4)_____	1490.000002 MHz	±0 Hz
1490 MHz 1 MHz	1489.999998 MHz	(5)_____	1490.000002 MHz	±0 Hz
5. Frequency Span Readout Accuracy				
Span Start Freq				
1500 MHz 0 Hz	1185 MHz	(1)_____	1215 MHz	±3.06 MHz
100 MHz 10 MHz	79 MHz	(2)_____	81 MHz	±204 kHz
100 kHz 10 MHz	79 kHz	(3)_____	81 kHz	±204 Hz
100 MHz 800 MHz	79 MHz	(4)_____	81 MHz	±204 kHz
100 kHz 800 MHz	79 kHz	(5)_____	81 kHz	±204 Hz
100 MHz 1400 MHz	79 MHz	(6)_____	81 MHz	±204 kHz
100 kHz 1499 MHz	79 kHz	(7)_____	81 kHz	±204 Hz
7. Noise Sidebands				
Offset from 1 GHz signal				
10 kHz		(1)_____	–93 dBc/Hz	±1.154 dB
20 kHz		(2)_____	–100 dBc/Hz	±1.154 dB
30 kHz		(3)_____	–104 dBc/Hz	±1.154 dB
100 kHz		(4)_____	–113 dBc/Hz	±1.154 dB
8. System Related Sidebands				
Offset from 500 MHz signal				
30 kHz to 230 kHz		(1)_____	–65 dBc	±1.154 dB
–30 kHz to –230 kHz		(2)_____	–65 dBc	±1.154 dB

Table 3-16 E4411B Performance Verification Test Record

Agilent Technologies				
Model E4411B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
9. Residual FM				
1 kHz Res BW		(1)_____	150 Hz	±9.24 Hz
10. Sweep Time Accuracy				
Sweep Time				
5 ms	–1.0%	(1)_____	1.0%	±0.28%
20 ms	–1.0%	(2)_____	1.0%	±0.28%
100 ms	–1.0%	(3)_____	1.0%	±0.28%
1 s	–1.0%	(4)_____	1.0%	±0.28%
10 s	–1.0%	(5)_____	1.0%	±0.28%
11. Display Scale Fidelity				
Cumulative Log Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–0.34 dB	(1)_____	0.34 dB	±0.064 dB
–8	–0.38 dB	(2)_____	0.38 dB	±0.064 dB
–12	–0.42 dB	(3)_____	0.42 dB	±0.064 dB
–16	–0.46 dB	(4)_____	0.46 dB	±0.064 dB
–20	–0.50 dB	(5)_____	0.50 dB	±0.063 dB
–24	–0.54 dB	(6)_____	0.54 dB	±0.064 dB
–28	–0.58 dB	(7)_____	0.58 dB	±0.064 dB
–32	–0.62 dB	(8)_____	0.62 dB	±0.064 dB
–36	–0.66 dB	(9)_____	0.66 dB	±0.064 dB
–40	–0.70 dB	(10)_____	0.70 dB	±0.063 dB
–44	–0.74 dB	(11)_____	0.74 dB	±0.064 dB
–48	–0.78 dB	(12)_____	0.78 dB	±0.064 dB
–52	–0.82 dB	(13)_____	0.82 dB	±0.089 dB

Table 3-16 E4411B Performance Verification Test Record

Agilent Technologies

Model E4411B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–56	–0.86 dB	(14)_____	0.86 dB	±0.089 dB
–60	–0.90 dB	(15)_____	0.90 dB	±0.088 dB
–64	–0.94 dB	(16)_____	0.94 dB	±0.089 dB
–68	–0.98 dB	(17)_____	0.98 dB	±0.089 dB
–72	–1.02 dB	(18)_____	1.02 dB	±0.089 dB
–76	–1.06 dB	(19)_____	1.06 dB	±0.089 dB
–80	–1.10 dB	(20)_____	1.10 dB	±0.088 dB
–84	–1.14 dB	(21)_____	1.14 dB	±0.089 dB
Incremental Log Fidelity, Res BW ≥1 kHz dB from Ref Level				
–4	–0.4 dB	(22)_____	0.4 dB	±0.064 dB
–8	–0.4 dB	(23)_____	0.4 dB	±0.064 dB
–12	–0.4 dB	(24)_____	0.4 dB	±0.064 dB
–16	–0.4 dB	(25)_____	0.4 dB	±0.064 dB
–20	–0.4 dB	(26)_____	0.4 dB	±0.063 dB
–24	–0.4 dB	(27)_____	0.4 dB	±0.064 dB
–28	–0.4 dB	(28)_____	0.4 dB	±0.064 dB
–32	–0.4 dB	(29)_____	0.4 dB	±0.064 dB
–36	–0.4 dB	(30)_____	0.4 dB	±0.064 dB
–40	–0.4 dB	(31)_____	0.4 dB	±0.063 dB
–44	–0.4 dB	(32)_____	0.4 dB	±0.064 dB
–48	–0.4 dB	(33)_____	0.4 dB	±0.064 dB
–52	–0.4 dB	(34)_____	0.4 dB	±0.089 dB
–56	–0.4 dB	(35)_____	0.4 dB	±0.089 dB
–60	–0.4 dB	(36)_____	0.4 dB	±0.088 dB

Table 3-16 E4411B Performance Verification Test Record

Agilent Technologies				
Model E4411B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
–64	–0.4 dB	(37)_____	0.4 dB	±0.089 dB
–68	–0.4 dB	(38)_____	0.4 dB	±0.089 dB
–72	–0.4 dB	(39)_____	0.4 dB	±0.089 dB
–76	–0.4 dB	(40)_____	0.4 dB	±0.089 dB
–80	–0.4 dB	(41)___	0.4 dB	±0.088 dB
Linear Fidelity, Res BW ≥1 kHz				
dB from Ref Level				
–4	–2.0%	(89)_____	2.0%	±0.064%
–8	–2.0%	(90)_____	2.0%	±0.064%
–12	–2.0%	(91)_____	2.0%	±0.064%
–16	–2.0%	(92)_____	2.0%	±0.064%
–20	–2.0%	(93)_____	2.0%	±0.063%
12. Input Attenuation Switching Uncertainty				
Input Attenuation Setting				
0 dB	–0.3 dB	(1)_____	0.3 dB	±0.108 dB
5 dB	–0.3 dB	(2)_____	0.3 dB	±0.107 dB
15 dB	–0.3 dB	(3)_____	0.3 dB	±0.107 dB
20 dB	–0.3 dB	(4)_____	0.3 dB	±0.089 dB
25 dB	–0.35 dB	(5)_____	0.35 dB	±0.089 dB
30 dB	–0.40 dB	(6)_____	0.40 dB	±0.089 dB
35 dB	–0.45 dB	(7)_____	0.45 dB	±0.089 dB
40 dB	–0.50 dB	(8)_____	0.50 dB	±0.089 dB
45 dB	–0.55 dB	(9)_____	0.55 dB	±0.089 dB
50 dB	–0.60 dB	(10)_____	0.60 dB	±0.089 dB

Table 3-16 E4411B Performance Verification Test Record

Agilent Technologies

Model E4411B **Report No.** _____

Serial No. _____ **Date** _____

Test Description		Minimum	Results Measured	Maximum	Measurement Uncertainty
55 dB		–0.65 dB	(11)_____	0.65 dB	±0.089 dB
60 dB		–0.70 dB	(12)_____	0.70 dB	±0.089 dB
13. Reference Level Accuracy					
Log					
Reference Level					
50 Ω (dBm)	75 Ω (dBmV)				
–15	33.75	–0.3 dB	(1)_____	0.3 dB	±0.144 dB
–5	43.75	–0.3 dB	(2)_____	0.3 dB	±0.144 dB
–35	13.75	–0.3 dB	(3)_____	0.3 dB	±0.144 dB
–45	3.75	–0.3 dB	(4)_____	0.3 dB	±0.144 dB
–55	–6.25	–0.5 dB	(5)_____	0.5 dB	±0.156 dB
–65	–16.25	–0.5 dB	(6)_____	0.5 dB	±0.156 dB
–75	–26.25	–0.7 dB	(7)_____	0.7 dB	±0.156 dB
Linear					
Reference Level					
50Ω (dBm)	75Ω (dBmV)				
–15	33.75	–0.3 dB	(8)_____	0.3 dB	±0.144 dB
–5	43.75	–0.3 dB	(9)_____	0.3 dB	±0.144 dB
–35	13.75	–0.3 dB	(10)_____	0.3 dB	±0.144 dB
–45	3.75	–0.3 dB	(11)_____	0.3 dB	±0.144 dB
–55	–6.25	–0.5 dB	(12)_____	0.5 dB	±0.156 dB
–65	–16.25	–0.5 dB	(13)_____	0.5 dB	±0.156 dB
–75	–26.25	–0.7 dB	(14)_____	0.7 dB	±0.156 dB

Table 3-16 E4411B Performance Verification Test Record

Agilent Technologies

Model E4411B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
15. Resolution Bandwidth Switching Uncertainty				
Resolution Bandwidth				
3 kHz	–0.3 dB	(1)_____	0.3 dB	±0.064 dB
9 kHz	–0.3 dB	(2)_____	0.3 dB	±0.064 dB
10 kHz	–0.3 dB	(3)_____	0.3 dB	±0.064 dB
30 kHz	–0.3 dB	(4)_____	0.3 dB	±0.064 dB
100 kHz	–0.3 dB	(5)_____	0.3 dB	±0.064 dB
120 kHz	–0.3 dB	(6)_____	0.3 dB	±0.064 dB
300 kHz	–0.3 dB	(7)_____	0.3 dB	±0.064 dB
1 MHz	–0.3 dB	(8)_____	0.3 dB	±0.064 dB
3 MHz	–0.3 dB	(9)_____	0.3 dB	±0.064 dB
5 MHz	–0.6 dB	(10)_____	0.6 dB	±0.083 dB
16. Absolute Amplitude Accuracy (Reference Settings)				
Log, Preamp Off	–0.4 dB	(1)_____	0.4 dB	±0.148 dB
Lin, Preamp Off	–0.4 dB	(2)_____	0.4 dB	±0.148 dB
18. Overall Absolute Amplitude Accuracy				
0 dBm Reference Level				
0 dBm input	–0.6 dB	(1)_____	0.6 dB	±0.08 dB
–10 dBm input	–0.6 dB	(2)_____	0.6 dB	±0.081 dB
–20 dBm input	–0.6 dB	(3)_____	0.6 dB	±0.082 dB
–30 dBm input	–0.6 dB	(4)_____	0.6 dB	±0.083 dB
–40 dBm input	–0.6 dB	(5)_____	0.6 dB	±0.084 dB
–50 dBm input	–0.6 dB	(6)_____	0.6 dB	±0.086 dB

Table 3-16 E4411B Performance Verification Test Record

Agilent Technologies

Model E4411B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
–20 dBm Reference Level				
–20 dBm input	–0.6 dB	(7)_____	0.6 dB	±0.082 dB
–30 dBm input	–0.6 dB	(8)_____	0.6 dB	±0.083 dB
–40 dBm input	–0.6 dB	(9)_____	0.6 dB	±0.084 dB
–50 dBm input	–0.6 dB	(10)_____	0.6 dB	±0.086 dB
–40 dBm Reference Level				
–40 dBm input	–0.6 dB	(11)_____	0.6 dB	±0.084 dB
–50 dBm input	–0.6 dB	(12)_____	0.6 dB	±0.086 dB
–50 dBm Reference Level				
–50 dBm input	–0.6 dB	(13)_____	0.6 dB	±0.086 dB
20. Resolution Bandwidth Accuracy				
Resolution Bandwidth				
5 MHz	3.5 MHz	(1)_____	6.5 MHz	±38.2 kHz
3 MHz	2.55 MHz	(2)_____	3.45 MHz	±22.9 kHz
1 MHz	0.85 MHz	(3)_____	1.15 MHz	±7.64 kHz
300 kHz	255 kHz	(4)_____	345 kHz	±2.29 kHz
100 kHz	85 kHz	(5)_____	115 kHz	±764 Hz
30 kHz	25.5 kHz	(6)_____	34.5 kHz	±229 Hz
10 kHz	8.5 kHz	(7)_____	11.5 kHz	±76.4 Hz
3 kHz	2.55 kHz	(8)_____	3.45 kHz	±22.9 Hz
1 kHz	850 Hz	(9)_____	1.15 kHz	±7.64 Hz
120 kHz	102 kHz	(10)_____	138 kHz	±154 Hz
9 kHz	7.65 kHz	(11)_____	10.35 kHz	±11.5 Hz

Table 3-16 E4411B Performance Verification Test Record

Agilent Technologies				
Model E4411B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
21. Frequency Response	Note: Enter data in the appropriate section below depending upon the ambient temperature at which the test was performed and installed options.			
20 to 30° C:				
Non-Option 1DP (50 Ω) Band 0 (9 kHz to 1.5 GHz)				
Maximum Response		(1)_____	0.50 dB	±0.245 dB
Minimum Response	–0.50 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	1.0 dB	±0.245 dB
Option 1DP (75 Ω) Band 0 (1 MHz to 1.5 GHz)				
Maximum Response		(1)_____	0.50 dB	±0.245 dB
Minimum Response	–0.50 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	1.0 dB	±0.245 dB
0 to 55° C:				
Non-Option 1DP (50 Ω) Band 0 (9 kHz to 1.5 GHz)				
Maximum Response		(1)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	2.0 dB	±0.245 dB

Table 3-16 E4411B Performance Verification Test Record

Agilent Technologies

Model E4411B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
Option 1DP (75 Ω) Band 0 (1 MHz to 1.5 GHz)				
Maximum Response		(1)_____	1.0 dB	±0.245 dB
Minimum Response	–1.0 dB	(2)_____		±0.245 dB
Peak-to-Peak Response		(3)_____	2.0 dB	±0.245 dB
27. Other Input Related Spurious Responses				
Input Frequency				
542.8 MHz		(1)_____	–65 dBc	±1.08 dB
510.7 MHz		(2)_____	–65 dBc	±1.08 dB
1310.7 MHz		(3)_____	–45 dBc	±1.08 dB
29. Spurious Responses	Note: Enter the results in the appropriate lines below based upon the input impedance of the analyzer. TR Entry 2 does not apply to E4411B.			
50 MHz TOI, 50 Ω	7.5 dBm	(1)_____		±0.489 dB
50 MHz TOI, 75 Ω	56.25 dBmV	(1)_____		±0.481 dB
40 MHz SHI, 50 Ω	35 dBm	(3)_____		±1.11 dB
40 MHz SHI, 75 Ω	83.75 dBmV	(3)_____		±1.11 dB
32. Gain Compression	Note: TR Entry 2 does not apply to E4411B.			
Test Frequency				
53 MHz		(1)_____	1.0 dB	±0.127 dB
1403 MHz		(3)_____	1.0 dB	±0.127 dB
34. Displayed Average Noise Level	Note: Enter data in the appropriate section below depending upon the input impedance of the analyzer.			
50 Ω:				
400 kHz		(1)_____	–115 dBm	±1.82 dB
1 MHz to 10 MHz		(2)_____	–115 dBm	±1.82 dB

Table 3-16 E4411B Performance Verification Test Record

Agilent Technologies

Model E4411B **Report No.** _____

Serial No. _____ **Date** _____

Test Description	Minimum	Results Measured	Maximum	Measurement Uncertainty
10 MHz to 500 MHz		(3)_____	–119 dBm	±1.82 dB
500 MHz to 1 GHz		(4)_____	–117 dBm	±1.82 dB
1 GHz to 1.5 GHz		(5)_____	–113 dBm	±1.82 dB
75 Ω:				
1 MHz to 10 MHz		(21)_____	–63 dBmV	±1.82 dB
10 MHz to 500 MHz		(22)_____	–65 dBmV	±1.82 dB
500 MHz to 1 GHz		(23)_____	–60 dBmV	±1.82 dB
1 GHz to 1.5 GHz		(24)_____	–53 dBmV	±1.82 dB
38. Residual Responses	Note: Enter data in the appropriate section below depending upon the input impedance of the analyzer.			
50 Ω, 150 kHz to 1.5 GHz		(1)_____	–90 dBm	±0.90 dB
75 Ω, 1 MHz to 1.5 GHz		(1)_____	–36 dBmV	±0.90 dB
40. Tracking Generator Absolute Amplitude and Vernier Accuracy	Note: Enter data in the appropriate section below depending upon the input impedance of the analyzer.			
50 Ω *(Option 1DN)*				
Absolute Amplitude Accuracy	–0.5 dB	(1)_____	0.5 dB	±0.14 dB
Positive Vernier Accuracy		(2)_____	0.75 dB	±0.19 dB
Negative Vernier Accuracy	–0.75 dB	(3)_____		±0.19 dB
Power Sweep Accuracy		(4)_____	1.5 dB	±0.19 dB
75 Ω *(Option 1DQ)*				
Absolute Amplitude Accuracy	–1.5 dB	(1)_____	1.5 dB	±0.14 dB
Positive Vernier Accuracy		(2)_____	0.9 dB	±0.19 dB
Negative Vernier Accuracy	–0.9 dB	(3)_____		±0.19 dB

Table 3-16 E4411B Performance Verification Test Record

Agilent Technologies				
Model E4411B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
Power Sweep Accuracy		(4)_____	1.8 dB	±0.19 dB
42. Tracking Generator Level Flatness	Note: Enter data in the appropriate section below depending upon the input impedance of the analyzer.			
50Ω *(Option 1DN)*				
Positive Level Flatness, <1 MHz		(1)_____	2.0 dB	±0.588 dB
Negative Level Flatness, <1 MHz	–2.0 dB	(2)_____		±0.588 dB
Positive Level Flatness, 1 MHz to 10 MHz		(3)_____	2.0 dB	±0.281 dB
Negative Level Flatness, 1 MHz to 10 MHz	–2.0 dB	(4)_____		±0.281 dB
Positive Level Flatness, >10 MHz		(5)_____	1.5 dB	±0.202 dB
Negative Level Flatness, >10 MHz	–1.5 dB	(6)_____		±0.202 dB
75 Ω *(Option 1DQ)*				
Positive Level Flatness, 1 MHz to 10 MHz		(3)_____	2.5 dB	±0.314 dB
Negative Level Flatness, 1 MHz to 10 MHz	–2.5 dB	(4)_____		±0.314 dB
Positive Level Flatness, >10 MHz		(5)_____	2.0 dB	±0.314 dB
Negative Level Flatness, >10 MHz	–2.0 dB	(6)_____		±0.314 dB
44. Tracking Generator Harmonic Spurious Outputs *(Option 1DN or Option 1DQ only)*				
2nd Harmonic, <20 MHz		(1)_____	–20 dBc	±2.6 dB
2nd Harmonic, ≥20 MHz		(2)_____	–25 dBc	±2.6 dB

Table 3-16 E4411B Performance Verification Test Record

Agilent Technologies				
Model E4411B		**Report No.** _____		
Serial No. _____		**Date** _____		
Test Description	**Minimum**	**Results Measured**	**Maximum**	**Measurement Uncertainty**
3rd Harmonic, <20 MHz		(3)_____	–20 dBc	±2.6 dB
3rd Harmonic, ≥20 MHz		(4)_____	–25 dBc	±2.6 dB
46. Tracking Generator Non-Harmonic Spurious Outputs *(Option 1DN or Option 1DQ only)*				
Highest Non-Harmonic Spurious Output Amplitude		(1)_____	–35 dBc	±2.67 dB

4 If You Have a Problem

This chapter includes information on how to check for a problem with your Agilent ESA Series Spectrum Analyzer, and how to return it for service. It also includes descriptions of the types of built-in messages.

What You'll Find in This Chapter

This chapter includes information on how to check for a problem with your Agilent ESA Series Spectrum Analyzer, and how to return it for service. It also includes descriptions of all of the analyzer built-in messages.

Your analyzer is built to provide dependable service. However, if you experience a problem, desire additional information, or wish to order parts, options, or accessories, Agilent Technologies's worldwide sales and service organization is ready to provide the support you need.

In general, a problem can be caused by a hardware failure, a software error, or a user error. Follow these general steps to determine the cause and to resolve the problem.

1. Perform the quick checks listed in "Check the Basics" in this chapter. It is possible that a quick check may eliminate your problem altogether.
2. If the problem is a hardware problem, you have several options:
   - Repair it yourself; see the "Service Options" section in this chapter.
   - Return the analyzer to Agilent Technologies for repair; if the analyzer is still under warranty or is covered by an Agilent Technologies maintenance contract, it will be repaired under the terms of the warranty or plan (the warranty is at the front of this manual).
   - If the analyzer is no longer under warranty or is not covered by an Agilent Technologies maintenance plan, Agilent Technologies will notify you of the cost of the repair after examining the instrument. See "How to Call Agilent Technologies" and "How to Return Your Analyzer for Service" for more information.

WARNING **No operator serviceable parts inside the analyzer. Refer servicing to qualified personnel. To prevent electrical shock do not remove covers.**

Before You Call Agilent Technologies

Check the Basics

A problem can often be resolved by repeating the procedure you were following when the problem occurred. Before calling Agilent Technologies or returning the analyzer for service, please make the following checks:

- ❑ Check the line fuse.
- ❑ Is there power at the receptacle?
- ❑ Is the analyzer turned on? Make sure the fan is running, which indicates that the power supply is on.
- ❑ If the display is dark or dim, press the upper **Viewing Angle** key in the upper-left corner of the front panel. If the display is too bright, adjust the lower **Viewing Angle** key in the upper-left corner of the front panel.
- ❑ If other equipment, cables, and connectors are being used with your Agilent ESA Series Spectrum Analyzer, make sure they are connected properly and operating correctly.
- ❑ Review the procedure for the measurement being performed when the problem appeared. Are all the settings correct?
- ❑ If the analyzer is not functioning as expected, return the analyzer to a known state by pressing the **Preset** key.

  Some analyzer settings are not affected by a Preset. If you wish to reset the analyzer configuration to the state it was in when it was originally sent from the factory, press **System**, **Power On/Preset**, **Factory Preset** (if it is displayed).

- ❑ Is the measurement being performed, and the results that are expected, within the specifications and capabilities of the analyzer? Refer to the "Specifications and Characteristics" chapters in Specifications Guide for analyzer specifications.
- ❑ In order to meet specifications, the analyzer must be aligned. Either Auto Align All must be selected (press **System**, **Alignments**, **Auto Align**, **All**), or the analyzer must be manually aligned at least once per hour, or whenever the temperature changes more than 3° C. When **Auto Align**, **All** is selected, AA appears on the left edge of the display.
- ❑ If the necessary test equipment is available, perform the Chapter 1, "Performance Verification Tests," of this guide. Record all results on the appropriate form in Chapter 3 , "Performance Verification Test Records," which follows the tests chapter.

- ❑ If the equipment to perform the performance verification tests is not available, you may still be able to perform the functional checks in the ***Agilent ESA Series Spectrum Analyzers User's Guide***.

Read the Warranty

The warranty for your analyzer is at the front of this manual. Please read it and become familiar with it's terms.

If your analyzer is covered by a separate maintenance agreement, please be familiar with its terms.

Service Options

Agilent Technologies offers several optional maintenance plans to service your analyzer after the warranty has expired. Call your Agilent Technologies sales and service office for full details.

If you want to service the analyzer yourself after the warranty expires, you can purchase the service documentation that provides all necessary test and maintenance information.

You can order the service documentation, Option 0BV (component level information including parts lists, component location diagrams and schematic diagrams) and Option 0BW (assembly level troubleshooting and adjustment procedures), through your Agilent Technologies sales and service office. Service documentation is described under "Component Level Service Documentation (Option 0BV)" and "Service Documentation and Adjustment Software (Option 0BW)" in Chapter 6 of the user's guide.

How to Call Agilent Technologies

Agilent Technologies has sales and service offices around the world to provide you with complete support for your analyzer. To obtain servicing information or to order replacement parts, contact the nearest Agilent Technologies sales and service office listed in Table 4-1. In any correspondence or telephone conversations, refer to your analyzer by its product number, full serial number, and firmware revision. (Press **System**, **More 1 of 3**, **Show System**, and the product number, serial number, and firmware revision information will be displayed on your analyzer screen.) A serial number label is also attached to the rear panel of the analyzer.

Table 4-1 Agilent Technologies Sales and Service Offices

UNITED STATES		
Instrument Support Center Agilent Technologies, Inc. (800) 403-0801		
EUROPEAN FIELD OPERATIONS		
Headquarters Agilent Technologies S.A. 150, Route du Nant-d'Avril 1217 Meyrin 2/ Geneva Switzerland (41 22) 780.8111	France Agilent Technologies France 1 Avenue Du Canada Zone D'Activite De Courtaboeuf F-91947 Les Ulis Cedex France (33 1) 69 82 60 60	Germany Agilent Technologies GmbH Agilent Technologies Strasse 61352 Bad Homburg v.d.H Germany (49 6172) 16-0
Great Britain Agilent Technologies Ltd. Eskdale Road, Winnersh Triangle Wokingham, Berkshire RG41 5DZ England (44 118) 9696622		
INTERCON FIELD OPERATIONS		
Headquarters Agilent Technologies, Inc. 3495 Deer Creek Rd. Palo Alto, CA 94304-1316 USA (415) 857-5027	Australia Agilent Technologies Australia Ltd. 31-41 Joseph Street Blackburn, Victoria 3130 (61 3) 895-2895	Canada Agilent Technologies (Canada) Ltd. 17500 South Service Road Trans-Canada Highway Kirkland, Quebec H9J 2X8 Canada (514) 697-4232
Japan Agilent Technologies Japan, Ltd. Measurement Assistance Center 9-1, Takakura-Cho, Hachioji-Shi, Tokyo 192-8510, Japan TEL (81) -426-56-7832 FAX (81) -426-56-7840	Singapore Agiloent Technologies Singapore (Pte.) Ltd. 150 Beach Road #29-00 Gateway West Singapore 0718 (65) 291-9088	Taiwan Agilent Technologies Taiwan 8th Floor, H-P Building 337 Fu Hsing North Road Taipei, Taiwan (886 2) 712-0404
China China Agilent Technologies, Inc. 38 Bei San Huan X1 Road Shuang Yu Shu Hai Dian District Beijing, China (86 1) 256-6888		

How to Return Your Analyzer for Service

Service Tag

If you are returning your analyzer to Agilent Technologies for servicing, fill in and attach a blue service tag. Several service tags are supplied at the rear of this chapter. Please be as specific as possible about the nature of the problem. If you have recorded any error messages that appeared on the display, or have completed a Performance Test Record, or have any other specific data on the performance of your analyzer, please send a copy of this information with your return.


Original Packaging

Before shipping, pack the unit in the original factory packaging materials if they are available. If the original materials were not retained, see "Other Packaging".

NOTE Ensure that the instrument handle is in the rear-facing position in order to reduce the possibility of damage during shipping. Refer to Figure 4-1.

NOTE Install the transportation disk into the floppy drive to reduce the possibility of damage during shipping. If the original transportation disk is not available, a blank floppy may be substituted.

Figure 4-1

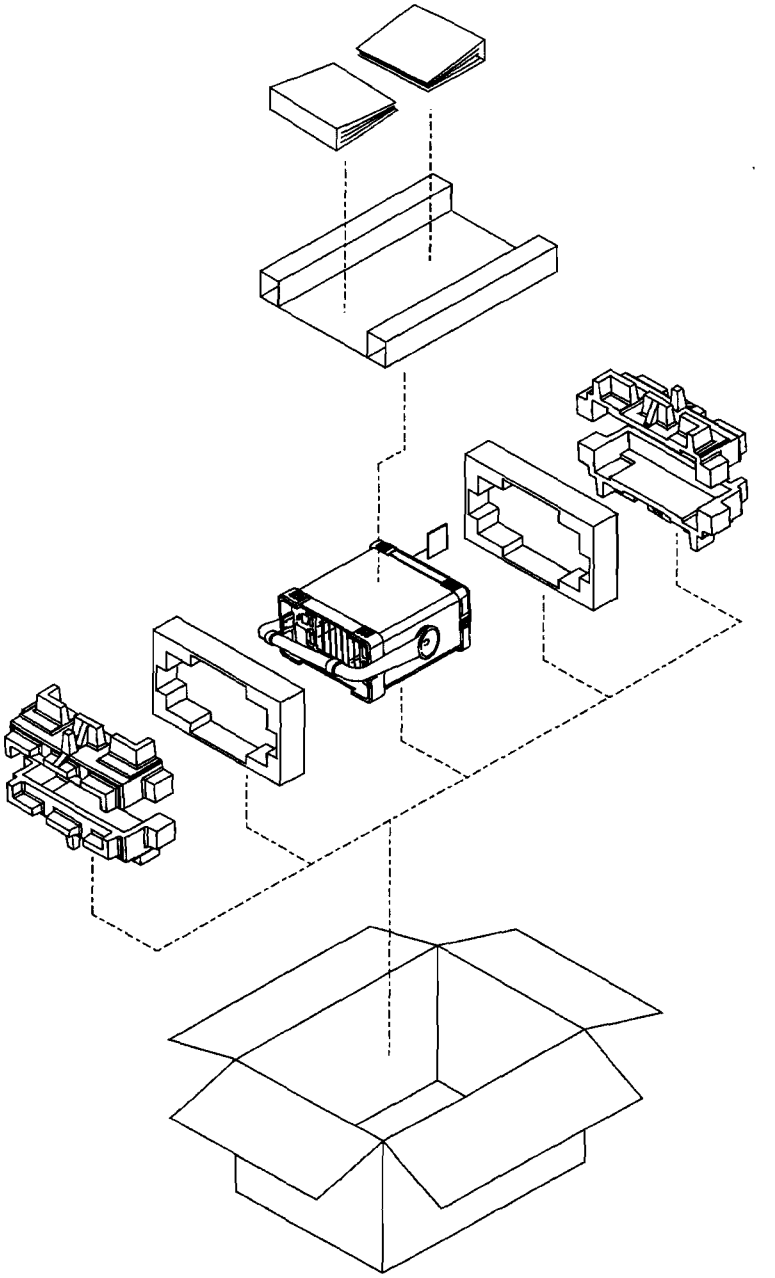

formt122

Other Packaging

CAUTION Analyzer damage can result from using packaging materials other than those specified. Never use styrene pellets in any shape as packaging materials. They do not adequately cushion the equipment or prevent it from shifting in the carton. They cause equipment damage by generating static electricity and by lodging in the analyzer louvers, blocking airflow.

You can repackage the instrument with commercially available materials, as follows:

1. Attach a completed service tag to the instrument.
2. Install the transportation disk or a blank floppy disk into the disk drive.
3. If you have a front-panel cover, install it on the instrument. If you do not have a front panel cover, make sure the instrument handle is in the forward-facing position to protect the control panel.
4. Wrap the instrument in antistatic plastic to reduce the possibility of damage caused by electrostatic discharge.
5. Use a strong shipping container. A double-walled, corrugated cardboard carton with 159 kg (350 lb) bursting strength is adequate. The carton must be both large enough and strong enough to accommodate the analyzer. Allow at least 3 to 4 inches on all sides of the analyzer for packing material.
6. Surround the equipment with three to four inches of packing material and prevent the equipment from moving in the carton. If packing foam is not available, the best alternative is S.D.-240 Air Cap™ from Sealed Air Corporation (Hayward, California, 94545). Air Cap looks like a plastic sheet filled with 1-1/4 inch air bubbles. Use the pink-colored Air Cap to reduce static electricity. Wrapping the equipment several times in this material should both protect the equipment and prevent it from moving in the carton.
7. Seal the shipping container securely with strong nylon adhesive tape.
8. Mark the shipping container "FRAGILE, HANDLE WITH CARE" to assure careful handling.
9. Retain copies of all shipping papers.