

ELECTRONIC CALIPERS

EC799 ELECTRONIC CALIPERS

0-40"/0-1000MM

The EC799 Electronic Caliper is light, comfortable, easy-to-use, and constructed with features that have made Starrett slide calipers the machinist's first choice for many years. Output now available on B models.

The EC799 offers a slim, streamlined profile, a large, clear, easy-to-read LCD display, long battery life, and function buttons for zero and inch/mm.

FEATURES

- Equipped with an RS232 output - ideal for use with DataSure Wireless Data Collection System
- Lightweight, ergonomic design
- Inch/millimeter conversion reads .0005" or 0.01mm
- Easy access to the single, long-life battery
- Last measuring position retained when shut off
- Hardened stainless steel body for long life
- Fine adjustment thumb wheel
- Lock screw to hold the slide in position
- Resolution is .0005" (0.01mm)
- Zero at any position
- Protective case

EC799 Electronic Slide Calipers

Cat. No.	EDP	Range in	mm
EC799A-6/150	00142	0-6	0-150
EC799A-6/150 W/SLC*	72665		
EC799B-6/150	00143		
EC799B-6/150 W/SLC*	00144	0-8	0-200
EC799A-8/200	00145		
EC799A-8/200 W/SLC*	72674		
EC799B-8/200	00146	0-12	0-300
EC799B-8/200 W/SLC*	00147		
EC799A-12/300	00148		
EC799A-12/300 W/SLC*	72673	0-12	0-300
EC799B-12/300	00149		
EC799B-12/300 W/SLC*	00150		

799 Extended Slide Calipers without Output

Cat. No.	EDP	Range in	mm
799AZ-24/600	11978	0-24	0-600
799AZ-40/1000	11979	0-40	0-1000

Accessories, Cables and Case Information for 799 Electronic Calipers

Cat. No.	EDP	Description
EC799BSCM	46000	Smart Cable to multiplexer
EC799BSCU	46002	Smart Cable to USB
EC799BSCKB	46001	Smart Cable to USB keyboard
PT26151	64440	Center distance attachment
PT22431	64640	Depth attachment for 6", 9" and 150mm calipers
PT99492	65650	3-volt battery; CR2032
723ZZ-6/722ZZ-6	57070	Deluxe padded case for 0-6" (150mm) calipers
950	63878	Finished wood case for 0-8" (200mm) calipers
946	56695	Finished wood case for 0-12" (300mm) calipers

* Includes redemption card for Standard Letter of Certification (SLC).

Approximate Jaw Depths for 799 Electronic Calipers

	6" (150mm)	8" (200mm)	12" (300mm)	24" (600mm)	40" (1000mm)
Outside	1-1/2" (38mm)	2" (50.8mm)	2-1/2" (63.5mm)	4" (100mm)	6" (150mm)
Inside	5/8" (16mm)	3/4" (19mm)	23/32" (18.3mm)	11/16" (17.46mm)	11/16" (17.46mm)

6", 8" AND 12" CALIPERS ONLY

- Large, easy-to-read .32" tall characters, high contrast LCD digital readout
- Auto OFF after 5 minutes of nonuse
- Linear accuracy meets DIN862
- Integrated depth rod







EXTENDED RANGE 24" AND 40" CALIPERS

- Preset and hold feature
- Minimum and maximum limits set
- I.D. jaw dimension is .800"/20.32mm
- LCD characters are .50" high
- Auto off after 30 minutes of nonuse



CALIPER ACCURACY SPECIFICATIONS AND CALIBRATION INFORMATION

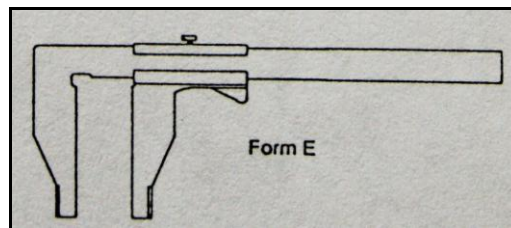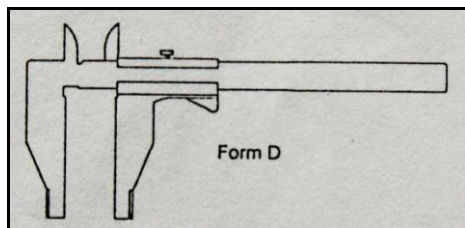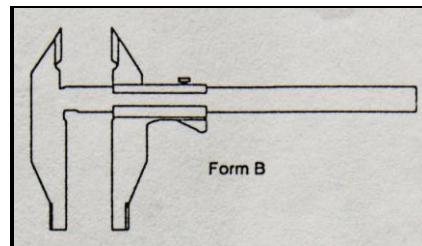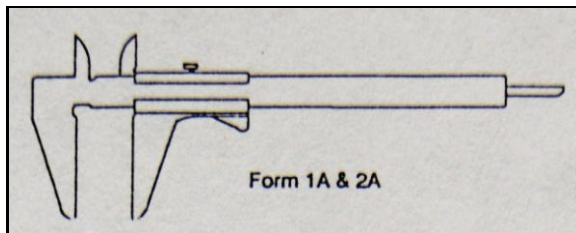

The information in this document applies to the caliper form types shown above.

Conversion:

mm to ins. = mm / 25.4 (50mm = 1.9685 ins.)

1µm (0,001mm) ins. ~ 0.00004 ins. (30µm = 0.00118 ins.)

The most internationally widely used caliper standard (**DIN 862 Vernier calipers; requirements, testing**) gives the following requirements (all in mm) for caliper measurement accuracy:

A more comprehensive version of this table (and much more) can be found in DIN 862			
Measurement length (mm)	Accuracy limits G ¹⁾ in µm (0,001mm)		
	Scale values:	Vernier and Dial	Digital
	0,1 and 0,05	0,02	0,01
50	50	20	20
100			
200			
300			
400	60	30	30
500	70		
600	80		
700	90		
800	100	40	40
900	110		
1000	120		
1200	140		
1400	160	50	---
1600	180		
1800	200		
2000	220		
G ¹⁾ values should be increased by 20 µm when measuring inside and depth measurements. The parallelism of measuring faces shall be preserved after locking.			

DIN 862 is the standard used by most manufacturers as the referenced requirement and testing standard. As the above table is only a small portion of the actual standard, it is recommended that DIN 862 be read by anyone wishing all information. It is available in (at least) German and English.

DIN 862 is identical to ISO 2012

For those that wish to be reasonably sure of their caliper functionality and accuracy, the following three pieces of advice/information may be useful.

Caliper Calibration Information

For caliper form types 1A, 2A, B, D and E note that the reading is carried out by vernier, dial or digital display. While DIN 862 states requirements more than those that having direct influence on measurement accuracy (secondary requirements to form, material etc.), then only those requirements pertinent to measurement accuracy are dealt with here.

DIN 862 does not have special requirements to repeatability. Two important factors having direct influence on measurement accuracy is the ability to establish a uniform measurement pressure and the caliper's measuring surfaces in relation to the reference (gauge blocks or ring gauges).

Reading deviation is the difference between the caliper's actual measurement and the "true" value. In other words, the difference between the caliper reading and the reference standard used.

Din 862 specifies requirements as to by how much the measurement deviation may vary. If measurements are carried out with different measurement force directions then there is an extra allowance.

Measurement surfaces	Reference ring gauge
Knife shaped	Ø 5 mm Ø 20 mm
Rounded	Ø 30 mm

The allowance for G (see table on page 1 - 4) for scale values 0,1 and 0,05mm is $(20 + 1/10 \text{ mm}) \mu\text{m}$.

The allowance for G (see table on page 1 - 4) for scale values 0,02 and 0,01mm is $(22 + 1/50 \text{ mm}) \mu\text{m}$.

Requirements for external and internal measurement with measurement jaws of form types 1A, 2A, B, D and E are given in the table on page 1 - ?. These requirements are also applicable to form type B with the knife edged and rounded measurement surfaces. The allowances for G for internal and depth measurement apply when relevant.

As mentioned for G¹⁾ in the table on page 1 - 4 this allowance also applies to depth measurement with the depth rod shown in form types 1A and 2A.

In principle all caliper measuring surfaces (external, internal and depth) should be calibrated. However, as it is the same scale being read, then it is enough to calibrate this once. The scale is normally calibrated at several points with the jaws for external measurement. If there is more than one set of jaws for external measurement then the longest should be chosen. The other measuring surfaces only need calibration at one or two points.

The result is shown on the scale (or display) and the deviation to the reference be noted. The accuracy of the reading will depend on the quality and display principle.

Recommended measurement steps			
Measurement point No.	Max. measurement length (mm)		
	150	300	500
1	0	0	0
2	12,9	37,9	42,9
3	22,8	47,8	102,8
4	41,4	81,4	131,4
5	55,1	105,1	185,1
6	67,6	142,6	217,6
7	75	165	265
8	90,3	190,3	310,3
9	107,7	207,7	357,7
10	120,2	145,2	400,2
11	142,5	252,5	452,5
12	150	300	500

For external calibration measurement gauge blocks should be used. Three measurements, at the top of the jaws near to the caliper beam, the middle of the jaws and at the bottom of the jaws, will reveal any variation in jaw parallelism. A round reference gauge is also recommended for a complete calibration. Measurements should be carried out at various points over the entire caliper range.

For external calibration measurement ring gauges should be used. Ø 5 and Ø 20 mm are recommended.

For depth calibration measurement gauge blocks should be used.

The uncertainty of measurement using a caliper is due to several factors.

The user's ability to maintain a uniform measurement pressure.

The temperature at the calibration environment.

The overall caliper condition. The sliding jaw too slack or too tight, measurement jaws nicked or marked etc.

Caliper Calibration Instruction

All calipers have an identification number. If owning and calibrating two or more calipers it is always a good idea to make a calibration report for each individual caliper. How detailed this "report" should be depends on the purpose for which it will be used.

Clean the caliper before calibration, especially the measuring surfaces.

Move the sliding jaw 10 times thorough the entire measurement range. The sliding jaw should move freely and without slack.

The measuring surfaces, especially the knife edged, should be checked visually for wear and other forms of deformation.

Check the condition of any scale. i.e. blurred lines etc.




Acclimatize the caliper and the reference items to be used.

External measurement calibration

Choose the block gauges to be used so that they cover the entire measurement length at suitable distances so that the various digits are part of the individual measurement calibration. The table on page 2 - 4 is an example of possible nominal values depending on caliper length.

Clean the gauge blocks and zero the caliper with the jaws closed. The measurement pressure used when calibrating should be kept as uniform as possible.

For repeatability, choose for example a 50 mm gauge block and measure at three stages with the caliper jaws as shown. Make sure the gauge block is squarely against the measurement jaws. Note the caliper measurement at each stage. Repeat each measurement five times and note each result. If the caliper has two external measuring surfaces calibrate both.

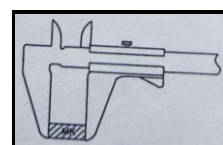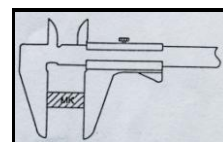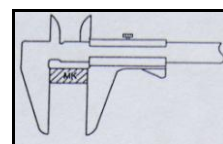

Internal measurement calibration




Chose the diameters of the gauge rings to be used. The diameters (or close to) recommended on page 2 - 4 are advisable but will depend on the calipers form type.

Clean the gauge rings and zero the caliper after pushing the jaws together.

Note the ring gauges diameter and measure as shown in the first figure. Repeat as shown in the second figure. Two results will be noted for the same gauge ring.

Repeat the process with the second ring gauge.

The same process should be used with calipers having rounded internal measurement jaws. One measurement should be enough.

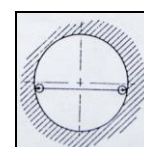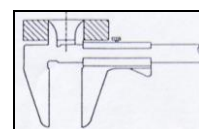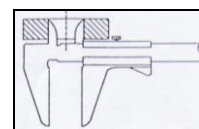

Depth measurement calibration

Choose a gauge block. i.e. 25 mm.


Clean the gauge block and the reference plane.

Zero the caliper after pushing the jaws together.

Place the caliper beam base on the gauge block and move the depth rod to the reference plane. The caliper must be at a right angle to the gauge block.

For all calibration measurement results the following formula applies:

Deviation shown = the noted value minus the "true" value.

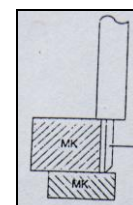

Depth rod

Caliper Check Instruction

When checking a caliper before use check as many of the previously mentioned stages as deemed relevant or necessary.

A caliper is an accurate measuring instrument when used correctly within the specified accuracy limitations.

Summation


A caliper should always have a specified reference to accuracy. For the majority of calipers DIN 862 is the one most often used. Buying a caliper (or any measuring instrument) without accuracy specifications being given is foolhardy at best. Know what you are dealing with and its limitations.

Special calipers, and especially those have long or otherwise special "legs" may have a larger accuracy specification than that given in DIN 862.

A new generation of digital calipers have displays showing measurement values of 0,005 and some showing 0,001mm. This does not mean they are this accurate, but will invariably have smaller than standard accuracy specifications given. Many calipers with a display of 0,005mm claim to be twice as accurate as specified in DIN 862. Is this claim correct? Check and find out – it's easy to do.

A good Rule of Thumb when buying a caliper, is to choose one with the name of the manufacturer on it. There is usually a reason why anonymous (and cheap) calipers are anonymous.


As a uniform measurement pressure is often critical for an accurate result, there are caliper pressure devices on the market. These can be used if the user is unsure or wants to eliminate any doubt as to the use of a correct uniform pressure to a third part. A pressure device is also useful when a large number of parts must be measured over a longer period of time. These pressure devices give a measurement force of up to 8N.

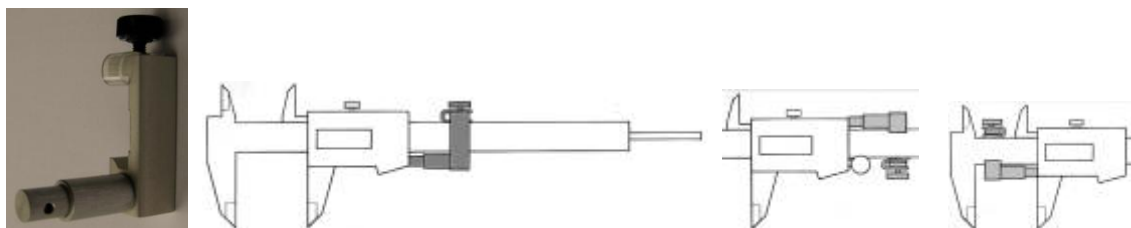

External pressure

External pressure

Internal pressure

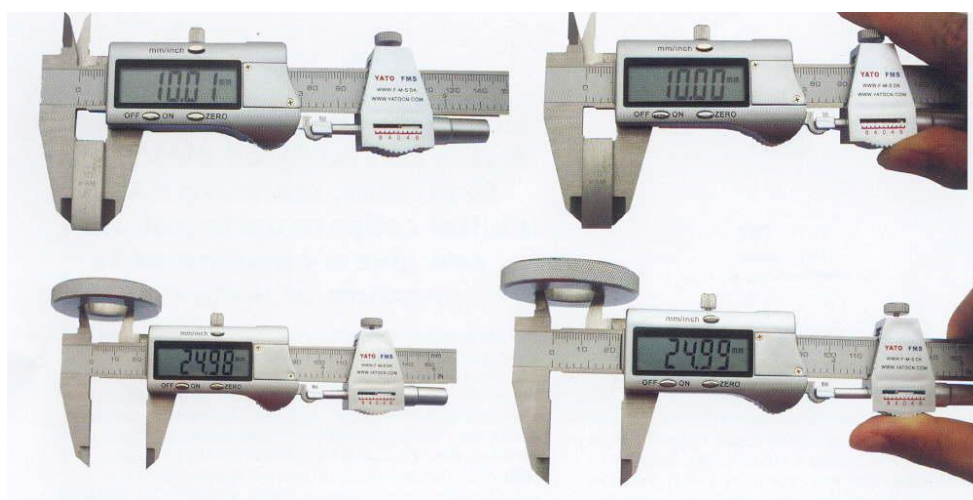

External and internal pressure with a genuine 2-way pressure device. Push or pull.
The measurement force used can be seen directly on the device scale.