

TOK-G

DIAL INDICATOR TORQUE WRENCHES

Easy to read dial indicator. Well suited for inspection and general maintenance service.



TOK-G (with peak indicator)




FEATURES

- Oval design with comfort rubber grip reduces strain.
- Easily readable for inspections.
- Useful for general tightening work.
- Accuracy : $\pm 3\%$ of indicated value over the full range

USING A TOK WRENCH

- (1) Turn the dial cap and set the indicator to 0.
 - (2) Mount a socket on the square drive.
 - (3) Tighten until the indicator points to the desired torque.
- * When using a peak indicator wrench, set it to 0 before tightening.

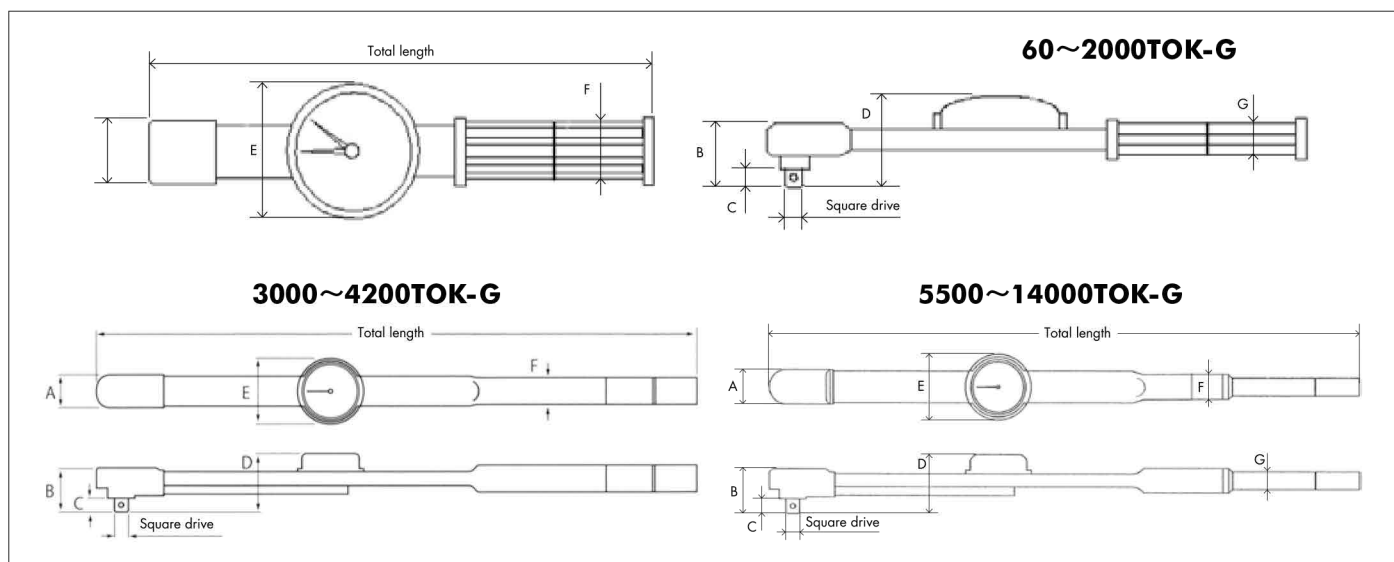

* 14000TOK-G and N1400TOK-G do not have the rubber head.

Model (kgf·cm/kgf·m)	Range (CW/CCW)	Increment	Model (N·m)	Range (CW/CCW)	Increment	Square drive	Total length	Dimensions (mm)							Weight
	kgf·cm/kgf·m			N·m		mm	mm	Head		Body					
60TOK-G	6 ~ 60	1 kgf·cm	N 6TOK-G	0.6 ~ 6	0.1	6.35 (1/4")	260	35	38.5	7.5	58	90	37	21.5	0.5
120TOK-G	10 ~ 120	2	N 12TOK-G	1 ~ 12	0.2	9.53 (3/8")	323	35	43	11	60	90	37	21.5	0.61
300TOK-G	50 ~ 300	5	N 30TOK-G	5 ~ 30	0.5										
500TOK-G	50 ~ 500	5	N 50TOK-G	5 ~ 50	0.5										
700TOK-G	100 ~ 700	10	N 70TOK-G	10 ~ 70	1										
1400TOK-G	200 ~ 1,400	20	N 140TOK-G	20 ~ 140	2	12.7 (1/2")	463	39	49	14	65	90	41	22.5	0.87
2000TOK-G	200 ~ 2,000	20	N 200TOK-G	20 ~ 200	2	19.05 (3/4")	682	41	55	20	77	90	φ30		1.6
3000TOK-G	3 ~ 30	0.5	N 300TOK-G	30 ~ 300	5										
4200TOK-G	4 ~ 42	1	N 420TOK-G	40 ~ 420	10										
5500TOK-G	5 ~ 55	1	N 550TOK-G	50 ~ 550	10										
7000TOK-G	7 ~ 70	1	N 700TOK-G	70 ~ 700	10										
8500TOK-G	10 ~ 85	1	N 850TOK-G	100 ~ 850	10	25.4 (1")	1,384	58	72	27	93	90	φ45	φ34	7.1
10000TOK-G	10 ~ 100	2	N 1000TOK-G	100 ~ 1,000	20		1,484	66	74		94		φ51	φ40	7.3
14000TOK-G	20 ~ 140	2	N 1400TOK-G	200 ~ 1,400	20		1,696						9		